

## **Technical Service Information**

## THM 4L60 (700-R4) NO WOT 3-4 UPSHIFT (POLICE ONLY)

**COMPLAINT:** 5.7L "B" Car (Police Only) may exhibit a loss of wide open throttle upshift after vehicle is

hot.

**CAUSE:** The cause may be the wrong calibration.

**CORRECTION:** There is now available from OEM a new 3-4 throttle valve and sleeve assembly, in service

package part number 8671953, to address this condition. Refer to Figure 1 for proper

assembly procedure.

## **SERVICE INFORMATION:**

3-4 Throttle Valve and Sleeve Service Package........... 8671953

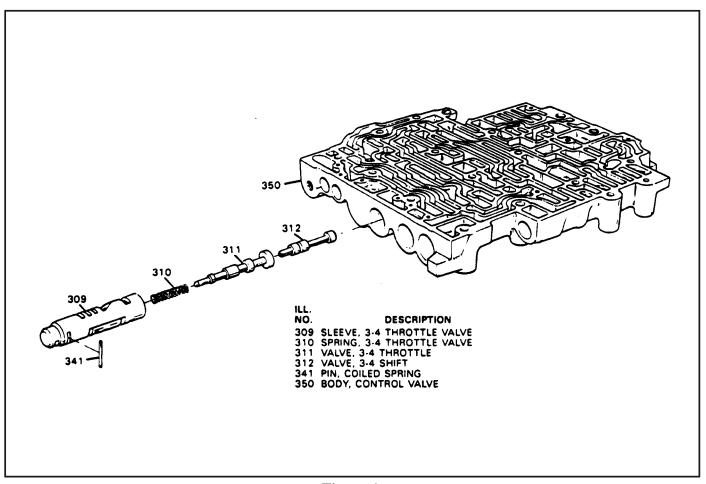


Figure 1

Copyright © 2000 ATSG