

Technical Service Information

THM 3T40 (125C) TCC FILTER ADDED

A TCC filter has been added to the TCC signal passage in the auxiliary valve body, beginning in March, 1987 (See Figure 1). This will reduce the possibility of sediment entering the TCC solenoid.

If the solenoid gets contaminated with sediment, it could result in a complaint of engine stalling when selector is placed in drive or reverse.

The filter cannot be used in previous models because of a machining process needed on the auxiliary valve body.

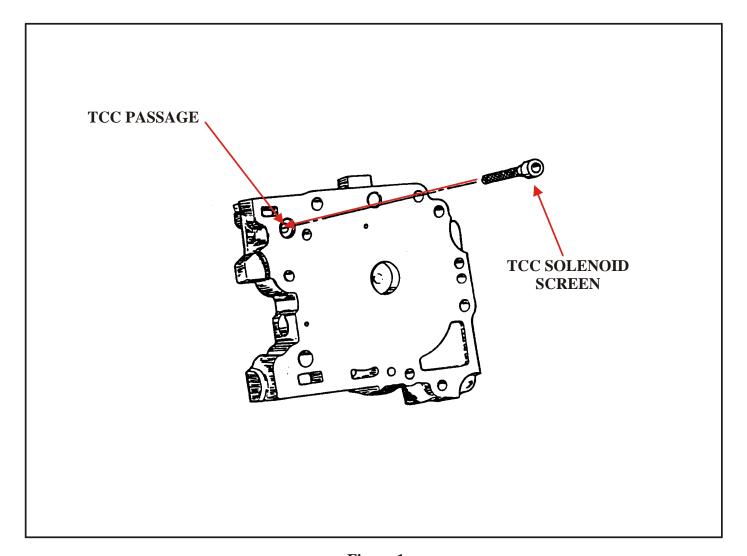


Figure 1