

Technical Service Information

AUDI 01F FILLER TUBE DOES NOT HAVE A DIP STICK

COMPLAINT: Late model Audi 100 series are equipped with an 01F transaxle that has a filler tube with out a

dipstick.


CAUSE: The factory chose to use the filler tube as a vent by providing a breather cap located on the top of

the tube as seen in figure 1.

CORRECTION: Dip stick can be purchased through Audi under the part number 01F 321 431 A for approximately

\$18.00 dollars (See Figure 2). This dip stick is to be used as a tool to obtain the correct fluid level. This dip stick CANNOT be left in the tube as the transaxle would no longer have a vent. In the event that you need to fabricate a tool to check the fluid level with, the total length of the dip stick

is approximately 24" long with the full mark at approximately 2VA".

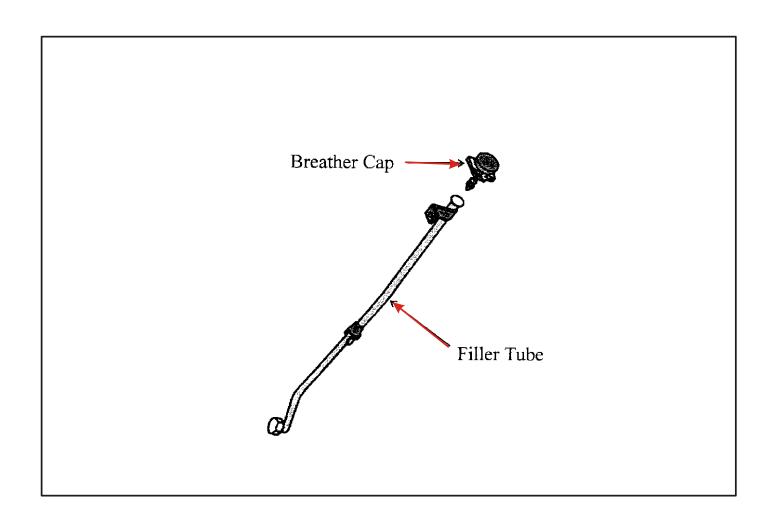

Copyright © 2000 ATSG



Technical Service Information

