


Technical Service Information

THM 4L60 (700-R4) T.V. EXHAUST VALVE

The 1982/83 Models of the THM 700 R4 did not come with a TV Exhaust valve I4 (Figure 1). All Information that was published prior to production will show this valve, however it was never installed.

For 1984, there is now a I 10 check ball as shown in (Figure 2) this check ball is larger in diameter than the others, and can easily be identified by its dark copper color. Also note that the check balls have been renumbered.

The intent of cht # 10 check ball is to protect the transmission in the event of a broken or unhooked cable. Causing a late or no upshift condition. We recommend leaving this check ball out

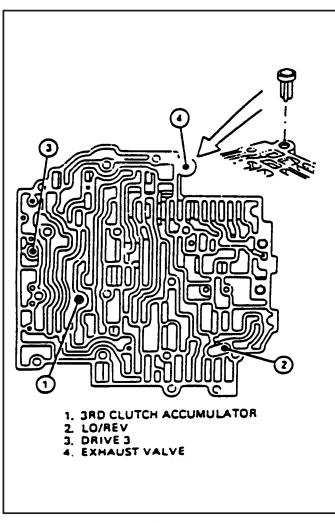

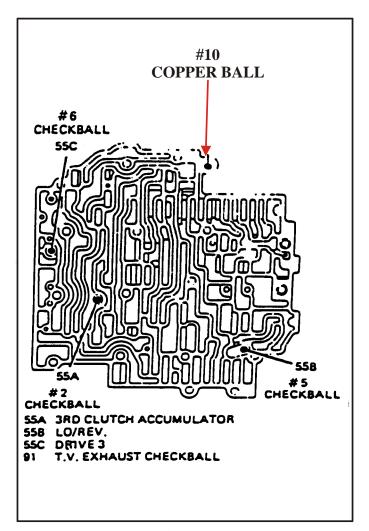


Figure 1 Figure 2

Copyright © 2000 ATSG