

# **Technical Service Information**

### SATURN NEW SHIFT FORK/REVERSE GEAR FOR 91&92 MODEL

**CHANGE:** The Forward and Reverse Shift Fork and Reverse "Driven" gear were changed to the 1993

model year design (2nd design) on 1991 and 1992 model year vehicles.

**REASON:** For better durability and to improve Forward and Reverse engagements.

#### **PARTS AFFECTED:**

#### (1) Forward and Reverse Shift Fork:

1st Design (91&92) - has a "Reverse side grind" and the Fork thickness is approximately .160".

**NOTE**: 1st design Fork is no longer serviced. (See Figure 1) 2nd design (93) - has "NO" "Reverse side grind" and the Fork thickness is approximately .190". (See Figure 1)

#### (2) Reverse Driven Gear:

1st Design (91&92) - the thickness of the gear is approximately .512".

#### NOTE: 1st design Reverse gear is no longer serviced. (See Figure 2)

2nd Design (93) - the thickness of the gear is approximately .449". The increase in the Fork thickness made it necessary to reduce the thickness of Reverse gear. (See Figure 2)

#### **SERVICE INFORMATION:**

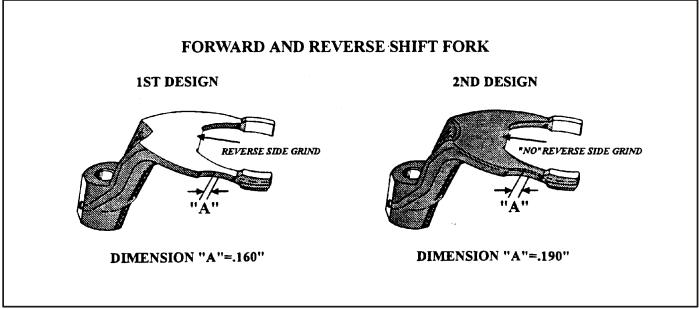


Figure 1

Copyright © 2000 ATSG



## **Technical Service Information**

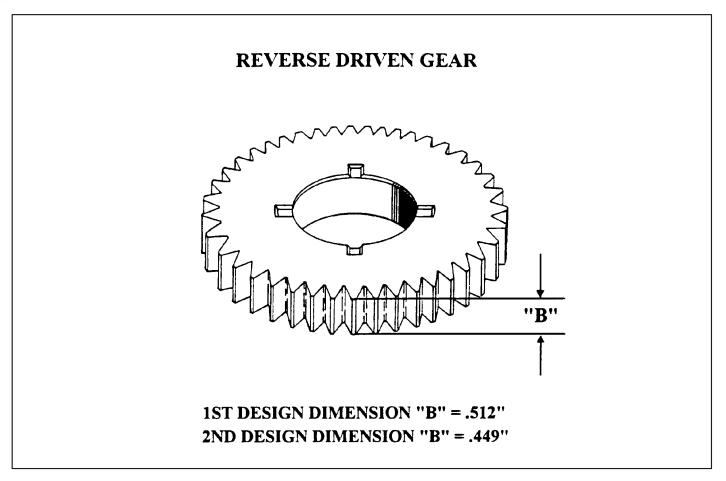


Figure 2