

Technical Service Information

THM 4L60 (700-R4) 4-3 NEUTRAL

COMPLAINT: Neutralizes on a 4-3 part throttle or full throttle downshift.

CAUSE: Defective forward sprag or assembly.

CORRECTION: Check inner and outer race for wear or cracks, if good, change sprag.

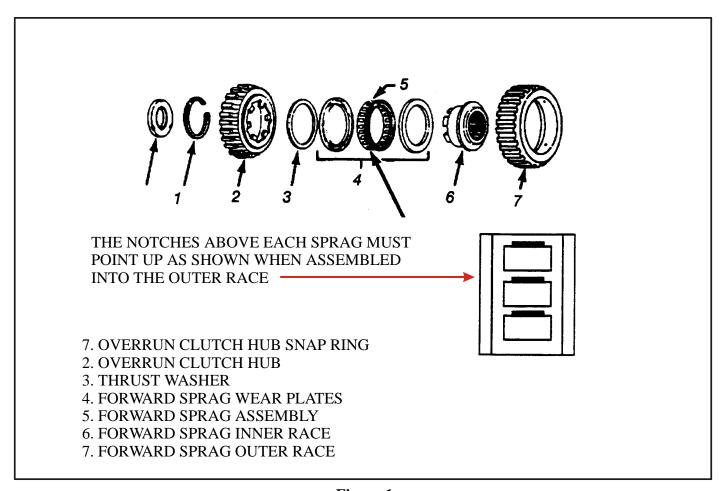


Figure 1

Copyright © 2000 ATSG