

Technical Service Information

REVERSE SHUDDER 1984 300ZX TURBO

APPLIED MODEL: 3584 300ZX turbo with automatic transmission. APPLIED VIN:

MODEL	VIN	TYPE	DATE
2 Seater Turbo	JN1CZ14S2EX016075	4N71B	4/84

Some 1984 300ZX Turbo models with automatic transmissions may exhibit a shudder while backing up in reverse gear. To eliminate this condition, the number of drive and driven plates in the low and reverse brake of 4N71B turbo automatic transmissions have been increased from 7 to 8 <u>beginning with</u> the Applied VIN below. Because of the additional plates, the transmission case has also been modified.

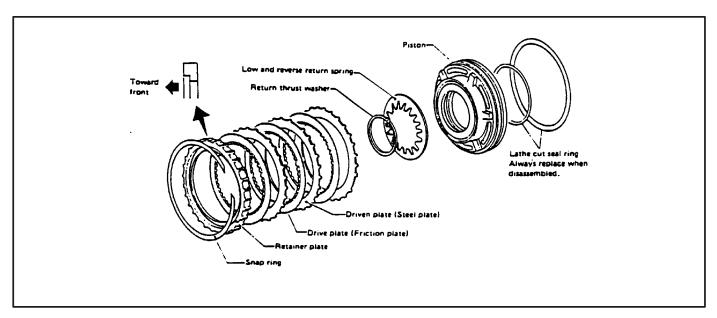


Figure 1



Technical Service Information

A/T TYPE	PART NAME		NEW PART NUMBER	FORMER PART NUMBER	INTER- CHANGEABILITY
4N716 (TURBO)	Automatic Transmission Assembly		31020-X8006 (From transmission unit no. 4343216)	31020-X8006 (Up to transmission unit no. 4343215)	Yes, new replaces former
	Tra Ca:	ensmission se	31310-X8656	31310-X8655	Yes, new replaces former only as a set
F	Low/ Reverse Brake	Drive Plate	31662-X0102 (8 plates required)	31662-X0101 (7 plates required)	
		Driven Plate	31666-X0100 (8 plates reqùired)	31666-X0100 (7 plates required)	
		Retaining Plate	31667-X2900 to X2905	31667-X0500 to X0505	

Figure 2