

## **Technical Service Information**

## EAGLE 4HP-18 DELAYED FORWARD ENGAGEMENT OR PREMATURE FAILURE OF THE FORWARD CLUTCH

**COMPLAINT:** ZF-4HP-18 transmissions may exhibit a no move condition in any forward range and

works fine in reverse.

CAUSE: One cause may be that either the 3-4 or 4-3 traction valve in the valve body has stuck in a

stroked position preventing forward clutch apply (See Figure 18).

**CORRECTION:** Remove the valve body from the transaxle. Inspect and free the valve that is stuck.

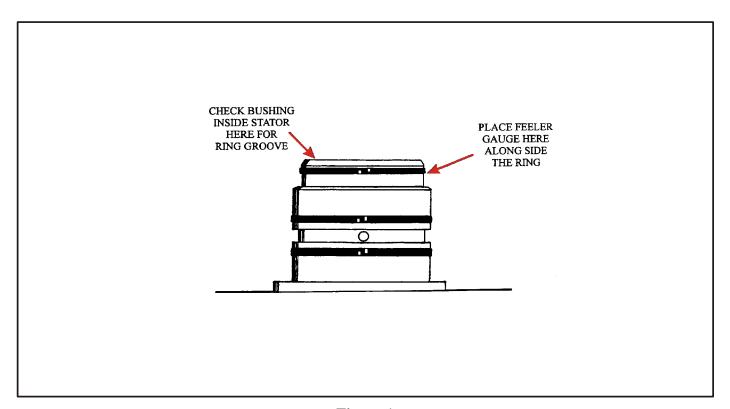


Figure 1

Copyright © 2000 ATSG