

## **Technical Service Information**

## THM 440-T4 TCC REGULATOR PLUG PART NUMBER

**COMPLAINT:** When installing SGSF-440 converter clutch regulator valve spring, as shown in A TSG

Bulletin # 88-45, removal of the aluminum valve plug proves to be so difficult that

destruction of the plug is necessary.

**CAUSE:** The plug retaining clip can beat up against the plug and flare the plug. The retaining clip also

wears and can break and further jam the plug.

**CORRECTION:** New aluminum plugs and retainers are now available from General Motors. The part number

for the converter regulator plug is 8649434. The part number for the retaining clip is

8656727. (See Figure 1.)

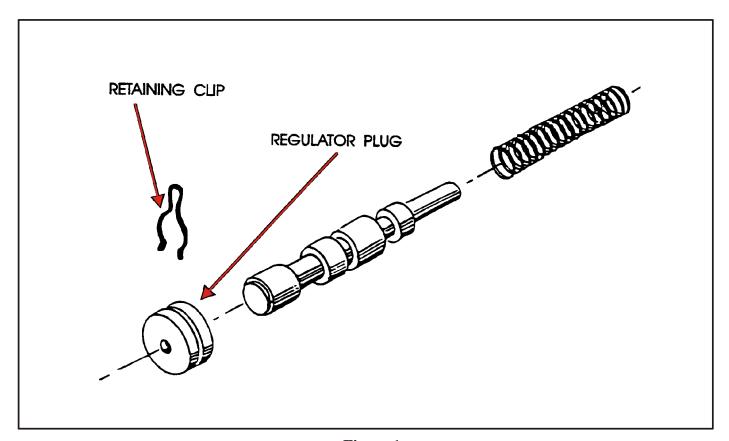


Figure 1