

Technical Service Information

FORD ATX CONVERTER ADAPTER SLEEVE FROM "FLC"

1987-88 Tempo Topaz only use a converter adapter sleeve, Part Number E7FZ-7A878-A. This sleeve has two internal splines and one external spline. (See Figure 1) Since this is a slip on adapter, it can stay engaged in the torque converter turbine hub upon removal of the converter from the transmission. If this adapter IS NOT reinstalled on the transmission (turbine and intermediate shafts), a NO DRIVE CONDITION WILL BE THE COMPLAINT AFTER INSTALLATION. (See Figure 2)

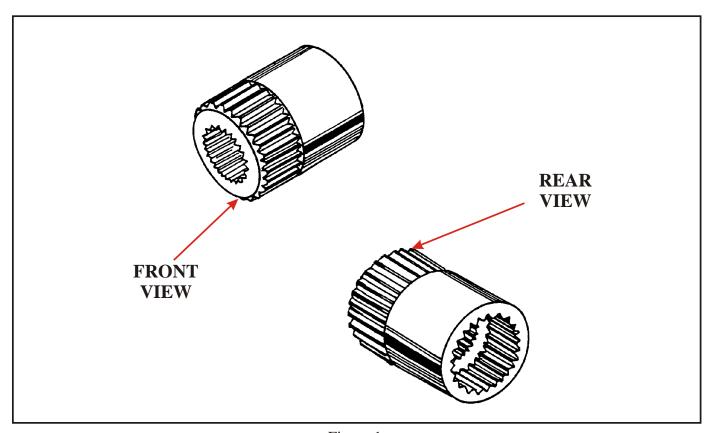


Figure 1



Technical Service Information

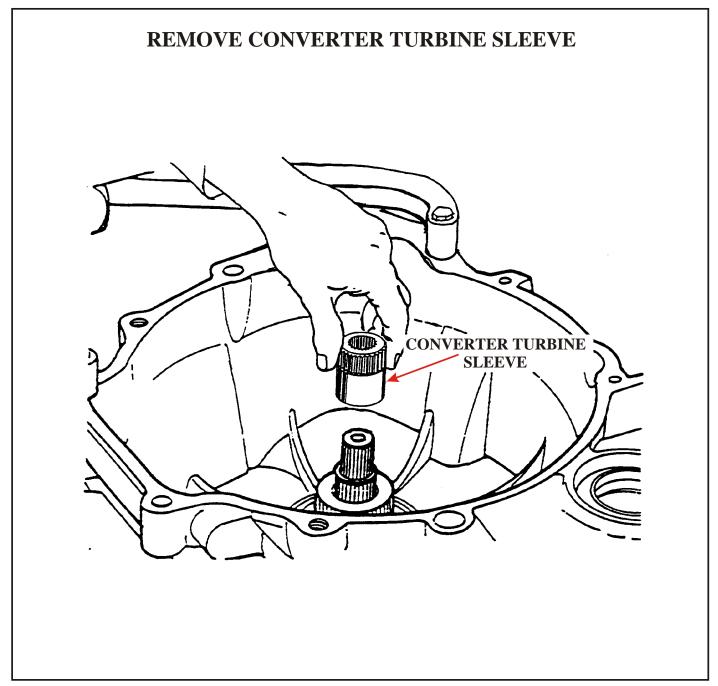


Figure 2