

Technical Service Information

FORD AXOD NEW SCREEN IN CASE

CHANGE: A new filter has been added to the 1989 AXOD 1-2 servo apply circuit (See Figure 1).

REASON: The filter prevents large metal chips from entering the valve body.


PARTS AFFECTED:

- (1) CHAIN COVER 1-2 servo passage changed to accommodate the new screen,
- (2) TRANSAXLE CASE 1-2 servo passage changed to accommodate the new screen.

INTERCHANGEABILITY:

The new screen WILL NOT retro fit to previous models. The 1-2 servo passage on the previous models chain cover will not accommodate the new screen and an interference will occur. NOTE: A no forward condition could occur if the filter becomes contaminated.

SERVICE INFORMATION:

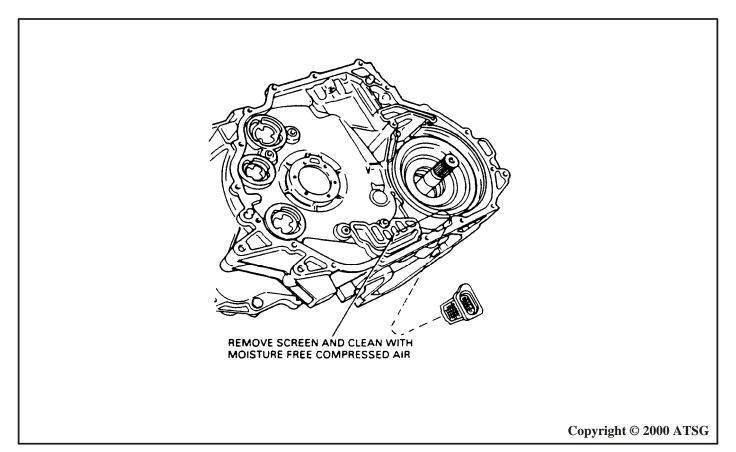

ND 89-58