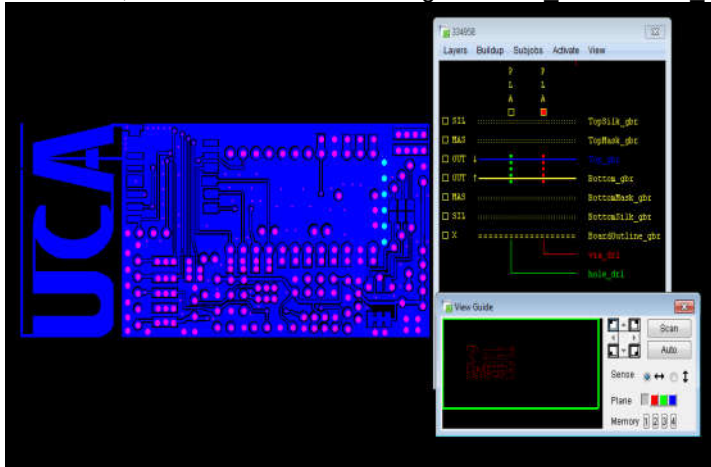## Exception: 1
In data set, two excellon drill files are given "hole_drl" and "via_drl" not clear to us.
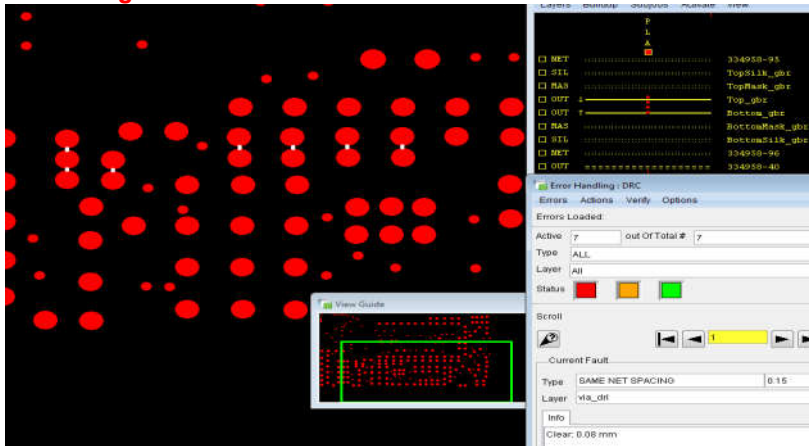

Suggested solution :
We can consider both excellon drill files are PTH and continued the order

Exception: 2
Minimum drill-drill distance in our Pcb Power Services is 0.15mm.
Your design has drill-drill distance of 0.08mm.

Example errors in white - Not all errors are shown - CHECK your complete design
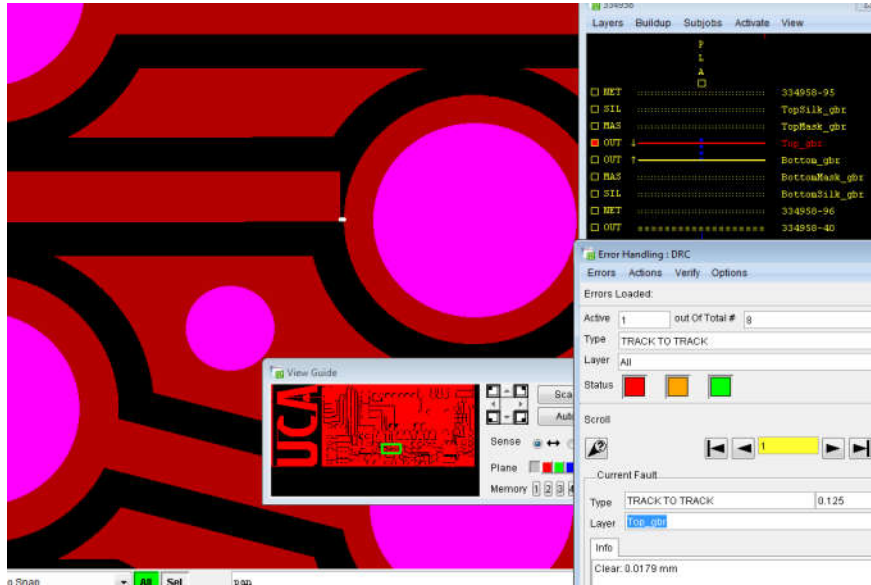## Suggested solution :
We request you to make changes accordingly. Refer last page for our capability.

:

Exception: 3

Minimum TT-TP-PP-TW in our Pcb Power service is 0.125mm.
Your design has TT-TP-PP-TW of 0.0179mm.
Total 01 TT-TP-PP-TW errors found which are <0.15mm.

Example errors in white - Not all errors are shown - CHECK your complete design

Suggested solution :

Can we continue the order by making short where PAD TO TRACK error found?