

Station name	TAS MIT
People present	Aso, SHL
Purpose	Maintenance / installation / take-down / quick visit / emergency
Date	4/9-21 and 7/9-21 15.30-17.30

Notes:

Have tightend wire on station

AWS to do list		Check after maintenance		
Part	Part shipped (Y/N)	Shipped part number	Part number upon departure.	
Radiometer	N			Clean? Y/N
Ablation hose assembly	Y		5028	No air in hose and bladder half full? ☒ Y/N
Iridium modem IMEI number	N			
Inclinometer/compass	Y	Attached to the radiometer? Y/N		
Satellite antenna	N			
Wind sensor	N	Black box pointing toward the radiometer (i.e. along the boom)? Y/N		
Temperature / humidity assembly	N	Fan spins? Y/N Sounds OK? ☒ Y/N		
HygroClip in T/hum assembly	Y	NB: could have a 40 °C offset		
Sonic ranger on AWS 2843	Y	Old sensor with new membrane? ☒ Y/N		
Sonic ranger on stake(s) SN 3504	Y	Old sensor with new membrane? Y/N NB: make sure not being buried next winter ☒ No new senso.		
Thermistor string	Y	Did not install new Thermistor string. Two drill flights stuck in ice		
Solar panel	N	Clean? Y/N NB: is not effective when partially covered		
GPS antenna	N	At top of logger enclosure? Y/N		
Data logger	N	CR1000 or CR1000X?		
Multiplexer	N	Clicking during measurement cycle? Y/N		
Logger enclosure	N	Replaced (including everything inside)? Y/N New desiccant bags? Y/N		
Battery box	N	New box? Y/N New desiccant bags? Y/N		
Stakes	Y	New one(s) drilled in? Y/N Length of new stake(s) 8 m? ☒ Y/N Bottom plugged to reduce melt-in? ☒ Y/N		
Tripod	N	New tripod? Y/N New sensor boom? ☒ Y/N		



Metadata maintenance

	Arrival	Departure
Time difference between logger clock and UTC ($\pm$ mm:ss)	15 sek	0 s
Download data to PC and/or change CF Card (wait for green light)	Y/N	Y/N
Name of logger program	Promic 2015 e. CR1	Same
Screen dump of values in fast scan mode	Y/N	Y/N
Photos of tripod, sensors, logger box wiring etc. (more is better)	Y/N	Y/N
Mast tilt towards radiometer (- if tilting towards anemometer)	blat 6 radiomet 9 °	+6 °
Mast tilt across boom looking from radiometer (- if clockwise)	8-5 °	8 °
Boom direction relative to north	15 ° true/magn.	1 ° true/magn. mod est
Box on wind sensor exactly towards mast? If not, measure.	Y/N	Y/N
Radiometer exactly aligned with inclinometer? If not, measure.	Y/N	Y/N
Temperature / humidity height (bottom of casing – surface)	238 cm	244 cm
Stake assembly standing?	Y/N / sort of	Y/N / sort of
Free length of stake (if 3: outer, holding boom with sonic ranger)	— cm	cm
Free length of stake 2 (if 3: middle)	— cm	cm
Free length of stake 3 (if 3: outer, without sonic ranger)	— cm	cm
Height of ablation bladder fluid level above the ice surface	126 cm	138 cm
Vertical difference in surface height (at station – at hose) (approx.)	70 cm	30 cm
Length of thermistor string on surface from surface marking	880 cm	— cm
Apparent damage to sensors? If yes, which?	Y/N	Y/N

Notes:

AM SR50 on stakes assembly completely melted out.
PT half fallen into crevasse

Large crevasses on either side of station in along flow dir.

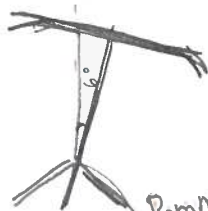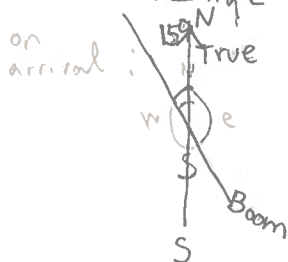

Bommen er bjet dvs 90°

Arrival height above surf
SR50 on stakes
269 cm

Two drill flights stuck in ice.

Must-do at next visit:

* Better solution for SR50 on stakes $\Rightarrow$ Bring new mount for:

* Redrill ablation $\Rightarrow$ Done

* Drill-in thermistor string

* New Boom on station $\Rightarrow$ the current one is bent. } New station? 2

* New wire on station

* Drill got stuck in ice on both visits.

Page 2 of 2

$\rightarrow$ pick up 2 drill flights?

* Station located between two large crevasses. See fieldpics.