


MAINTAINCE SHEET FOR PROMICEv3

Station name:	NUK_U-v3	Date:	24/6/26
People present:	Aggathaliit, Penny, Alex (pilot)	Maintenance	Install Take-down Data Download

Weather:	Sunny, 50C, some cloud
----------	------------------------

METADATA		
	Arrival	Departure
Download Data	YES / NO	NA
Time difference between logger and UTC ($\pm$ mm:ss)	00 : 43	00 : 00
Screenshot of 'Status' table	YES / NO	YES / NO
Screenshot of 'Public' table in FastScan mode	YES / NO	YES / NO
Photos of tripod, loggerbox and sensors (inc. radiometer serial)	YES / NO	YES / NO

STATION POSITON AND OREINTATION		
	Arrival	Departure
Lufft height (see A)	231cm	235cm
Station SR50 height (see A)	225cm	227cm
Radiometer height (to bottom)	250cm	250cm
Boom direction (towards radiometer, see B)	156° (looking along boom)	156° (same)
Wind sensor orientation (away from black box, see C)	Just like C. No need for correction	correction ✓
Radiometer across-boom tilt, looking at the front (see D)	10°	10°
Stake assembly condition	Top pole had cracked off	Vertical / OK / Down
Stake SR50 height (see A)	N/A	41cm
Length of PTA hose between 0 m mark and surface	9230	900cm
Length of t-string between SDI-12 converter and surface (see E)	270	600cm

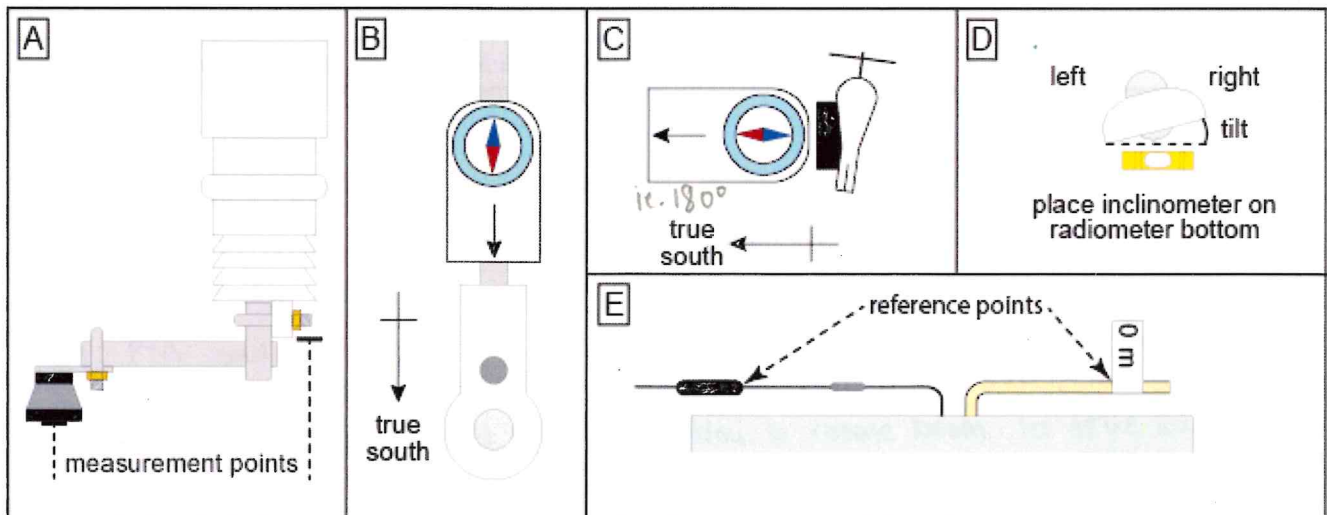

Station name: NUK_U-v3

Date: 24/6/2026

STATION HARDWARE			
To do?	Done?	Item	Comments
		Loggerbox	ID arrival: T3B-0005 ID departure: Same
		Modem IMEI	IMEI arrival: 300-534-063-817-730 IMEI departure: Same
		Radiometer	Serial arrival: 213257 Serial departure: Same
Replace	NO	Wind sensor	Type arrival: Black / White Type departure: Black / White Shipped wind sensor used on NUK-Lv3
Replace	✓	Lufft	Swapped with a lufft calibrated in 2022. However, it has just sat in storage, so not used
Replace	✓	SR50 station	
Replace	✓	PTA	Serial arrival: Unknown Serial departure: 50305
Replace	✓	Thermistor string	
Replace	✓	Stake assembly	
Replace	✓	SR50 stake	
		Iridium antenna	Looks fine
		Solar panel	Looks fine
Replace	✓	Battery box	New battery box installed
Wire Tightener	NO	Tripod	Replace wire tightner NOT REPLACED. the

NOTES (e.g. sensor damage, must-do at next visit)

- Re: wire tightener
we tried the wire tightener, but it didn't put the wire under enough tension. The current solution doesn't have any visible rubbing or damage to the wire, so we kept that instead.
- Re: PTA and thermistor
we only had 10 Kovacs drill flights, so both holes are 10m deep.
- RE: station heading - did not have time to rotate boom to true south/north

MUST DO NEXT VISIT: wind sensor, radiometer, SR50s, lufft