VACUUM GAUGE FOR NCSENDER

Power the gauge from the SLB 5 V

Instead of a USB power adapter, the ATOM Lite can take its 5 V from the SuperLongBoard (SLB). Two wires: 5 V and GND.

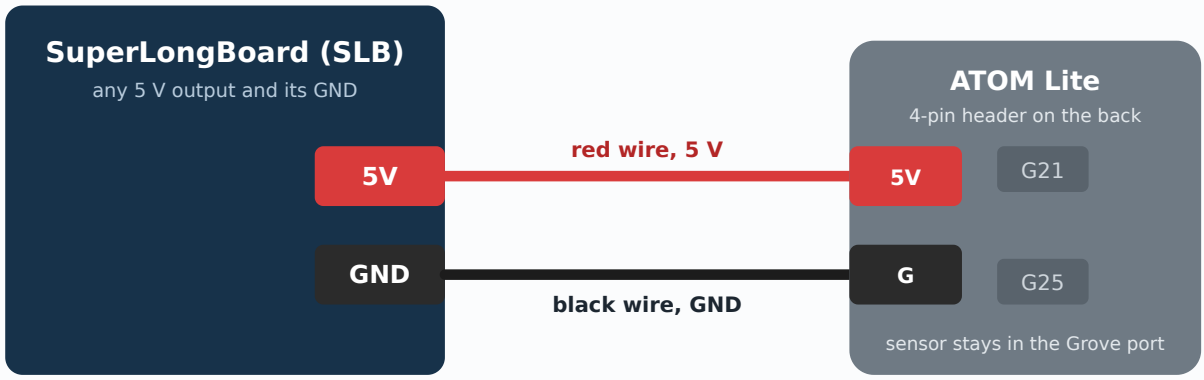

The two boards must share GND. Keep the wires short and away from the spindle and motor cables.

STEPS

1. Switch the SLB off.
2. Connect a 5 V output of the SLB to the pin marked **5V** on the back of the ATOM Lite.
3. Connect the GND next to that output to the pin marked **G**.
4. Check the two wires are not swapped, then switch the SLB on. The ATOM's light comes on.

5 V POINTS ON THE SLB (FROM THE SIENCI TECHNICAL MANUAL)

CONNECTOR	PINS, AS LABELLED	USE FOR THE GAUGE?
Spindle / RS485, 4-pin	B, A, **5V**, **GND**	Yes, if the 5V pin is free
Limit switch terminal	**VCC**, X, Y1, Y2, Z, A, **GND**	Yes. VCC is 5 V by default (it can be changed to 24 V on the board: measure it first)
Flood output	+ and −	**No.** Rated 40 mA only, and it is a switched output

Measure before you connect. Check the pin reads 5 V with a multimeter. 24 V on the ATOM's 5V pin destroys it. The Sienci manual does not state how much current the 5 V pins can give; the ATOM with WiFi and the sensor needs roughly 0.1 to 0.25 A. If the ATOM restarts or drops WiFi, use a USB power adapter instead.

Programming. The ATOM's 5V pin is joined to its USB-C power. Unplug the SLB 5 V wire before you connect the ATOM to a computer by USB.