POWER

Power the ATOM Lite

The ATOM Lite needs 5 V through its USB-C port. Use a USB power adapter, or take 5 V from the SLB-EXT so the gauge switches on with the machine.

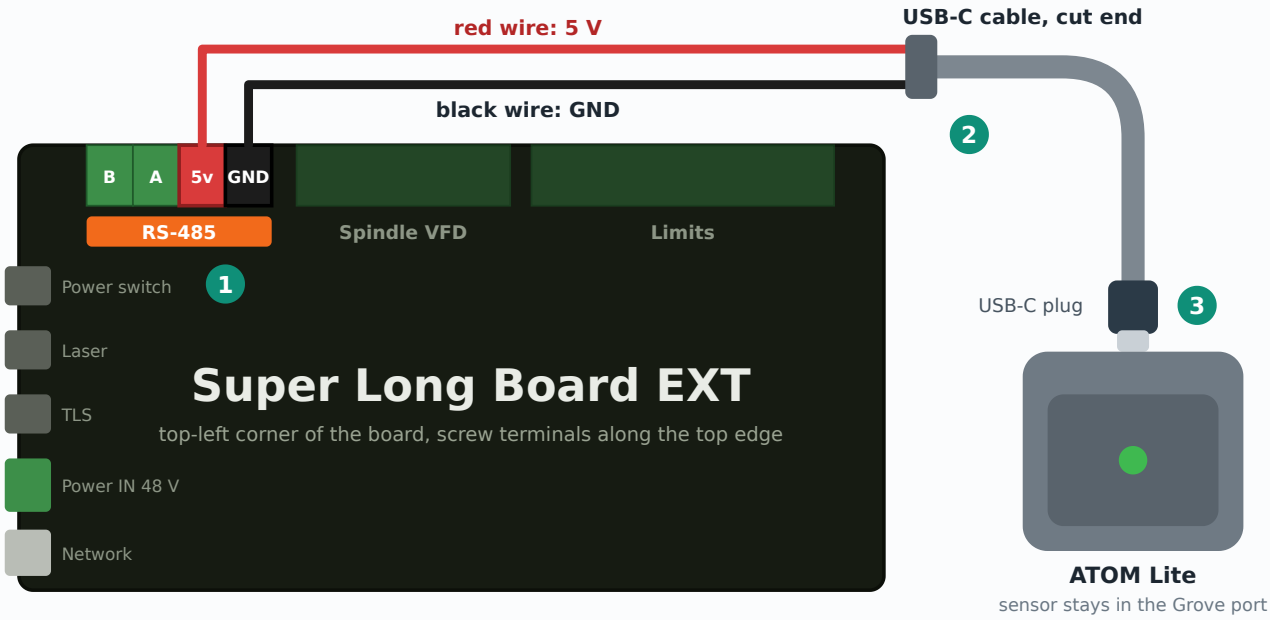

5 V and GND from the RS-485 terminal on the SLB-EXT, through a USB-C cable, into the ATOM Lite.

FROM THE SLB-EXT

1. **Find the RS-485 terminal** at the top-left of the SLB-EXT. It has four screws marked **B**, **A**, **5v**, **GND**. B and A are for the spindle VFD. Leave them as they are.
2. **Prepare a USB-C cable.** Use a USB-C power cable with two bare wires, or cut the other plug off a spare USB-C cable and strip the **red** and **black** wires. Tape off any other wires. With the machine off, screw **red into 5v** and **black into GND**.
3. **Plug the USB-C end into the ATOM Lite** and switch the machine on. The ATOM's light comes on.

Check before you plug in. Wire colours in a cut cable can differ. With a multimeter, confirm 5 V between the two wires and which one is plus, before the plug goes into the ATOM. Never use a 24 V or 48 V terminal.

If the ATOM restarts or drops WiFi, the 5 V pin is not giving enough current. Use a USB power adapter instead. To program the ATOM, unplug this cable and use a normal USB-C cable to the computer.