STANDARD OPERATING PROCEDURE OF HARDNESS VF-A01

Lab /SOP/ 01



Base Hardness Tester
Weight:1kg,5kg




Calibration Durometer hardness testers before testing.



Place the test sample on a hard horizontal surface.Apply the presser foot of the durometer hardness tester to the test sample as rapidly as possible (without shock),keeping the foot parallel to the surface of the test sample.



Perform six measurements per material.
Take the reading within three seconds
or if the durometer has a maximum indicator, use the maximum reading.

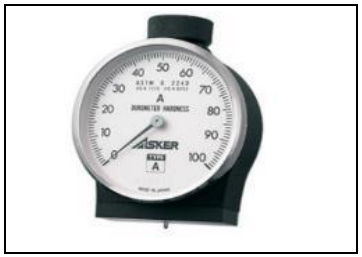

Asker A
Solid rubber material
6 mm thick, minimum load 1kg
six measurements per material
Take the reading within three seconds
Reading must be taken at least 12 mm
from any edge, and at least 6 mm apart



Asker D
Solid plastic material
6 mm thick, minimum load 5kg
six measurements per material
Take the reading within three seconds
Reading must be taken at least 12 mm
from any edge, and at least 6 mm apart



Asker C
Medium to hard foam material
10 mm thick, minimum load 1kg
six measurements per material
Take the reading within three seconds
Reading must be taken at least 12 mm
from any edge, and at least 20 mm apart



Asker F
Soft foam material
10 mm thick, minimum No additional load
six measurements per material
Take the reading within three seconds
Reading must be taken at least 12 mm
from any edge, and at least 20 mm apart

Prepared by	Approved by	REVISION		DATE	