
STANDARD OPERATING PROCEDURE OF TENSILE FOR LEATHER VF-B01

Lab /SOP/ 04-01



1. Tensile testing machine with chart recorder
2. Clamps
3. Steel scale or calipers

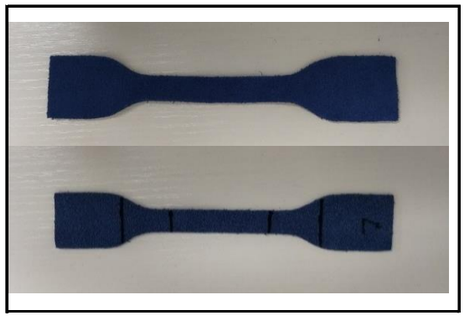

Cut three (3) samples per material in each direction with a width of 1. 27+/- 0.10cm in the gage area.
Draw two elongation bench marks at 5 cm apart.



Measure and record the width of the test sample to the nearest 0.5mm




Zero and calibrate the tensile testing machine.




Set the tensile testing machine to the specified load range, crosshead speed and jaw gap.
Crosshead speed =250 mm/minute
Jaw gap =10.0+/- 0.3cm
Elongation bench mark gaps =5.0 +/- 0.1cm



Insert the sample centrally in the top and bottom jaws of the tensile testing machine the sample is vertical.No slack or tension is present
Operate the tensile testing machine at the specified crosshead speed.

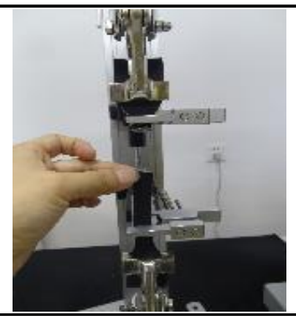

Record the breaking load to the nearest 0.1kgf (B)

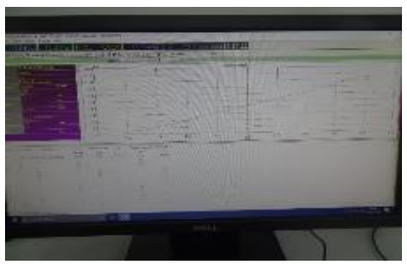

Materials of specified thickness (leather, synthetic leather, fabric etc).
Tensile Strength (kgf/cm) = B / W
Elongation (%) = (D2 - D1) / D1 x 100

Prepared by	Approved by	REVISION		DATE	