STANDARD OPERATING PROCEDURE OF TENSILE FOR THREAD VF-B01

Lab /SOP/ 04-04




1. Tensile testing machine with chart recorder
2. Clamps
3. Steel scale or calipers




Cut three (3) samples per material
Prepare samples with at least 25 cm length.
Draw two elongation bench marks at 10 cm apart.



Measure and record the width of the test sample to the nearest 0.5mm

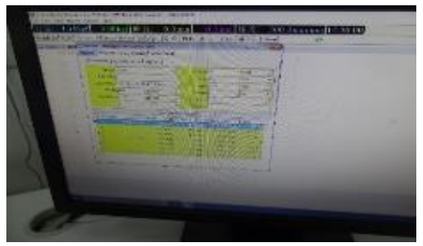

Zero and calibrate the tensile testing machine.

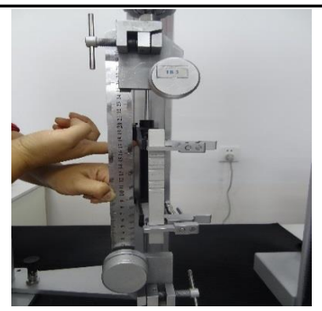


Set the tensile testing machine to the specified load range, crosshead speed and jaw gap.
Crosshead speed =300 mm/minute
Jaw gap =25.0+/- 3.0cm
Elongation bench mark gaps =10.0 +/- 0.1cm



Insert the sample centrally in the top and bottom jaws of the tensile testing machine the sample is vertical.No slack or tension is present
Operate the tensile testing machine at the specified crosshead speed.



Record the breaking load to the nearest 0.1kgf (B)

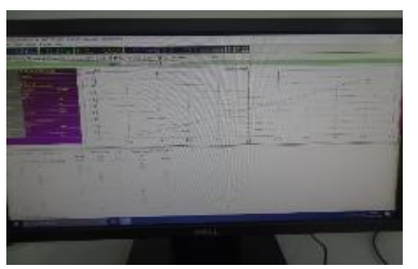

Tensile Strength (kgf) = Peak load when thread break
Elongation (%) = (D2 - D1) / D1 x 100

Prepared by	Approved by	REVISION		DATE	