STANDARD OPERATING PROCEDURE OF DIE-C TEAR VF-B05

Lab /SOP/ 06



1. Tensile testing machine with chart recorder
2. Thickness gauge
3. Steel scale or calipers



Clamp for rubber, EVA, PU material



Cut samples using a die as described. Test samples must be of a uniform thickness, and within the thickness range of 3.0 +/- 1.0mm.

Test three (3) samples per material.



Measure the thickness of the test sample at the apex of the 90° cut, and record to the nearest 0.1mm (T).




Zero and calibrate the testing machine.
Set the tensile testing machine to a crosshead speed of 500 mm/minute and a jaw gap of 57+/-3mm.



Insert the sample centrally in the top and bottom jaws of the tensile testing machine such that the sample is vertical, no slack or tension is present, and equal portions of the test sample are positioned in the top and bottom jaws.



Operate the tensile testing machine to test and stop test when material break.

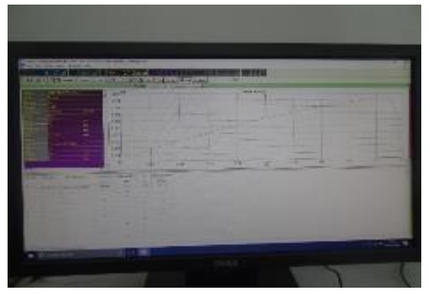

Record the tearing strength as the load at the instant of the initial tear to the nearest 0.1kgf (L).
Die-C tear strength (kgf/cm) = L/T

Prepared by	Approved by	REVISION		DATE	