STANDARD OPERATING PROCEDURE OF SPLIT TEAR VF-B06

Lab /SOP/ 08



1. Tensile testing machine with chart recorder
2. Clamps
3. Steel scale or calipers



Sample size:75mmX25mmX10mm


Test three (3) samples per material.



Draw a “tear line” lengthwise, at the midpoint of the thickness of the foam
Using a sharp blade or razor, hand cut a slit at each end of the test sample which is approximately 25 mm in length.




Zero and calibrate the tensile testing machine.

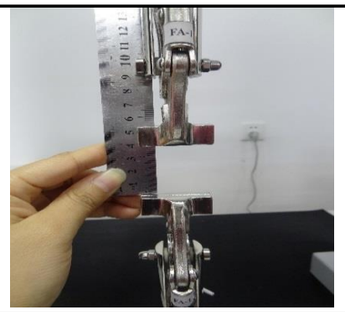

Set the tensile testing machine to a crosshead speed of 50mm/minute, and a jaw gap of 4.0+/-0.5cm.
crosshead speed of 50mm/minute.



Insert and clamp one tab centrally in each of the top and bottom jaws,
such that a minimal amount of tension is present on the tear line, and the sample points to the rear of the tensile testing machine.

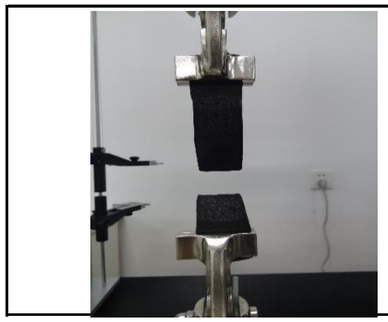

Operate the tensile testing machine
If possible allow the sample to tear for a distance of 50mm but do not cut - allow it to tear freely.



Record the maximum load (L) reached during the test.
Split tear strength (kgf/cm) = L/2.5cm

Prepared by	Approved by	REVISION		DATE	