
STANDARD OPERATING PROCEDURE OF Edgewise Crush Strength VF-B27

Lab /SOP/ 13




1.Tensile testing machine with chart recorder
2. Clamps
3.Steel scale or calipers

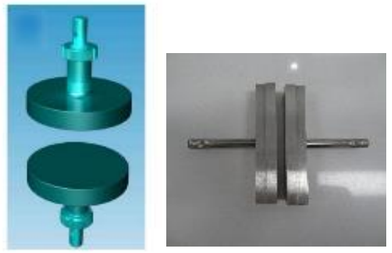


Compression platens,
Two rectangular smooth-finished metal guide blocks: 100±5 mm long and 20±1 mm




Sharp cutter, straight and parallel-sided perpendicular to the board surfaces.
Cut the samples with dimensions of 5.0 ± 0.1 cm square.

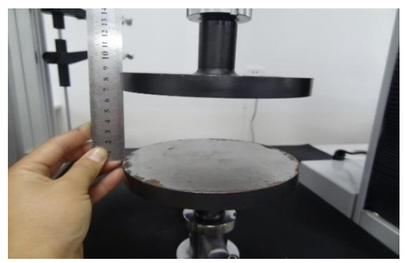


Adjust the compression / tensile testing machine so that the platens are approximately 70 mm apart.

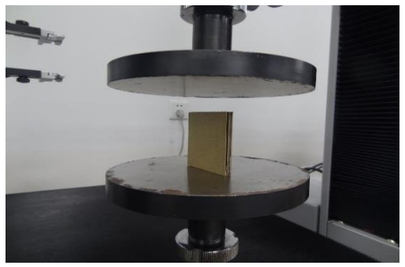


Position the test plate vertically at the center of the bottom platen such that the axes of the flutes are perpendicular to the surface of the platens, meaning the waves of the flute sections are visible at the top of the test piece.

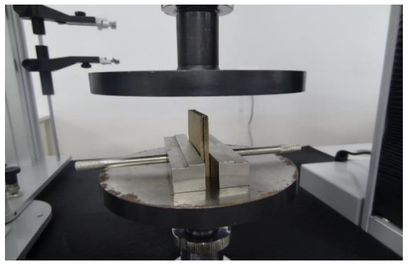

Place the two guide blocks, either side of the test piece to support the test piece in vertical alignment. These should be placed so that they are just touching the test piece without exerting any pressure on it.

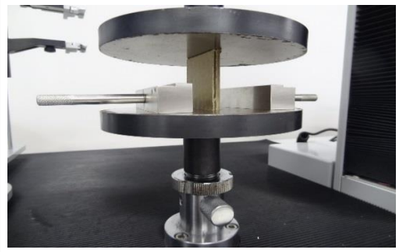

Tare the compression / tensile testing machine.
Set the crosshead speed to 10 mm/min
When the load is between 4.0 - 5.0 kgf, carefully move the guide blocks away from test piece

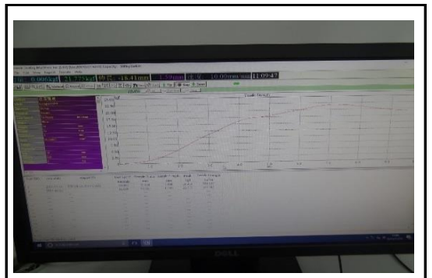

Terminate the test after buckling has occurred and a maximum load recorded.
Edgewise Crush Strength (kgf/m) = F/ W
F = load in kilogram.
W = width of test plate in meter

Prepared by	Approved by	REVISION		DATE	