www.65drones.com
Not to be reused without prior permission


Troubleshooting Guide to HULA Drone_V1_July2024

Table of contents

0. Maintenance of HULA UAV
   A. How to check drifting issues and how to calibrate
   B. How to put propellers
1. The control terminal cannot find the aircraft WIFI .....
   A. The device may not support 5G WIFI band .....
   B. Aircraft WiFi is not in direct connection mode .....
   C. The upgrade failed, or the old firmware has a bug (referring to version 1.0.1 or before), resulting in no WIFI on the aircraft .....
2. The WIFI network is unstable, and the image transmission is stuck or often disconnected .
3. Can search WIFI, but cannot connect to control .....
4. Hula APP installation fails, crashes, or cannot enter the programming interface, or the display is incomplete .....
V. Optical flow anomaly .....
VI. Flight Correction and Calibration .....
   1. Takeoff deviation .....
   2. Takeoff deviation correction .....
   3. Inaccurate flight distance, or flight deviation and correction .....
   4. Inaccurate flight altitude and correction. .....
7. Abnormal or missing functions. .....

0. Maintenance of HULA

Refer to page 21 of your instruction manual to **download the HULA App on your mobile device.**

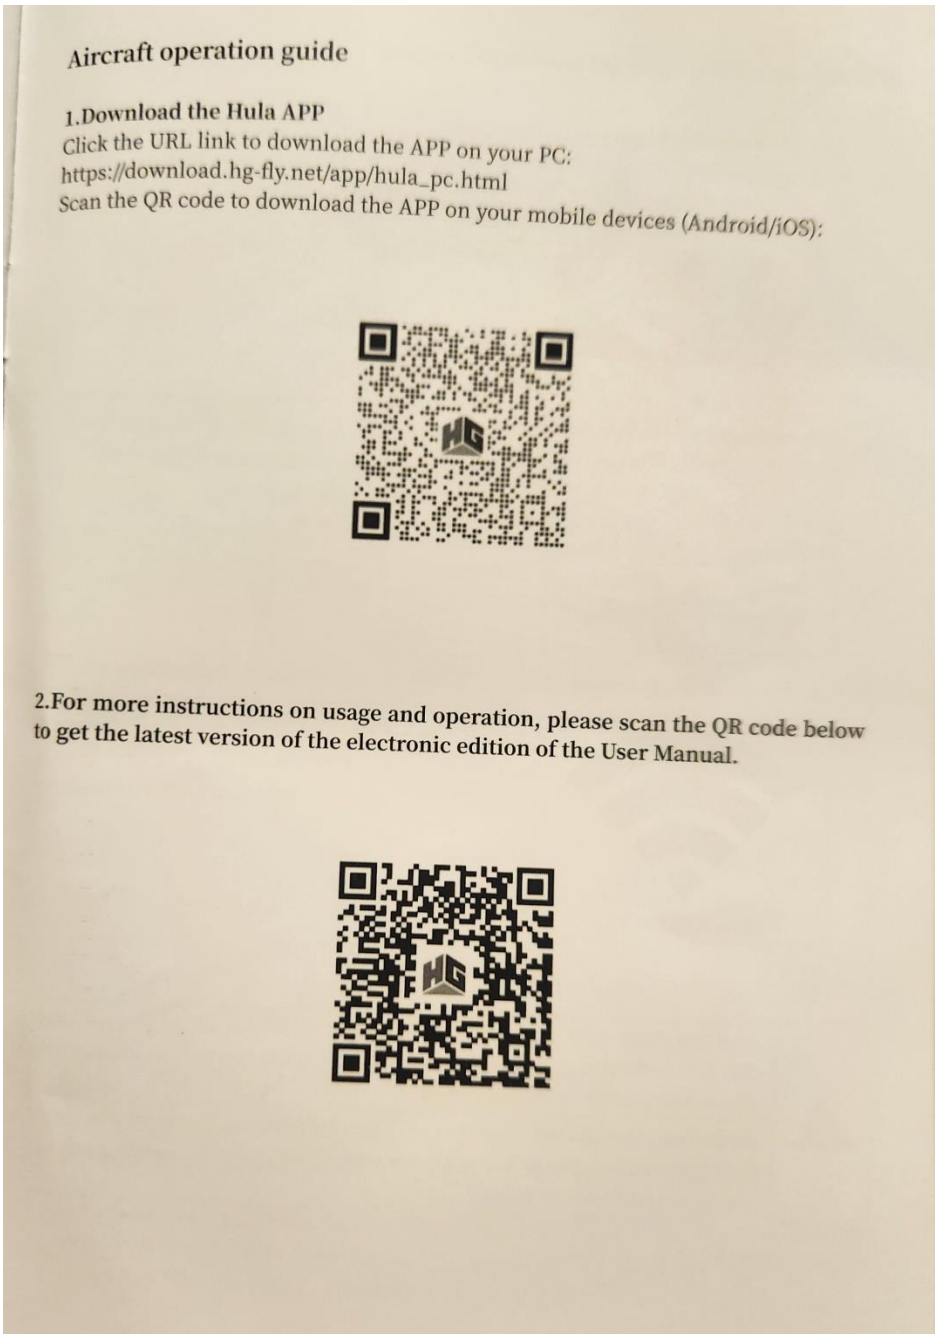

Aircraft operation guide

1.Download the Hula APP
Click the URL link to download the APP on your PC:
https://download.hg-fly.net/app/hula_pc.html
Scan the QR code to download the APP on your mobile devices (Android/iOS):

2.For more instructions on usage and operation, please scan the QR code below to get the latest version of the electronic edition of the User Manual.

A. How to calibrate HULA

After a few crashes (uses) , the drone might drift.


How to check that your drone is drifting?

You need to make sure that the take-off ground is flat, and the ground below the take-off point is non-pure color and textured, non-reflective, and windless. Take off and hover to check whether it deviates. Under normal circumstances, the aircraft deviates ± 40cm during take-off, which is within the normal range. If it exceeds this range, you can try to calibrate the aircraft IMU.


Calibration Video tutorial at

https://youtu.be/nMDENsZGDd4?si=3e_2U01eRscMYsRw

Step 1: Remove all the propellers and guards.
Step 2: Go to setting of the HULA App

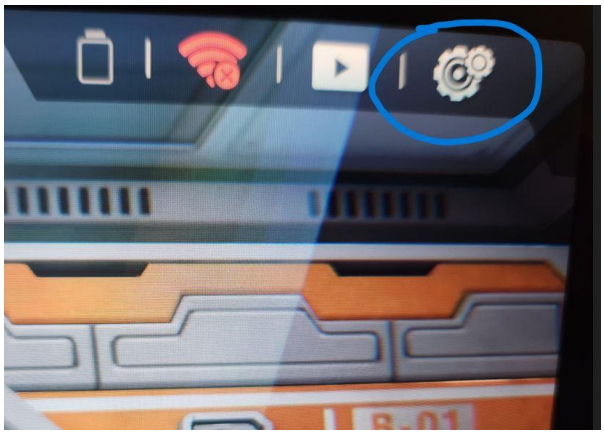

Step 3: go to calibrate IMU and follow the instructions

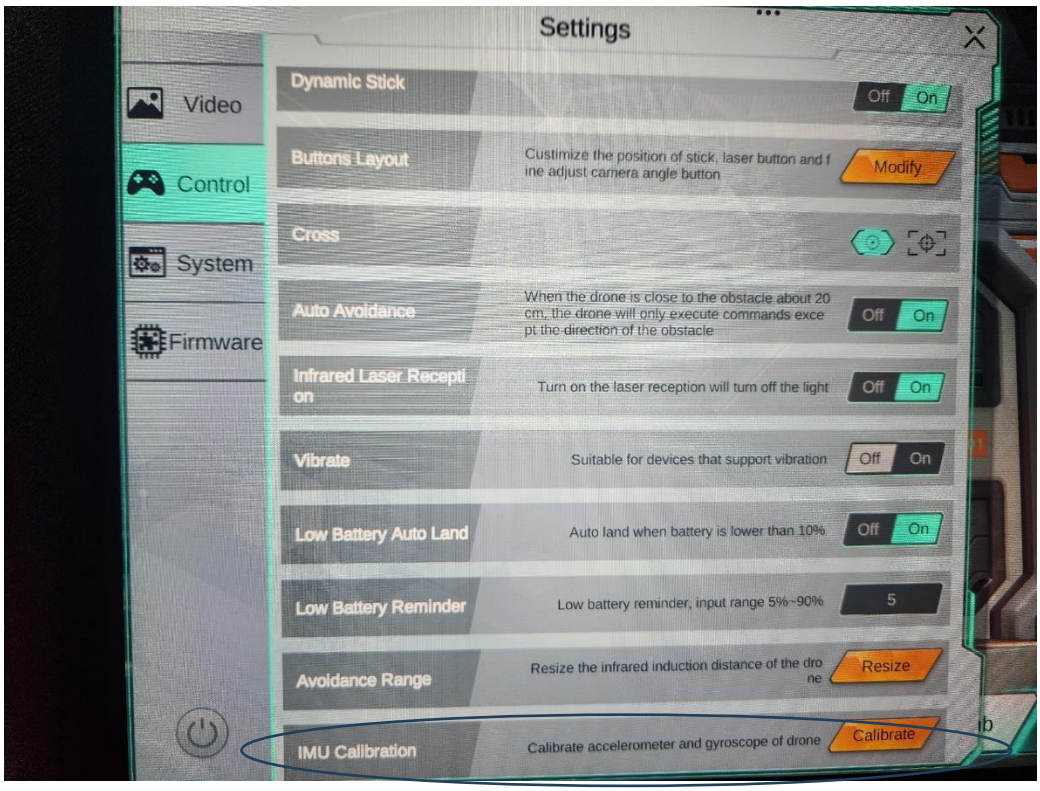

B. How to put propellers

Please follow diagram below.

CW propellers should have a curvature that curves towards clockwise direction. CCW propellers have a curvature that curves towards the counter clockwise direction.



The control terminal cannot find the aircraft WIFI


There are many reasons why the control device cannot find WIFI:

A. The device may not support 5G WIFI Frequency band

Explanation: Usually some mobile phones or computers are old or cheap, so these devices are generally not supported. In this case, you need to switch the aircraft WIFI to 2.4G frequency .

How to switch the aircraft WIFI frequency band:

1. Use a device that supports 5G WIFI , connect to the aircraft, and switch the frequency in the settings interface.

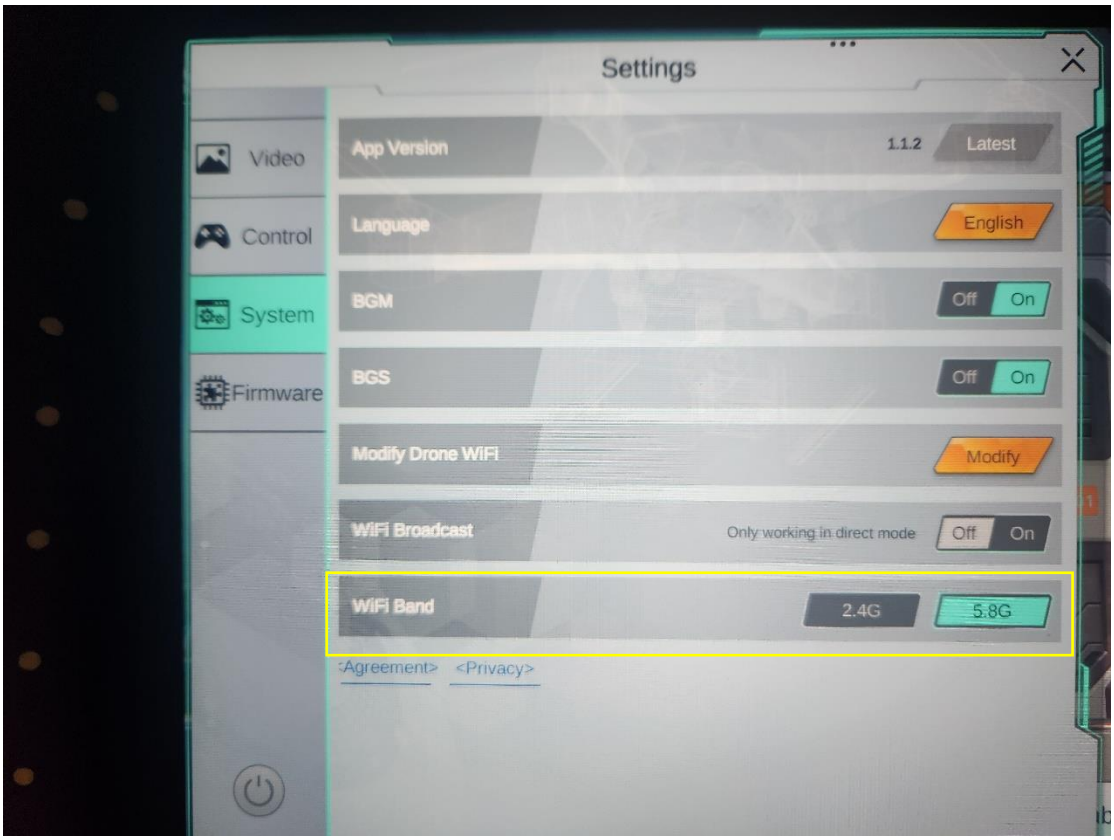

After the frequency is switched, the aircraft WIFI will be refreshed and restarted, and the device will be disconnected. Then please manually refresh the device WIFI list, and you can see the WIFI name: Hula - XXXXX -2.4 . The suffix "2.4 " indicates that the WIFI uses the 2.4G frequency . This means that the frequency switch is successful. Switching back to 5.8G is the same method. Note that you need to re-enter the password to connect after switching.

B. Aircraft WiFi is not in direct connection mode

Check the aircraft light language. The aircraft does not have a normal green light. Instead, the purple-white light flashes quickly, and then the aircraft lights up white after about 1 minute. In this case, the aircraft may have entered the mode of connecting to the router. At this time, you need to quickly press the power switch three times to switch the mode. During the switching process, pay attention to the changes in the light language. The light will flash quickly.

aircraft mode switching process takes about 1 minute. Please do not switch modes repeatedly within 1 minute.

The status light of the aircraft in the mode of connecting to the router : the purple-white light flashes quickly, and after the quick flashing, the white light lights up. We can only switch the mode after the white light lights up.

Aircraft status light in direct connection mode : Green light on

If the user cannot switch modes due to unknown reasons such as the switch button, you can try to reset the WIFI. To reset the WIFI, use a needle to poke the reset hole on the right side of the power switch, press and hold for 5 seconds and then release it. The WIFI reset time is about 1 minute. After 1 minute of WIFI reset, the default is to return to direct mode, but the WIFI frequency is factory configured to 2.4G . If the user wants to switch back to 5.8G , switch it through the above method **A.**

C. The upgrade failed, or the old firmware has a bug (version 1.0.1 or before), causing the aircraft to have no WIFI.

In this case, you need to re-flash the device, but please note that you need to use the elimination method before using this method. Use methods A and B above to eliminate the problems before using this method.


Flashing method: Use USB data cable to connect to computer. Then use special repair tool software to connect and repair. For repair tool software and usage, please contact our after-sales technicians.

2. The WIFI network is unstable, and image transmission is stuck or often disconnected.

solution:

Typically, this is caused by radio interference or a firewall installed on the computer equipment.

1. Disable computer firewall and other security software.
2. Turn off other irrelevant WIFI network devices to reduce network congestion. At the same time, limit the number of Hula drones in direct connection mode to less than 20 .
3. 5.8G WIFI vs 2.4G WIFI has better anti-interference performance. If conditions permit, use the aircraft 5.8G as much as possible . WIFI.
4. In Hula In the APP settings, set the Hula drone to competition mode to enhance anti-interference, but it is not recommended to turn it on under interference-free conditions (meaning there are no other WIFI devices in the venue).

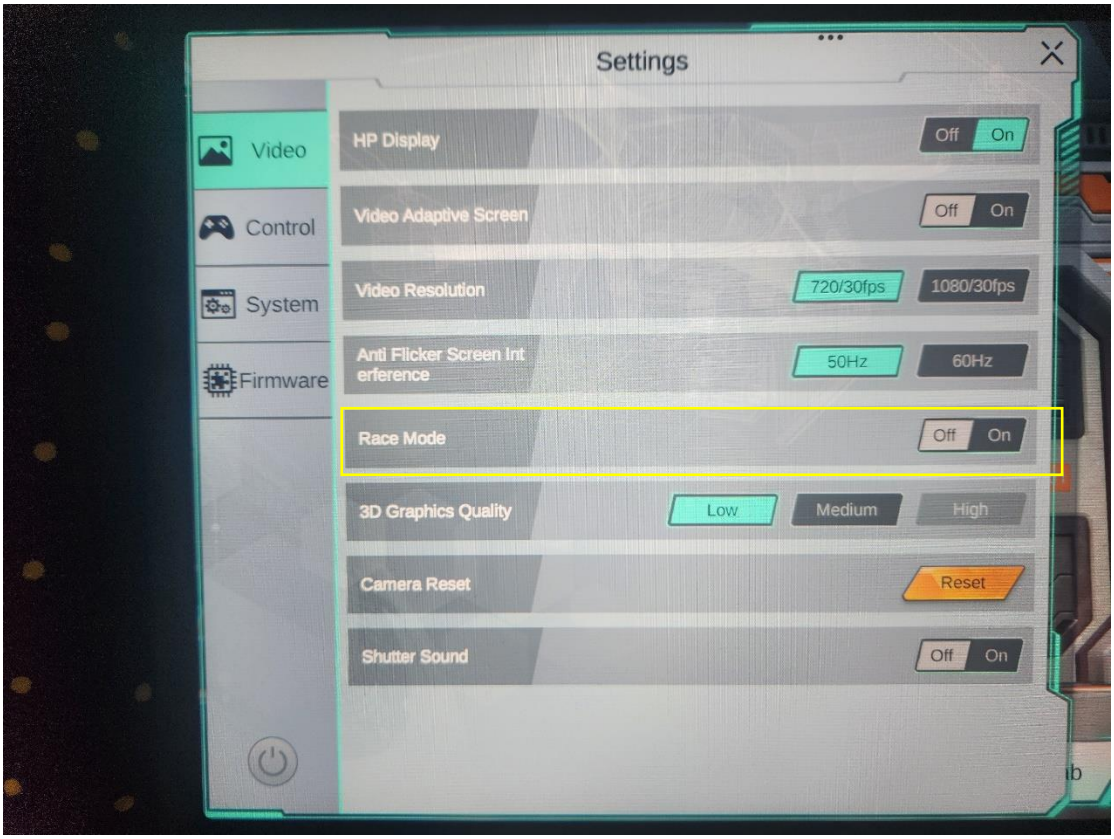

5. If all the previous methods have been tried but the problem still cannot be solved, please try to change a control device . It may be caused by poor performance of your control device, especially the wireless WIFI of some laptops, which has poor network performance. It is recommended to install an external wireless network card to solve the problem.

3. Can search WIFI, but cannot connect to control

On WIFI In the list, I can search for Hula's WIIF name, but I can't connect to it.

1. Check whether the WIFI password is entered correctly. You can try to forget the network in the device, then refresh the WIFI list and enter the WIFI password to connect. If you forget the WIFI password, you can try to

factory reset the WIFI (note that the factory default setting is 2.4G band).

2. Check whether the firmware and APP versions are updated to the latest version. The release time of different platforms (IOS, PC, Android) may be inconsistent. Users only need to check whether they are updated to the latest APP version and firmware of the current platform system.
3. When installing the APP, please give the APP sufficient network permissions and trust its network connection. At the same time, when using it, some mobile devices have network acceleration function, please turn off the network acceleration function. At the same time, mobile data (i.e. mobile phone traffic) of Xiaomi or Huawei series phones also needs to be turned off.

4. Hula Problems such as APP installation failure, crash, inability to enter the programming interface, or incomplete display.

1. **On the PC side** , you need to check whether there is Chinese in the installation path. When installing software, the installation path is not allowed to contain Chinese, spaces or special symbols. At the same time, check to turn off the firewall software.

If the automatic upgrade installation fails, you can ask the after-sales technician for the .exe executable file installation package and perform manual installation.

2. **On the mobile side,** enable all application permissions required by the HulaAPP application. If the problem still cannot be solved, it is recommended to uninstall the APP and reinstall it.

Due to the wide variety of mobile phones and PAD models on the market, the mainstream device models and systems are currently compatible, but it is not ruled out that some models are temporarily incompatible. If it still cannot be used after checking according to the above method, please report your control device brand model and system version to our technical support staff.

5. Optical flow anomaly

solution:

a. The aircraft needs to fly on a ground with clear texture , not solid color , and with sufficient light and no reflections;

b. In order to meet the needs of special events, the minimum flight altitude is reduced from 0.5m to 0.35m. When the aircraft's flight altitude is lower than 0.5m, the flight speed needs to be reduced. It is recommended that

the flight speed is ⩽25%, otherwise the optical flow abnormality may be reported and the aircraft may lose control.

c. If there is dust or fingerprints on the optical flow lens, please clean it before use.

6. Flight Correction and Calibration

When flying, you may encounter the situation where the aircraft deviates during takeoff. , or the aircraft deviates from the flight path, or the distance or flight altitude is incorrect during the flight.

4. Inaccurate flight altitude and correction .

First of all, you need to understand the altitude value used by the aircraft. The aircraft uses the location of the take-off point as the initial altitude coordinate, and the initial altitude is always referenced during the flight. This altitude is usually called the "fusion altitude", which is not the real altitude above the ground. The real altitude above the ground, that is, the real-time altitude, is usually the "TOF altitude".

Inaccurate flight altitude is usually caused by the following problems:

a. Check whether the TOF lens below is dirty. If so, please wipe it.

b. The aircraft takes off from a platform that is not at the same height

as the ground. Or there are obstacles protruding from below during flight, or the accumulated flight distance is too long, etc.


c. After performing stunts such as rolling.

7. Abnormal or missing functions.


Abnormal or missing functions mainly refer to the inability to use certain functions on the software, such as: unable to control the drone, unable to fly at negative altitudes , unable to switch frequencies, etc. Other drones can achieve this, but some cannot. This problem is mainly caused by the APP software and the flight control firmware not being updated to the latest version.

To check the version:

2. When the control device is connected to the external network, check whether the APP is the latest version .

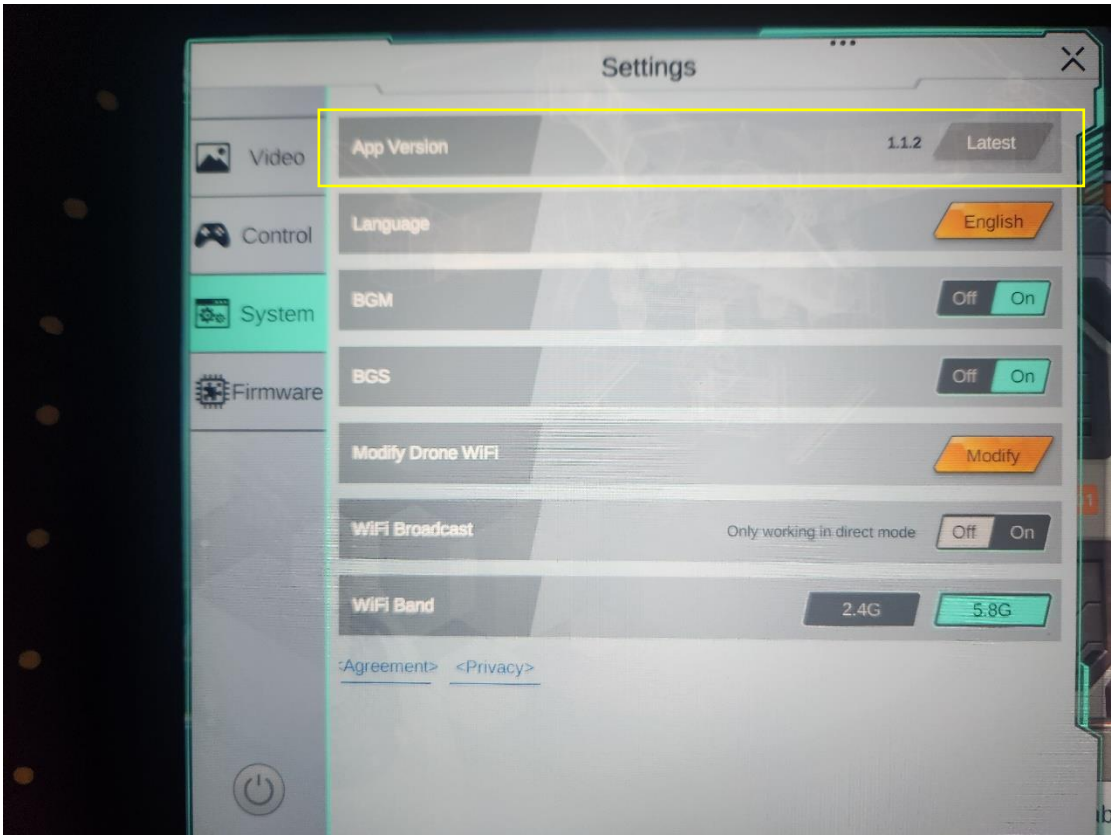

2. Check if the firmware is the latest version. The APP needs to download the firmware to the local computer while connected to the external network , and then connect to the aircraft to check if the aircraft's firmware is consistent with the local firmware.

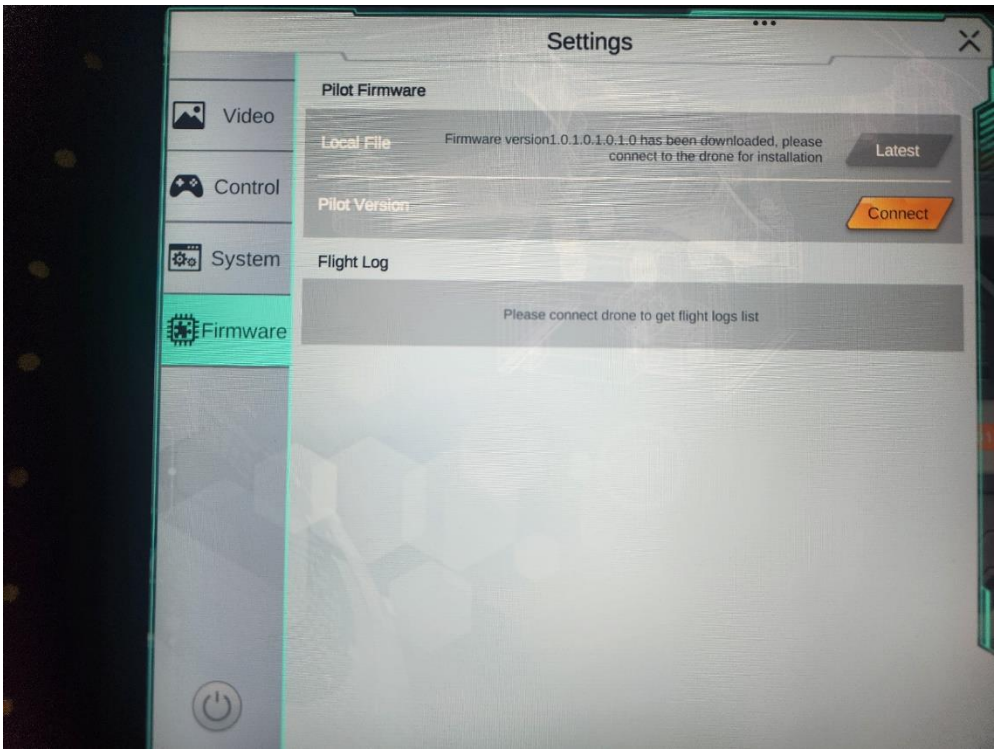
Settings
Video
Control
System
Firmware
Pilot Firmware
Local File
Firmware version1.0.1.0.1.0.1.0 has been downloaded, please connect to the drone for installation
Latest
Pilot Version
Connect
Flight Log
Please connect drone to get flight logs list