OsdagBridge
Functional Testing Report

Short-span steel girder bridge module

FOSSEE Winter Internship Screening Task

Harish Raghav S
B.Tech Computer Science and Engineering
SASTRA University

Tests carried out: 8-11 November 2026
Report date: 11 November 2026

Contents

1 Introduction and test setup **1**

1.1 Overview 1

1.2 Method and environment 2

1.3 Complete test register 3

2 Inputs and material properties **4**

2.1 Geometry and additional inputs 4

2.2 Material properties 5

3 Test observations **7**

3.1 T01 and T02: baseline and custom materials 7

3.2 T03: three consecutive runs 9

3.3 T04: saved custom materials after reload 10

3.4 T05, T05B and T05C: additional inputs 12

3.5 T06: validation and skew-bridge run 13

3.6 Structural-component coverage 15

4 Bugs and code review **16**

4.1 Save Input resets thickness values 16

4.2 End-diaphragm results in the wrong tab 17

4.3 Support reactions and barrier width 19

4.4 Further evidence on material issues 20

4.5 Report errors and unresolved observations 21

5 Coverage and published issues **23**

5.1 Requirement coverage and limits 23

5.2 Published issue register 24

6 Reproduction and conclusion **25**

6.1 Reproducing the tests and reviewing the evidence 25

Chapter 1

Introduction and test setup

1.1 Overview

Case groups	Recorded checks / attempts	New GitHub issues	Supporting comments
8	14	4	6

I tested default and custom materials, repeated designs in one session, saved-input reloads, additional-input persistence and a skew bridge. The application produced useful results, CAD and plots, but several input and display paths did not preserve or represent the intended data correctly.

I found four problems that I reported as new issues: Save Input resets the thickness values, the end-diaphragm tab shows cross-bracing results, support-reaction values disagree within the same screen, and the runtime crash-barrier width differs from my input. I included the reproduction steps and relevant source code in each issue.

Throughout this report, I have kept successful execution separate from the engineering result. A run can finish and display its outputs while still failing a design check. The completed cases reviewed here contain failed engineering checks, so I have not described them as safe bridge designs.

Repository: github.com/HR5206/OsdagBridge
Source revision recorded from T03 onward:
d74f56dd7f22925fb8148cabf5740ed8d1e39ff3

1.2 Method and environment

I used the desktop application for the manual tests and retained original screenshots, saved OSI inputs and generated reports. From T03 onward, a recorder captured input/output dictionaries around the core design call, selected runtime properties, exceptions, timing and source metadata.

Evidence layer	What I used it to check
UI screenshots and interaction notes	Entered values, visible outputs, validation warnings, CAD rotation and opening plots.
Saved .osi files	Serialization and reload fidelity; complete saved parameter combinations.
Before/after JSON and runtime objects	Actual inputs supplied to Design, result changes and selected material/geometry propagation.
Generated PDFs	Agreement with the displayed inputs, dictionary outputs and reported design status.
Source inspection and isolated checks	Specific explanations for anomalies and proposed regression checks. These are distinct from desktop runs.

Environment and provenance

My recorded sessions identify Windows 11 and Python 3.12.16 from conda-forge. The source metadata records commit d74f56d and only untracked evidence directories. I did not capture the installed revision or operating-system release during T01 and T02, so I have not assigned the later revision to those tests.

I used a recorder that wraps the original design method in memory and calls it once. The recorded time covers that call; it excludes later GUI rendering and report export. I have used these timings to describe the runs, not as performance benchmarks. I have included the scripts and source-level checks with the submission.

Status conventions

PASS means the stated functional check passed. **FAIL** identifies an observed defect or a software-reported engineering failure, with the category made explicit. **Cancelled** retains a cancellation outcome without calling it an unexpected crash. **Inconclusive** means the supplied evidence does not establish the intended scenario.

I compared values in the same units and allowed for rounding in the display. I also checked beyond the selected grade name, because a correct name does not prove that every calculation used the entered properties. I recorded videos separately. The comparisons in this report use my screenshots, saved files and logs; the video files were not independently reviewed for this report.

1.3 Complete test register

Case / date	Action or scenario	Observed outcome
T01 / 8 Nov	25 m default-grade baseline	Completed; CAD/plot/PDF generated. Reported engineering FAIL.
T02 / 8 Nov	25 m; custom steel and concrete	Material UI/OSI retention passed; CAD rotation worked. Engineering FAIL.
T03-R1 / 10 Nov	First run, span 25 m	Core returned; numerical baseline recorded.
T03-R2 / 10 Nov	Unlock/change span to 20 m	Core returned; geometry, plots and numerical outputs changed.
T03-R3 / 10 Nov	Unlock/return span to 25 m	Core returned; R1 numerical output reproduced, apart from report timestamp.
T04-A1 / 10 Nov	Reloaded custom-material session; run 01	Cancelled: RuntimeError with cancellation message; 67.24 s.
T04-A2 / 10 Nov	Same session; run 02	Cancelled: same cancellation message; 65.38 s.
T04-A3 / 10 Nov	Same session; run 03	Design error: required material.deck.fck missing; 63.50 s.
T05 / 10 Nov	Intended deck 300 / wearing course 75 mm	Inconclusive intended run: saved/results state is 250/50; no captured core call.
T05B / 10 Nov	Isolate main Save Input action	FAIL: 300/75 becomes 250/50 in saved input. No design run.
T05C / 11 Nov	300/75, direct Design after dialog Save	PASS for retention and deck output consistency; engineering FAIL.
T06-V1 / 11 Nov	Enter span 19 m	PASS: range warning and reset; subsequent screenshot shows 20.0 m.
T06-V2 / 11 Nov	Enter skew 16 degrees	PASS: range warning; I confirmed the reset. Exact replacement not captured.
T06-D / 11 Nov	30 m, 9 m width, skew 10; distinct materials	Core returned; CAD rotation/plots worked. UI/data defects and engineering FAIL.

I completed the three T03 runs in one session. The evidence supports seven completed designs: T01, T02, T03-R1/R2/R3, T05C and T06-D. Five have recorder success records. I have not counted T05 as a verified 300/75 design or combined the functional checks and engineering results into one pass percentage.

Chapter 2

Inputs and material properties

2.1 Geometry and additional inputs

Case	Span / width / skew	Deck / wearing course	Materials
T01	25 m / 7.5 m / 0 deg	250 / 50 mm	Steel A; concrete A
T02	25 / 7.5 / 0	250 / 50	Steel B for all steel; concrete B
T03-R1, R3	25 / 7.5 / 0	250 / 50	B / B
T03-R2	20 / 7.5 / 0	250 / 50	B / B
T04 source	25 / 7.5 / 0	250 / 50	B / B before reload loss
T05 saved	25 / 7.5 / null	250 / 50; UI intended 300/75	B / B
T05B intended	25 / 7.5 / 0	300 / 75; save resets to 250/50	B / B
T05C	25 / 7.5 / 0	300 / 75	B / B
T06-D	30 / 9 / 10	300 / 75	Girder B; CB C; ED D; concrete B

For the valid design cases, I used Highway Bridge, Chennai (Minambakkam) (A), Tamil Nadu, Optimized design, no median and no footpath. T05 has no basic-input screenshot and stores a null skew. I have kept that value in the record rather than replacing it with the intended zero.

Additional inputs and loading

In the executed or saved baseline layout, I found four physical girders with 2.1 m spacing and 1.05 m overhang for the 25 m cases. T06 uses four physical girders, 2.475 m spacing and 1.2375 m overhang, giving an overall width of approximately 9.9 m. The T05 preview shows different values. I have kept those preview values separate from the executed state.

The saved baseline enables Class A, AA wheeled/tracked, 70R wheeled/tracked/bogie, SV and fatigue vehicle flags, with no custom vehicles. Self-weight factor is 1.0, eccentricity 1.2 m, reinforcement Fe 500, top/bottom/side cover 50 mm and fatigue cycles 2,000,000. The exact wind, seismic, member and partial-factor settings remain in each full input file; these were not all varied independently.

I noticed that several saved baseline OSIs contain a wearing-course density of 24 kN/m3, while the UI and captured direct-design inputs contain 25 kN/m3. I have recorded both values. T05C and T06 retain 25 kN/m3 through execution.

2.2 Material properties

Steel property	A: E 350A	B: custom 345/500	C: custom 275/430	D: custom 355/510
Density, kN/m3	76.4	77.0	77.2	78.0
Fy, MPa	350	345	275	355
Fu, MPa	490	500	430	510
E, GPa	200	205	200	210
G, GPa	76.9	78.8	76.9	80.8
Poisson ratio	0.30	0.30	0.30	0.30
Thermal, x10^-6 / deg C	11.7	11.7	12.0	12.1

Full custom names: B = custom_steel_345_500; C = custom_steel_275_430; D = custom_steel_355_510. Profile A values are from the T01 saved OSI. Profiles C and D were used in T06 to distinguish cross-bracing and end-diaphragm material paths.

Concrete property	A: M40	B: custom_concrete_45_3.5
Density, kN/m3	24.5	25.5
Cube strength fck, MPa	40	45
Mean tensile strength fctm, MPa	3.0	3.5
Secant modulus Ecm, GPa	33	35
Thermal, x10^-6 / deg C	11.7	10.5

What I checked after the run

I compared the T02 OSIs before and after the run and found them identical. The property dialogs also showed my custom values. T03, T05C and T06 retained the material keys through the design call, but the runtime girder density was 78,500 N/m3 instead of the entered 77,000 N/m3. This is why I checked how the values were used, as well as whether they remained in the dictionary.

In T06, I found that all material.* values matched across input-before, input-after and output. The runtime girder E/Fy/Fu and concrete fck/fctm/Ecm also matched after unit conversion. I did not capture the separate member-design material objects. During source review, I found fixed CLI-template material fields that need to receive the properties of the relevant component.

Chapter 3

Test observations

3.1 T01 and T02: baseline and custom materials

T01 and T02 | 8 November 2026

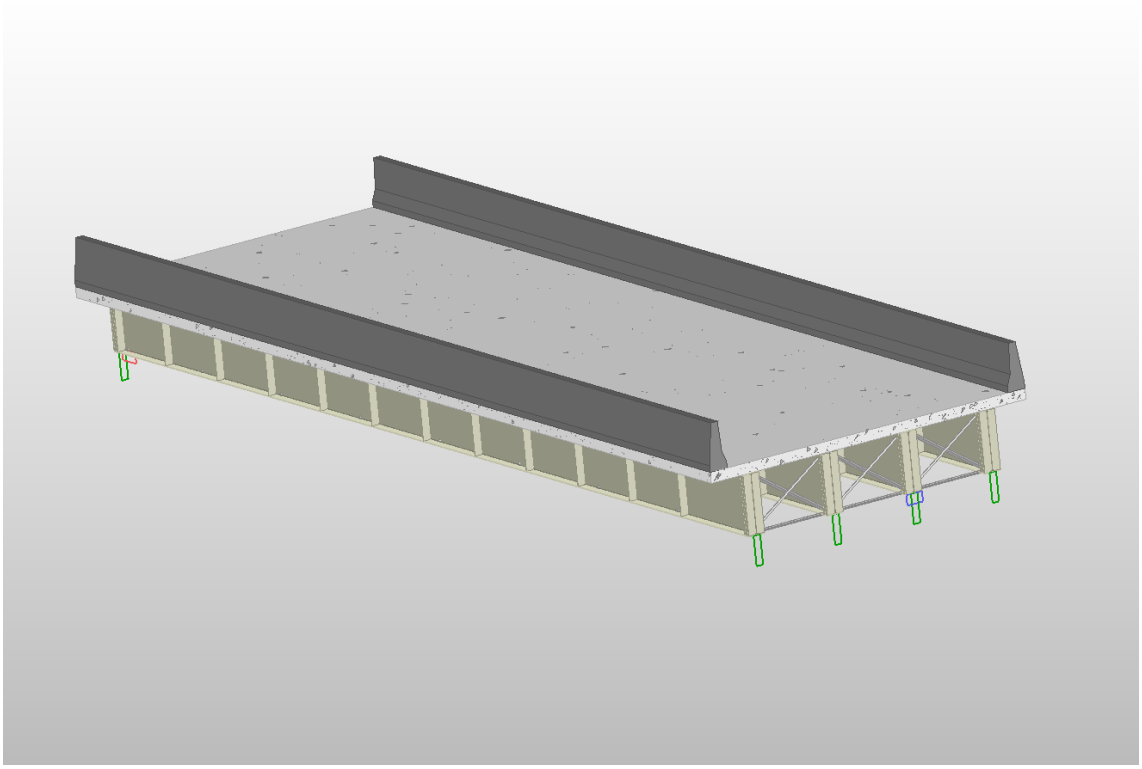


Figure 3.1: T01: generated bridge CAD (original screenshot).

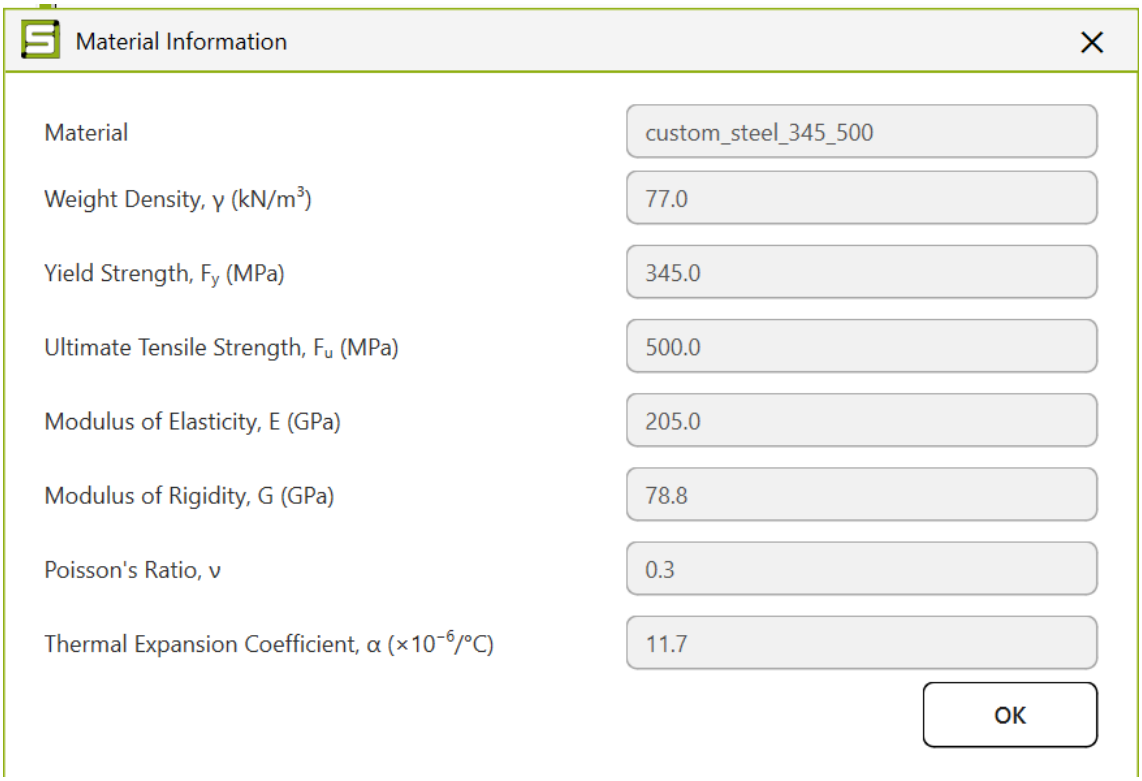


Figure 3.2: T02: retained custom steel properties after the run.

Check	T01 baseline	T02 custom materials
Geometry / steel / deck	25 m / E 350A / M40	25 m / custom steel B / concrete B
Evidence of completion	Log: analysis complete; 125.99 s	Generated model and PDF; exact duration not captured
Input evidence	576-key saved OSI	580-key before/after OSIs; identical
CAD interaction	Model visible; rotation not attributed to this case	I confirmed rotation
Engineering outcome	Report FAIL; max girder UR about 2.00	Report FAIL; fatigue about 2.00
Selected output comparison	SW moment 97.318 kNm in report; UI 97.32	Moment resistance 6907.037 kNm vs baseline 6863.47

In T01, I noticed that the Girder 1/SW screen showed RB = 14.17 kN in the field but 19.3 kN on the sketch. I found the same type of mismatch in T06, where I had recorder evidence, and reported it in Issue #73.

Both runs completed, but I found failed checks in both reports. T01 shows total deflection up to 56.704 mm against a displayed limit of about 41.7 mm. In T02, the comparable maximum falls to 55.321 mm, which is still above the limit. Several material properties changed together, so I cannot attribute this change to one property alone.

I did not capture live backend dictionaries for T01/T02. In their detailed notes, I have separated the UI, saved-file and report evidence and included every saved input in an appendix. I used the recorder in later tests to check runtime values.

3.2 T03: three consecutive runs

T03 | One session, 25 m -> 20 m -> 25 m

Quantity	R1: 25 m	R2: 20 m	R3: 25 m
Core-call duration, s	131.52	68.41	136.86
Runtime span, m	25	20	25
Transverse mesh count	18	14	18
Girder depth / flange width, mm	1390 / 420	1120 / 340	1390 / 420
Visible plot Dy, mm	-3.70	-2.32	-3.70
Fatigue ratio	1.9985	2.2152	1.9985
Core exception	None	None	None

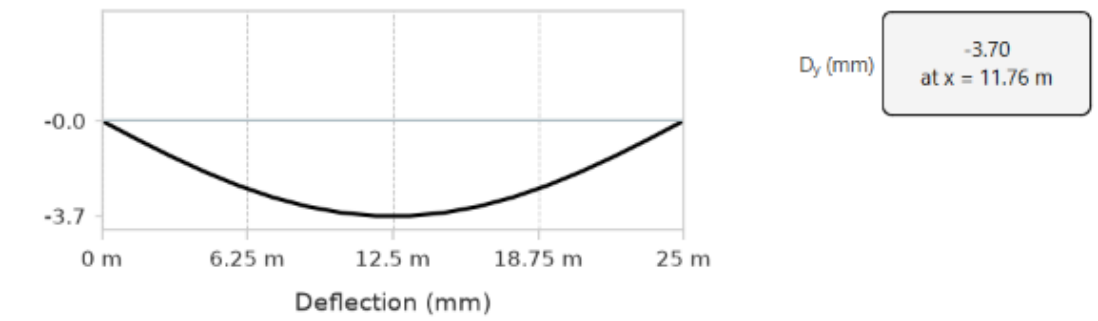


Figure 3.3: R1 plot: span 25 m; visible Dy -3.70 mm.

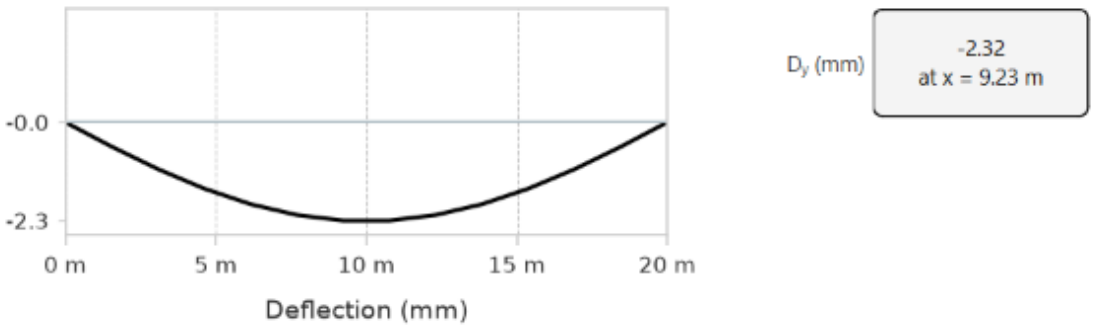


Figure 3.4: R2 plot: span 20 m; visible Dy -2.32 mm.

After each completed design, I unlocked the inputs, changed the span and ran again without restarting. The final 25 m run reproduced R1: parsed input-before dictionaries are equal; output dictionaries differ only in the generated timestamp inside design_results.report_text. R2 changes 163 top-level output entries.

This sequence passed: I could change the span and return to the original span without restarting. I have not treated one sequence as proof that every consecutive-run scenario is stable. Changing the span also regenerated suggested sections; 84 before-input fields changed between R1 and R2, not just the span field.

All three designs reported engineering FAIL. My plot screenshots are cropped and do not show the member/load selectors, so I have not labelled their deflection values as a verified total-load case. I used the runtime lengths and plot axes to confirm the geometry update.

3.3 T04: saved custom materials after reload

T04 | Fresh-session load exposes a dialog exception and loss of concrete properties

Concrete key	Source OSI	Re-saved state
density	25.5	24.5
fck	45	null
fctm	3.5	null
ecm	35	null
thermal	10.5	11.7

```
  File "C:\Users\Haris\fossee-work\OsdagBridge\src\osdagbridge\d
esktop\ui\docks\input_dock.py", line 806, in _show_material_info
    MaterialPropertiesDialog(
  File "C:\Users\Haris\fossee-work\OsdagBridge\src\osdagbridge\d
esktop\ui\dialogs\material_properties.py", line 261, in __init__
    self._load_material_info_for_view(self.selected_material)
  File "C:\Users\Haris\fossee-work\OsdagBridge\src\osdagbridge\d
esktop\ui\dialogs\material_properties.py", line 751, in _load_ma
terial_info_for_view
    KEY_MATERIAL_GIRDER_E: "{:.1f}".format(defaults.get("E", 0.0
)) if defaults else "",

      ^^^^^^^^
UnboundLocalError: cannot access local variable 'defaults' where
 it is not associated with a value
```

Figure 3.5: Steel info callback: UnboundLocalError for defaults.

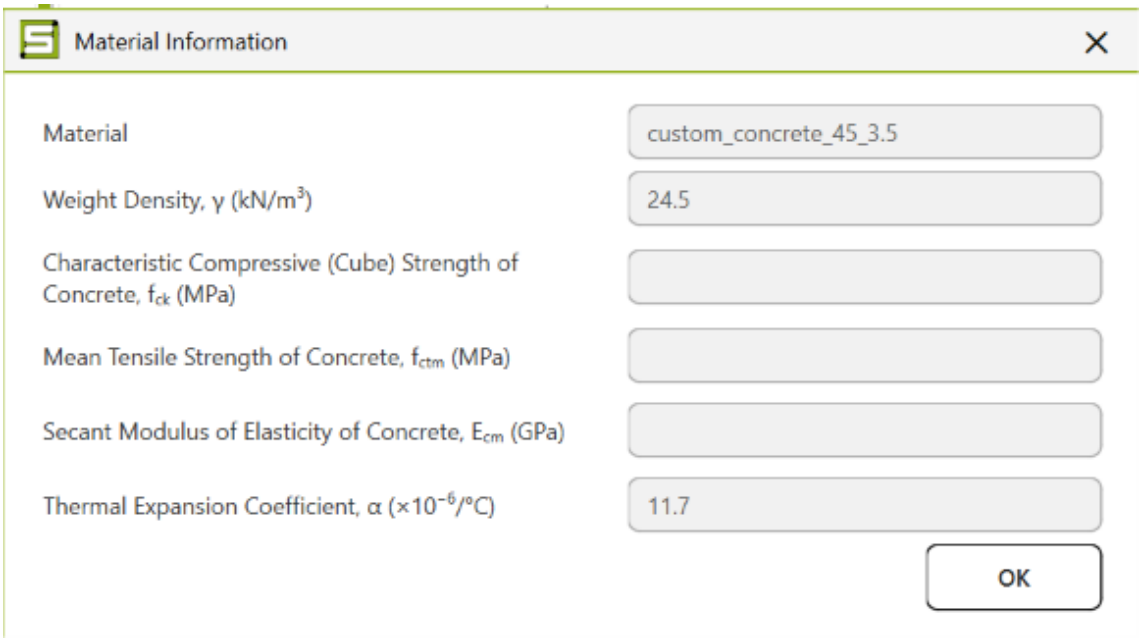


Figure 3.6: Concrete info: custom name remains, strength/modulus blank.

I checked the source OSI against the T03-R3 after-save file and found them byte-identical. After reload, exactly five of the 580 saved values changed, all under material.deck. On the third recorded attempt, Design stopped because material.deck.fck was missing. The first two attempts contain cancellation messages, so I have recorded them as cancelled attempts.

After the steel-info exception, I could still open the deck dialog and attempt Design. I have therefore recorded a dialog callback exception followed by a handled design error, rather than a complete application crash.

Cause and proposed correction

In the source, I found that loading does not rebuild InputDock._material_custom_fields. Later material priming can replace the saved values with defaults. In material_properties.py:751, a custom-name branch also reaches defaults before assignment. I suggest restoring the complete properties for each component on load, checking incomplete custom materials and initializing the dialog variables safely. Fixing only the exception would not restore the lost data.

My supporting comment on #19 includes the OSIs, screenshots and run_03 traceback. I have kept these partial failure outputs separate from completed design results.

3.4 T05, T05B and T05C: additional inputs

T05, T05B and T05C | Keep the inconclusive attempt and the controlled follow-ups separate

Case / checkpoint	Deck thickness	Wearing course	Interpretation
T05 input screenshots	300 mm	75 mm	Intended values visible
T05 saved/result state	250 mm	50 mm	Does not establish the intended run
T05B after dialog Save	300 mm	75 mm	Values I observed after dialog Save
T05B after main Save Input	250 mm	50 mm	Reset reproduced in source function
T05C input -> output -> PDF	300 mm	75 mm	Direct Design retains intended values

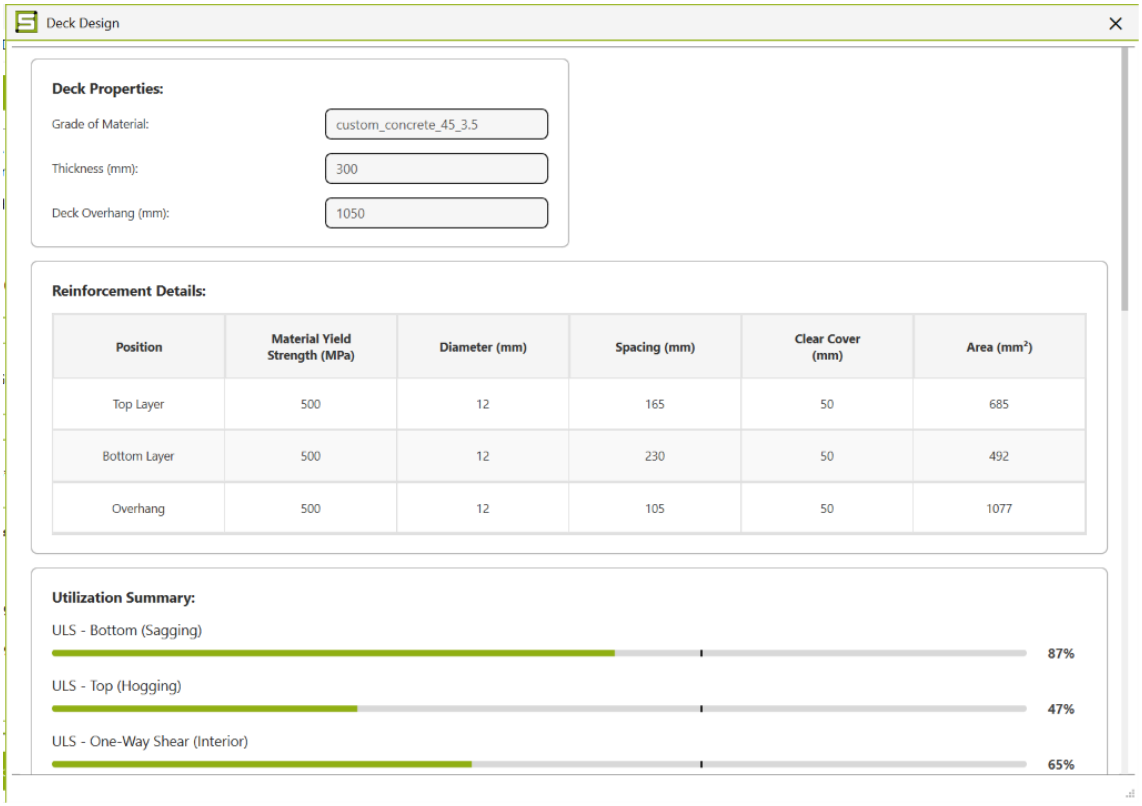


Figure 3.7: T05C: the actual 300 mm deck result, with reinforcement and utilization displays.

I do not have a numbered recorder run for T05. Its component screenshots show the 250 mm state, so I have not counted it as a successful 300 mm design. I used T05B to isolate the main Save Input action. In T05C, I went directly to Design after saving the dialog and verified 300/75 in the backend and report.

T05C returned in 31.48 s without a captured exception. I compared its deck bottom/top/shear ratios of 0.866/0.470/0.646 with the displayed 87%/47%/65% and found that they matched after rounding. The overall engineering status was still FAIL, with fatigue DCR 2.1776.

3.5 T06: validation and skew-bridge run

T06 | Two rejected values, then one valid 30 m / 9 m / 10-degree design

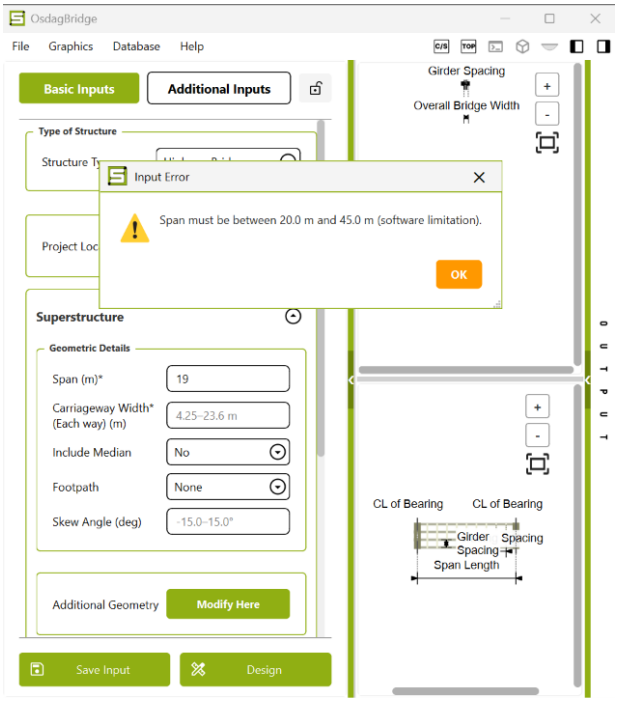


Figure 3.8: Span 19 m rejected: supported range 20-45 m.

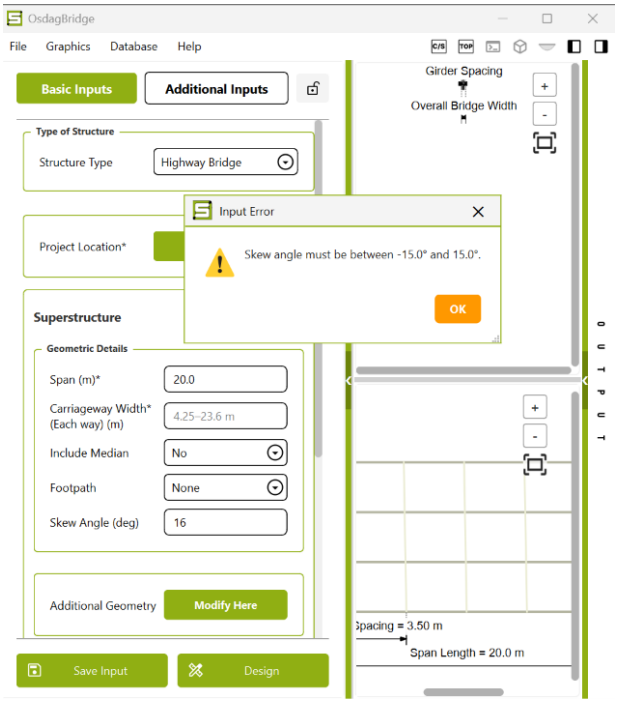


Figure 3.9: Skew 16 degrees rejected: supported range -15 to 15.

Both warnings appeared and the fields reset. The second screenshot shows the span reset to 20.0 m. The skew replacement value is not captured; its reset is my interaction observation. Neither invalid input was submitted for design.

Valid-run check	Result
Runtime span / width / skew	30.0 m / 9.0 m / 10.0 degrees
Deck / wearing course	300 / 75 mm retained through inputs, outputs and PDF
Core call	152.41 s; engine_returned; no captured error
CAD and plots	Generated; rotation and opening plots confirmed
Girder 1 / SW plot	Mz 205.54 kNm; Vy 25.19 kN; Dy -5.28 mm
Engineering outcome	FAIL; fatigue DCR 1.8924 (189.24%)

For this case, I selected different grades for the girder, cross bracing and end diaphragm. The before/after inputs each contain 588 keys, and the output contains 1,070. I found 35 input changes related to section normalization and optimized thickness resolution. The geometry and material fields I was checking remained intact.

I confirmed that the CAD model was generated and could be rotated. I did not measure every solid in the model, so the 10-degree input and runtime angle alone do not verify the skew of every rendered component.

3.6 Structural-component coverage

Component	Evidence and comparison	Limit
Main girders	UI dimensions and SW plots; runtime materials; utilization and report tables	No independent full-code structural recalculation
Concrete deck	Custom properties; 250/300 mm outputs; reinforcement and ratio comparisons	Density load path differs from custom input
Cross bracing	Selected grade, section, demand/capacity/UR rows and output dictionary	Separate material propagation not verified by UI retention
End diaphragms	Distinct output compared to UI in T06	UI substitutes cross-bracing ratios
Intermediate / bearing stiffeners	Custom grade and dimensions visible in T05; report checks reviewed	Not a complete independent design audit
Longitudinal stiffeners	Disabled / NA in tested configuration	Enabled configuration not tested
Shear connectors / reinforcement	Saved dimensions and report checks retained	No separate connection-detail validation

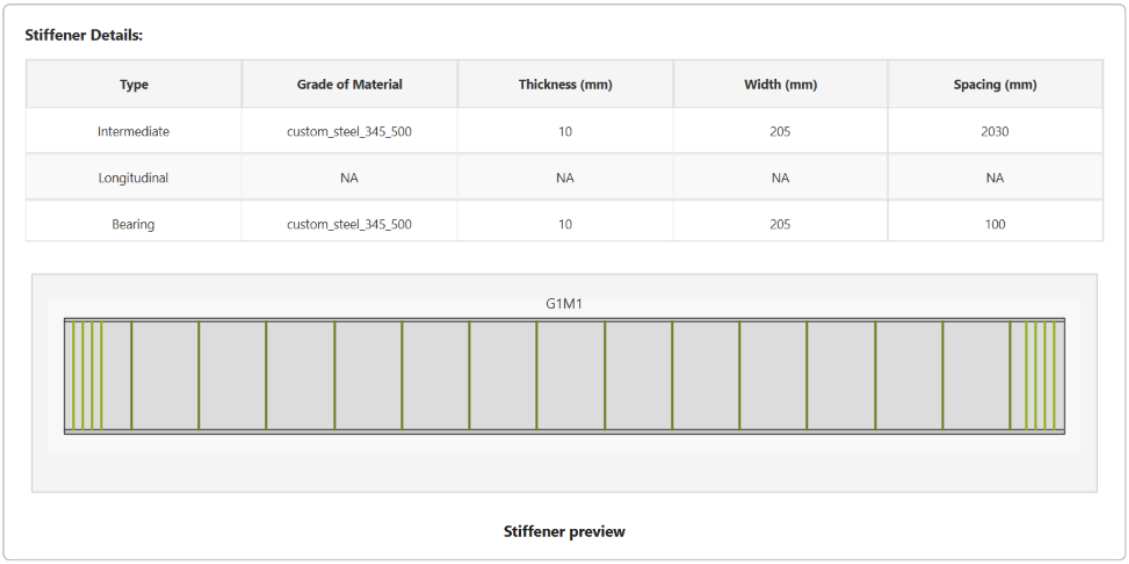


Figure 3.10: T05: intermediate and bearing stiffeners show custom grade, 10 mm thickness and 205 mm width; spacing 2030 and 100 mm respectively.

I noticed that the file named 06_end_stiffner_results actually shows the end-diaphragm view. I used the visible content to classify it. The table records what I checked for each component; it does not claim that I verified every design equation.

Chapter 4

Bugs and code review

4.1 Save Input resets thickness values

Published Issue #71 | Input persistence | Reproduced in GUI observations and an isolated source check

Open issue #71: Save Input thickness reset

I saved a 300 mm deck and 75 mm wearing course in Additional Inputs. When I then used the main Save Input button, the saved file contained 250/50. T05C showed that direct Design could retain 300/75. I therefore reported this as a problem in the save path, rather than saying that custom thicknesses never work.

Checkpoint	Deck, mm	Wearing course, mm
Values I entered before Save Input	300	75
T05B saved OSI	250	50
Independent defaults-function reproduction	250	50

Source path

desktop/ui/template_page.py:793 calls solve_extend_basic_input_dict(self.input_dict) before the file dialog. core/bridge_types/plate_girder/defaults.py:181 uses an unconditional dictionary update for defaults.

```
def _update(key, value):
    if input_dict.get(key) in (None, ""):
        input_dict[key] = value
```

I suggest this guard for inserting defaults into user-editable fields without overwriting entered values. The complete fix still needs to separate initialization,

derived-layout recomputation and saving. Copying the dictionary before calling the current function would protect the live state but still save the wrong values. Applying the guard to every derived value could also stop necessary recomputation.

Checks I would run after the fix


For regression testing, I would check that 300/75 survives save, reload and repeated save; missing optional defaults are filled; and dependent geometry is recalculated when its inputs change. I would also check cancelling Save because the mutation occurs before the file dialog opens. I identified that cancellation risk from the source; I did not execute it as a desktop test.

scripts/reproduce_save_reset.py reads a copy of the OSI and calls the original function. Its assertion fails on the tested revision and should pass after a correct fix. No application patch has been applied or validated in this submission.

4.2 End-diaphragm results in the wrong tab


Published Issue #72 | UI/output dictionary consistency | G1-G2, Envelope

Check	CB output / UI	ED output	ED UI
Diagonal tension	0.18	0.23	0.180
Diagonal compression	0.85	0.54	0.850
Chord tension	0.16	0.20	0.160
Chord compression	0.74	0.47	0.740

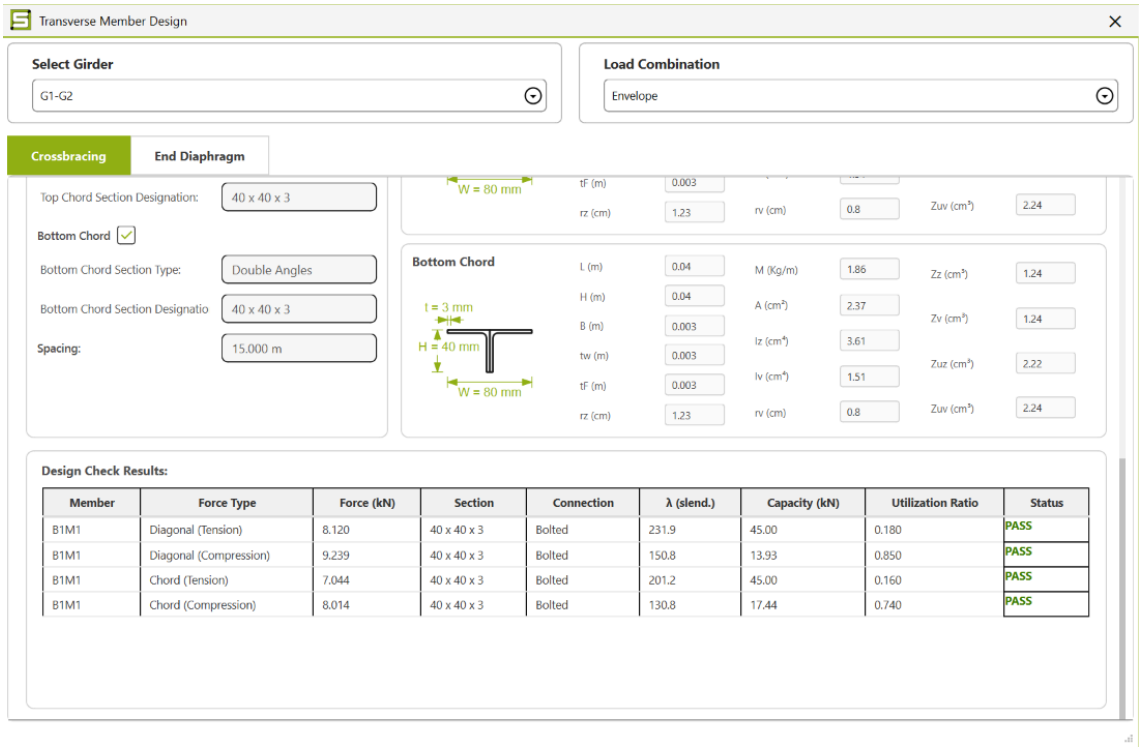

Member	Force Type	Force (kN)	Section	Connection	λ (slend.)	Capacity (kN)	Utilization Ratio	Status
B1M1	Diagonal (Tension)	8.120	40 x 40 x 3	Bolted	231.9	45.00	0.180	PASS
B1M1	Diagonal (Compression)	9.239	40 x 40 x 3	Bolted	150.8	13.93	0.850	PASS
B1M1	Chord (Tension)	7.044	40 x 40 x 3	Bolted	201.2	45.00	0.160	PASS
B1M1	Chord (Compression)	8.014	40 x 40 x 3	Bolted	130.8	17.44	0.740	PASS

Figure 4.1: Cross-bracing screen.

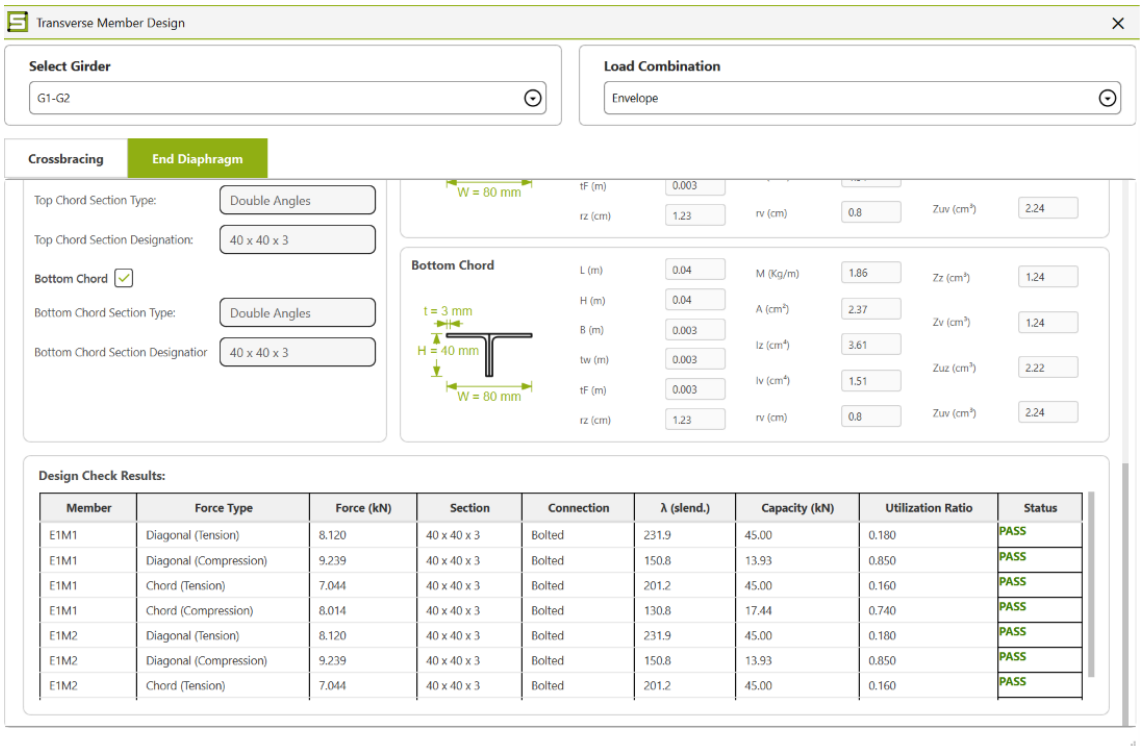

Member	Force Type	Force (kN)	Section	Connection	λ (slend.)	Capacity (kN)	Utilization Ratio	Status
E1M1	Diagonal (Tension)	8.120	40 x 40 x 3	Bolted	231.9	45.00	0.180	PASS
E1M1	Diagonal (Compression)	9.239	40 x 40 x 3	Bolted	150.8	13.93	0.850	PASS
E1M1	Chord (Tension)	7.044	40 x 40 x 3	Bolted	201.2	45.00	0.160	PASS
E1M1	Chord (Compression)	8.014	40 x 40 x 3	Bolted	130.8	17.44	0.740	PASS
E1M2	Diagonal (Tension)	8.120	40 x 40 x 3	Bolted	231.9	45.00	0.180	PASS
E1M2	Diagonal (Compression)	9.239	40 x 40 x 3	Bolted	150.8	13.93	0.850	PASS
E1M2	Chord (Tension)	7.044	40 x 40 x 3	Bolted	201.2	45.00	0.160	PASS

Figure 4.2: End-diaphragm screen repeats the CB ratios.

I found different results in the two core dictionaries, but the end-diaphragm screen repeated the cross-bracing values. Comparing the source merge with the screenshots confirmed the substitution. Open issue #72 contains full-size evidence.

desktop/ui/dialogs/transverse_member_design.py:920 starts with a shallow copy of CB results, then attaches ED entries using setdefault. Existing diagonal/chord keys remain CB values. Both tab builders consume that merged map.

```
self._cb_designs = deepcopy(cb_designs)
self._ed_designs = deepcopy(ed_designs)
# Render each tab with its own design AND force records.
```

I suggest keeping each component's results and governing forces separate when the dialog loads and refreshes. Replacing setdefault with update would only make the other tab wrong. The included AST-based script executes the actual merge statements against the captured output and reproduces all four substitutions. It does not launch Qt or run another analysis.

4.3 Support reactions and barrier width

Published issues #73 and #74 | Two independent consistency failures

Support reactions disagree within one screen

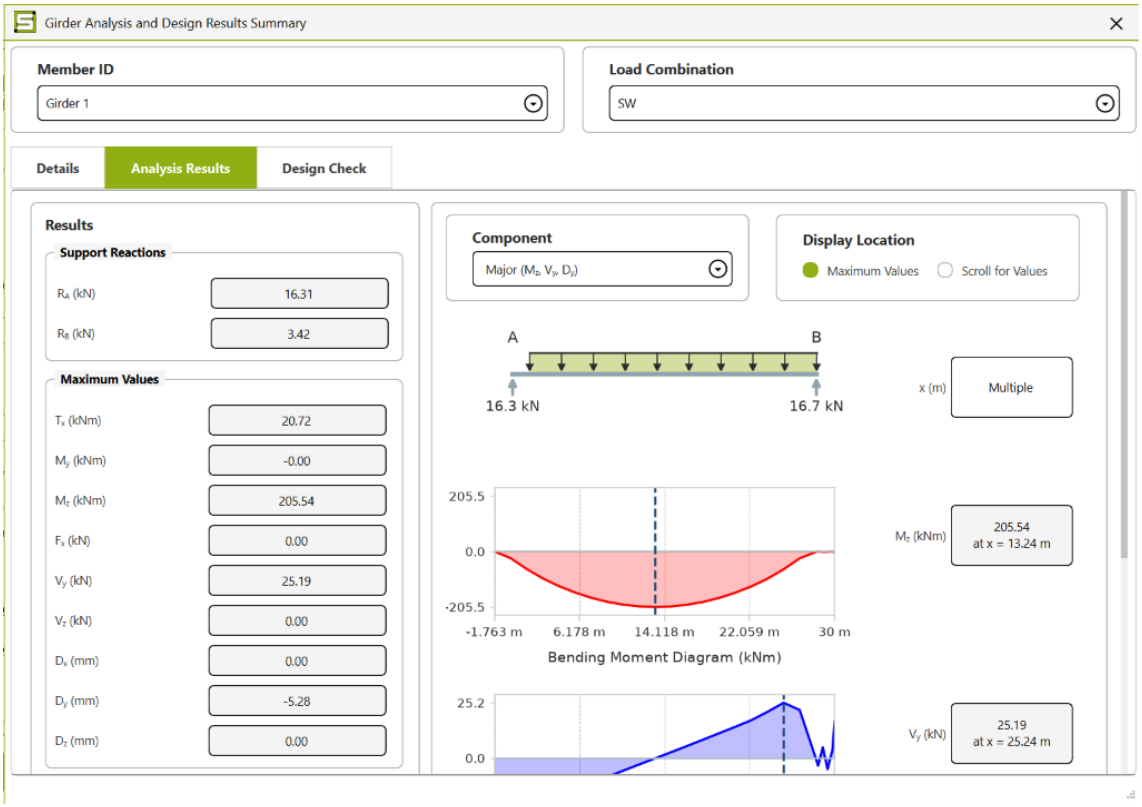


Figure 4.3: T06 Girder 1 / SW: RB field 3.42 kN; sketch label about 16.7 kN.

Issue #73 traces the field to first/penultimate shear samples in steel_design.py:947, while the sketch calls engine.extract_reactions(). I suggest retrieving the reactions once and using that record for both displays. Missing data should be shown explicitly, and the extractor fallback should be checked against

the actual support nodes. I have not independently calculated which displayed reaction is correct.

Crash-barrier width is replaced in the runtime DTO

Location	Width
Input before and after Design	0.45 m
Runtime deck_layout.crash_barrier_width	0.50 m

Issue #74 identifies _build_dtos() in plategirderbridge.py:1017, which assigns DEFAULT_CRASH_BARRIER_WIDTH. I suggest using the validated KEY_CB_WIDTH value and handling a missing value explicitly. I would check several accepted widths and the dependent layout updates after the change. I confirmed the mismatch, but I have not quantified its structural effect.

4.4 Further evidence on material issues

Property / path	Entered or saved	Runtime / calculation	Status
Girder E	205 GPa	205e9 Pa	Match
Girder Fy / Fu	345 / 500 MPa	345e6 / 500e6 Pa	Match
Girder density	77 kN/m3	78,500 N/m3	Mismatch
Concrete fck / fctm	45 / 3.5 MPa	45 / 3.5 MPa	Match
Concrete Ecm	35 GPa	35 GPa / 35,000 MPa	Match
Deck self-weight, 300 mm	25.5 x 0.300 = 7.65 kN/m2	7.36 kN/m2 in deck design	Mismatch

Steel density - My supporting comment on #20

I found 77 in the input and output, but _build_material_props() falls back to 78,500 when the custom-grade lookup returns no database density. I suggest reading the validated custom key and converting kN/m3 to N/m3 once. A regression test should expect 77,000 and check self-weight while keeping the section and geometry fixed.

Deck density - My supporting comment on #41

In T05C, I found another path related to the existing analysis-load issue. The deck-design calculation in deckdesign.py:516 reads a code-table density and multiplies it by 9.81 instead of using my custom weight density. I suggest passing the same validated density into analysis and deck design, without applying another gravity conversion to an input already in kN/m3.

Component materials - My supporting comment on #43

T06 preserves distinct grades in the input/output dictionaries, but the global material object follows the girder. Source review also finds member-design jobs copied from fixed templates in core/utils/connect.py; load and length are updated without replacing the member material fields. Separate DTOs alone would not fix those payloads. Propagate validated component properties in the downstream solver's supported representation and keep connector materials separate.

I included evidence and proposed regression checks in my comments. I did not run an isolated component-strength sensitivity test or validate a patched material calculation.

4.5 Report errors and unresolved observations

Finding	Evidence	Reporting route
False girder PASS text	T06 PDF p.6: fatigue UR 1.89, then “Girder design pass”; output status FAIL	Supporting comment on #65
False deck detailing assurance	T05C PDF p.41: 50 mm cover vs 75 mm required, FAIL; sentence says all detailing requirements satisfied	Additional source location in #65
Hardcoded M40 label	T06 PDF p.50: M40 in quantities despite custom fck 45	Supporting comment on #48
Metres labelled mm	T01/T05: 1.39 mm vs actual 1390 mm; web 0.008 mm vs 8 mm	Existing #66; no new duplicate
Railing value changes	Saved 1.4715 kN/m vs design input/report 6.806 kN/m	Existing #64; retained in case notes
Empty reaction/load rows	Report tables omit values despite completed designs	Existing #48/#68; not all graphics are missing

Proposed report corrections

I suggest generating the pass/fail wording from the evaluated checks and showing an unavailable state when data is missing. The quantity labels should use the selected material name and strength. Units also need to be defined where data enters the report, with pre-design inputs kept separate from optimized results. Multiplying every value by 1000 would give incorrect results for values already in millimetres.

Observations I could not fully resolve

Force/UR rows: T06 reports 9.239/13.93 kN with UR 0.85, although the displayed ratio is about 0.663. Another summary uses 11.84 kN, consistent with 0.85. The governing force, capacity and utilization need a common source or clearer labelling; this does not establish a wrong capacity equation.

Deflection summaries: T03-R1/R3 per-girder maximum total deflection is 55.321 mm, while the unsuffixed summary uses 22.190 mm. T05C similarly uses 60.608 versus 22.565 mm. Both are retained; member/load-combination mapping is unresolved. I do not choose the smaller value to claim a pass.

Chapter 5

Coverage and published issues

5.1 Requirement coverage and limits

Screening requirement	Evidence supplied	Practical limit
Basic and additional inputs	20/25/30 m spans; 7.5/9 m widths; 0/10-degree skew; 250/300 mm deck; 50/75 mm wearing course	Not every supported geometry or load option was tested
Custom steel and concrete	Full custom properties; distinct CB/ED selections; runtime comparisons	Some downstream use fails or remains unverified
At least three consecutive designs	T03: one session, 25 -> 20 -> 25; before/after dictionaries and plots	One three-run sequence, not long-duration stress testing
CAD and structural plots	Generated models; rotation confirmations; BMD/SFD/deflection views	No dimensional audit of every CAD solid
Input/output dictionary comparisons	Recorder snapshots T03/T04/T05C/T06; complete saved OSIs elsewhere	T01/T02 lack live snapshots; T05 intended run inconclusive
Steel components and deck	Girder, bracing, diaphragm, intermediate/bearing stiffener and deck evidence	Longitudinal stiffener enabled case not tested
Successful and failed cases	Fourteen checks/attempts; cancellations and inconclusive case retained	No verified all-pass bridge case
Code-level bug reports	Four original issues and six supporting comments, with source and proposed fixes	Proposed fixes not applied or regression-tested in GUI
PDF, repository and supporting files	This report; README, scripts, notes, originals and integrity manifest	Publication and final submission checks are separate

I have treated this work as functional testing and consistency checking. I have not independently certified the bridge-design equations or compliance with every cited engineering standard. I also have not counted a failed engineering check alone as a software defect. My bug reports concern contradictory displays, lost inputs and values that do not reach the intended calculation.

5.2 Published issue register

All links below were verified live under HR5206 on 11 November 2026

Type	Finding	Live reference
Original issue	Save Input resets additional thicknesses	Issue #71
Original issue	End Diaphragm tab shows CB results	Issue #72
Original issue	Reaction field and sketch disagree	Issue #73
Original issue	Runtime barrier width ignores input	Issue #74
Supporting comment	Reload loss, info-dialog exception	My supporting comment on #19
Supporting comment	Custom steel density runtime evidence	My supporting comment on #20
Supporting comment	Additional deck-density calculation path	My supporting comment on #41
Supporting comment	Distinct materials and fixed job templates	My supporting comment on #43
Supporting comment	Wrong concrete grade in take-off	My supporting comment on #48
Supporting comment	False PASS wording, including deck detailing	My supporting comment on #65

I checked open and closed issues and related discussions before preparing new reports. Where an existing issue covered the problem, I added my findings as a comment. The six comments listed above are my additions to those existing reports. I have kept the full URLs, post text and author metadata in issues/github_posts.json and issues/LIVE_ISSUES.md.

All ten posts include file-attachment links. I have also included the same original evidence in this submission so it can be reviewed without relying only on the GitHub attachments. My code changes are suggestions; I have not claimed that they are merged or validated.

Chapter 6

Reproduction and conclusion

6.1 Reproducing the tests and reviewing the evidence

Folder / file	Contents
report/	This PDF and its Markdown text version.
case_notes/	Eight detailed case notes, including historical observations and exact saved-input appendices.
evidence/T01 ... T06/	Original screenshots, OSIs, generated app reports, recorder metadata and run JSON files.
scripts/capture_osdagbridge.py	Recorder used for the captured sessions; wraps the original core design call.
scripts/reproduce_save_reset.py	Isolated default-expansion reproduction; assertion fails on tested source.
scripts/reproduce_ed_merge.py	Actual source merge executed against captured results; no Qt/solver run.
scripts/build_report.py	Rebuilds this report from the packaged evidence; requires ReportLab and Pillow and uses standard Helvetica/Courier fonts.
issues/	Links to my published issues/comments and the saved verification snapshot.
SHA256SUMS.txt	Checksums for the packaged evidence and documents.

How to replay a case

Use the recorded source revision and the repository environment. For an OSI-backed case, open its original saved file in the desktop and follow the relevant case notes. For T05C/T06, no OSI export is claimed: use the full input_before.json as the exact parameter record and enter the documented configuration. Main Save Input is intentionally avoided in these follow-ups because of issue #71.

For the isolated scripts, provide the T05B OSI or the T06 output JSON and the tested source file as described in each script header. These checks reproduce narrow failure mechanisms; they do not constitute additional desktop tests or validate the full solver.

Evidence handling

I have kept the original evidence filenames and file bytes unchanged. Some case notes say “next test” or “not yet posted” because I wrote them while testing. The issue register in this final report gives the updated reporting status. I have also kept the original application-generated reports unchanged, including the errors discussed here.

What I would fix first

I would first fix the lost inputs and the incorrect component results shown in the UI. Next, I would check custom-material propagation and report status wording. For regression testing, I would include save/reload, separate component result maps, custom-material payloads and the full three-run change-and-return sequence.

From these tests, I found that the module can complete repeated designs and generate CAD models, plots and reports. I also found problems with saved inputs, custom-material use and consistency between outputs. I have kept both the successful checks and the failures, along with the files needed to repeat them. This gives a clearer record of what worked and what still needs correction.