Table of Contents

Purpose/Policy:.....1

Scope:.....2

Definitions/Acronyms:.....2

Authorities/Responsibilities:.....2

Resources and Materials:.....2

PPE Required:.....3

Procedures:.....3

Turning off the Peripherals:.....3

Draining Brinks:.....3

Brink Recovery:.....5

Basic Cleaning the Brink (outside of tanks):.....6

Deep Cleaning:.....6

Forms:.....7

Reference Documents:.....7

Common Issues:.....7

Document History and Approval:.....8

Purpose/Policy:

"This "Brink Cleaning Operations" standard operating procedure has been created to assist operators with setup, operations, changeover, cleaning, and troubleshooting.

Scope:

When packaging product on the Racker, the filling units use Caustic, Acid, Hot water and Wastewater to complete the filling and cleaning functions. When these tanks get dirty, the Racker will have increased faults resulting in lower packaging efficiency.

When the Brinks are cleaned and recovered on a regular schedule, the Racker will run at its best. “

Definitions/Acronyms:

- SOP – Standard Operating Procedure
- PPE – Personal Protective Equipment
- HMI – Human Machine Interface (the touch screen used to control a machine)
- MM – Minomats
- F400 – Caustic cleaning solution (Rochester Midland)
- Racker – The keg line (keg washing and filling line)
- Brink – Tank that holds cleaning or sanitizing media (caustic, acid, hot water, PAA) for the filling units

Authorities/Responsibilities:

“This SOP can be completed by a Lead level packaging operator after proper training from a senior member of the Keg line packaging team. The objective of this SOP is to gain the knowledge needed to perform the operation of “Brink Cleaning Operations” and trouble shoot any issues that may arise.”

Resources and Materials:

Operations:

- Rubber Gloves.

Changeovers:

- N/A

Basic Cleaning:

- Hot Water.
- F400 Foaming Unit.
- Cleaning Brush.
- Hot hose.

Troubleshooting:

- Recovering tanks takes time, please read SOP thoroughly.
- If any issues arise, please reach out to maintenance.

PPE Required:


- During the Draining, Cleaning and foaming operation in the cleaning section of this SOP document, rubber gloves, a face shield, and safety glasses must be worn.

Procedures:

Turning off the Peripherals:

1. From the HMI on Minomat #2, shut off the peripheral.

Figure 1: HMI Screen

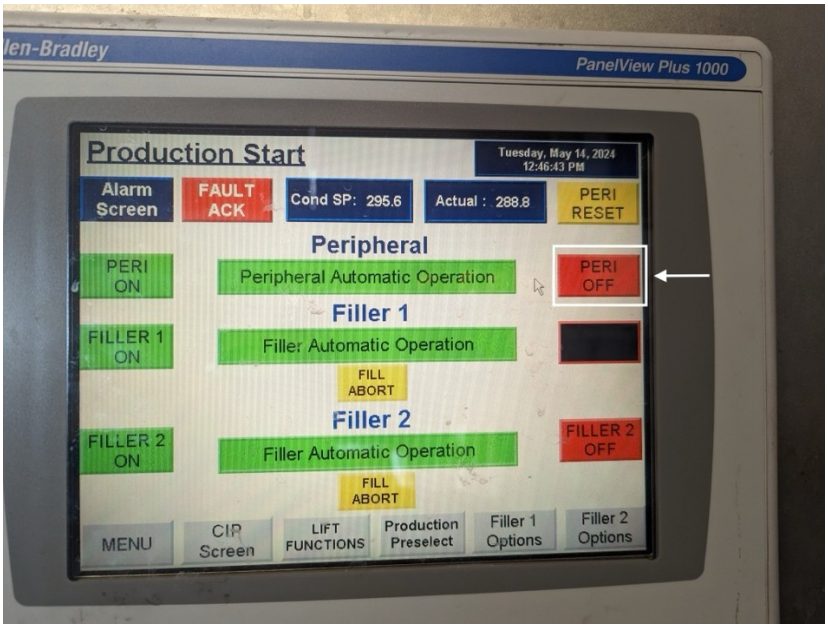

Draining Brinks:

1. Open the dump valves on each media brink located behind and to the left of the brink. See Figure 2 for visuals.

Figure 2: Opening Drain Valve



2. Once the brinks have fully drained, open the top hatch of the brink and proceed with the following steps:
   2.1 Rinse down the drink with hot water, outside and inside.
   2.2 Using a brush, scrub the insides of the brinks.
   2.3 Rinse off any remaining soilage.
   2.4 Once clean, close the top hatch of the brinks and shut off the drain valve as pictured in Figure 3.


Figure 3: Closing Drain Valve



Brink Recovery:


1. After the brinks have been cleaned, return to the HMI screen.
2. Turn the peripheral on

Figure 4: Peripheral On

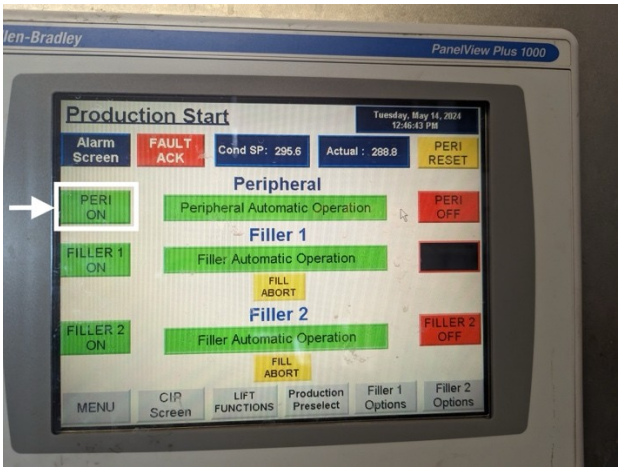

3. Navigate to the “Media Settings” page and press “Tank Recovery” on all four brinks.

Figure 5: Media Settings

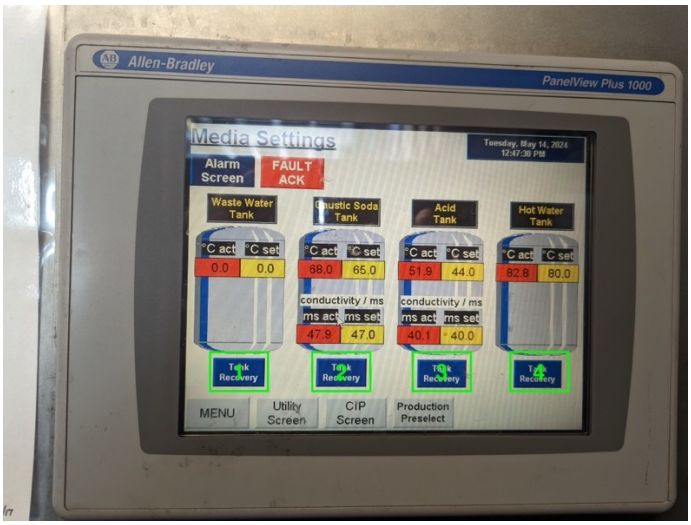

4. After pressing “Tank Recovery”, the caustic and acid tanks may tank longer to recover when compared to the hot water and wastewater tanks.
5. If the HMI gives a fault, acknowledge and press the “Tank Recovery” button again.
6. The Recovery takes approximately an hour to pump the caustic and acid from their respective bulk tanks located on the lower floor of the Racking line.

Basic Cleaning the Brink (outside of tanks):

1. The outside of the Media brinks will get dirty over time and will need to be cleaned.
2. Using a hot hose, rinse the outside of the brinks and the floor below.
3. Using a mix of hot and cold water (no higher than 160 degrees) fill the F400 foaming unit to 5 gallons.
4. Add 6oz of F400 per gallon of water in the F400 Foaming Unit.
5. Foam the brinks to help loosen up any grime.
6. Brush outside of the tanks as needed to loosen soilage.
7. Rinse outside of the brinks with hot water.
8. Foam and scrub the floors below the brinks.
9. Rinse with hot water.

Deep Cleaning:

1. Refer to Racking Line Zone Cleaning, Zone 6 for more information.

Forms:

Not Applicable

Reference Documents:

Not Applicable

Common Issues:

1. In the event a failed tank recovery, inspect to make sure all steps above have been completed
    1.1 In the event faults are still present, please contact maintenance or a Senior member of the Keg Line team.

Document History and Approval:

Revise document history as described in the table and key below.

(Reference to following document: B1C.SOP.P001: Document Control and Approval Procedure Template)

VERSION NO.	VERSION DATE	DESCRIPTION OF CHANGE	AUTHOR NAME/PROJECT MANAGER
001	2024/07/12		Kyle Szymanski
002	2026/10/26	Updated SOP to Newest Layout Version	Kyle Szymanski

Version Approval Number: 002

Approved by: Kyle Szymanski

Position Title: OSCI Manager

Date: 10/26/26