GrappStar build guide

One guide from parts to first mission: print, wire, flash, calibrate, test. Every hands-on step is in order. Every wiring step starts with the battery unplugged.

Built 2026-11-03 12:54 Sydney time from commit `4c0552c`.

How to use it: read section 1 and 2 first, then work through the "Order of work" list in section 1. Where a section says "From `some/file.md`", that text comes straight from the repo, so it is always the latest version. Re-build the guide after any change: `python3 docs/build/make_guide.py`.

First session back: what to do, in order . . . 2

1. What the system is 4

Order of work . . . 4

2. Safety 6

Electrical . . . 6

Mechanical . . . 6

3. Parts 8

The only purchase: 608 bearings . . . 8

Possible extra purchases . . . 8

Base station and rover . . . 8

Dart (KEDGE v30) . . . 8

Tools . . . 9

Base bill of materials (from the model) . . . 9

4. Printing 10

Day-one risk coupons (print before any big part) . . . 10

Dart prints . . . 16

Base prints . . . 16

5. Base assembly 17

6. Dart build 18

What changed from the run sheet . . . 18

Dart build order (follow this; it merges the three documents) . . . 18

Dart wiring (new pin map) . . . 19

Dart bench tests . . . 25

7. Electronics and wiring (base and rover) 29

7.1 The whole system . . . 29

7.2 Base ESP32 wiring (pin by pin) . . . 34

8. Flashing both ESP32s 38

8.1 Base: ESP32-S3 DevKitC-1-N8 . . . 38

8.2 Dart: XIAO ESP32S3 . . . 40

9. Jetson setup 43

GrappStar rover software (Jetson) . . . 43

10. Calibration (base) 51

Base station calibration . . . 51

11. Bench tests 55

11.1 Base . . . 55

11.2 Dart . . . 58
12. First tests, bench to field 59
First tests: bench to field . . . 59
Expected numbers (physics model) . . . 62
13. Troubleshooting 64
Base . . . 64
Rover and video . . . 64
Dart . . . 65
14. Measure list 66
What to measure or confirm . . . 66
Numbers still assumed in params.py right now . . . 70
15. Sources and appendices 71
16. Glossary 72

From `docs/build/FIRST_DAY.md`*:*

First session back: what to do, in order

Everything else waits until these are done. The measuring takes an afternoon; the coupons wait for the 608s to arrive.

1. Read (15 minutes)

- Build guide sections 1 (what the system is) and 2 (safety).
- The rule for every wiring step: battery unplugged first.

2. Measure (1 to 2 hours; caliper, kitchen scale, water bottles, phone camera)

Take a photo of every caliper reading and put them in a new folder `originals/measure_2026-11/` (create it). Write each number into `docs/build/MEASURE_RESULTS.md` (a fill-in sheet; print it).

1. Wiper motor (MEASURE_LIST A1 to A5, A8): output shaft diameter and flats, end thread and length, the mount hole pattern (press the motor face onto paper), the housing size, the boss and hub.
2. Launch springs (B1 to B3), safety glasses on while a loaded spring hangs: free length with a steel rule or tape (the spring is longer than a caliper), then hang about 1, 2 and 3 kg of water bottles (weigh each load: W1, W2, W3 in kg) from ONE spring and measure hook to hook each time (L1, L2, L3 in mm). Both springs. `python3 base/physics/calib.py spring L0 W1:L1 W2:L2 W3:L3` gives the rate and initial tension. Enter the weaker spring's numbers.
3. Small parts (H1, H3, H4): drum N20 shaft, CSK20PP keyway depths, BTS7960 heatsink height and hole spacing.
4. Count the parts box (group C): worm N20s (4 needed), the spare MP1584, 8 mm rod or M8 bolts, 693ZZ / F693ZZ left after the dart, resistors (2 x 10 k, 1 k, 680 R, 100 k, 22 k), a small magnet for the AS5600, spare XT60s, and the coupon extras (C21: O-ring 20 x 1.5, e-clip for 8 mm, M3 x 16 and x 20, jam nut, heat-set inserts).
5. Update the design with the numbers (build guide section 14, "After you measure"): the easy way is to open Claude Code in the repo, give it MEASURE_RESULTS.md and ask it to enter the numbers in params.py and re-run the base pipeline. By hand: the commands are in that section.

3. Buy

- 608 bearings, 10 (search "608ZZ bearing 8x22x7").
- Only if not in the box after counting (C21): the O-ring 20 x 1.5 and the 8 mm e-clip the coupons and the aim splitter use. Ask a Claude session first whether a printed substitute exists.
- Only if not in the box: a small neodymium disc magnet for the AS5600 (6 to 10 mm across, 2 to 3 mm thick, or a 6 x 2.5 mm diametric disc).

4. Print first (test pieces only)

1. The dart fit coupon (`kedge/pack_v30/fit_coupon.stl`, 20 minutes). Check it against run sheet section 4.

2. The two base risk coupon plates (`base/pack/coupons/risk_plate_1_PLA.3mf` PLA, `risk_plate_2_PPA-CF.3mf` PPA-CF: hardened nozzle, dry spool) and the test sheet `COUPON_TEST.pdf` (test stage 0). Every check must pass before the big base parts. The coupons need a few bought parts (C21) and one each of 608, F693ZZ, 693ZZ and a CSK20PP.
3. The dart plates A and B do not wait for the base coupon or the measurements: start them once the dart fit coupon passes.

5. Do NOT do yet

- Do not print the big base parts until the coupons pass AND the measurements are in params.py and the pipeline has been re-run (the motor adapter, saddle and couplers depend on them).
- Do not connect the LiPo to anything new. No wiring with a battery plugged in, ever.
- Do not fit the launch springs (they go on at test stage 5).
- Do not fire anything. When the time comes: never without the tether tied on.
- Do not plug the dart into the Mac with its power loop plug in.

1. What the system is

GrappStar is a rover that can pull itself out of trouble. A launcher on the rover fires a small dart (KEDGE) on a Dyneema tether. The dart lands, screws itself into the soil, and the rover winches against it. Then the dart lets go and is reeled home.

Three parts:

- **Rover.** Jetson Orin Nano Super on the rover's 3S LiPo. It runs the mission, the operator web page, and the vision (rover camera Razer Kiyo X, and the dart's video through an RC832 receiver and a DIGITNOW USB capture).
- **Base station** (on the rover). ONE 12 V wiper motor drives everything. A sliding dog collar on the main shaft couples the wiper to the LAUNCH train, to nothing (NEUTRAL), or to the REEL train. A small N20 motor turns a selector drum (like a motorcycle gear drum) through four zones in a fixed order: LAUNCH, NEUTRAL, WRAP, REEL.
  - LAUNCH, wiper forward: draws the spring carriage back (241 mm), fires at the end of the stroke, resets.
  - LAUNCH, wiper backward: tilts the rail between 6 and 47 degrees to aim. A self-locking worm holds the angle.
  - WRAP zone: the collar stays in NEUTRAL while the drum turns a wrap cup 7 times round the capstan.
  - REEL, wiper forward: the capstan (REEL gear 50T to capstan gear 22T, 2.27 times wiper speed) winds in and tows. A one-way bearing stops it ever turning out. Tow limit 50 N by default.
  - Take-up: every forward wiper turn also winds the storage reel through a slip clutch, so slack never builds up.
  - Payout at launch: the line skips the capstan and pulls off the free-spinning storage reel against a light payout brake (0.5 N; over 1 N costs range).
  - Range: about 3 to 5 m with the two springs (6 to 47 degrees of pitch; minimum about 2.9 m, best about 5 m; `base/out/ballistics.json` has the current table), about 8.5 m with a second pair.
  - Protection: current trips in the firmware and a printed torque limiter (about 5 N m) in the wiper coupler. Any fault: wiper off, drum to NEUTRAL (except when the wraps are on, the spring is drawn or the drum itself faulted: then the drum holds, decision D27). A hand lever on the drum is the fallback.
  - Brain: an ESP32-S3 DevKitC on USB from the Jetson, with an AS5600 angle sensor on the main shaft and printed contact switches (an M3 screw head touching an M3 nut).
- **Dart (KEDGE v30).** 42 mm x 152 mm, its own XIAO ESP32S3, 2S 18350 pack, WiFi access point. After landing a kick leg swings over the nose and plants a foot auger, then two drill pods swing down and screw in. A nose camera sends analog video at 5.8 GHz.

How they talk: the Jetson talks to the base over USB serial (JSON lines, `firmware/base/PROTOCOL.md`) and to the dart over WiFi (HTTP at 192.168.4.1, `firmware/dart/API.md`). Video is analog 5.8 GHz into the USB capture.

A mission (the fixed sequence in BASE_SPEC section 10.1): pick a target on the rover camera view; the Jetson looks up the pitch; the base aims, cocks and fires on your confirmation; the dart video is checked for the landing zone; the base wraps the capstan at once while the line is still slack (the drum parks at WRAPPED); the dart anchors; the base tidies the slack, shifts into REEL and tows; the dart releases; the base reels in to about 1.5 m, unwraps, and brings the dart home on the take-up until it seats; back to LAUNCH.

Order of work

0. Get the repo onto the Mac (Terminal; if macOS asks to install the command line developer tools for `git`, say Install and run the command again): `cd ~ && GIT_LFS_SKIP_SMUDGE=1 git clone https://github.com/HarryHYu/GrappStar.git` (skips the 145 MB photo PDF). `cd ~/GrappStar && git pull` updates it later.
1. Measure the wiper motor shaft, mount and housing (section 14, A1 to A5 and A8), the springs (group B), and the parts in H1, H3, H4. Put the numbers in `base/spec/params.py` and re-run the base pipeline. The base parts that touch the motor depend on them. A6 and A7 (speed, current, torque) need the base electronics: do them at step 7. They change no printed part.
2. Confirm the parts box (section 14, group C). The only purchase is 608 bearings (and an AS5600 magnet if none is in the box).
3. Print the dart fit coupon and the base risk coupon plate, and test them (section 4, test stage 0). The dart plates (section 4) do not wait for the base coupons or the measurements: start them any time after the dart fit coupon

passes.

4. Flash the dart and build it (sections 6 and 8, and the dart run sheet in the appendix).
5. Set up the Jetson on its own wall supply (section 9, steps 0 to 4 only; the rest comes later).
6. Flash the base ESP32 from the Mac (section 8.1). Battery out is enough: any wiring already on the board can stay.
7. Wire the base electronics on the bench, wiper motor clamped in a vice and the drum N20 loose (section 7.2, firmware/base/WIRING.md Parts A to D), then bench test them (section 11.1). Measure A6 and A7 here.
8. Print the base (section 4, after the coupons pass and the measurements are in) and assemble it with the motor and drum N20 (section 5).
9. Put the base on the rover and wire the rover (section 7.1), then do the first power-on of everything together (7.1, its part 4).
10. Calibrate (section 10). Commands go to the base from the Jetson from now on (see section 10).
11. Run the staged tests, bench to field (section 12).

2. Safety

Read this before any hands-on step.

Electrical

- **Battery unplugged before you touch, add or move any wire.** On the dart that means the power loop plug out. The first XIAO died from wiring with the battery live.
- Order for every power-up: USB cables in first, battery last. Power-down: battery out first. A board may stay on the Mac's USB while the battery goes in (firmware/base/WIRING.md Part D does this), but never plug the USB in while the battery is in.
- Check for shorts with the meter on beep before the first power-on of anything you wired: red to black must not beep.
- The 3S LiPo can deliver over 100 A into a short. Keep the 20 A and 10 A fuses in their leads. Never bypass them.
- LiPo care: charge on the iMax B6 in balance mode at 1C (5.2 A) or less, on a non-flammable surface (tile, concrete, a LiPo bag), never unattended and never overnight. Recharge when the pack reads 3.6 V per cell at rest (10.8 V); never run it below 3.3 V per cell under load (9.9 V).
- LiPo storage: if it will sit for more than a few days, use the B6 "storage" mode (3.8 V per cell), keep it in a LiPo bag or metal box, away from heat (never in a hot car). A puffed, dented or hot pack: stop, put it outside on concrete, then to battery recycling. Never puncture or short one.
- 18350 cells: never let both cells touch metal at the same time. Charge out of the dart in the XTAR MC2, or through the tail balance socket with the loop plug out: on the B6 choose Li-ion (LiIo) 2S balance, 1.0 A or less (not the LiPo 3S program). Check each cell's direction against the marks in the cell bay and meter the pack (7.2 to 8.4 V) before the loop plug goes in. Look the cells over after a hard landing; a dented cell is scrapped.
- Setting a buck on the live LiPo (dart step 3, base WIRING Part A): use clip leads or insulate every free lead end first, so nothing loose can touch.
- Never connect the DRV8833 motor supply (VM) to the LiPo directly: 10.8 V maximum. It runs from the 9.0 V buck.
- The dart VTX must have its antenna on before it is powered.

Mechanical

- The wiper motor is strong (about 15 N m) and self-locking. Hands out of the gears, drum and rail while the battery is plugged in.
- **Stopping (the same everywhere):** 1. send `estop` (or the STOP button on the operator page). 2. If anything still moves, pull lead #2's XT60: both motors lose power, the Jetson stays up. Keep that plug within arm's reach whenever the base is powered; it is the physical kill switch. 3. Only then the main battery plug.
- **Cutting power freezes stored energy, it does not release it.** Both worms self-lock, so a drawn spring and a line under tension stay loaded with the power off. The dart has its own battery.
- **Before you walk up to the base or the dart** (to measure a range, fetch the dart, or touch anything): `estop`; lead #2 out; telemetry shows `cock` 0 and `H` (SW_HOME) closed; the line is slack (no tension); the dart reads IDLE on the operator page, or its loop plug is out. If the carriage is drawn and `cal decock` fails: treat the launcher as loaded, keep the rail pointed down range, and fire it with the tethered dummy into the clear zone.
- Never use the hand lever while the carriage is drawn (`cock` above 0 or `SW_HOME` open) or while the line is under tension: shifting under load can dry fire the launcher or drop the line. De-cock and slacken the line first.
- The launch springs store energy. Cocked carriage = loaded. Never put a hand in front of the rail or the carriage. To unload a cocked base without firing, see troubleshooting. The spring hooks have little margin at full draw (about 40 N each at full cock against the 38.4 N rating of the Century C-243, decision D30, until the springs are measured): during shots stand beside the base, not behind or in front of the springs, and fit the printed spring guard if the pack has one. After B2, if the force at full cock is over the rating, use the fallback hole set (MEASURE_LIST B4).
- **Line under tension:** the capstan never turns back (one-way bearing), so a towing line cannot be let off at the base. During any pull (hand test or tow) stand beside or behind the rover, never in line with the dart, glasses on. To slacken it, release the dart (`release`) or drive the rover toward the dart. Calibrate the current-to-tension number (MEASURE_LIST G9) before any tow: the shipped value lets the line reach about twice the limit.
- Chock or brake the rover during every shot and every tow. Strap the LiPo down under a cover on the rover.

- **Picking up a landed dart:** send dart STOP, check it reads IDLE (an armed dart can start anchoring when moved), then pull its loop plug before you touch it.
- The dart is 279 g leaving the rail at about 8 m/s: about 9 J, like a thrown cricket ball, with sharp augers. From the first spring test on: safety glasses on, nobody in front of the rail or within 2 m to either side, and the area in front clear for 30 m (four times the longest expected range, for a misfire at a wrong pitch).
- Before every shot: look along the rail, call "firing" out loud, keep hands off the rail and carriage.
- A cocked carriage stays loaded until it fires or is de-cocked (`cal decock`). Treat the base as loaded whenever `cock` in telemetry is above 0.
- **Never fire a dart, dummy or real, without the tether tied on.** The tether keeps it nose first; without it the dart can tumble or come down tail first.
- Augers and drills are sharp and turn with force. Hold the dart by the hull, never near a pod or the foot.
- Soldering: iron on its stand, fan on for fumes, 3 s at most per joint near PLA. Heat gun on low, no lighter near PLA.

3. Parts

Everything below is already in hand except the 608 bearings (and possibly the AS5600 magnet, and the O-ring and e-clip the risk coupons list; section 14 C21). Section 14 group C lists the items to confirm by looking in the box.

The only purchase: 608 bearings

- Search: "608ZZ bearing 8x22x7" (or "608-2RS", sealed). Buy 10. Skateboard bearings are 608s and fine.
- Specs: 8 mm bore, 22 mm outside, 7 mm wide, rated well over 10,000 rpm.
- Uses: storage reel (2), aim pedestal worm wheel and worm shaft (4), spares. Axles: M8 bolt or 8 mm rod (check the box).

Possible extra purchases

- **AS5600 magnet** (optional): the Adafruit board does not include one. The magnet cap takes any small neodymium disc (6 to 10 mm across, 2 to 3 mm thick) mounted edge-on, or a 6 x 2.5 mm diametric disc. Look in the box first (old speakers, fridge magnets with a neodymium disc). Without a magnet the firmware has a less precise fallback (decision D12): a printed 6-bump index cam read by the contact SW_INDEX on GPIO35, switched on in firmware/base config.h.
- **Optional, for range:** a second pair of the same launch springs (Bunnings I/N 0487961). The two springs give about 5 m; four give about 8.5 m. The base has the mounting provision built in.

Base station and rover

Part	Qty	Note
12 V wiper motor, self-locking worm	1	Rebuilt to 2 wires, park linkage removed. Measure it first (section 14 A)
BTS7960 motor driver module	1	Drives the wiper
ESP32-S3 DevKitC-1-N8	1	Base brain, USB to the Jetson
Adafruit AS5600 (STEMMA QT)	1	Main shaft angle. Needs a small magnet (see above)
DRV8833 carrier	1	DRV8833 #3, freed from the dart by the new dart pin map
MP1584 buck	1	MP1584 #2 from the dart build, set to 9.0 V
N20 right-angle worm motor	1	Selector drum (count your N20s: section 14 C3)
693ZZ / F693ZZ bearings	as many as are left after the dart	Line pulleys (the dart uses 5 F693ZZ; count what is left, section 14 C20)
CSK20PP one-way bearings (20 x 47 x 14)	2	#1 spring cock and fire, #2 capstan backstop
Century 16 x 165.1 x 1.4 mm extension springs	2	Launch springs (Bunnings 0487961). Measure them (section 14 B)
608 bearings	10	The purchase
Dyneema braid 150 lb, 1 mm	20 m	Tether
100 kg load cell + HX711	1	Optional line tension
3S LiPo 5200 mAh (Zeee), iMax B6 charger	1	Rover battery
XT60 lead #1 (10 A fuse), lead #2 (20 A fuse), spare XT60s, fuse holder		Lead #2 feeds the wiper; build the Y harness from spares
Barrel plug lead 5.5 x 2.5 mm	1	Jetson from the LiPo
Jetson Orin Nano Super	1	
Lockmaner RC832 receiver, DIGITNOW USB capture, RCA lead	1 each	Dart video in
Razer Kiyo X	1	Rover camera
Resistors 10 k x 2, 1 k, 680 R, 100 k, 22 k		Pull-downs and dividers (firmware/base/WIRING.md)
M3 screws, M3 nuts, M3 brass heat-set inserts		Frame joints and printed contacts
Dupont jumpers, 14 / 18 / 22 / 26 AWG wire, heat shrink		

Dart (KEDGE v30)

The full dart list with quantities is in the dart run sheet, section 2 (appendix). In short: XIAO ESP32S3, 2 x DRV8833 (the third goes to the base), INA219, BNO085, MP1584 #1 (5.04 V), OTOTEC 2S BMS, 2 x 18350 cells, 3 worm N20s (kick, deploy, foot), 2 drill gearmotors, 5 x F693ZZ, Caddx Ant, Zeus VTX and antenna, JST-XH sockets, Schottky diode, capacitor, M3 hardware, 15 g nose ballast.

Tools

Soldering iron and solder, flux, multimeter, wire strippers, flush cutters, small flat screwdriver (MP1584 trimmer), heat shrink and heat gun, caliper, hex keys, tweezers, kitchen scale, luggage scale, tape measure, safety glasses, 5-minute epoxy, threadlocker, zip ties, foam tape.

Base bill of materials (from the model)

> *NOT IN THE REPO YET:* `base/out/base/BOM.md` *(written by cad-infra (assembly pipeline)). Re-run* `python3 docs/build/make_guide.py` *after it lands and this section fills in.*

4. Printing

Printer: Bambu X2D (bed 256 x 256 x 260 mm). PLA for everything except loaded gears and keyed shafts, which are PPA-CF (the print list says which).

Print settings (the 3MF files carry geometry only: set material and settings in Bambu Studio for each plate):

Plate	Material	Layer	Walls	Infill	Top / bottom	Hole compensation
Dart fit coupon, dart plates A and B	PLA	0.16 mm	4	40% gyroid	5 / 5	start at 0; adjust from the dart fit coupon (run sheet section 4)
Base fit coupon, risk plate 1	PLA	0.2 mm	4	40% gyroid	5 / 5	0 ("print as exported")
Risk plate 2	PPA-CF	0.2 mm	6	60% gyroid	6 / 6	0
Base plates, PLA	PLA	0.2 mm	4	40% gyroid	5 / 5	0, unless the coupons showed a fit off
Base plates, PPA-CF	PPA-CF	0.2 mm	6	60% gyroid	6 / 6	0, unless the coupons showed a fit off

No supports on any plate. The base print sheet (below) has the final word for each part.

Hole compensation is a process setting in Bambu Studio, "X-Y hole compensation" (Process, Quality tab; the name may move between versions). It is saved with each project, so check it on every plate.

PPA-CF (risk plate 2 and the loaded base parts): hardened steel nozzle only (CF wears a brass nozzle quickly). Dry the spool first (about 80 C for 8 hours in a filament dryer, or the printer's own drying if it has one; it absorbs water and prints weak and stringy otherwise). Use the Bambu PPA-CF profile for temperatures. Print with the room ventilated, and wear a dust mask when sanding or trimming CF parts.


Order: dart fit coupon first (20 minutes, checks your printer's hole sizes), then the base fit coupon (`base/pack/fit_coupon/coupon_plate_1.3mf`, PLA) and the two base risk coupon plates (below, test stage 0), then the dart plates, then the base once the coupons pass and the wiper and spring numbers are in (section 1, order of work).

Day-one risk coupons (print before any big part)

Two plates from the base print pack with small test pieces of the riskiest features: swing splitter, printed contact, dog clutch, slip clutch, bearing seats, heat-set inserts and nut traps, key rib, gear meshes, shear pin. Print them, then work through the test sheet. Do not print the big base parts until every coupon passes.


Plates: `base/pack/coupons/risk_plate_1_PLA.3mf` (PLA, 19 pieces) and `risk_plate_2_PPA-CF.3mf` (PPA-CF, 26 pieces). Each piece is also there on its own (`base/pack/coupons/rcN_*.stl`) for a reprint. A printable copy of the test sheet is `base/pack/coupons/COUPON_TEST.pdf`. The coupons need a few bought parts (MEASURE_LIST C21): O-ring 20 x 1.5, e-clip for an 8 mm pin, M3 screws and a jam nut, heat-set inserts, one each of 608ZZ, F693ZZ and 693ZZ, a CSK20PP. Take the CSK20PP and bearings back out of the coupons after testing: they go into the base.

If a coupon fails: write down which test and what you saw, and do not change the CAD yourself. The sheet names the design numbers to change; give the result to a Claude Code session in the repo and ask it to change them and re-run the coupons (`kedge/.venv/bin/python -m tools.risk_coupon`, run in `base/`, after `bash kedge/setup_mac.sh` once). Then reprint only that piece from its `rcN_*.stl`.

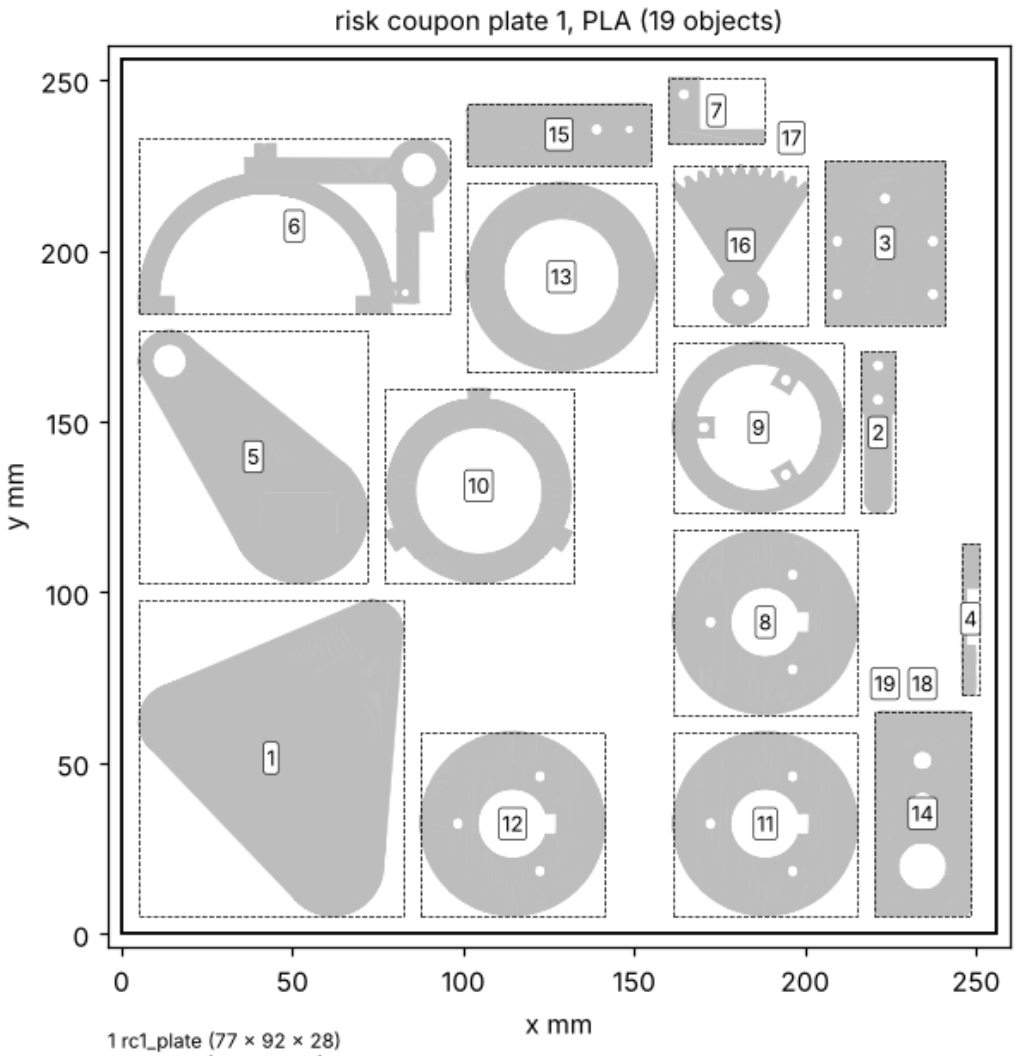

1 rc1_plate (77 × 92 × 28)
2 rc1_stop (10 × 47 × 6)
3 rc2_switch_base (35 × 48 × 12)
4 rc2_switch_lever (5 × 44 × 8)
5 rc3_base (67 × 74 × 45)
6 rc3_fork (91 × 51 × 20)
7 rc3_fork_stop (28 × 20 × 14)
8 rc4_adjuster_plate (54 × 54 × 4)
9 rc4_flexure (50 × 50 × 2)
10 rc4_friction_disc (55 × 57 × 3)
11 rc4_hub_plate (54 × 54 × 6)
12 rc4_pressure_plate (54 × 54 × 4)
13 rc5_csk20_seat (55 × 55 × 16)
14 rc5_seats_608_693 (28 × 60 × 10)
15 rc6_m3_tile (54 × 18 × 9)
16 rc8_m125_seg (40 × 47 × 6)
17 rc9_shear_pin__c1 (6 × 6 × 12)
18 rc9_shear_pin__c2 (6 × 6 × 12)
19 rc9_shear_pin__c3 (6 × 6 × 12)

Risk coupon plate (risk_plate_1.png)

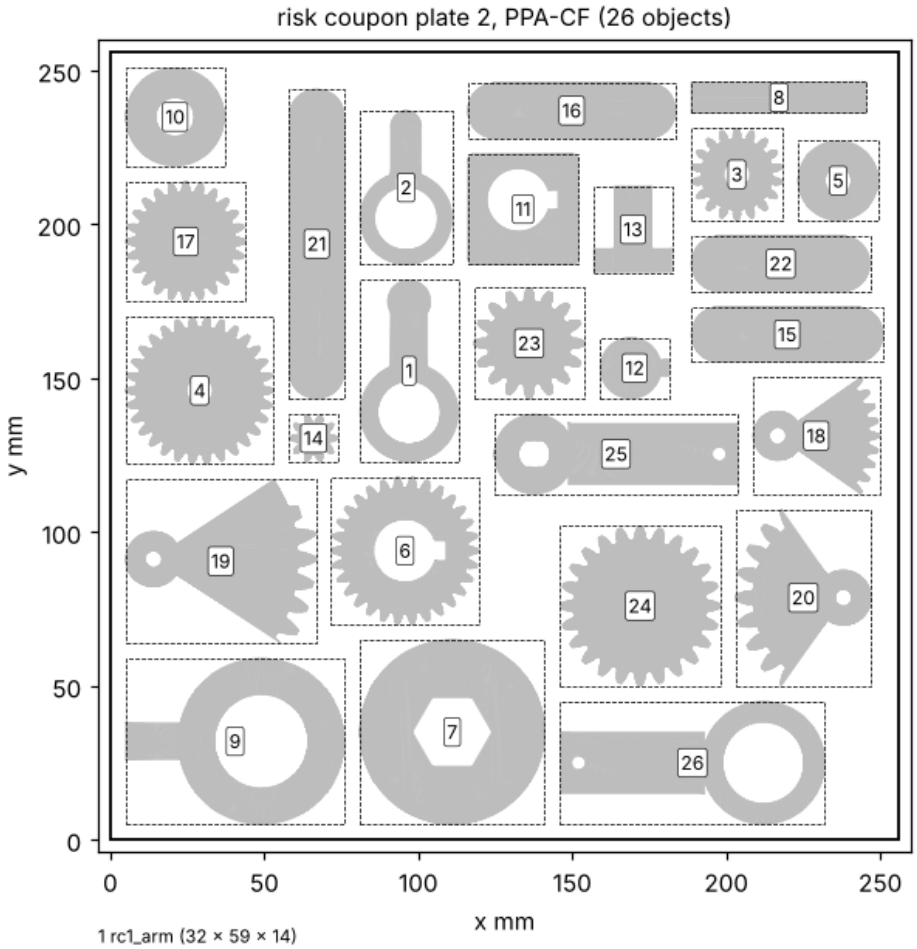

Risk coupon plate (risk_plate_2.png)

From `base/pack/coupons/COUPON_TEST.md`*:*

Day-one risk coupons: test sheet

Print these before the big parts. Each coupon is made from the same geometry functions and numbers as the real part, so a pass here is a pass there. Print as exported, no supports, 0.4 nozzle, 0.2 layers, 4 walls; PLA plate and PPA-CF plate as marked. Let parts cool 10 minutes before testing. Change one number at a time, then rerun `python -m tools.risk_coupon` (from `base/`) and reprint only that coupon.

Plates

plate	material	objects
risk_plate_1.3mf	PLA	19
risk_plate_2.3mf	PPA-CF	26

Tests

1. Swing-arm direction splitter

- Parts: rc1_plate, rc1_sleeve, rc1_sun, rc1_arm, rc1_idler, rc1_output, rc1_crank, rc1_stop
- Bought: O-ring 20 x 1.5 (arm hub groove), e-clip for the d8 arm pin, 2 x M3x16
- Do: O-ring into the arm hub groove. On the plate: sleeve on the centre pin, sun on its rib, arm on the sleeve above the sun with its pin down through the idler, e-clip on the pin, output on its pin, crank on top, stop finger on the column (2 x M3x16). Turn the crank 10 turns each way.
- Pass: Clockwise seen from above: the arm swings the idler into the output at once and the output turns, no skipped teeth. Anticlockwise: the arm swings out to the finger within about 20 deg of crank, the idler runs free and the output stays still. No jam at engagement.
- If it fails, change: launch_aim.py: FIT (pin and bore play), arm_solid O-ring groove (drag), A() alpha_d = alpha_e + 20 (swing out), _stop_post_xy; launch_gears.py center_distance extra / spur backlash (mesh).
- Made from: launch_aim.sun_solid, arm_solid, idler_solid (m1.5 z30/18/30, face 8, FIT 0.35), launch_gears.spur for the output, launch_aim.A: centre distances 36.10 / 36.10, output at (11.7, 68.4), engaged arm 96.2 deg, stop 116.2 deg (launch_aim._stop_post_xy), sleeve rib launch.RIB_W 6 / RIB_R 12.8

2. Printed contact switch

- Parts: rc2_switch_base, rc2_switch_lever
- Bought: M3x10 SHCS ISO 4762 + M3 jam nut, M3 nut, 2x M3x10 self tapping (pan or SHCS) through the lever root into the pad, at most M3x11.7, 2 wires, multimeter
- Do: Nut into the pillar trap (drop of glue), lever clamped with 2 M3 self tappers, contact screw head down through the lever, set the head 0.9 mm above the nut (0.5 mm per turn), lock the jam nut. Meter on beep between screw and nut. Press the lever tip 100 times.
- Pass: Beeps after about 1.2 mm of tip travel, silent when let go, tip stops on the hard stop without cracking, lever back flat, same after 100 presses.
- If it fails, change: cad/lib/switch.py contact_switch args travel, overtravel, t, b; STRAIN_LIMIT, NUT_PRESS (loose nut), SCREW_LENGTHS.
- Made from: cad.lib.switch.contact_switch(lever_len=30) with the library defaults (travel 0.8, overtravel 0.6, beam t 1.4): gap 0.93, pretravel at the tip 1.24, close force 1.10 N, strain 0.0078

3. Dog clutch and compliant fork

- Parts: rc3_base, rc3_reel_face, rc3_collar, rc3_fork, rc3_fork_stop, rc3_rail
- Bought: 1 x M3x12 (fork stop), M3 nut (tab), 2 x M3 screws (SW_DOG prongs, optional)
- Do: Press the rail into the base. REEL face on the journal (dogs up), collar on the hex (dogs down), fork pads in the collar groove and its sleeve on the rail, fork stop on (M3). Push the fork 7 mm down with the dogs tip to tip, then turn the REEL face until they drop in. Turn the face hard both ways, then pull the fork back.
- Pass: Yoke flexes when tip to tip (no jam, roofs slide off), dogs drop in within a quarter turn, under hand torque the dogs pull in, never walk out, a light pull on the fork releases them, the yoke springs back flat.
- If it fails, change: _drum_kin.py DEFAULTS dog_backcut, dog_roof, dog_deg, dog_gap, fork_k; drum.py GEOM fork_t, yoke_r, groove; fits.py SHAFT_IN_BORE (collar on the hex, face on the journal), HOLE_SLIDE (fork on the rail).
- Made from: drum.dog_teeth (dog_n 4, dog_h 5, dog_deg 36, backcut 4, roof 1.2, r 18..26), drum.fork, drum.fork_stop, drum.rail, drum.hexprism, GEOM journal d30, groove (72.0, 78.0), stroke 7, neutral gap 2.5

4. Face slip clutch with the flexure spring

- Parts: rc4_hub_plate, rc4_friction_disc, rc4_pressure_plate, rc4_flexure, rc4_adjuster_plate
- Bought: 3 x M3x20 SHCS, 3 x M3 nut, string, luggage scale
- Do: Stack on the key stub: hub plate (counterbores down), friction disc, pressure plate (pads up), flexure (beam down, tabs on the screws), adjuster plate (traps up); 3 screws from below, nuts on top. Run the nuts down until the flexure just touches, then turn each nut 1/2 turn at a time (0.25 mm). Clamp the stub, tie a string to a disc lug (r 28.5 mm), pull along the rim with the luggage scale while it slips steadily.
- Pass: Smooth steady slip, no judder; the reading repeats within 20 percent and rises with each half turn, close to the table below (kg on the scale at the lug); the nuts never bottom the flexure before the last row.
- If it fails, change: cad/lib/clutch.py: slip_clutch args flex_t, flex_gap, flex_ro, r_in, r_out, n_grooves; MU_PLA_PLA, E_PLA, SIGMA_FLEX_PLA_SUSTAINED (creep: if the torque falls overnight).
- Made from: cad.lib.clutch.slip_clutch() defaults (reel does not use it: its clutch is the spool face plus the PETG rocker): shaft d20 key 6, friction r 18.5..27, mu 0.3, flexure t 0.8 gap 0.5, 0.106 N m per mm, travel 0.50; on the

shared keyed stub of coupon 7

- Expected slip (nut travel: torque, scale reading at r 28.5): 0.00 mm: 0.000 N m, 0.00 kg; 0.12 mm: 0.013 N m, 0.05 kg; 0.25 mm: 0.027 N m, 0.10 kg; 0.38 mm: 0.040 N m, 0.14 kg; 0.50 mm: 0.053 N m, 0.19 kg

5. Bearing seats

- Parts: rc5_seats_608_693, rc5_csk20_seat
- Bought: 608ZZ, F693ZZ, 693ZZ, CSK20PP
- Do: Press each bearing in square with a flat block or a vice (tile left to right: 608, F693ZZ, 693ZZ); CSK20PP into the round boss with its outer keyway on the printed key.
- Pass: Firm press, seated flat on the lip, stays in when tapped upside down, spins as freely as before; the CSK20PP key slides in without force, it still freewheels one way and locks the other.
- If it fails, change: fits.py BRG_RIB_INTERF, BRG_RIB_BORE (all seats); bearings.py CSK20_KEY_RCLEAR, CSK20_OKEY_W (key), KEY_CLEAR in fits.py. Print the fit coupon tile A if the 608 is off.
- Made from: cad.lib.bearings.seat_608(bottom lip, lip_d 14) as reel, seat_f693(), seat_693(), seat_csk20(key_deg 90) as the reel capstan block (wall 4); fits BRG_RIB_INTERF 0.15, BRG_RIB_BORE 0.3, CSK20_KEY_RCLEAR 0.2

6. M3 holes

- Parts: rc6_m3_tile
- Bought: M3x4x5 heat-set insert, M3 nut, 2 x M3x10
- Do: Left to right: heat-set the insert (220 C), press the nut in, push a screw through, self-tap a screw in.
- Pass: Insert flush and does not spin when the screw is tightened; nut presses in and holds; screw drops through the clearance hole; the tap hole cuts a thread and holds a hard pull without splitting.
- If it fails, change: fits.py M3_INSERT_D, M3_NUT_AF, M3_CLEAR_D, M3_TAP_D (the fit coupon tiles C, D, E bracket them).
- Made from: cad.lib.fasteners.m3_insert (d 4.0), m3_nut_trap (AF 5.8), m3_clear (d 3.4), m3_tap (d 2.6)

7. Key rib and spigot

- Parts: rc7_key_stub, rc7_key_bore, rc7_spigot, rc7_bushing
- Bought: CSK20PP from coupon 5 (inner keyway)
- Do: Slide the key stub into the keyed tile and into the CSK20PP inner race (the real interface). Push the spigot into the sleeve slice and turn it.
- Pass: Stub slides in by hand, key in the keyway, no visible rock, under 1 deg of play when turned; the spigot turns freely with no wobble.
- If it fails, change: fits.py KEY_CLEAR, SHAFT_IN_BORE; shafts.py KEY20_H, SHAFT_PRINT_UNDERSIZE; launch.py SPIGOT_BORE (now 12.35); drum.py GEOM spig_d.
- Made from: cad.lib.shafts.keyed_shaft(d 20, key_w 6, key_h 2.6) and keyed_bore (clear 0.3); drum.main_shaft (spig_d 12); launch.sleeve_solid (SPIGOT_BORE 12.35)

8. Gear meshes m1.25, m1.5, m2, m2.5

- Parts: rc8_m125_plate, rc8_m125_seg, rc8_m125_pinion, rc8_m15_plate, rc8_m15_z42, rc8_m15_z24, rc8_m2_plate, rc8_m2_z24, rc8_m2_z16, rc8_m25_plate, rc8_m25_big, rc8_m25_drive
- Bought: none
- Do: Each pair on its plate (label = module), flat faces down; turn or rock through every tooth.
- Pass: Smooth, no tight spot, a little play when rocked; m2.5: the tall tooth and the cut-down last tooth pass without catching, then the mesh lets go at the gap.
- If it fails, change: fits.py GEAR_BACKLASH, GEAR_CENTER_EXTRA (m1.25, m1.5, m2); launch_gears.py center_distance extra, spur backlash, sector_gear_2d tall_factor (m2.5); _drum_kin.py pin_x (m1.25 pinion).
- Made from: m1.25: gears.spur_gear z60 sector / z10 shift 0.4, cd 44.33 (drum.a_seg); m1.5: gears.spur_gear z42 sector / z24, cd 49.60; m2: gears.spur_gear z24 / z16, cd 40.10 (reel take-up); m2.5: launch_gears.sector_gear_2d z40 (n_present 27, last 6 + gap) / launch_gears.spur z26, cd 82.60 (launch L); coupon face 6, fits GEAR_BACKLASH 0.15, GEAR_CENTER_EXTRA 0.1

9. Shear-pin torque limiter

- Parts: rc9_hub_lever, rc9_outer_lever, rc9_shear_pin x3
- Bought: string or a strap, luggage scale
- Do: Hub slice into the outer slice, pin through both holes (head outside). Clamp the hub lever, hang the luggage scale on the outer lever hole (r 60 mm) at right angles and pull slowly until the pin shears. Break all 3

pins. Torque = kg x 9.81 x 0.06 N m.

- Pass: Clean single shear at about 8.3 kg (4.9 N m), the 3 pins within 20 percent, both slices undamaged (holes still round); a fresh pin goes in by hand.
- If it fails, change: drum.py GEOM shear_d (torque goes with d squared), hub_od (radius), shear_s; fits for the hole: drum.coupler shear hole (shear_d + 0.1) and shear_pin (shear_d - 0.04). Spec D8 / D26 limit 5 N m.
- Made from: drum.coupler_hub and drum.coupler (sliced s 3.5..16.5), drum.shear_pin: d4 PLA in single shear at r 13 (shear_s 11.5); 4.9 N m at 30 MPa

Parts

part	material	qty	print bbox mm	what
rc1_plate	PLA	1	77.4 x 92.4 x 28.3	Splitter base: centre pin d8, output pin d8, stop finger column (2 x M3 tap)
rc1_sleeve	PPA-CF	1	26.0 x 26.0 x 24.5	Sleeve stub d20 with the integral key rib (launch.RIB_W, RIB_R) under the sun and the crank
rc1_sun	PPA-CF	1	48.0 x 47.8 x 8.0	launch_aim.sun_solid: sun m1.5 z30 as built
rc1_arm	PPA-CF	1	59.1 x 32.0 x 14.0	launch_aim.arm_solid: swing arm as built (O-ring groove, d8 pin, clip groove)
rc1_idler	PPA-CF	1	30.0 x 29.7 x 8.0	launch_aim.idler_solid: idler m1.5 z18 as built
rc1_output	PPA-CF	1	48.0 x 47.8 x 8.0	Output m1.5 z30 (launch_gears.spur, face 8) on a d8 pin
rc1_crank	PPA-CF	1	50.0 x 30.0 x 20.0	Hand crank, keyed on the sleeve rib like the sun
rc1_stop	PLA	1	47.1 x 10.0 x 6.4	Stop finger: rounded end at the as-built stop post position
rc2_switch_base	PLA	1	48.0 x 35.0 x 11.5	contact_switch base: pad, nut pillar, hard stop, wire channel
rc2_switch_lever	PLA	1	44.0 x 5.0 x 8.0	contact_switch lever, printed on its side (Y up)
rc3_base	PLA	1	74.0 x 67.0 x 45.0	Base: d30 journal (REEL sleeve) and hex 22 AF (main shaft), rail hole (press)
rc3_reel_face	PPA-CF	1	71.0 x 54.0 x 9.5	REEL gear dog face (drum.dog_teeth, phase 45) with a handle
rc3_collar	PPA-CF	1	60.0 x 60.0 x 18.0	Collar lower half: drum.dog_teeth facing down, fork groove, hex bore
rc3_fork	PLA	1	91.0 x 51.0 x 20.0	drum.fork as built: compliant yoke, follower pin, M3 nut in the tab
rc3_fork_stop	PLA	1	19.5 x 28.0 x 14.5	drum.fork_stop as built
rc3_rail	PPA-CF	1	57.0 x 10.0 x 9.0	drum.rail profile d10 with the print flat, cut to 57 long
rc4_hub_plate	PLA	1	54.0 x 54.0 x 6.0	clutch.slip_clutch hub_plate (library defaults)
rc4_friction_disc	PLA	1	57.0 x 55.0 x 3.0	clutch.slip_clutch friction_disc (library defaults)
rc4_pressure_plate	PLA	1	54.0 x 54.0 x 3.5	clutch.slip_clutch pressure_plate (library defaults)
rc4_flexure	PLA	1	50.0 x 50.0 x 1.7	clutch.slip_clutch flexure (library defaults)
rc4_adjuster_plate	PLA	1	54.0 x 54.0 x 4.0	clutch.slip_clutch adjuster_plate (library defaults)
rc5_seats_608_693	PLA	1	60.0 x 28.0 x 9.6	608 (reel spool seat), F693ZZ and 693ZZ crush-rib seats
rc5_csk20_seat	PLA	1	55.3 x 55.3 x 16.0	CSK20PP seat with the printed key (reel capstan block, key_deg 90)
rc6_m3_tile	PLA	1	54.0 x 18.0 x 8.6	M3 heat-set hole, nut trap, clearance and tap holes (fits.py values)
rc7_key_stub	PPA-CF	1	22.6 x 19.9 x 31.0	shafts.keyed_shaft d20 key 6 (reel capstan tube numbers), 31 long, also the coupon 4 clutch shaft
rc7_key_bore	PPA-CF	1	36.0 x 36.0 x 8.6	shafts.keyed_bore d20 key 6, 8 long (keyed hubs on the sleeve rib are PPA-CF)
rc7_spigot	PPA-CF	1	28.0 x 25.4 x 22.0	drum.main_shaft slice: hex 8 long + d12 spigot 20 long, on a hex flat
rc7_bushing	PPA-CF	1	32.0 x 32.0 x 16.0	launch.sleeve_solid slice 16 long: spigot bore d12.35
rc8_m125_plate	PPA-CF	1	62.3 x 18.0 x 11.0	Pins at 44.33
rc8_m125_seg	PLA	1	46.8 x 39.5 x 6.0	drum segment gear m1.25 z60 sector
rc8_m125_pinion	PPA-CF	1	16.0 x 15.3 x 6.0	drum wrap pinion m1.25 z10 x0.4
rc8_m15_plate	PPA-CF	1	67.6 x 18.0 x 11.0	Pins at 49.60
rc8_m15_z42	PPA-CF	1	41.0 x 37.9 x 6.0	drum wrap idler output m1.5 z42 sector
rc8_m15_z24	PPA-CF	1	39.0 x 39.0 x 6.0	reel cup ring gear m1.5 z24
rc8_m2_plate	PPA-CF	1	58.1 x 18.0 x 11.0	Pins at 40.10
rc8_m2_z24	PPA-CF	1	52.0 x 52.0 x 6.0	reel take-up idler m2 z24
rc8_m2_z16	PPA-CF	1	36.0 x 36.0 x 6.0	reel gear m2 z16
rc8_m25_plate	PPA-CF	1	100.6 x 18.0 x 11.0	Pins at 82.60
rc8_m25_big	PPA-CF	1	61.7 x 53.1 x 6.0	launch big gear m2.5 z40 sector: teeth 21..26 (tall, relieved)

part	material	qty	print bbox mm	what
rc8_m25_drive	PPA-CF	1	44.0 x 57.3 x 6.0	launch drive gear m2.5 z26 sector
rc9_hub_lever	PPA-CF	1	79.0 x 26.0 x 13.0	drum.coupler_hub slice (shear pin hole) with a lever, string hole at r 60
rc9_outer_lever	PPA-CF	1	86.0 x 40.0 x 7.0	drum.coupler slice (shear pin hole) with a lever, string hole at r 60
rc9_shear_pin	PLA	3	6.0 x 6.0 x 12.1	drum.shear_pin as built (d4 PLA)

Base fit coupon

> *NOT IN THE REPO YET:* `base/pack/fit_coupon/COUPON.md` *(written by cad-infra (print pack)). Re-run* `python3 docs/build/make_guide.py` *after it lands and this section fills in.*

Dart prints

Dart plates (in `kedge/pack_v30/`, also inside `kedge/dist_v30/KEDGE_v30_build_pack.zip` under `print/`):

- `kedge/pack_v30/plate_A_hull.3mf`
- `kedge/pack_v30/plate_B_legs_tray.3mf`
- `kedge/pack_v30/fit_coupon.stl` (print this first, 20 minutes)

Dart part	Print pose	Size on bed mm	Volume cm3
hull_top	split face down (on the bed), saddle up	121 x 50 x 35	17.41
hull_bottom	split face down, belly up	121 x 42 x 21	11.5
nose	tip down on the bed (flat Ø22), spigot up	42 x 42 x 27	8.25
tail_cap	end face down, spigot up (no supports)	42 x 42 x 15	7.13
tray	keel down on the bed; discs stand up, decks bridge 26 mm between discs	109 x 39 x 36	15.98
kick_leg	on its side (pole axis horizontal, hub face down)	119 x 15 x 15	8.7
drill_leg_L	upright, motor pocket open to the top (as installed folded)	46 x 15 x 13	3.37
drill_leg_R	upright, motor pocket open to the top (as installed folded)	46 x 15 x 13	3.37
drill_leg_L_auger	base down, nut slot sideways	17 x 17 x 73	5.5
drill_leg_R_auger	base down, nut slot sideways	17 x 17 x 73	5.5
foot_auger	base down	17 x 17 x 40	3.06
coupler_L	standing on its socket end	7 x 6 x 36	1.24
coupler_R	standing on its socket end	7 x 6 x 27	0.9

Settings: PLA, 0.4 nozzle, 0.16 mm layers, 4 walls, 40% gyroid infill, 5 top and bottom layers, supports off, brim on for the augers and couplers. Hole compensation from the fit coupon (run sheet section 4).

Base prints

The base print pack comes from the base pipeline (`base/out/base/pack`: PRINT_SHEET.pdf, the plates in `plates/plate_<n>_<material>.3mf`, print_report.json). It holds every part already in print orientation, the plates as 3MF, and the material for each part.

> *NOT IN THE REPO YET:* `base/pack (print list)` *(written by cad-infra (print pack)). Re-run* `python3 docs/build/make_guide.py` *after it lands and this section fills in.*

Before printing the base:

1. The wiper and spring numbers are in params.py and the pipeline was re-run (the audit said CLEAN).
2. Print one test part from the pack in PPA-CF and check a 608 drops into its seat with a firm thumb press, and an M3 heat-set insert sets straight. Adjust hole compensation the same way as the dart coupon.
3. PPA-CF: dry the spool first (it absorbs water), hardened nozzle, settings from the Bambu PPA-CF profile.

5. Base assembly

The assembly steps come from the base pipeline: every step is generated from the same model that passed the collision audit, with a picture per step. They are in `base/out/base/guide.pdf` (attached as an appendix at the end of this guide).

> *NOT IN THE REPO YET:* `base/out/base/guide.pdf` *(written by cad-infra (assembly pipeline)). Re-run* `python3 docs/build/make_guide.py` *after it lands and this section fills in.*

General rules for the base:

- Heat-set inserts: soldering iron at about 220 C with the insert tip, press straight in, let it cool before loading.
- Bearings: press in square with a flat block, never hammer on the inner race.
- Keyed shafts: check the key slides in the sprag (CSK20PP) keyway by hand before final assembly.
- Turn every train by hand (battery unplugged) after each step: it must turn without binding before the next step.
- Leave the springs off until test stage 5 (section 12).
- Motor adapter: bolt the wiper motor to the adapter on the bench first (M6 bolts from the cheek side), then fit the 6 x M3 x 12 from inside the cheek box, before any shaft goes in.
- Bearing blocks slide on over bearings that are already on their shaft.
- Drum coupler: drop the M8 nut through the socket, then the M3 cross screw.
- AS5600: heat-stake the board onto its printed pegs (soldering iron tip, gently); glue the magnet in its cap.
- Wires: leave a 150 mm loop at the rail pivot for SW_SEATED and SW_HOME. Never route a wire across a moving part.
- Contacts: set each gap by turning the screw (MEASURE_LIST G12).
- Manual drum fallback: loosen the N20 cradle thumb screw and slide the N20 out of mesh, then turn the drum by the hand lever on its 14 mm hex boss. Battery unplugged. Never use the hand lever while the carriage is drawn (`cock` above 0 or `SW_HOME` open) or while the line is under tension: shifting under load can dry fire the launcher or drop the line. De-cock and slacken the line first.
- Aim only with the carriage at HOME (springs slack). Fire low-pitch shots with the rover braked or chocked.

6. Dart build

The dart is built from three documents. This section says which to use for what, and in what order.

- **KEDGE v30 run sheet** (appendix at the end, also `kedge/pack_v30/KEDGE_v30_run_sheet.pdf`): printing, board prep, mechanical assembly, function test. Its own section numbers are used below.
- `firmware/dart/WIRING.md` (below): the new wiring. It replaces the run sheet's wiring (its sections 7 and 9 and its wiring picture).
- `firmware/dart/BENCH_TEST.md` (below): the bench checks for the new firmware.

What changed from the run sheet

- The dart now uses two DRV8833 boards. DRV#3 goes to the base selector drum; its pocket on the keel stays empty.
- DRV#2 channel A drives BOTH drill motors (right drill leads still swapped), channel B drives the foot.
- No pin bridge on DRV#2 (ignore the bridge in run sheet 7.3).
- To reverse a motor, swap its two thin input wires at the driver instead of the motor leads (run sheet 7.6 and 10 swap motor leads by v29 number): drills = D8 / D9 at DRV#2 AIN1 / AIN2, foot = D6 / D7 at DRV#2 BIN1 / BIN2, deploy = D0 / D1 at DRV#1 AIN1 / AIN2, kick = D2 / D3 at DRV#1 BIN1 / BIN2. Exception: if only ONE drill turns the wrong way, swap that drill's motor leads.
- **Wire numbers changed.** The tape flags carry the NEW numbers from the new cut list. Wherever the run sheet names a wire number (sections 7.6, 8b, 8d, 8e, 8f and 10), look it up in the table "Run sheet wire numbers" below.
- Use the firmware in `firmware/dart/`, not the copy inside the v30 pack. Ignore the run sheet's `firmware/reel` sketch: `firmware/base/` replaces it. The Adafruit INA219 library is no longer needed (BNO08x still is).
- Run sheet section 10, "Put them in kedge_logic.h (kickContactMa, kickStallMa, deployStallMa)": kickContactMa is still there, but kickStallMa and deployStallMa are gone (now `stallMa[]`). Enter the measured currents as BENCH_TEST.md says.
- Foot direction: the foot auger is right-hand thread, so it screws in when it turns **clockwise seen from the motor end, looking toward the auger tip**. The run sheet's "clockwise, seen from the shaft end" in 7.6 means the same only if you stand behind the motor; use the motor-end wording.

Dart build order (follow this; it merges the three documents)

1. Run sheet section 4: print and check the fit coupon.
2. Run sheet section 5: start plate A, flash the firmware from `firmware/dart/` (section 8.2 of this guide).
3. Run sheet section 6 steps 1 to 3: clip headers, set the buck. Set MP1584 #1 to 5.04 V and MP1584 #2 to 8.0 V from the 3S LiPo on XT60 lead #1 (run sheet 6.2), before either buck is soldered to anything. (This replaces WIRING.md step B2.) MP1584 #2 later becomes the base drum supply at 9.0 V.
4. Run sheet section 6 step 4: find the SLP pad on DRV#1 and DRV#2 (WIRING.md step B6). Meter on beep: SLP to VM must NOT beep (a Pololu pull-up of tens of kilohms is fine; a beep means the pad is the motor supply).
5. Battery unplugged. Solder the bench harness with WIRING.md Path B, steps B3 to B10 (B2 is replaced by step 3 above), on the bench, outside the hull, motor leads left free at their far ends. B1 (cells and BMS) and every wire end that goes to the BMS (P+, P-) wait for step 9.
6. Battery unplugged. **Click the u.FL antenna onto the VTX** (never power the VTX without it). Bench power-up: the 8.0 V MP1584 #2 on the LiPo feeds the INA219 VIN+ pad and main ground, exactly as run sheet 7.5. Check the readings there (about 4.7 V at the XIAO 5V pad, VTX LED on, z finds 0x40 and 0x4a). USB unplugged whenever the bench supply is connected. BENCH_TEST.md section "Power: bench supply or battery" says how the bench supply stands in for the battery.
7. Motor directions on the bench (BENCH_TEST.md, the steps that need only a loose motor; run sheet 7.6 with the new wire numbers). Mark each motor lead. Disconnect the bench supply.
8. Start plate B. Run sheet 8a: nose ballast.
9. Battery unplugged. Run sheet 8b: battery contacts and BMS, using the new wire numbers.
10. Run sheet 8c, 8d, 8e, 8f in order (pods, tray, close the hull, kick leg and foot). The run sheet closes the hull with the kick and drill leads threaded out through their holes, then solders those motors outside: that is intended. Antenna still on before every loop-plug-in.

11. BENCH_TEST.md for everything that needs the legs fitted, then run sheet section 10 (function test in damp soil). Steps that use the Jetson (`kedge_client.py`, the RC832) wait until sections 7 and 9 are done: from the Jetson use `python3 -m grappstar dart status`.

Dart wiring (new pin map)

From `firmware/dart/WIRING.md`*:*

KEDGE dart wiring v4 (DRV8833 #3 removed)

This replaces Appendix A of `kedge/CLAUDE.md` (the v29 list of 53 wires). The new list has 50 wires: `wiring/wire_cut_list.csv`. Diagram: `wiring/wiring.svg` / `wiring/wiring.png`. Changes only: `wiring/changes_from_v29.csv`. Regenerate everything with `python3 firmware/dart/tools/wires_v4.py` (lengths from the v30 model, same rule as before).

What changed:

- DRV8833 #3 leaves the dart and goes to the base station (selector drum). **The dart geometry does not change.** v30 is still the default build; the DRV#3 pocket on the keel in the sled simply stays empty.
- DRV#2 channel A now drives **both** drill motors (wired in parallel on AOUT1 / AOUT2). The pair stalls at about 0.7 A, inside one channel's 1.2 A. The right drill's leads stay swapped so the augers counter-rotate.
- DRV#2 channel B now drives the **foot** motor (it was on DRV#3).
- The pin bridge on DRV#2 (AIN1 to BIN1, AIN2 to BIN2) is **gone**. Channels A and B now have their own inputs.

Pin map (firmware v4):

XIAO pin	Goes to	Motor
D0 / D1	DRV#1 AIN1 / AIN2	deploy N20
D2 / D3	DRV#1 BIN1 / BIN2	kick N20
D8 / D9	DRV#2 AIN1 / AIN2	both drill motors
D6 / D7	DRV#2 BIN1 / BIN2	foot N20 (these two pins twitch at reset: harmless on the slow worm)
D4 / D5	INA219 + BNO085 SDA / SCL	I2C
3V3	DRV#1 SLP, DRV#2 SLP, INA219 VCC, BNO085 VIN	logic power

Rules for every step

1. **Battery unplugged.** Pull the power loop plug (the ON switch in the tail) before you touch any wire, and leave it out until the step says so. The first XIAO died from wiring with the battery live.
2. USB unplugged while you solder. Never have USB and the power loop plug in at the same time unless a step says so.
3. Heat shrink on before you solder, not after. Keep the iron off the PLA.
4. After each solder joint, tug the wire gently. It must not move.

Path A: you already wired the v29 harness (convert it)

Do these steps in order. Wire numbers in brackets are the v29 numbers, then the new numbers.

Step A1. Battery unplugged. Pull the power loop plug. Unplug USB. Take the cells out if the hull is open.

Step A2. Battery unplugged. Remove DRV#3. Unsolder and remove these three wires completely:

- [13] DRV#2 VM to DRV#3 VM (red, 22 AWG)
- [17] DRV#2 GND to DRV#3 GND (black, 22 AWG)
- [27] DRV#2 SLP to DRV#3 SLP (red/white, 28 AWG)

Wires 13 and 17 share the DRV#2 VM and GND pads with wires 12 and 15: leave 12 and 15 in place and tug them after. Also unsolder the foot motor wires [52] [53] from DRV#3, and remove the XIAO D6 / D7 wires [42] [43] completely (desolder them at the XIAO end too and throw them away). Lift DRV#3 out of the sled and put it in a labelled bag for the base station. The pocket stays empty.

Step A3. Battery unplugged. Cut the bridge on DRV#2. In v29 the D8 wire went to AIN1 *and* BIN1 (bridged), and the D9 wire to AIN2 *and* BIN2. Desolder the jumper wire or solder blob that joins AIN1 to BIN1 and AIN2 to BIN2 (desoldering braid). The 45 mm D8 and D9 wires stay. After this:

- D8 goes to **AIN1 only** (new wire 37)
- D9 goes to **AIN2 only** (new wire 38)

Check with the meter on beep: AIN1 to BIN1 must NOT beep. AIN2 to BIN2 must NOT beep.

Step A4. Battery unplugged. Move the right drill to channel A. Unsolder the right drill wires from BOUT1 / BOUT2 and solder them to the channel A pads, keeping the swap:

- right drill **black** to **AOUT1** (the same pad as the left drill red) (new wire 47)
- right drill **red** to **AOUT2** (the same pad as the left drill black) (new wire 48)

Two wires in one pad hole, one pad at a time: desolder the left drill red from AOUT1 (braid or pump). Strip 3 mm of it and of the right drill black, twist the two bare ends together, tin them, push them through the hole, solder. Trim the ends flush on the far side. Check with a magnifier that no strand touches the next pad. Tug both. Then the same on AOUT2 with the left drill black and the right drill red.

Step A5. Battery unplugged. Foot inputs to DRV#2 B. Cut two new 45 mm 28 AWG wires (purple and grey):

- XIAO D6 to DRV#2 **BIN1** (purple, new wire 39)
- XIAO D7 to DRV#2 **BIN2** (grey, new wire 40)

Step A6. Battery unplugged. Foot motor to DRV#2 B. The foot wires are now longer, because DRV#2 sits in the board bay behind the cells, not in the sled. Cut two new 330 mm silicone 26 AWG wires (red and black). Run them forward along the top of the hull through the disc notches (with the camera wires), out the skin hole, a 60 mm loop round the kick hub, then down the pole channel:

- DRV#2 **BOUT1** to foot N20 **+ (red)** (new wire 49)
- DRV#2 **BOUT2** to foot N20 **- (black)** (new wire 50)

If the old 255 mm foot wires are already through the pole channel, you may instead solder an 80 mm extension at the DRV#2 end: joint inside the hull, heat shrunk, never in the hub loop.

Step A7. Battery unplugged. Meter checks (meter on beep, nothing powered):

- DRV#2 AOUT1 beeps to the left drill red AND the right drill black.
- DRV#2 AOUT2 beeps to the left drill black AND the right drill red.
- DRV#2 BOUT1 beeps to the foot red, BOUT2 to the foot black.
- No beep between any AOUT pad and any BOUT pad.
- No beep between XIAO D6, D7, D8, D9 (each pair).
- Meter on ohms (not beep): AOUT1 to AOUT2 and BOUT1 to BOUT2 read a few ohms or more (that is the motor winding), never 0.0.
- VM to GND: a short chirp is a capacitor charging and is fine; a steady beep is a short: find it before power.

Then go to "Power-on check" below.

Path B: fresh build (the whole harness)

Use `wiring/wire_cut_list.csv` for colours, gauges and cut lengths. Cut every wire 10 mm longer than listed if you are unsure; trim at the end. Work in this order. Every step starts with the battery unplugged.

Step B1. Battery unplugged. Cells and BMS (wires 1 to 8). Solder the plate tabs before the plates go in their recesses. The series link (wire 2) carries the full current: 22 AWG. Charge socket pins: 1 = B-, 2 = BM, 3 = B+.

Step B2. Set the buck before it is wired in (as in the run sheet step 6.2). The MP1584 on its own: 3S LiPo on XT60 lead #1 to MP1584 IN+ / IN-, meter on DC volts across OUT+ and OUT-, turn the small brass screw until it reads **5.04 V**. Disconnect the LiPo. Then fit the capacitor across OUT (long leg OUT+, striped leg OUT-; rated 10 V or more).

Step B3. Battery unplugged. Motor rail (wires 9 to 15). Power loop socket pin 2 to INA219 VIN+, the buck IN+ taps the same VIN+ pad, INA219 VIN- to DRV#1 VM, then DRV#1 VM to DRV#2 VM. Grounds: BMS P- to buck IN-, buck IN- to DRV#1 GND, DRV#1 GND to DRV#2 GND. **The chain ends at DRV#2.** There is no DRV#3.

Step B4. Battery unplugged. 5 V (wires 16 to 21). Click the u.FL antenna onto the VTX now: never power a VTX without its antenna. Buck OUT+ to XIAO 5V **through the Schottky diode, stripe towards the XIAO**. Buck OUT- to XIAO GND. Buck OUT to the VTX, VTX pads on to the camera.

Step B5. Battery unplugged. Camera video (wire 22): camera yellow to VTX video in, twisted with the camera ground.

Step B6. Battery unplugged. Find the SLP pad (before wires 23, 24). On each DRV8833 board find the pad named SLP, nSLEEP or EEP. Meter on **ohms** (beep mode only catches a dead short): that pad to VM. **Under 50 ohms means it is tied to the motor supply on this board: do not connect 3V3 to it.** (Pololu boards pull SLP up through a resistor of tens of kilohms, which is fine; on a generic board with a solder bridge from SLP to VCC, open the bridge first.) Then: XIAO 3V3 to DRV#1 SLP (wire 23), DRV#1 SLP to DRV#2 SLP (wire 24).

Step B7. Battery unplugged. Sensors (wires 25 to 32). 3V3 and GND from the XIAO to the INA219, then on to the BNO085. SDA (blue): D4 to INA219 SDA to BNO085 SDA. SCL (green): D5 to INA219 SCL to BNO085 SCL.

Step B8. Battery unplugged. Driver inputs (wires 33 to 40): D0, D1 to DRV#1 AIN1, AIN2 (deploy). D2, D3 to DRV#1 BIN1, BIN2 (kick). D8, D9 to DRV#2 AIN1, AIN2 (drills). D6, D7 to DRV#2 BIN1, BIN2 (foot). **No bridges between pads.**

Step B9. Battery unplugged. Motors, leave them hanging outside the hull for now (wires 41 to 50):

- DRV#1 AOUT1 / AOUT2 to deploy red / black.
- DRV#1 BOUT1 / BOUT2 to kick red / black.
- DRV#2 AOUT1 to left drill red **and** right drill black; DRV#2 AOUT2 to left drill black **and** right drill red (two wires per pad, twisted and tinned together exactly as in step A4).
- DRV#2 BOUT1 / BOUT2 to foot red / black (330 mm silicone).

Step B10. Battery unplugged. Meter checks: the list in step A7, plus 5V to GND and 3V3 to GND: no steady beep.

Optional, if you have them (recommended):

- 470 to 1000 uF, 10 V or more, across the XIAO 5V and GND pins, on the XIAO side of the Schottky diode (long leg to 5V). It keeps the XIAO running through a short power break at impact (the JST plug is the only power path), so the flight state survives. Glue or tape the power loop plug so it cannot shake loose.
- 100 uF, 16 V, across DRV#1 VM and GND (long leg to VM): bulk capacitor for the motor rail (TI asks for 10 uF or more).

Power-on check (both paths)


1. **Battery unplugged.** Motors still outside the hull, legs free to turn, nothing touching the augers.
2. USB only, power loop plug out: flash the firmware (README.md). Serial Monitor at 115200. Type `z`: expect `0x40` and `0x4a` (or `0x4b`).
3. Antenna on the VTX. Unplug USB. Insert the power loop plug. Nothing should move, nothing should get warm. Join WiFi `KEDGE`.
4. Open `http://192.168.4.1`. Status line must show `IDLE`, `INA219 ok`, `BNO085 ok`, rail about 7 to 8.4 V.
5. Go through BENCH_TEST.md: steps 0 to 6 (directions, free currents) on the loose motors now, the rest after assembly (the table at the top of BENCH_TEST.md says which).

Drill direction check (BENCH_TEST.md step 4): hold "drills in" (key 3) and look at each auger from its motor end, looking toward the tip. The left auger (right-hand thread) must turn **clockwise**, the right auger (left-hand thread) **anticlockwise**: then both screw into the ground.

- Left auger wrong: battery unplugged, swap the two thin input wires at DRV#2 AIN1 and AIN2 (D8 and D9). This reverses both drills. Check again.
- Then if the right auger is wrong: battery unplugged, swap the right drill's own two wires on AOUT1 / AOUT2.
- Swapping a motor's two input wires at its driver is the easy way to reverse any motor.

Totals (cut from the reel)

Wire	mm
22 AWG red	520
22 AWG black	360
24 AWG orange / black	160 / 160
26 AWG silicone red / black (foot pair)	330 / 330
26 AWG red / black (other motors)	760 / 855
26 AWG white / orange	180 / 95
28 AWG red/white, black, blue, green, purple, grey, yellow, orange	240, 225, 120, 120, 200, 200, 105, 105

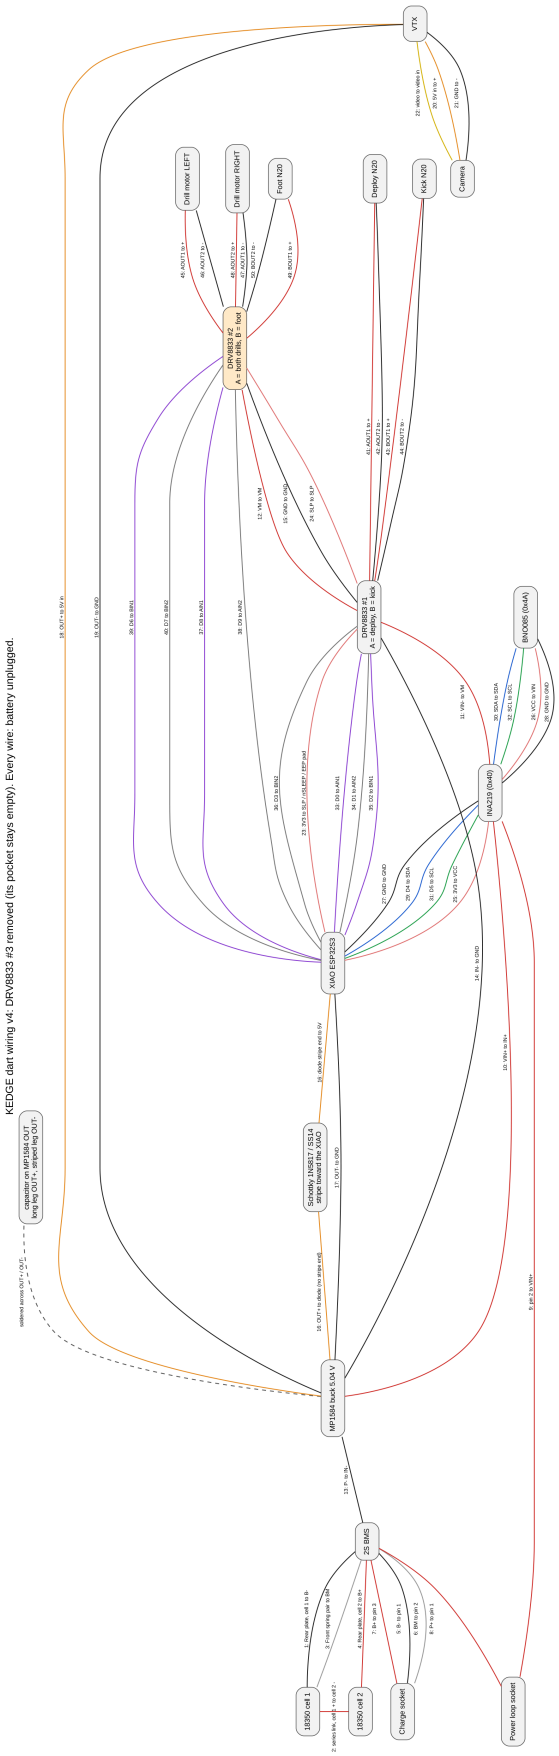

Dart wiring v4 (numbers match the new cut list). To zoom in, open firmware/dart/wiring/wiring.svg on a screen.

Run sheet wire numbers

When the run sheet names a wire number, use the new number from this table.

Run sheet wire	New wire	Run sheet says
1	1	Rear plate, cell 1 (-) to BMS B-
2	2	Front spring, cell 1 (+) to Front spring, cell 2 (-)
3	3	Front spring pair (cell 1 + / cell 2 -) to BMS BM
4	4	Rear plate, cell 2 (+) to BMS B+
5	5	BMS B- to Charge socket pin 1 (tail window)
6	6	BMS BM to Charge socket pin 2
7	7	BMS B+ to Charge socket pin 3
8	8	BMS P+ to Power loop socket pin 1 (tail window)
9	9	Power loop socket pin 2 to INA219 VIN+
10	10	INA219 VIN+ (same pad) to MP1584 IN+
11	11	INA219 VIN- to DRV#1 VM
12	12	DRV#1 VM to DRV#2 VM
13	REMOVED (no DRV#3)	DRV#2 VM to DRV#3 VM
14	13	BMS P- to MP1584 IN-
15	14	MP1584 IN- (same pad) to DRV#1 GND
16	15	DRV#1 GND to DRV#2 GND
17	REMOVED (no DRV#3)	DRV#2 GND to DRV#3 GND
18	16	MP1584 OUT+ (5.04 V) to XIAO 5V via a Schottky diode (stripe toward the XIAO)
19	17	MP1584 OUT- to XIAO GND
20	18	MP1584 OUT+ to VTX 5V in
21	19	MP1584 OUT- to VTX GND
22	20	VTX 5V in (same pad) to Camera + (red)
23	21	VTX GND (same pad) to Camera - (black)
24	22	Camera video (yellow) to VTX video in
25	23	XIAO 3V3 to DRV#1 SLP / nSLEEP / EEP pad (NOT VCC or VIN)
26	24	DRV#1 SLP to DRV#2 SLP
27	REMOVED (no DRV#3)	DRV#2 SLP to DRV#3 SLP
28	25	XIAO 3V3 to INA219 VCC
29	26	INA219 VCC to BNO085 VIN
30	27	XIAO GND to INA219 GND
31	28	INA219 GND to BNO085 GND
32	29	XIAO D4 to INA219 SDA
33	30	INA219 SDA to BNO085 SDA
34	31	XIAO D5 to INA219 SCL
35	32	INA219 SCL to BNO085 SCL
36	33	XIAO D0 to DRV#1 AIN1
37	34	XIAO D1 to DRV#1 AIN2
38	35	XIAO D2 to DRV#1 BIN1
39	36	XIAO D3 to DRV#1 BIN2
40	37	XIAO D8 to DRV#2 AIN1 + BIN1 (bridge the two pads)
41	38	XIAO D9 to DRV#2 AIN2 + BIN2 (bridge the two pads)
42	39	XIAO D6 to DRV#3 AIN1
43	40	XIAO D7 to DRV#3 AIN2
44	41	DRV#1 AOUT1 to Deploy N20 + (red)
45	42	DRV#1 AOUT2 to Deploy N20 - (black)
46	43	DRV#1 BOUT1 to Kick N20 + (red)
47	44	DRV#1 BOUT2 to Kick N20 - (black)
48	45	DRV#2 AOUT1 to Drill motor LEFT + (red)
49	46	DRV#2 AOUT2 to Drill motor LEFT - (black)

Run sheet wire	New wire	Run sheet says
50	47	DRV#2 BOUT1 to Drill motor RIGHT - (black) SWAPPED
51	48	DRV#2 BOUT2 to Drill motor RIGHT + (red) SWAPPED
52	49	DRV#3 AOUT1 to Foot N20 + (red)
53	50	DRV#3 AOUT2 to Foot N20 - (black)

New dart wire cut list (replaces run sheet section 9)

From `firmware/dart/wiring/wire_cut_list.csv`*:*

#	from	to	colour	gauge	cut length mm	note	v29 #
1	Rear plate, cell 1 (-)	BMS B-	black	22 AWG	45	solder to the plate tab before it goes in its recess	1
2	Front spring, cell 1 (+)	Front spring, cell 2 (-)	red	22 AWG	45	the series link: carries the full battery current; glue both springs in the front recess	2
3	Front spring pair (cell 1 + / cell 2 -)	BMS BM	white	26 AWG	55	midpoint sense	3
4	Rear plate, cell 2 (+)	BMS B+	red	22 AWG	45		4
5	BMS B-	Charge socket pin 1 (tail window)	black	26 AWG	80	JST-XH 3-pin, balance charge	5
6	BMS BM	Charge socket pin 2	white	26 AWG	125		6
7	BMS B+	Charge socket pin 3	red	26 AWG	80		7
8	BMS P+	Power loop socket pin 1 (tail window)	red	22 AWG	80	JST-XH 2-pin; the shorting plug is the ON switch	8
9	Power loop socket pin 2	INA219 VIN+	red	22 AWG	95	main + after the loop	9
10	INA219 VIN+ (same pad)	MP1584 IN+	red	22 AWG	140	buck taps before the shunt, so INA219 reads motor current only	10
11	INA219 VIN-	DRV#1 VM	red	22 AWG	50	motor rail 6.0-8.4 V	11
12	DRV#1 VM	DRV#2 VM	red	22 AWG	65	daisy chain ends here (no DRV#3)	12
13	BMS P-	MP1584 IN-	black	22 AWG	130	main ground	14
14	MP1584 IN- (same pad)	DRV#1 GND	black	22 AWG	120		15
15	DRV#1 GND	DRV#2 GND	black	22 AWG	65		16
16	MP1584 OUT+ (5.04 V)	XIAO 5V via a Schottky diode (stripe toward the XIAO)	orange	24 AWG	160	set and check 5.04 V BEFORE connecting; 1N5817 or SS14 in heat shrink	18
17	MP1584 OUT-	XIAO GND	black	24 AWG	160		19
18	MP1584 OUT+	VTX 5V in	orange	26 AWG	95		20
19	MP1584 OUT-	VTX GND	black	26 AWG	95		21
20	VTX 5V in (same pad)	Camera + (red)	orange	28 AWG	105	runs forward along the top through the disc notches	22
21	VTX GND (same pad)	Camera - (black)	black	28 AWG	105		23
22	Camera video (yellow)	VTX video in	yellow	28 AWG	105	twist with the camera ground	24
23	XIAO 3V3	DRV#1 SLP / nSLEEP / EEP pad (NOT VCC or VIN)	red/white	28 AWG	55	wakes the driver; meter check first (WIRING.md step B6)	25

#	from	to	colour	gauge	cut length mm	note	v29 #
24	DRV#1 SLP	DRV#2 SLP	red/white	28 AWG	65		26
25	XIAO 3V3	INA219 VCC	red/white	28 AWG	60		28
26	INA219 VCC	BNO085 VIN	red/white	28 AWG	60		29
27	XIAO GND	INA219 GND	black	28 AWG	60		30
28	INA219 GND	BNO085 GND	black	28 AWG	60		31
29	XIAO D4	INA219 SDA	blue	28 AWG	60	I2C SDA	32
30	INA219 SDA	BNO085 SDA	blue	28 AWG	60		33
31	XIAO D5	INA219 SCL	green	28 AWG	60	I2C SCL	34
32	INA219 SCL	BNO085 SCL	green	28 AWG	60		35
33	XIAO D0	DRV#1 AIN1	purple	28 AWG	55	deploy	36
34	XIAO D1	DRV#1 AIN2	grey	28 AWG	55	deploy	37
35	XIAO D2	DRV#1 BIN1	purple	28 AWG	55	kick	38
36	XIAO D3	DRV#1 BIN2	grey	28 AWG	55	kick	39
37	XIAO D8	DRV#2 AIN1 (only AIN1: NO bridge to BIN1)	purple	28 AWG	45	drills	40
38	XIAO D9	DRV#2 AIN2 (only AIN2: NO bridge to BIN2)	grey	28 AWG	45	drills	41
39	XIAO D6	DRV#2 BIN1	purple	28 AWG	45	foot (slow worm, harmless if it twitches at reset)	42
40	XIAO D7	DRV#2 BIN2	grey	28 AWG	45	foot	43
41	DRV#1 AOUT1	Deploy N20 + (red)	red	26 AWG	165	motor sits in the sled cradle	44
42	DRV#1 AOUT2	Deploy N20 - (black)	black	26 AWG	165		45
43	DRV#1 BOUT1	Kick N20 + (red)	red	26 AWG	150	out through the hole in the saddle floor	46
44	DRV#1 BOUT2	Kick N20 - (black)	black	26 AWG	150		47
45	DRV#2 AOUT1	Drill motor LEFT + (red)	red	26 AWG	195	out the left flank hole, 30 mm loop for the pod swing	48
46	DRV#2 AOUT2	Drill motor LEFT - (black)	black	26 AWG	195		49
47	DRV#2 AOUT1 (same pad as the LEFT red)	Drill motor RIGHT - (black) SWAPPED	black	26 AWG	170	reversed on purpose: the pair counter-rotates	50
48	DRV#2 AOUT2 (same pad as the LEFT black)	Drill motor RIGHT + (red) SWAPPED	red	26 AWG	170		51
49	DRV#2 BOUT1	Foot N20 + (red)	red	26 AWG	330	forward along the top through the disc notches, out the skin hole, 60 mm loop round the hub, through the pole channel	52
50	DRV#2 BOUT2	Foot N20 - (black)	black	26 AWG	330	silicone wire, it flexes every deploy	53

Dart bench tests

From `firmware/dart/BENCH_TEST.md`*:*

KEDGE dart bench test (before closing the hull)

Goal: every motor turns the right way and stops on its own, both sensors work, the current thresholds are real numbers, and one full anchor + release runs on soil. About 1 hour.

When to run each part:

Steps	When
0 to 2, and the direction + free current parts of 3 to 6	loose motors on the bench (bench harness, before routing into the hull)
stall at the end stops in 3 to 6, then 7 to 10	assembled: legs and pods fitted, hull open
11, and 12 step 4 (camera picture)	after the Jetson, RC832 and capture card are set up (rover section)

You need: charged 18350 cells (XTAR MC2), multimeter, phone or laptop on WiFi `KEDGE`, a stopwatch, a tray or bucket of damp soil at least 10 cm deep, a folded towel, and this sheet to write numbers on.

Directions used below (firmware convention, +1 in `/status motors`):

Key	Motor	Must do
1	deploy	pods swing **down**
2	kick	leg swings **out**, over the nose
3	drills	augers turn to **screw in**: left clockwise, right anticlockwise, seen from the motor end, looking toward the tip
4	foot	foot auger turns to **screw in**: clockwise seen from the motor end, looking toward the tip (right-hand foot auger)

If a motor turns the wrong way: **battery unplugged**, swap that motor's two thin input wires at its driver (deploy: DRV#1 AIN1/AIN2, kick: DRV#1 BIN1/BIN2, drills: DRV#2 AIN1/AIN2, foot: DRV#2 BIN1/BIN2). Then check again.

Power: bench supply or battery

The loose-motor steps (0 to 2, and the direction and free-current parts of 3 to 6) usually run before the cells and the power loop socket are fitted. Then power comes from the **bench supply**: the spare MP1584 (#2) set to **8.0 V**, fed by the 3S LiPo on XT60 lead #1 (10 A fuse), as in run sheet step 7.5.

- Connect it with the LiPo unplugged: bench MP1584 OUT+ to the dart's **INA219 VIN+** pad, bench MP1584 OUT- to the dart's **main ground** (the dart MP1584 IN- pad). Use small clip leads, or two temporary wires soldered to those pads. Check the polarity twice: red to VIN+, black to ground.
- "Insert the power loop plug" below then means: plug the LiPo into the bench MP1584. "Pull the plug" means: unplug the LiPo. "The battery voltage" means: the bench supply voltage, metered at INA219 VIN+ to ground (about 8.0 V).
- **USB out** while the bench supply is connected, exactly as with the battery.
- The assembled steps (end-stop stalls in 3 to 6, then 7 to 10) use the real cells and the power loop plug.

Step 0. Set up

1. **Battery unplugged.** Wiring done and meter-checked (WIRING.md step A7 or B10). Firmware flashed (README.md).
2. Motors and legs outside the hull or with the hull open, legs free to swing, nothing near the augers. Fingers clear.
3. The u.FL antenna must be clicked onto the VTX before any power (a VTX without its antenna can burn out). Unplug USB. Then insert the power loop plug. Nothing moves, nothing gets warm in 30 s. If anything heats: pull the plug.
4. Join `KEDGE`, open `http://192.168.4.1`. The status line must show `IDLE`, `INA219 ok`, `BNO085 ok`.

Step 1. Power and current sensor

1. Meter the supply: the battery at the power loop socket, or the bench supply at INA219 VIN+ to ground. Compare with `rail` on the page: within 0.15 V (the INA219 reads after its shunt, so `rail` can be a few tens of mV lower). Write both down.
2. With nothing running, `current` reads 0 to 5 mA (the INA219 sees the motor rail only).
3. Press `i` on the page: it prints rail, current, and the peak since the last `i`.

Pass: INA219 ok, rail agrees with the meter. If `INA219 MISSING`: battery unplugged, check D4/D5 and 3V3/GND to the INA219. Then, with the power off (plug out or LiPo unplugged), plug in USB: Serial Monitor `z` must list 0x40.

Step 2. BNO085 and attitude

1. Press `b`: roll, pitch and |a| about 1.00 g with the dart still.

2. Tilt the dart nose up: pitch changes by about 90. Roll it on its side: roll changes by about 90.
3. If `BNO085 MISSING`: battery unplugged, check wires. Then, plug still out, plug in USB: Serial `z` must list 0x4a (or 0x4b). If the Serial Monitor stays blank: right port, 115200 baud, tap R on the XIAO.

If a motor in steps 3 to 6 does not stop by itself at the end within 8 s (the hold cap), the default stall threshold is above its real stall current. So press `i` once BEFORE each hold (it resets the peak), then hold, release, and press `i` again: the peak it prints is the stall current.

Also check once, battery unplugged, meter on ohms: each DRV8833 SLP pad to VM. Under 50 ohms means the pad is tied to the motor supply on that board: do not connect 3V3 to it (WIRING step B6).

Step 3. Deploy (DRV#1 A)

1. Hold `deploy down` (key `1`) for 1 s. Pods swing **down**. Wrong way: fix as above.
2. Hold it until the pods reach the end. They stop by themselves (event `stalled: deploy at ... mA, stopped`). Write down that mA: **deploy stall =** ____ **mA**. While moving freely, `current` reads **deploy free =** ____ **mA**.
3. Hold `deploy up` (`!`) until they stow and stop by themselves.

Step 4. Drills (DRV#2 A, both motors)

1. Pods down first (step 3). Hold `drills in` (3) for 2 s. Check the directions in the table (left clockwise, right anticlockwise, from motor end to tip). If both turn the same way: WIRING.md "Drill direction check".
2. **Drill pair free =** ____ **mA** (expect 60 to 70). Press a printed stick or a pencil end lightly against one auger flight (never a cloth or fingers: cloth winds in and pulls fingers with it): current rises. Do not stall both for long (two sticks, never hands). Stalling both reads **drill pair stall =** ____ **mA** (expect about 700 at 8 V).
3. Hold `drills out` (#): they reverse.

Step 5. Kick (DRV#1 B)

1. Hold `kick out` (2): the leg swings **out over the nose**. Wrong way: fix as above.
2. Time a full swing from stowed to the ground with the stopwatch: **kick swing =** ____ **s**. It must be well under 15 s (the auto limit). Hold `kick back` (@) until it stows and stops by itself: **kick stall =** ____ **mA**.
3. **Kick free =** ____ **mA** while swinging.
4. Note: a hold is capped at 8 s. A swing longer than that needs two holds (release, press again).

Step 6. Foot (DRV#2 B)

1. Hold `foot in` (4): the foot auger turns the way that screws in. Wrong way: fix as above.
2. **Foot free =** ____ **mA** (expect about 40). Brake it by holding the coupler with pliers, or press a printed stick against the auger (never a cloth or fingers): **foot stall =** ____ **mA** (expect 500 to 600).
3. Hold `foot out` ($): it reverses.

Step 7. BNO085 axes (for the Jetson flight analysis)

1. Lay the dart flat, belly down. Open `http://192.168.4.1/flightlog` and look at the last sample: `ax, ay, az`. The axis reading about +9.8 points **up**.
2. Stand the dart on its tail, nose up: the axis reading about +9.8 points to the **nose**.
3. Lay it on its right side (kick side up): the axis reading +9.8 points **left**.
4. Write: **nose =** ___ **(e.g. +x), left =** ___**, up =** ___. The Jetson flight analysis needs this mapping.

Step 8. Flight log (safe, log only)

1. Open `http://192.168.4.1/arm?on=1&auto=0` (arm, log only: no motors will run). Status shows `ARMED`.
2. Hold the dart over the towel on the floor. Jerk it sharply upwards and let go about 40 cm above the towel.
3. Status should go `FLIGHT` then `LANDED` (or stay `ARMED` if the jerk was under 4 g: jerk harder).
4. Wait until the status shows `LANDED`, then 4 s more (if the towel landing ends as `timeout` that is about 18 s after the jerk; `/flightlog` is refused while armed or in flight). Open `http://192.168.4.1/flightlog`: `frozen: true`, `t_launch_ms` and `t_land_ms` set, a few hundred samples. Save it. The towel drop usually reads `landing: "timeout"` or `"still"` (soft), which is correct.
5. Open `http://192.168.4.1/stop` to disarm.

Safe to touch, after any arm or auto test: press STOP, check the status shows `IDLE` (not `ARMED`, `FLIGHT` or `ANCHORING`), pull the power loop plug (or unplug the bench LiPo), and only then pick the dart up or touch a leg. An armed dart can start the auto sequence by itself after a knock.

Step 9. Anchor and release on soil (assembled, hull open)

1. Legs stowed. Lay the dart on the damp soil, belly down, nose clear of the tray wall.

2. Page: press AUTO anchor. Watch the status: kick swing, foot touches, kick + foot planting, foot finishing, deploy + drills, drills finishing, ANCHORED. Write the time of each event from the event lines on the web page (not the Serial Monitor: no USB while the battery is in). Note the working currents for loadMa.
3. Pull the tether gently by hand: the dart should hold.
4. Press RELEASE: drills out, pods up, foot out, kick back, released. The legs end stowed. Before lifting the dart out of the soil: STOP, status IDLE, plug out (the "safe to touch" rule in step 8).
5. If it stops with FAULT: write down the fault and the last event, press STOP, and fix the threshold (step 10).

Step 10. Write the real thresholds

In kedge_logic.h, struct Tuning, set (all at full speed 255, battery fully charged):

Setting	Rule	Default
stallMa[DEPLOY]	80 % of deploy stall	150
stallMa[KICK]	80 % of kick stall	150
stallMa[DRILLS]	85 % of drill pair stall	600
stallMa[FOOT]	80 % of foot stall	450
kickContactMa	about 2 x kick free, below kick stall / 2	60
freeMa[...]	measured free currents (steps 3 to 6)	30, 30, 70, 45
loadMa[...]	typical working current in soil (step 9)	40, 70, 420, 130
impactG	under the peak_g of a real landing (step 8 and the first shots), over 2 g	3.5
kickMaxMs	2 x kick swing time, at least 8000	15000

Re-run test/run_tests.sh, upload, repeat steps 3, 5 and 6 and step 9 once to see the stops still work.

Step 11. Jetson link (after the Jetson is set up)

From the Jetson on KEDGE: python3 -m grappstar dart status (the jetson package). Phase IDLE, fields present. Or simply curl http://192.168.4.1/status.

Step 12. Close the hull

1. **Battery unplugged.**
2. Route the wires: drill wires with a 30 mm loop at each flank hole for the pod swing; the foot pair with a 60 mm loop round the kick hub; nothing crossing a hinge; nothing pinched by the hull halves. The DRV#3 pocket stays empty.
3. Close the hull, insert the plug, and repeat steps 3, 5 and 6 (one swing each way) to make sure no wire catches.
4. Camera (after the RC832 is set up): switch on the RC832 and check the picture.

Bring back: the numbers from steps 1 to 7 and 9. They go into Tuning and the REPORT.

7. Electronics and wiring (base and rover)

Battery unplugged for every step in this section. Two documents, used in this order:

1. **Base electronics bay, on the bench** (7.2, `firmware/base/WIRING.md` section 7, Parts A to D): set the buck, wire the ESP32, BTS7960, DRV8833, sensors and contacts, run the meter checks, first power with the ESP32 on the Mac's USB. Then `firmware/base/BENCH_TEST.md`.
2. **The whole rover** (7.1, the system page): the XT60 Y harness, the fuses, the Jetson and video, and the first power-on of everything together (its part 4). Do this once the base is assembled and on the rover (order of work step 9), and again after any rewiring.

One-page printable pin sheets for the bench: `docs/build/Wiring_Cheat_Sheet_Base.pdf` (base ESP32-S3) and `docs/build/Wiring_Cheat_Sheet_Dart.pdf` (dart XIAO).

When you reach WIRING.md Part B step 12 (buck input), put a 2 A inline fuse in the IN+ wire right at the B+ screw (system page, run P4).

Where the two differ, the system page adds the rover parts (Y harness, 2 A and 1 A tap fuses, Jetson, RC832); the ESP32 pins always come from WIRING.md.

7.1 The whole system

From `docs/build/SYSTEM_ELECTRICAL.md`*:*

GrappStar system electrical (rover, base and dart)

Diagram: `system_electrical.svg` / `system_electrical.png` (source `system_electrical.dot`). The ESP32 pin table is owned by `firmware/base/WIRING.md` and `firmware/base/grappstar_base/pins.h`; this page shows how the whole rover is powered and connected. If this page and WIRING.md ever disagree on a pin, WIRING.md wins. Decision D9: the DRV8833 #3 SLP pin is NOT wired (GPIO21 is now the SW_HOME contact, decision D27).

1. What is on the rover

Block	Part	Powered from
Battery	Zeee 3S LiPo 5200 mAh, XT60 (9.9 V empty in use, 11.1 V nominal, 12.6 V full)	
Wiper branch	XT60 lead #2 with the 20 A fuse, BTS7960 module, 12 V wiper motor (red and black only; never wire the green park wire, it may switch +12 V: tape it off)	LiPo
Drum branch	MP1584 #2 buck set to 9.0 V, DRV8833 #3 (the one freed from the dart), selector drum N20 worm	BTS7960 B+ / B- terminals, after the 20 A fuse
Base brain	ESP32-S3 DevKitC-1-N8	Jetson USB (the port marked USB, not UART)
Sensors on the ESP32	Adafruit AS5600 (STEMMA QT, I2C 0x36), printed contacts (M3 screw head on an M3 nut), optional HX711 + 100 kg load cell, battery divider	ESP32 3V3
Jetson	Orin Nano Super dev kit	XT60 lead #1 (10 A fuse) to a 5.5 x 2.5 mm barrel pigtail
Video in	Lockmaner RC832 5.8 GHz receiver, AV (yellow RCA) out to the DIGITNOW USB capture, which plugs into the Jetson	XT60 lead #1 branch (12 V class input)
Rover camera	Razer Kiyo X	Jetson USB
Dart	KEDGE: XIAO ESP32S3, 2 x DRV8833, INA219, BNO085, Caddx Ant, Zeus VTX	its own 2S 18350 pack. No wire to the rover: the tether is Dyneema and carries no power

2. Power tree

```
3S LiPo (XT60)
  -> XT60 Y harness (one male in, two female out; made from your spare XT60s, 14 AWG)
       -> lead #2, 20 A fuse, 14 AWG -> BTS7960 B+ / B-  -> wiper motor (BTS7960 M+ / M-, 14 AWG)
                                     \-> 2 A inline fuse, 22 AWG from the B+ / B- screws -> MP1584 #2 IN (
  9.0 V out)
                                                 -> DRV8833 #3 VM / GND -> drum N20 (AOUT1 / AOUT2)
       -> lead #1, 10 A fuse, 18 AWG -> barrel pigtail -> Jetson DC jack
                                     \-> 1 A inline fuse, 22 AWG -> RC832 power in
Jetson USB -> ESP32-S3 DevKitC (5 V from USB; the board makes its own 3V3)
                ESP32 3V3 -> BTS7960 VCC, AS5600, HX711 (DRV8833 #3 gets only AIN1, AIN2, GND)
Jetson USB -> DIGITNOW capture <- RC832 AV out
Jetson USB -> Kiyo X
```

Why it is laid out this way:

- The DRV8833 motor supply (VM) is 10.8 V maximum. The LiPo is 12.6 V full, so the drum N20 runs from MP1584 #2 set to 9.0 V. MP1584 #2 is the spare from the dart build (it was the 8.0 V bench supply there, 8.0 to 8.12 V): reset it to 9.0 V after the dart bench test.
- The buck taps the BTS7960 screw terminals, so both motor branches sit behind the 20 A fuse and the Jetson branch stays separate. A wiper stall that blows the 20 A fuse does not reboot the Jetson.
- The thin taps (MP1584 input, RC832) each get their own small inline fuse (2 A and 1 A) right at the tap. A 22 AWG wire behind only the 20 A or 10 A fuse would burn before that fuse blew if it shorted.
- The ESP32 takes power only from USB. It never connects to the LiPo directly. Its ground meets battery minus through the BTS7960 and DRV8833 GND wires (needed so the logic signals have a reference). There is a second ground path through USB, the Jetson and its barrel lead, so if the BTS7960 B- screw came loose the wiper current would try to return through the thin GND jumper and the USB cable. Keep the B- screw tight (tug test) and never run the wiper with B- disconnected.
- The wiper and the Jetson share the pack. A wiper stall (about 18 A) makes the pack voltage sag; with a low pack that sag can brown out the Jetson. Charge the pack when it reads 3.6 V per cell at rest (10.8 V).

3. Wires and connectors

Run	From	To	Gauge	Connector	Note
P1	LiPo	Y harness	14 AWG	XT60	Make the Y from spare XT60s; solder, heat shrink each joint. This short run is the only unfused part: keep the Y's legs under 10 cm so both fuses sit right at the split, sleeve it, and strap it so it cannot rub
P2	Y harness	BTS7960 B+ / B-	14 AWG	XT60 lead #2 (20 A fuse), screw terminals at the BTS7960	Red to B+, black to B-. 10 A blew on wiper inrush before: keep 20 A
P3	BTS7960 M+ / M-	wiper motor	14 AWG	screw terminals; spade or solder at the motor	Red wire (+) and black (-) of the rebuilt 2-wire motor
P4	BTS7960 B+ / B-	MP1584 #2 IN+ / IN-	22 AWG	under the same screws, 2 A inline fuse in the + wire right at the screw	Set 9.0 V with nothing on the output first
P5	MP1584 #2 OUT+ / OUT-	DRV8833 #3 VM / GND	22 AWG	solder	Check 9.0 V on the meter before you connect
P6	DRV8833 #3 AOUT1 / AOUT2	drum N20	26 AWG	solder or JST	Swap the pair if the drum turns the wrong way (see calibration)
P7	Y harness	Jetson DC jack	18 AWG	XT60 lead #1 (10 A fuse), 5.5 x 2.5 mm barrel plug (same as the plug on the Jetson supply), centre positive	Check polarity with the meter before the first plug-in
P8	lead #1 (after the fuse)	RC832 power in	22 AWG	the RC832 power lead, 1 A inline fuse in the + wire at the tap	Read the RC832 label for its input range first (see MEASURE_LIST)
S1	Jetson USB-A	ESP32-S3 USB port (native, marked USB)		USB-C or micro-USB cable to suit the board	Data cable, not charge-only
S2	Jetson USB-A	DIGITNOW capture		its own USB plug	
S3	RC832 AV out	DIGITNOW video in		yellow RCA	Video only; audio not used
S4	Jetson USB-A	Kiyo X		its own USB plug	
L1	ESP32 pins	BTS7960 RPWM, LPWM, R_EN, L_EN, IS, VCC, GND	26 to 28 AWG	Dupont jumpers	Pins in firmware/base/WIRING.md
L2	ESP32 pins	DRV8833 #3 AIN1, AIN2, GND	26 to 28 AWG	Dupont	SLP / nSLEEP is not wired: the board pulls it high, and its inputs are pulled low so the outputs are off until the ESP32 drives them
L3	ESP32 SDA / SCL / 3V3 / GND	AS5600		STEMMA QT to Dupont cable (400 mm or longer)	Magnet 1 to 2 mm from the chip
L4	ESP32 pins	each printed contact (names: BASE_SPEC section 4; GPIO for each: WIRING.md)	26 AWG twisted pair	Dupont at the ESP32, M3 ring or solder at the contact	One wire to the pin, the other to GND
L5	ESP32 pins	HX711 DT, SCK, VCC, GND (optional)	26 AWG	Dupont	Load cell 4 wires into HX711 E+, E-, A+, A-

Run	From	To	Gauge	Connector	Note
L6	BTS7960 B+	ESP32 battery pin through the 100 k / 22 k divider	26 AWG	solder the 100 k resistor right at the B+ screw (in heat shrink), so the long wire only carries the divided voltage; the 22 k goes from the pin to GND at the ESP32	12.6 V reads 2.27 V at the pin

Gauges assume runs under 0.5 m. 14 AWG carries the 18 A wiper stall; 18 AWG is fine for the Jetson (about 2.5 A at 10 V); 22 AWG is fine for the drum branch (N20 stall about 0.2 A) and the RC832 (about 0.2 A).

4. First power-on sequence (do it in this order, once, after any rewiring)

Before you start: the pull-down and divider resistors are fitted as in firmware/base/WIRING.md (10 k from R_EN to GND, 10 k from L_EN to GND, the IS divider, the battery divider). Both motors are disconnected from their drivers for this first power-on, and the DRV8833 VM wire (P5) is soldered to the DRV8833 but NOT yet to MP1584 #2 OUT (tape its free end). If the base electronics already passed firmware/base/WIRING.md Part D on the bench (the normal order of work), the buck is already set and the motors may stay connected (nothing moves without a command): in step 5 only check the buck reads 9.0 V (do not turn the screw), and skip steps 6 and

10. If the Jetson is still on its wall supply: in step 7 skip the barrel plug (plug only the ESP32 USB into the

Jetson, battery out), and in step 8 expect only the RC832 and ESP32 LEDs. Multimeter ready.

1. Battery unplugged. Jetson barrel plug and ESP32 USB cable unplugged. Pull both fuses (20 A and 10 A) and both small inline fuses.
2. Battery unplugged. Meter on beep, check for shorts: the two pins of the Y harness male XT60; red to black at the BTS7960 B+ / B-; at MP1584 #2 IN and OUT; at DRV8833 VM / GND; at the barrel plug; at the RC832 lead. Nothing may beep steadily. A short chirp that stops is a capacitor charging, not a short. A steady beep is a short: find it before going on.
3. Battery unplugged. Look at the wiring: only three DRV8833 #3 pins go to the ESP32 (AIN1, AIN2, GND). Its SLP / nSLEEP / EEP pad is NOT wired: the board holds it high by itself. Check no wire is on SLP, VM or VCC going to the ESP32.
4. Battery unplugged. Meter on DC volts on the LiPo balance lead: each cell 3.7 to 4.2 V.
5. Battery unplugged. Fit the 20 A fuse and the 2 A inline fuse. Plug the battery in. Meter on DC volts:
   - BTS7960 B+ (red probe) to B- (black probe): battery voltage, positive. Negative means reversed: unplug at once.
   - MP1584 #2 IN+ to IN-: battery voltage, positive.
   - MP1584 #2 OUT: turn the brass screw until it reads 9.0 V.
6. Unplug the battery. Connect the DRV8833 VM wire (P5) to MP1584 #2 OUT.
7. Battery unplugged. Fit the 10 A fuse and the 1 A inline fuse. Plug the battery in. Meter on the barrel plug (not in the Jetson yet): centre pin positive, battery voltage. Unplug the battery. Push the barrel into the Jetson and plug the ESP32 USB cable into the Jetson (USB cables in first, battery last).
8. Plug the battery in: the Jetson boots (green LED), the RC832 lights, and the ESP32 power LED lights once the Jetson is up.
9. On the Jetson, in `~/GrappStar/jetson`: `python3 -m grappstar base ping` (expect `"ok": true`), then `python3 -m grappstar base monitor`. Check `vbat` in telemetry matches the meter within 0.3 V.
10. Unplug the battery. Connect the motors (wiper to BTS7960 M+ / M-, drum N20 to AOUT1 / AOUT2). Check the B- screw is tight. Plug the battery in. Nothing moves until a command is sent (a mode change may turn the wiper a few degrees to free the dogs: that is a command too).


Emergency stop: send `estop`. If that does not stop it, pull lead #2's XT60 (or its 20 A fuse): that kills both motors and leaves the Jetson running. Pull the main battery plug only if that is not enough.

Shut-down order (every time): `estop`, then `sudo shutdown now` on the Jetson and wait for its LED to go off, then unplug the battery.

5. Rules

- Battery unplugged before you touch, add or move any wire, or fit a fuse. This killed the first XIAO.
- Battery unplugged before you plug the ESP32 into the Mac. Flash from the Mac with the ESP32 out of the rover harness, or flash from the Jetson (firmware/base/README.md).
- Charge the LiPo at 3.6 V per cell at rest (10.8 V). Never run it below 3.3 V per cell under load (9.9 V); the firmware reports `vbat`.

- Never connect the DRV8833 VM to the LiPo directly (10.8 V maximum; the LiPo is 12.6 V full).
- Never put 3V3 on a DRV8833 pad called VIN, VCC or VM: on these carriers that is the motor supply. On the base, the DRV8833 SLP / nSLEEP / EEP pad is left unwired.
- Dart: power loop plug out whenever a wire moves or USB is plugged in (the dart run sheet rule).
- The VTX on the dart must have its antenna on before it is powered.

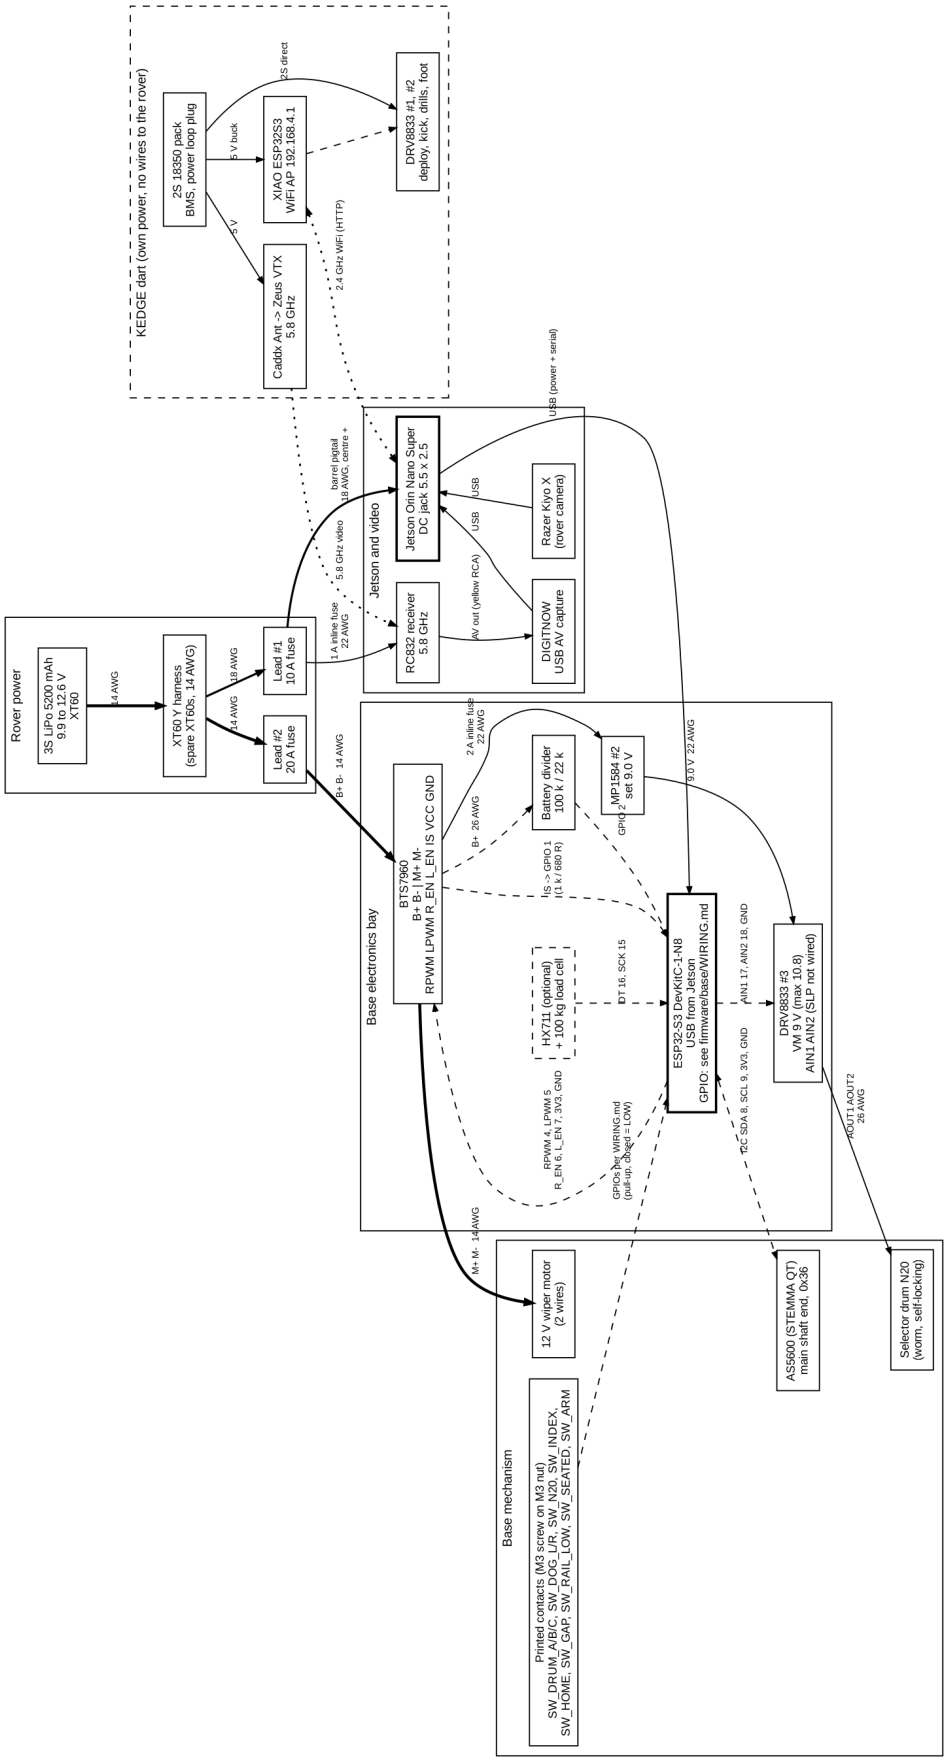

Whole system electrical diagram (bold = battery power, dashed = signal, dotted = radio)

7.2 Base ESP32 wiring (pin by pin)

From `firmware/base/WIRING.md`*:*

Base station wiring

Board: ESP32-S3 DevKitC-1-N8. Pins come from `grappstar_base/pins.h`. Nothing here has been wired and tested on real hardware yet: check every step with the multimeter.

The rule: battery unplugged whenever a wire or plug moves. Plug the battery in last, after the checks. Never pull a plug while the battery is in.

1. Pin table

GPIO	Name in pins.h	Connects to	Note
4	`PIN_RPWM`	BTS7960 RPWM	wiper FORWARD (dir 1), PWM 20 kHz
5	`PIN_LPWM`	BTS7960 LPWM	wiper BACKWARD (dir -1), PWM 20 kHz
6	`PIN_REN`	BTS7960 R_EN	plus 10 k from R_EN to GND
7	`PIN_LEN`	BTS7960 L_EN	plus 10 k from L_EN to GND
1	`PIN_WIPER_IS`	BTS7960 R_IS + L_IS through 1 k	plus 680 R from GPIO1 to GND (the IS divider)
2	`PIN_VBAT`	battery divider middle	100 k from 3S + (fused side) to GPIO2, 22 k from GPIO2 to GND
8	`PIN_SDA`	AS5600 SDA	STEMMA QT blue wire
9	`PIN_SCL`	AS5600 SCL	STEMMA QT yellow wire
15	`PIN_DRUM_IN1`	DRV8833 AIN1	drum N20
16	`PIN_DRUM_IN2`	DRV8833 AIN2	drum N20
10	`PIN_SW_A`	contact `SW_DRUM_A`	drum code bit A
11	`PIN_SW_B`	contact `SW_DRUM_B`	drum code bit B
12	`PIN_SW_C`	contact `SW_DRUM_C`	drum code bit C
13	`PIN_SW_D`	contact `SW_DOG_L`	collar engaged in LAUNCH
14	`PIN_SW_E`	contact `SW_DOG_R`	collar engaged in REEL
47	`PIN_SW_F`	contact `SW_N20`	drum N20 in mesh (open = hand lever latched out)
21	`PIN_SW_G`	contact `SW_HOME`	carriage on its front stop (uncocked)
39	`PIN_SW_H`	contact `SW_GAP`	big gear in its toothless gap (rest)
40	`PIN_SW_I`	contact `SW_RAIL_LOW`	rail at its lowest pitch (aim home)
41	`PIN_SW_J`	contact `SW_SEATED`	dart tail on the pusher
42	`PIN_SW_K`	contact `SW_ARM`	wrap cup ring at home (one pulse per cup turn)
35	`PIN_SW_L`	contact `SW_INDEX`	only on a build without the AS5600 magnet (decision D12). Leave open otherwise
17	`PIN_HX_DT`	HX711 DT (DOUT)	optional load cell
18	`PIN_HX_SCK`	HX711 SCK	optional load cell
3V3		AS5600 VIN, BTS7960 VCC, HX711 VCC	logic supply
GND		common ground (see section 2)	

The DRV8833 SLP pin is **not wired** (decision D9: the Pololu board pulls it high by itself). Its FLT pin is not used either.

Which contact goes on which pin comes from `swBit` in `config.h`. Default: the order above, `SW_DRUM_A` on `PIN_SW_A` through `SW_ARM` on `PIN_SW_K`. `SW_INDEX` is switched off in `config.h` unless the build has no magnet.

Pins the firmware avoids on purpose: 0, 3, 45, 46 (boot strapping), 19 and 20 (the USB port), 26 to 32 (flash), 43 and 44 (UART), 38 and 48 (the RGB LED). `params.py` suggested GPIO38 for `SW_HOME`; that is the RGB LED on newer boards, so `SW_HOME` is on GPIO21 instead.

2. Power

```
3S LiPo + --> 20 A fuse (XT60 lead #2) --> BTS7960 B+ --+--> 1 to 2 A fuse --> MP1584 IN+   (buck, set
  to 9.0 V first)
                                                         +--> 100 k --> GPIO2 --> 22 k --> GND
3S LiPo - ----------------------------------------> BTS7960 B- --> MP1584 IN-

MP1584 OUT+ (9.0 V) --> DRV8833 VM (Pololu labels it VIN)
MP1584 OUT-         --> DRV8833 GND

BTS7960 M+ / M-  --> wiper motor red / black (never the green park switch wire)
```

```
DRV8833 AOUT1 / AOUT2 --> drum N20 motor
ESP32 power: USB from the Jetson (from the Mac on the bench)
```

- **Wiper:** 3S LiPo, then the 20 A fuse, then BTS7960 B+ and B-. Use thick wire (14 AWG) on B+, B-, M+ and M-. Never wire the wiper's green park switch wire.
- **Drum N20:** through the MP1584 buck set to **9.0 V**. The DRV8833 VM maximum is 10.8 V and a full 3S is 12.6 V, so **never connect the 3S straight to the DRV8833.** Set the buck to 9.0 V BEFORE its output touches the DRV8833 (Part A below). Take the buck input from the BTS7960 B+ and B- terminals, so it sits behind the main fuse.
- **Small fuse (recommended):** a 1 to 2 A fuse in the buck IN+ lead. A short in the buck or the DRV8833 then blows this little fuse instead of burning thin wires on the way to the 20 A fuse.
- **You may need a spare MP1584.** Both of yours are in the dart (one at 8.12 V, one at 5.04 V). Buy another one, or borrow one from the dart for the bench. 8 to 9 V works for the N20; 9.0 V is the target.
- **ESP32:** powered over USB from the Jetson (on the bench: from the Mac). Never connect the battery to the ESP32 5V or 3V3 pins.
- **Common ground:** ESP32 GND, BTS7960 GND (logic header), DRV8833 GND and MP1584 OUT- must all be joined. Without a common ground the control signals mean nothing.
- **Battery divider:** 100 k from the fused 3S + to GPIO2, 22 k from GPIO2 to GND. 12.6 V reads 2.27 V on the pin. It feeds `vbat` in telemetry and the battery checks (`NO_POWER` under 6 V, `BROWNOUT` under 9.9 V while a motor runs). With the battery unplugged `vbat` reads about 0. Optional: a 100 nF capacitor from GPIO2 to GND steadies the reading. If you leave the divider out, send `{"id":1,"cmd":"set","key":"vbat_wired","val":false}` (then `vbat` is `null` and there is no battery check).

3. BTS7960 details

- **10 k pull-downs on R_EN and L_EN.** While the ESP32 resets or is being flashed its pins float, and a floating enable pin can let the motor twitch. With 10 k to GND the BTS7960 stays off until the firmware drives R_EN and L_EN high. Solder each resistor between the EN pin and a GND pin on the BTS7960 header.
- **VCC** to ESP32 3V3, **GND** to ESP32 GND.
- **IS divider:** tie R_IS and L_IS together. From there a 1 k resistor to GPIO1. From GPIO1 a 680 R resistor to GND. The BTS7960 IS pin gives a small current: motor amps divided by 8500. At 20 A that is 2.35 mA, and 2.35 mA through the 680 R gives about 1.6 V at GPIO1, well under 3.3 V. So `amps_per_volt` = 8500 / 680 = 12.5 (the default).
- **Optional:** a 1 uF to 2.2 uF capacitor from GPIO1 to GND smooths the PWM pulses on the IS signal. Only if you have one. Ceramic is best; with an electrolytic the striped leg goes to GND.
- **Check for an onboard IS resistor first.** With everything unpowered, tie R_IS and L_IS together and put the meter (ohms) between that point and GND. Open (no reading) means no onboard resistor: the default scale 12.5 is right. If it reads a resistance Rb, write it down. The scale changes:

`Rx = 1680 in parallel with Rb`, then `amps_per_volt = 8500 x 1680 / (Rx x 680)`.

No onboard resistor gives 12.5. Two onboard 1 k gives about 54.5. Set it with `{"id":1,"cmd":"set","key":"amps_per_volt","val":54.5}` (your number), then calibrate it (CALIBRATION.md).

4. DRV8833 details

- VM (Pololu: VIN) from the buck OUT+ at 9.0 V. GND to the buck OUT- and to the ESP32 GND.
- AIN1 to GPIO15, AIN2 to GPIO16, AOUT1 and AOUT2 to the drum N20. Only channel A is used. Leave BIN1, BIN2, BOUT1, BOUT2 open.
- **SLP: leave it unconnected** (decision D9). The board pulls it high itself, so the driver is always awake. The DRV8833 chip has pull-downs on its AIN inputs, so the motor stays off while the ESP32 boots.
- FLT: leave it unconnected.
- Never put 3V3 on a pad that is the motor supply. Meter check (unpowered): if a pad beeps to VM, it is the motor supply.
- If the drum turns the wrong way, swap the two N20 wires at AOUT1 and AOUT2 (battery unplugged). CALIBRATION.md step (c) says how to tell.

5. Contact switches

Each printed contact is an M3 screw head touching an M3 nut.

- One side of each contact to its GPIO, the other side to GND.

- The ESP32 uses its internal pull-up. Closed = LOW = shown as closed in telemetry.
- No resistors needed. All the GND sides may share one GND wire.

Contact	Pin	GPIO	Telemetry `sw` key
`SW_DRUM_A`	`PIN_SW_A`	10	`a`
`SW_DRUM_B`	`PIN_SW_B`	11	`b`
`SW_DRUM_C`	`PIN_SW_C`	12	`c`
`SW_DOG_L`	`PIN_SW_D`	13	`l`
`SW_DOG_R`	`PIN_SW_E`	14	`r`
`SW_N20`	`PIN_SW_F`	47	`n`
`SW_HOME`	`PIN_SW_G`	21	`H`
`SW_GAP`	`PIN_SW_H`	39	`G`
`SW_RAIL_LOW`	`PIN_SW_I`	40	`L`
`SW_SEATED`	`PIN_SW_J`	41	`S`
`SW_ARM`	`PIN_SW_K`	42	`W`
`SW_INDEX`	`PIN_SW_L`	35	`I` (only shows when switched on in `config.h`)

The three drum code contacts read the drum position as a code (BENCH_TEST.md step 2 has the table). All three open (code 000) never happens on a working drum: the firmware treats it as a wire off and faults (`DRUM_SENSOR`).

On the bench, before the drum is built, use two jumper wires:

- GPIO11 to GND: code "b only" = NEUTRAL.
- GPIO47 to GND: `SW_N20` closed. Without it the firmware thinks the hand lever is latched out and refuses every drum move (`HAND_MODE`).

6. AS5600 and HX711

- **AS5600** (Adafruit STEMMA QT): use a STEMMA QT cable. Red to 3V3, black to GND, blue (SDA) to GPIO8, yellow (SCL) to GPIO9. DIR pad to GND (fixed count direction).
- **Magnet:** the Adafruit board comes without one. Any small neodymium disc edge-on (6 to 10 mm) or a 6 x 2.5 mm diametric disc in the magnet cap on the main shaft end, **1 to 3 mm from the chip, centred** on it.
- **HX711** (optional): VCC to 3V3, GND to GND, DT to GPIO17, SCK to GPIO18. Load cell wires to E+, E-, A+, A- as printed on the HX711 board. The firmware finds it at boot (`"hx711":true` in the `HELLO` line).

7. Build order, step by step

You need: multimeter, the 20 A fuse lead (XT60 lead #2), a 1 to 2 A inline fuse for the buck, 2 x 10 k, 1 k, 680 R, 100 k, 22 k, optionally a 1 uF to 2.2 uF and a 100 nF capacitor, an insulated small screwdriver for the buck.

Part A: set the buck (on its own, before the build)

The buck must be set to 9.0 V before it ever touches the DRV8833. This is done with the buck on its own: nothing else is wired to it.

1. Battery unplugged. Solder short input leads to the MP1584: red to IN+ (with the 1 to 2 A fuse in it), black to IN-. Nothing on the output.
2. Battery unplugged. Connect the input leads to the fused side of the XT60 lead (red to +, black to -). Check with the meter (beep mode) that IN+ and IN- are not shorted.
3. Battery unplugged. Clip the meter probes onto OUT+ and OUT- (meter on DC volts), so you do not have to hold them.
4. Plug the battery in. Turn the little screw on the buck with the insulated screwdriver until the meter reads **9.0 V**. Turn slowly: many turns may be needed. Keep the screwdriver and probes off the other pads.
5. Battery unplugged: unplug it now, before anything else. Then disconnect the buck input leads from the XT60 lead. Mark the buck "9.0 V".

Part B: build

1. Battery unplugged. Solder the two 10 k pull-downs: R_EN to GND and L_EN to GND on the BTS7960 header.
2. Battery unplugged. Check the BTS7960 for an onboard IS resistor (section 3). Write the number down.
3. Battery unplugged. Wire the IS divider: R_IS and L_IS tied, 1 k to GPIO1, 680 R from GPIO1 to GND. Optional capacitor from GPIO1 to GND.
4. Battery unplugged. BTS7960 logic: RPWM GPIO4, LPWM GPIO5, R_EN GPIO6, L_EN GPIO7, VCC 3V3, GND to ESP32 GND.

5. Battery unplugged. Battery divider: 100 k from the BTS7960 B+ terminal to GPIO2, 22 k from GPIO2 to GND. Optional 100 nF from GPIO2 to GND.
6. Battery unplugged. AS5600: STEMMA QT cable to 3V3, GND, GPIO8 (SDA), GPIO9 (SCL). DIR to GND.
7. Battery unplugged. Contacts: one side to the GPIO from section 5, other side to GND. Contacts not built yet: put the two bench jumpers on (GPIO11 to GND, GPIO47 to GND, section 5).
8. Battery unplugged. HX711 if you have it: 3V3, GND, GPIO17 (DT), GPIO18 (SCK).
9. Battery unplugged. USB check with no power wiring yet: plug USB into the port labelled USB, open the Serial Monitor and do "First contact" in README.md. `status` must show `"magnet":"OK"`. Close each contact and watch telemetry `sw` (BENCH_TEST.md step 2). Unplug USB.
10. Battery unplugged. DRV8833: AIN1 GPIO15, AIN2 GPIO16, GND to ESP32 GND. SLP and FLT stay unconnected. AOUT1 and AOUT2 to the drum N20.
11. Battery unplugged. Buck output (already set to 9.0 V in Part A): OUT+ to DRV8833 VM, OUT- to DRV8833 GND.
12. Battery unplugged. Buck input: IN+ (through its 1 to 2 A fuse) to BTS7960 B+, IN- to BTS7960 B-.
13. Battery unplugged. Power: fused XT60 lead + to BTS7960 B+, - to B-. Use 14 AWG. The 20 A fuse in the + lead.
14. Battery unplugged. Wiper motor to M+ and M- (red to M+, black to M-). On the bench the motor is clamped and has nothing attached (BENCH_TEST.md).
15. Battery unplugged. Ground: check ESP32 GND, BTS7960 GND, DRV8833 GND and buck OUT- are all joined.

Part C: checks with the multimeter (still unplugged)

16. Battery unplugged. Beep mode: **B+ to B- must NOT beep.** A very short chirp is fine (capacitors on the boards charging from the meter). A steady beep is a short: stop and find it.
17. Battery unplugged. Beep mode: buck OUT+ to OUT- must not beep. DRV8833 VM to GND must not beep.
18. Battery unplugged. Beep mode: ESP32 GND to BTS7960 GND, DRV8833 GND and buck OUT- must beep (common ground).
19. Battery unplugged. Beep mode: ESP32 3V3 to GND must not beep (a short chirp is fine). 3V3 must not beep to B+ or to DRV8833 VM.
20. Battery unplugged. Ohms: GPIO2 to GND about 22 k (a bit less is fine). R_EN to GND and L_EN to GND about 10 k.
21. Battery unplugged. Check every motor and power screw terminal is tight and no bare strand touches its neighbour.

Part D: first power

22. Battery unplugged. Plug USB in first. The Serial Monitor shows telemetry with `"state":"IDLE"`.
23. Plug the battery in, last. Nothing should move.
24. Measure the buck output again: 9.0 V. Measure the battery at the XT60 and compare with `vbat` in telemetry.
25. If anything is hot, smells or a motor moves on its own: unplug the battery at once.
26. Go on with BENCH_TEST.md.

8. Flashing both ESP32s

Rules for both boards: battery unplugged (dart: power loop plug out) before the USB cable goes in. Use a data USB cable. Flash the dart XIAO before it goes into the hull (run sheet section 5).

8.1 Base: ESP32-S3 DevKitC-1-N8

From `firmware/base/README.md`*:*

GrappStar base station firmware

Firmware `base-1.0` for the ESP32-S3 DevKitC-1-N8 in the base station. It follows BASE_SPEC v1.0 and the mission sequence in `base/spec/panel/B_reliable.md` sections 7.1 to 7.4.

Nothing in this folder has run on real hardware yet. The logic passes the PC tests (a simulation). Go slowly the first time and follow BENCH_TEST.md before the wiper motor goes into the base.

What it does

One wiper motor (BTS7960 driver, AS5600 angle sensor) drives everything: launch, aim, take-up and reel. A small N20 motor (DRV8833 driver) turns the selector drum. The drum slides the dog collar and runs the wrap cup. Its order is LAUNCH, NEUTRAL, WRAP, REEL:

- LAUNCH: the collar drives the launcher.
- NEUTRAL: the collar drives nothing. Forward wiper turns only drive the take-up (it winds slack onto the storage reel through a slip clutch).
- WRAP: the collar stays in NEUTRAL while the cup lays 7 turns of line on the capstan.
- REEL: the collar drives the capstan. REEL is only reached with the wraps on.

Printed contact switches (12 of them) tell the firmware where everything is.

Wiper direction	LAUNCH	NEUTRAL and WRAP	REEL
FORWARD (`dir` 1, RPWM)	cocks, fires and resets the launcher	take-up only, at most 40 % power	winds the capstan
BACKWARD (`dir` -1, LPWM)	aims (turns the rail pitch)	turns nothing	refused (`BACKSTOP`): sprag #2 holds the capstan

The Jetson sends commands over USB as JSON lines. The base answers every command, sends telemetry 10 times a second (20 while something moves) and sends an event when an action ends. Full details: PROTOCOL.md.

A mission in short: `mode LAUNCH`, `aim`, (`cock`), `arm`, `fire`, `mode NEUTRAL`, tidy (`reel until slip`), `wrap`, tow (`reel until tension`), reel in, `unwrap`, final approach (`reel until seated`), `mode LAUNCH`.

Files

File	What
`grappstar_base/grappstar_base.ino`	the sketch: hardware glue (pins, USB, AS5600, HX711, flash). Open this one in the Arduino IDE
`grappstar_base/pins.h`	every GPIO pin
`grappstar_base/config.h`	defaults, contact list, drum sectors, current trips
`grappstar_base/base_logic.h`	all the logic: commands, states, faults, telemetry
`grappstar_base/drives.h`	wiper and drum motor drive (soft start, reverse pause, current trip, stall)
`grappstar_base/sensors.h`	contact debounce, AS5600 angle tracking
`grappstar_base/persist.h`	what is saved in flash
`grappstar_base/json_lite.h`	small JSON reader and writer
`grappstar_base/params_gen.h`	GENERATED from `base/spec/params.py`. Do not edit
`tools/gen_params.py`	makes `params_gen.h`
`test/run_tests.sh`	builds and runs the PC tests
`PROTOCOL.md`	every command, reply, event, setting and fault code
`WIRING.md`	pin table, power, step by step build
`BENCH_TEST.md`	first checks on the bench, before the motor goes into the base
`CALIBRATION.md`	direction, current, drum, aim and tension calibration

Arduino IDE setup (Mac)

1. Install the Arduino IDE 2 from arduino.cc if you do not have it.

2. Arduino IDE > Settings. In "Additional boards manager URLs" add `https://espressif.github.io/arduino-esp32/package_esp32_index.json` (skip if it is already there).
3. Tools > Board > Boards Manager. Search `esp32`. Install **esp32 by Espressif Systems**, version **3.3.12**. The sketch is written for the 3.x versions; 2.0.17 should also work (the sketch handles both) but is untested.
4. Tools > Manage Libraries. Search `HX711`. Install **HX711 by Rob Tillaart**. You need it even without a load cell (the sketch includes it and finds out at boot whether one is fitted).
5. File > Open: `firmware/base/grappstar_base/grappstar_base.ino`. All the `.h` files open as tabs next to it.
6. Tools menu, set:
   - Board: **ESP32S3 Dev Module**
   - USB CDC On Boot: **Enabled** (the sketch refuses to compile otherwise, on purpose)
   - USB Mode: **Hardware CDC and JTAG**
   - Flash Size: 8MB (the N8 board has 8 MB)
   - Leave the rest at the defaults.
7. Plug a USB cable into the DevKitC port labelled **USB** (the native USB port). This is the same port the Jetson uses. The other port is labelled UART: do not use it for this firmware. Note: the old ground station used the UART port. This one does not.
8. Tools > Port: pick the one called something like `/dev/cu.usbmodem...`.
9. Click Upload (the arrow). If the upload cannot connect: hold the BOOT button, tap RESET, release BOOT, then Upload again. After an upload done this way, tap RESET once.

First contact

1. Battery unplugged. USB only. If the contacts are not wired yet, put two jumper wires on the board first: GPIO11 to GND (makes the drum code read NEUTRAL) and GPIO47 to GND (says the drum N20 is in mesh). WIRING.md section 5 explains why. Without the GPIO11 jumper you get a harmless `FAULT DRUM_SENSOR` "drum code 000" a moment after start-up.
2. Tools > Serial Monitor. At the bottom right set the line ending to **Newline**. The baud rate does not matter (USB).
3. Tap RESET on the board. You should see a `HELLO` line, then a `BOOT` line, then telemetry lines:

```
 {"evt":"HELLO","fw":"base-1.0","reset":"POWERON","hx711":false,"as5600":true,"pwm":true}
 {"evt":"BOOT","t":60,"fw":"base-1.0","record":false,"was_moving":false,"drum_known":true,
"wraps_known":true,"aim_known":false,"phase":"UNKNOWN","angle":"AS5600"}
 {"tel":{"state":"IDLE","mode":"NEUTRAL","drum_deg":41,"drum_pos":"NEUTRAL",...,"sw":{"b":1,"n":1},
"fault":null,"vbat":0}}
```

The board waits only 1.5 s for the Serial Monitor at start-up, so you may miss `HELLO`. That is fine. With USB only, `vbat` reads about 0: that is normal. Motor commands are refused with `NO_POWER` until the battery is in.

4. Type this in the box at the top and press Enter:

```
{"id":1,"cmd":"ping"}
```

You should get `{"id":1,"ok":true,"fw":"base-1.0","t":...}` somewhere between the telemetry lines.

5. Telemetry scrolls fast. Untick "Autoscroll" to read a line, tick it again to follow.
6. Also try `{"id":2,"cmd":"status"}`. It shows `"magnet"`: `OK`, `WEAK`, `STRONG` or `NONE`.

Every command is one line of JSON with a `"cmd"`. The `"id"` is any whole number you like; the reply carries the same id (a number like 1.5 gives `BAD_ID`). A few examples (all in PROTOCOL.md):

```
{"id":3,"cmd":"jog","motor":"wiper","dir":1,"ms":500}
{"id":4,"cmd":"stop"}
{"id":5,"cmd":"get","key":"amps_per_volt"}
{"id":6,"cmd":"set","key":"limit_n","val":50}
{"id":7,"cmd":"clear"}
```

A refused command replies with `"ok":false` and an `"err"` code, and nothing moves.

PC tests

The logic is plain C++ and runs on a computer against a simulated base. On the Mac you need the command line tools once: `xcode-select --install` (gives g++ and `python3`). Then, from the repository folder:

```
sh firmware/base/test/run_tests.sh
```

It tests the params generator, then builds `test_base` (the mission and fault tests) and runs it, then the fuzz test (random commands and faults, checking that nothing unsafe ever happens). Look for `ALL PASS` and `fuzz: no`

`invariant violated`.

How spec numbers get into the firmware

The shared numbers live in `base/spec/params.py`. After that file changes, run:

```
python3 firmware/base/tools/gen_params.py
```

It rewrites `grappstar_base/params_gen.h`. Then upload again. Never edit `params_gen.h` by hand. If a value is missing in `params.py`, the firmware uses its own default from `config.h`, so the build never breaks.

Bench values (current scale, free current, N per amp, aim offset and so on) are not in `params.py`. You set them over USB with `set` or learn them with `cal` (see CALIBRATION.md). They are saved in flash and kept over a power cycle and over a new upload.

Safety summary

- Any fault: the wiper stops at once. Then the drum goes to NEUTRAL when that is safe, so the wiper turns nothing.
- The drum does NOT go to NEUTRAL, and holds where it is, when:
  - the launch spring may be drawn: there is no sear, only the wiper worm holds the spring, and a shift under that load could dry fire. Recover with `cal decock`;
  - wraps are on the capstan: the capstan holds the line. Recover with `unwrap`;
  - the drum itself faulted, its position or the wraps are unknown, or the N20 is latched out (hand mode).

It then sends a `MODE` event with `"err":"DRUM_HELD"` and a `"why"` that says which.

- `stop`: wiper off now, drum stops. `estop`: the same, then the drum goes to NEUTRAL when safe.
- Before every shift out of LAUNCH or REEL the wiper makes a small centering jog so the collar is not loaded.
- Soft start: the wiper ramps up over 300 ms (inrush once blew a 10 A fuse). It always stops for 200 ms before it changes direction.
- Current trips per job: 5 A (reel, tow), 6.5 A (cock, fire), 2.5 A (take-up), 3 A (jogs), each for 30 ms after a 50 ms start; 17 A at any time. Stall: the shaft slower than 12 deg/s for 200 ms while driving.
- AS5600 lost while the wiper runs: fault `ANGLE_SENSOR`. Without the AS5600 the wiper does not start.
- Battery below 9.9 V for 300 ms while a motor runs: fault `BROWNOUT`.
- Fire needs a fresh 6-digit token from `arm`, valid 3 s, used once, plus the dart seated.
- Both worm gears self-lock, so the mechanism stays where it stopped when the power goes. The position is saved in flash, and after a power cut mid-motion the base only trusts what its sensors can prove.
- After a fault, fix the cause, then send `{"id":1,"cmd":"clear"}`.

And the rule that matters most: **battery unplugged whenever a wire or plug moves.** Plug the battery in last, and never pull a plug while the battery is in.

8.2 Dart: XIAO ESP32S3

Arduino IDE: board XIAO_ESP32S3, Tools > USB CDC On Boot: Enabled (the sketch refuses to compile otherwise). Library: Adafruit BNO08x (the INA219 library is no longer needed). Open `firmware/dart/kedge_dart/kedge_dart.ino`. After the first USB upload you can upload over WiFi (port "kedge").

From `firmware/dart/README.md`*:*

KEDGE dart firmware v4

Firmware for the KEDGE dart: Seeed XIAO ESP32S3, two DRV8833 drivers (four motor channels), INA219 current sensor, BNO085 IMU. It anchors the dart after landing, releases it again, records the flight, and takes commands over WiFi.

File	What
`kedge_dart/kedge_dart.ino`	the sketch (hardware: pins, PWM, I2C, WiFi, web page, HTTP API)
`kedge_dart/kedge_logic.h`	all control logic (sequences, safety, flight detection, flight log), plain C++
`test/test_logic.cpp`, `test/run_tests.sh`	PC tests of the logic against a motor model and synthetic IMU traces
`API.md`	the HTTP API for the Jetson (contract C2)
`WIRING.md`, `wiring/`	wire cut list, change list from v29, diagram
`BENCH_TEST.md`	how to check every motor and sensor before closing the hull
`tools/wires_v4.py`	regenerates `wiring/`

File	What
`sim/`	host simulator: the real sketch compiled on Linux with stub Arduino headers, serving the real HTTP API (`make && python3 test_sim.py`)
`REPORT.md`	build-day report

Arduino IDE setup (once)

1. Install Arduino IDE 2 (arduino.cc).
2. File > Preferences > Additional boards manager URLs, add: `https://espressif.github.io/arduino-esp32/package_esp32_index.json`
3. Tools > Board > Boards Manager: search `esp32`, install **esp32 by Espressif Systems** (3.3.x tested; 2.0.17 also compiles).
4. Sketch > Include Library > Manage Libraries: install **Adafruit BNO08x** (say yes to its dependencies, Adafruit BusIO). The INA219 is read directly, so the Adafruit INA219 library is no longer needed (having it installed does no harm).
5. Open `firmware/dart/kedge_dart/kedge_dart.ino` (the folder name must stay `kedge_dart`; `kedge_logic.h` sits next to it and opens as a second tab).

Tested versions (3 Nov 2026, `arduino-cli compile --fqbn esp32:esp32:XIAO_ESP32S3 --warnings all`**)**

esp32 core	Result	Flash	RAM
3.3.12 (latest)	OK, no warnings from the sketch	1,011,135 B (30 %)	70,316 B (21 %)
3.3.2	OK, no warnings from the sketch	1,015,763 B (30 %)	68,344 B (20 %)
2.0.17	OK, no warnings from the sketch	801,985 B (23 %)	66,784 B (20 %)

Libraries: Adafruit BNO08x 1.2.7, Adafruit BusIO 1.17.4 (installed with it). arduino-cli 1.5.2. Note for arduino-cli users: on this board the menu value for "USB CDC On Boot: Enabled" is `CDCOnBoot=default` and `CDCOnBoot=cdc` means Disabled (the sketch then refuses to compile, on purpose).

Board settings

- Tools > Board > esp32 > **XIAO_ESP32S3**.
- Tools > **USB CDC On Boot: Enabled** (the default for this board). If it is Disabled, the sketch will not compile.
- Leave the rest at the defaults.

Upload over USB

1. **Battery unplugged** (power loop plug out). Never have the battery plug and USB in together while you work.
2. Plug the XIAO into the Mac with a USB-C data cable.
3. Tools > Port: pick the one that appears (`/dev/cu.usbmodem...`).
4. Click Upload (arrow). Wait for "Hard resetting via RTS pin" / "Done uploading". If the port does not appear or the upload fails: hold the XIAO's **B** (boot) button, tap **R** (reset), release B, then upload again. After such an upload, tap R once.
5. Tools > Serial Monitor, 115200 baud, "No line ending". You should see `KEDGE v4 ready` and the key list. Type `z` and press Enter: expect `I2C device at 0x40` (INA219) and `0x4a` (BNO085; some boards answer at `0x4b`, also fine).

Upload over WiFi (after the first USB upload)

USB unplugged, power loop plug in. Join WiFi `KEDGE` (password `grappstar`). Tools > Port > network port `kedge`. Upload. Motors stop, any sequence is aborted and the dart disarms when the upload starts.

Driving it

- Web page: join `KEDGE`, open `http://192.168.4.1`. Hold a button or key to run, release to stop.
- Serial Monitor: type a key and press Enter, each press runs 1.5 s.
- Keys: `1`/`!` deploy down/up, 2/@ kick out/back, 3/# drills in/out, 4/$ foot in/out, space or `s` STOP, `a` auto-anchor, `r` release, A arm/disarm (auto-anchor on landing), +/- speed, `i` current, b attitude, p status, `f` flight log summary, z I2C scan, h help.
- Jetson: see `API.md`.

Safety built in

- All motors are off from the first lines of `setup()`. If the chip resets, the DRV8833 inputs fall low and the motors coast.

- Every manual run has a deadman (350 ms on WiFi, 1.5 s per Serial key) and a total hold cap (8 s, 2 s without the INA219). A motor driven into an end stop stops on stall.
- WiFi client gone: manual motors stop at once. A running anchor or release sequence carries on (it is autonomous and has its own limits).
- Over-current trip 2000 mA, low rail (under 5.6 V while driving), sequence time limits, jam detection in release.
- All safety runs in its own task every 5 ms with a 2 s watchdog; a stuck web client or Serial port cannot block it.
- After a brownout or watchdog reset the dart boots with motors off and reports FAULT until `/stop`, `/auto`, `/release` or `/arm`.
- INA219 missing: manual keys only (on timers), auto and release refused. BNO085 missing: no arming, no flight log.

Tuning

The current thresholds in `kedge_logic.h` (`struct Tuning`) are from the v29 bench numbers at 8 V. Measure the real ones with BENCH_TEST.md steps 3 to 6 and write them in at step 10. Then run the PC tests.

PC tests

```
cd firmware/dart/test && ./run_tests.sh
```

Needs g++ and python3 (Mac: run `xcode-select --install` once for g++). Prints every check and ALL PASS, then checks the JSON files the tests wrote.

Simulator (Linux, optional)

```
cd firmware/dart/sim && make && python3 test_sim.py      # 11 HTTP tests against the real sketch
./kedge_sim --port 8790                                  # then open http://localhost:8790 (the real
  web page)
```

`/sim/launch`, `/sim/state` and `/sim/set?k=v` drive the simulated hardware (see `sim/sim_main.cpp`).

Compile check without the IDE (optional)

```
arduino-cli core install esp32:esp32 --additional-urls https://espressif.github.io/arduino-esp32/
  package_esp32_index.json
arduino-cli lib install "Adafruit BNO08x"
arduino-cli compile -b esp32:esp32:XIAO_ESP32S3 firmware/dart/kedge_dart
```

9. Jetson setup

The Jetson already runs JetPack 6.2 (Ubuntu 22.04, Python 3.10) from the SD card with WiFi and SSH. Keep numpy below 2 and do not pip install opencv-python (both broke things in August).

From `jetson/README.md`*:*

GrappStar rover software (Jetson)

This folder is the software that runs on the rover's Jetson Orin Nano. It talks to the base station (USB serial), the KEDGE dart (WiFi), and two cameras, and it serves the operator page in a web browser.

Run everything from this folder (`jetson/`) with `python3 -m grappstar <command>`. Every command has `--help`, for example `python3 -m grappstar serve --help`. If this README and `--help` disagree, `--help` is right (and please fix this README).

Marked **NOT VERIFIED** below: things nobody has checked on the real hardware yet.

Contents

0. What you need
1. Get the code
2. Install
3. Test with no hardware
4. Plug in the base
5. Cameras
6. Dart WiFi (and how the operator connects)
7. Calibrate the rover camera
8. Operator page tour and a full dry mission in sim
9. First real mission checklist
10. Troubleshooting
11. File map

Command summary:

Command	What it does
`python3 -m grappstar serve`	operator page at `http://<jetson>:8080`. Options: `--sim`, `--port 8080`, `--base /dev/grappstar-base`, `--dart 192.168.4.1`, `--rover-cam /dev/grappstar-rovercam`, `--dart-cam /dev/grappstar-dartcam`, `--fourcc YUYV` or `MJPG`
`python3 -m grappstar cameras`	list cameras and the formats they offer
`python3 -m grappstar base status` / `ping` / `monitor`	talk to the base. `monitor` prints telemetry live (Ctrl+C stops)
`python3 -m grappstar base cmd '<json>'`	send one raw command, e.g. `'{"cmd": "status"}'`
`python3 -m grappstar dart status`	one dart status reading
`python3 -m grappstar dart key <c> --hold <s>`	hold a dart motor key for s seconds
`python3 -m grappstar dart auto` / `release` / `flightlog`	auto anchor, release sequence, download the flight log
`python3 -m grappstar mockbase --pty`	fake base for testing; prints a pty path to use as `--base`
`python3 -m grappstar calibrate intrinsics` / `mount`	rover camera calibration (step 7)
`python3 -m grappstar replay <logdir>`	re-run the vision on a recorded mission
`python3 -m grappstar selftest`	run checks that need no hardware

---

0. What you need

- Jetson Orin Nano Super with JetPack 6.2 on its SD card (already done in August: hostname `GrappStar`).
- Internet for the Jetson during install (home WiFi or Ethernet).
- A way to type on it: monitor and keyboard, or SSH from the Mac: `ssh <your user>@GrappStar.local` (or the IP address, which was 192.168.0.249 on home WiFi in August).
- For later steps: the base station (ESP32-S3 DevKitC-1) and a USB cable, the Razer Kiyo X, the RC832 receiver and the DIGITNOW USB capture dongle, the KEDGE dart, a phone or laptop for the operator page.

- A printed checkerboard for step 7.

Two things learned in August that this kit works around:

- snap is broken on JetPack 6.2. Use `apt` for everything, never `snap`.
- numpy must stay below 2. pip once upgraded it to 2.x and broke system packages. The install keeps it at 1.x.

1. Get the code

On the Jetson:

```
cd ~
GIT_LFS_SKIP_SMUDGE=1 git clone https://github.com/HarryHYu/GrappStar.git
cd GrappStar
git checkout main
cd jetson
```

- `GIT_LFS_SKIP_SMUDGE=1` skips the big caliper photo PDF (145 MB). The Jetson does not need it.
- If `main` has no `jetson/` folder yet (before the build day merge), use the integration branch instead: `git checkout base-v1`.
- To update later: `cd ~/GrappStar && git pull`.

2. Install

```
cd ~/GrappStar/jetson
bash setup/install.sh
```

It asks for your password (sudo). What it does, in order:

1. apt installs `python3-numpy python3-serial python3-pytest python3-pip v4l-utils network-manager`.
2. OpenCV: JetPack normally already has OpenCV for Python (NVIDIA's build, with GStreamer). If `import cv2` already works the script leaves it alone. Only if it is missing does it run `apt install python3-opencv`. Why not `pip install opencv-python`? The pip version has no GStreamer, carries its own JPEG and video libraries (August's JPEG mismatch was exactly this kind of clash), and can drag numpy up to 2.x.
3. `pip install --user -r requirements.txt` for anything apt did not provide. The file pins `numpy>=1.21,<2`.
4. Adds you to the groups `dialout` (serial ports) and `video` (cameras).
5. Installs `setup/99-grappstar.rules` so the devices get fixed names: `/dev/grappstar-base`, `/dev/grappstar-base-uart`, `/dev/grappstar-rovercam`, `/dev/grappstar-dartcam`.
6. Runs `setup/check_env.py` and prints a report.

Then **log out and back in** (or `sudo reboot`) so the new groups work.

Check any time with:

```
python3 setup/check_env.py
```

Look for: numpy 1.x, cv2 with `V4L2 YES` (and `GStreamer YES` on the Jetson), pyserial, groups dialout and video yes.

Optional: start the operator page automatically at boot (do this after step 3 works):

```
bash setup/install.sh --service
systemctl status grappstar          # should say "active (running)"
journalctl -u grappstar -f          # live log, Ctrl+C to leave
```

The service runs `python3 -m grappstar serve --port 8080` as your user from this folder, and restarts it if it crashes. While the service runs, do not also start `serve` by hand (both want port 8080). Stop it with `sudo systemctl stop grappstar`, remove it from boot with `sudo systemctl disable --now grappstar`.

Optional: onnxruntime-gpu for a GPU terrain model. Not needed to run anything. See the note at the bottom of `requirements.txt` (Jetson AI Lab wheel, NOT VERIFIED).

Optional: maximum performance mode (already set in August): `sudo nvpmodel -q` shows the mode. `jtop` shows load.

3. Test with no hardware

Nothing needs to be plugged in for this step. It also works on a PC.

```
cd ~/GrappStar/jetson
python3 -m pytest                 # all tests; ends with "N passed"
python3 -m grappstar selftest     # quick checks, prints PASS or FAIL per check
python3 -m grappstar serve --sim  # operator page with a simulated base, dart and cameras
```

With `serve --sim` running, open the page:

- on the Jetson itself: `http://localhost:8080`
- from the Mac or phone on the same network: `http://GrappStar.local:8080` or `http://<jetson IP>:8080` (find the IP with `hostname -I`).

You should see both camera views moving (simulated) and base and dart status updating. Ctrl+C in the terminal stops the server. Step 8 walks through a whole simulated mission.

Test the real base client against a fake base (two terminals):

```
python3 -m grappstar mockbase --pty          # terminal 1: prints a path like /dev/pts/5
python3 -m grappstar base ping --base /dev/pts/5    # terminal 2, using the path it printed
```

(The `--base` option on the `base` subcommand is assumed to match `serve`; check `python3 -m grappstar base --help`.)

4. Plug in the base

Battery unplugged. For this step the base runs from USB only: the Jetson's USB powers the DevKitC. Do not connect the 3S LiPo, the BTS7960 or the motors yet.

1. Battery unplugged. Plug a USB cable from the Jetson into the DevKitC port marked **USB** (the ESP32-S3 native port), not the one marked UART or COM.
2. Check the name appeared:

```
ls -l /dev/grappstar-base
lsusb                              # expect a line with 303a:1001 (Espressif)
```

`/dev/grappstar-base -> ttyACM0` means it worked. If you used the UART port instead you get `/dev/grappstar-base-uart`; move the cable to the USB port.

3. Talk to it:

```
python3 -m grappstar base ping      # expect a reply with "ok": true
python3 -m grappstar base status
python3 -m grappstar base monitor   # telemetry lines about 10 per second, Ctrl+C stops
```

4. Only after this works, and following the base build guide: battery unplugged, wire the power side, then connect the battery last.

The base firmware must use the native USB CDC (Arduino IDE: "USB CDC On Boot: Enabled", "USB Mode: Hardware CDC and JTAG"). The base talks JSON lines (contract C1, `firmware/base/PROTOCOL.md`).

5. Cameras

Battery unplugged before connecting the RC832 receiver's power. Always screw the antennas onto the RC832 and onto the dart's Caddx Ant VTX before powering them: a VTX powered without an antenna can burn out.

1. Plug in the Kiyo X and the DIGITNOW capture dongle (USB). Connect the RC832 video out (yellow) to the dongle's video in. Battery unplugged while you wire the RC832 power; power it as its label says (NOT VERIFIED which supply on the rover).
2. List the cameras:

```
python3 -m grappstar cameras
ls -l /dev/grappstar-rovercam /dev/grappstar-dartcam
```

If a name is missing, run `lsusb`, find the camera's `ID vvvv:pppp`, and fix the line in `setup/99-grappstar.rules` (the Kiyo X ID 1532:0e4f and the dongle ID 534d:2109 are NOT VERIFIED). Then rerun `bash setup/install.sh --no-apt` and replug.

3. See exactly which formats each camera offers:

```
v4l2-ctl -d /dev/grappstar-rovercam --list-formats-ext
v4l2-ctl -d /dev/grappstar-dartcam --list-formats-ext
```

Look for `YUYV` and `MJPG` and the sizes listed under each.

4. Pick the format. The software always asks for a format explicitly, because on JetPack the default path through NVIDIA's JPEG library failed in August (Cheese crashed). Default is YUYV:

```
python3 -m grappstar serve --fourcc YUYV     # safe, works at lower resolutions
python3 -m grappstar serve --fourcc MJPG     # needed for 1920x1080 on the Kiyo X
```

If the picture is black or you see JPEG errors with one, try the other.

5. Dart video: power the dart (its VTX transmits). On the RC832, press the button to step through channels until the picture is clean. The RC832 must be on the same band and channel as the Caddx Ant VTX (the VTX shows its channel with its LED or button; see its manual). Snow means wrong channel, no antenna, or too far.
6. Start `serve` and check both views on the page. The dart view is analog: some snow and dropouts are normal, and the software marks bad frames and skips them for vision.

6. Dart WiFi (and how the operator connects)

The dart is a WiFi access point: name **KEDGE**, password **grappstar**, address **192.168.4.1**. The Jetson must join it to control the dart. At the same time the operator's phone or laptop must reach the Jetson's page.

The plan

- The Jetson's built-in WiFi joins KEDGE. Always.
- The operator connects in one of three ways. **Start with A** (nothing extra to buy). Move to B or C for real missions if A is slow or drops.

Option	Operator connects to	Page address	Good	Bad
A	KEDGE too	`http://<Jetson KEDGE IP>:8080`	nothing extra, simplest	all video goes through the dart's small ESP32 radio, which also carries the dart's own commands. NOT VERIFIED how well it copes
B	Jetson hotspot GRAPPSTAR-ROVER on a USB WiFi adapter	`http://10.42.0.1:8080`	separate radio for video	needs a USB WiFi adapter with Linux AP mode support
C	travel router plugged into the Jetson's Ethernet	Jetson's address on the router	most reliable	one more box to power

The ESP32 access point allows only a few clients at once (4 by default), so with option A keep it to the Jetson and one operator device.

Join KEDGE from the Jetson

Do the install (step 2) first: once the built-in WiFi is on KEDGE, the Jetson has no internet through it.

Power the dart, then on the Jetson:

```
nmcli device                                  # find the WiFi interface, usually wlP1p1s0
nmcli device wifi list                        # KEDGE should be listed
sudo nmcli device wifi connect KEDGE password grappstar ifname wlP1p1s0 name kedge
# KEDGE has no internet: never use it as the default route
# keep retrying when the dart is off, and prefer it over home WiFi
sudo nmcli connection modify kedge ipv4.never-default yes ipv6.method ignore \
    connection.autoconnect yes connection.autoconnect-priority 10 connection.autoconnect-retries 0
ping -c 3 192.168.4.1
python3 -m grappstar dart status
```

Replace `wlP1p1s0` if `nmcli device` shows a different name. Back to home WiFi for updates: `nmcli connection up <home wifi name>` (list names with `nmcli connection show`). Note: with priority 10, the Jetson picks KEDGE whenever the dart is on.

Dart commands:

```
python3 -m grappstar dart status           # phase, battery, motors
python3 -m grappstar dart key 2 --hold 1.0  # hold "kick out" for 1 s
python3 -m grappstar dart auto             # auto anchor sequence
python3 -m grappstar dart release          # release sequence
python3 -m grappstar dart flightlog        # download the last flight log
```

Dart keys: `1` deploy down, `!` deploy up, 2 kick out, @ kick back, 3 drills in, # drills out, 4 foot in, $ foot out. Quote the symbols in the shell, e.g. `dart key '!' --hold 1.0`.

Tell the Jetson how the IMU sits in the dart

The dart's flight log is in the BNO085 chip's own axes. The bench test in `firmware/dart/BENCH_TEST.md` (step 7) finds how the chip sits in the hull. Write it as three entries: which chip axis points along the nose (body x), which points left (body y) and which points up when the dart lies level (body z), with a minus sign where the chip axis points the other way. Examples: `x,y,z` (chip matches the dart), `y,-x,z` (chip turned 90 degrees). Put it in `settings.json` (below) as `"imu_axes": "y,-x,z"`, or pass `--imu-axes y,-x,z` to `serve`. A mirrored entry (for example `y,x,z`) is refused: one sign is wrong.

Settings file

Copy `settings.example.json` to `settings.json` in this folder and edit it once. `serve` (and the boot service) read it, so you do not have to type options. Options typed on the command line still win. Keys: `base`, `dart`, `rover_cam`, `dart_cam`, `fourcc`, `rover_fourcc`, `rover_size`, `dart_size`, `tow_limit`, `drag`, `imu_axes`.

Option A: the operator joins KEDGE too

1. On the Jetson, find its KEDGE address:

   ```
   ip -4 addr show wlP1p1s0         # look for "inet 192.168.4.x"
   ```

2. Phone or laptop: join WiFi KEDGE (password grappstar). It will say "no internet": choose to stay connected (Android asks; turn off "switch to mobile data" if it keeps leaving).

3. Open `http://192.168.4.x:8080` (the x from step 1). `http://GrappStar.local:8080` may also work (mDNS works on iPhone and Mac, not on every Android).

Option B: hotspot on a USB WiFi adapter

1. Plug in the USB WiFi adapter. `bash setup/hotspot.sh list` shows it (a name like `wlx...`).
2. Start the hotspot (it also starts at every boot from now on):

```
bash setup/hotspot.sh up                # picks the free WiFi interface
bash setup/hotspot.sh up wlx00c0ca123456 # or name it
```

This runs `nmcli device wifi hotspot ifname <adapter> con-name grappstar-hotspot ssid GRAPPSTAR-ROVER password grappstar`.

3. Operator: join **GRAPPSTAR-ROVER** (password grappstar), open `http://10.42.0.1:8080`.
4. Stop it: `bash setup/hotspot.sh down`. Status: `bash setup/hotspot.sh status`.

Do not run the hotspot on the built-in WiFi: that radio is on KEDGE.

Option C: travel router on Ethernet

1. Set up the travel router as a normal WiFi router (its own WiFi name and password, DHCP on). Plug a cable from one of its LAN ports to the Jetson's Ethernet port.
2. On the Jetson:

```
nmcli device                                    # find the Ethernet name, usually eth0 or enP8p1s0
sudo nmcli connection add type ethernet ifname eth0 con-name rover-lan ipv4.method auto \
    connection.autoconnect yes
ip -4 addr show eth0                            # the Jetson's address on the router
```

Replace `eth0` with the name `nmcli device` showed.

3. Operator: join the router's WiFi and open `http://<that address>:8080`. In the router's admin page you can reserve that address so it never changes.

7. Calibrate the rover camera

The rover aims the base at things it sees, so it must know how its camera maps pixels to angles (intrinsics) and how the camera sits on the rover (mount: height and tilt).

The exact options of the `calibrate` commands are set by the code: run `python3 -m grappstar calibrate intrinsics --help` and `python3 -m grappstar calibrate mount --help` first. The steps below are the method.

Print the checkerboard

- **9 by 6 inner corners** (that is 10 by 7 squares), **25 mm squares**. A generator such as calib.io ("Checkerboard", 10 columns, 7 rows of squares, 25 mm) or OpenCV's `pattern.png` works.
- Print at 100 percent ("actual size", no "fit to page"). Measure a square with calipers. If it is not 25.0 mm, give the measured size to the command (see `--help`).
- Tape it flat on something stiff (cardboard, a clipboard). A bent board gives bad results.

Intrinsics

1. Stop the operator page if it is running (it holds the camera).
2. Run `python3 -m grappstar calibrate intrinsics` (with `--help` options for the camera and square size).
3. Hold the board in front of the camera and move it: near and far, left, right, top, bottom corners, and tilted. Aim for 20 or more good views. Keep it still for each capture and avoid glare.
4. It prints the result (and an error number: under 0.5 pixels is good, over 1 means redo it) and where it saved the file.

Mount

1. Fix the camera in its final position on the rover. If it moves later, redo this part.
2. Rover on flat ground. Lay the board flat on the ground in front of it, in view.
3. Run `python3 -m grappstar calibrate mount` and follow what it asks (measured distances, see `--help`).
4. It saves camera height and pitch.
5. Check: put an orange object at a distance you measured with a tape (for example 5.0 m), click it on the page, and compare the range the page shows. Within about 5 percent is good.

8. Operator page tour and a full dry mission in sim

Start the simulator and open the page (step 3):

```
python3 -m grappstar serve --sim
```

What is on the page (layout may differ a little from this list):

- **Camera views**: rover camera and dart camera, live. Click on the rover view to mark a target.
- **Base panel**: link, state, mode, drum position, aim angle, current, battery, fault.
- **Dart panel**: link, phase (IDLE, ARMED, FLIGHT, LANDED, ANCHORING, ANCHORED, RELEASING, FAULT), battery.
- **Mission panel**: current step, history, and the **prompt** box. Before anything dangerous (firing, reeling) the mission stops and asks you to confirm, e.g. "Fire" or "Cancel". Nothing dangerous happens without your click.
- **Target**: range and bearing of the clicked or auto found target, and the ballistic solution (pitch, flight time).
- **Results**: after a flight, the landing zone verdict (GO, NO_GO or UNSURE with reasons), the landing image, the aerial map built from the dart video, and the flight analysis.
- **Manual**: jog the wiper and drum motors, dart keys, record on or off.
- **STOP** (wiper off now) and **E-STOP** (wiper off and drum to neutral). Always visible. Know where they are before you press anything else.

The mission steps, in order (the page highlights the current one):

Step	What happens	You do
PREFLIGHT	links, faults, dart seated, battery, videos, a target set	fix what it lists, then Retry
LAUNCH_MODE	drum to LAUNCH (about 4 s per drum step)	
AIM	pitch from the ballistics table; the page says how far to turn the rover	turn the rover, press Aim
COCK	the base draws the spring (up to about 20 s)	
ARM	the dart's landing detector is armed (it only records; you decide on anchoring)	
FIRE	two confirmations, then the shot	Fire, then FIRE NOW
FLIGHT	waits for the dart to say LANDED (or the dart video to go still)	
LANDING_ZONE	landing report, map, verdict; the base is told how much line is out	Anchor, or Retrieve and reshoot
BASE_NEUTRAL	launcher back at rest, drum to NEUTRAL	
ANCHOR	the dart digs in (kick, foot, drills)	
TIDY	slack wound onto the storage reel (if the base firmware has it)	
WRAP	the capstan wraps go on (about 24 s)	
CHECK	a gentle test pull must reach the check tension and hold it	
TOW	reel to the tension limit and hold	drive the rover gently, then Take up slack or Rover free
RELEASE	the dart unscrews and folds	
RETRIEVE	capstan reels in until about 1.5 m is left	
UNWRAP	capstan wraps come off	
FINAL_APPROACH	the last metre until the dart is seated	
LAUNCH_READY	drum back to LAUNCH for the next shot	

If you abort after COCK and before FIRE, the spring stays drawn: press **Decock** in the Manual section before you touch the launcher.

Dry mission in sim, step by step:

1. Press **Preflight**. Everything should go green (base link, dart link, cameras).
2. Click a target on the rover view (or press auto target). Check the range and solution.
3. Press **Start**. Answer each prompt. At the fire prompt press **Fire**.
4. Watch the dart view: the simulated flight, impact and landing.
5. Read the landing verdict and look at the map.
6. Follow the prompts through anchoring, tensioning, release and reeling in.
7. Try **STOP** and **E-STOP** in the middle of a second run and check the mission stops and says why.
8. Replay the recorded mission's vision:

```
python3 -m grappstar replay <logdir>
```

where <logdir> is the mission log folder (its path is printed in the terminal and shown on the page when the mission ends).

9. First real mission checklist

Before the first real launch:

- [ ] Steps 3 to 8 all worked. `python3 -m pytest` passes on the Jetson.
- [ ] Clear area: nobody in front of the launcher or anywhere along the flight path or the line. Check behind the target too. Everyone knows the shout for stop.
- [ ] Line attached at both ends (dart and reel) and laid so it cannot snag on the rover, feet or wires.
- [ ] Tension limit set to a low value for the first runs (the base `set` key, or the page) and you know what it is.
- [ ] STOP button: you can see it on the page, and your hand is on it during every motion. Know that E-STOP sends the drum to neutral. Know where the battery connector is so you can unplug it fast.
- [ ] Battery charged (3S full is 12.6 V), 20 A fuse fitted. Battery unplugged while you check any wiring.
- [ ] Antennas on the VTX and RC832 before power. Dart view clean on the page.
- [ ] Dart status OK (`python3 -m grappstar dart status`), base ping OK, preflight all green.
- [ ] Recording on, so you can replay it.
- [ ] Start with a short shot at low pitch.
- [ ] The real launcher reaches only about 3 to 4.4 m (base/out/ballistics.json). The page says "not reachable" for anything outside that: move the rover instead.

10. Troubleshooting

Problem	Likely cause	Fix
No `/dev/grappstar-base`	rules not installed, cable in the UART port, charge-only cable, or a different USB ID	`ls /dev/ttyACM* /dev/ttyUSB*`, `lsusb` (expect 303a:1001). Use the DevKitC port marked USB and a data cable. Rerun `bash setup/install.sh --no-apt` and replug. If lsusb shows another ID, edit `setup/99-grappstar.rules`
Only `/dev/grappstar-base-uart`	cable in the UART/COM port	move it to the port marked USB
`/dev/ttyUSB0` appears then vanishes (CH340)	brltty grabs it	`bash setup/install.sh --remove-brltty`
`Permission denied` on the serial port or camera	not in groups dialout or video yet	`groups` should list both. If not, `bash setup/install.sh --no-apt`, then log out and in (or reboot)
Base ping times out	wrong firmware USB mode, or another program has the port	check the firmware is built with "USB CDC On Boot: Enabled". Stop the service (`sudo systemctl stop grappstar`) or other `serve` before using `base` commands
Camera black, or JPEG errors like "Corrupt JPEG data"	format mismatch with NVIDIA's JPEG library (seen in August)	set the format explicitly: `--fourcc YUYV`, or `--fourcc MJPG` if YUYV does not offer the size. Check sizes with `v4l2-ctl --list-formats-ext`
Camera "busy" or will not open	another program has it (Cheese, a second `serve`, the service, calibrate)	close it. `sudo fuser /dev/video*` shows who holds it
Dart view is snow	RC832 channel does not match the VTX, antenna missing, dart off or too far	step the RC832 channel, check both antennas, move closer
Dart view stuck or blue screen	RC832 has no signal, dongle not getting video	check the yellow video cable and RC832 power
Dart unreachable (`dart status` fails, no ping to 192.168.4.1)	Jetson not on KEDGE, dart off, or out of range	`nmcli device` (is the WiFi on `kedge`?), `nmcli connection up kedge`, power the dart, move closer
Page unreachable from the phone	phone on a different network, wrong address, or serve not running	phone must be on KEDGE (A), GRAPPSTAR-ROVER (B) or the router (C). Find the address with `hostname -I`. On the Jetson, `curl -I http://localhost:8080` checks serve is up. `systemctl status grappstar` if using the service
Phone keeps leaving KEDGE	it wants internet	tell it to stay connected; turn off mobile data switching; or use option B

Problem	Likely cause	Fix
`numpy.core.multiarray failed to import`, "compiled using NumPy 1.x cannot be run in NumPy 2"	numpy 2 got installed by pip	`python3 -m pip install --user 'numpy>=1.21,<2'`, then `python3 setup/check_env.py`
Two OpenCVs (cv2 version or GStreamer NO in check_env on the Jetson)	`pip install opencv-python` was run	`python3 -m pip uninstall opencv-python opencv-python-headless`, keep the apt one
A program wants `snap install`	snap is broken on JetPack 6.2	use apt (or the project's apt or pip instructions) instead
Port 8080 already in use	the service is running, or an old `serve`	`sudo systemctl stop grappstar`, or close the other terminal. Or use `--port 8081`

11. File map

```
jetson/
  README.md              this guide
  INTERFACES.md          how the modules fit together (for programmers)
  requirements.txt       Python packages (numpy below 2, pyserial, pytest; OpenCV from apt)
  pytest.ini             test settings (tests/ folder)
  setup/
    install.sh           installs everything (step 2)
    check_env.py         prints what is installed and plugged in
    99-grappstar.rules   udev rules: /dev/grappstar-base, -base-uart, -rovercam, -dartcam
    grappstar.service    systemd unit to start the page at boot
    hotspot.sh           optional operator hotspot on a USB WiFi adapter (option B)
  grappstar/
    __main__.py, cli.py  the command line (python3 -m grappstar ...)
    app.py               owns the base, dart, cameras and mission; what the page talks to
    mission.py           the mission steps and operator prompts
    rover.py             rover side helpers
    config.py            settings and defaults
    jlog.py              mission logs
    ballistics.py        aim solution from the ballistics table
    data/                placeholder ballistics table
    comms/               base.py (serial), dart.py (HTTP), mock_base.py, mock_dart.py
    video/               camera capture, discovery, frame quality, recording, replay
    vision/              flight.py, mosaic.py (aerial map), terrain.py (landing verdict), target.py (
  aiming)
    sim/                 simulated dart flight video and terrain textures
    ui/                  operator web page
  tests/                 one test file per module, run with python3 -m pytest
```

10. Calibration (base)

Where to type the commands: on the bench (ESP32 on the Mac's USB) in the Arduino Serial Monitor. Once the ESP32 is on the Jetson, on the Jetson in `~/GrappStar/jetson`: `python3 -m grappstar base cmd '<the same JSON>'`, with `python3 -m grappstar base monitor` in a second terminal for telemetry. If you installed the grappstar service, stop it first (`sudo systemctl stop grappstar`): it holds the serial port. Never move the USB plug with the battery in.

Do it after the base is assembled and wired, springs off, before test stage 4. The bench test (section 11.1) comes first, on the bench (order of work step 7). Part (f), the cock geometry check, needs the springs: do it at test stage 5. The values are stored on the ESP32.

From `firmware/base/CALIBRATION.md`*:*

Base station calibration

Do BENCH_TEST.md first. Steps (a) and (b) can be done on the bench. The rest needs the base assembled.

- Every command below goes into the Serial Monitor (line ending "Newline"). Any whole `id` number works.
- Every value you `set` or learn with `cal` is **saved in flash automatically** (once everything has stopped) and is kept over a power cycle and over a new upload. Read a value back with `get`, for example `{"id":1,"cmd":"get","key":"amps_per_volt"}`.
- If something faults, read the `FAULT` line (`code` and `why`), fix the cause, then send `{"id":1,"cmd":"clear"}`.
- `stop` is always there: `{"id":1,"cmd":"stop"}`. Keep it pasted in the box, ready to send.
- **Battery unplugged** before you touch any wire, plug, contact or the meter leads. Never pull a plug while the battery is in.

Nothing here has been tried on the real base yet. Expect to adjust.

New build: tell the firmware the launcher is at rest

On a new build (or after a fresh upload with no saved state) the firmware does not know where the launcher is: the shot phase is `UNKNOWN`. Then `aim` is refused (`PHASE_UNKNOWN`) and leaving LAUNCH is refused (`LAUNCH_BUSY`), because only the wiper worm holds the spring and the firmware will not shift while the spring might be drawn.

Look at the launcher: carriage fully forward on its stop (`H` in telemetry `sw`) and the big gear in its gap (`G`). Then send `{"id":1,"cmd":"cal","what":"cock_rest"}`. `SWITCH_DISAGREE` means `SW_HOME` is open: the carriage is not home, or the contact is not touching.

(a) AS5600 magnet and direction

1. Battery unplugged. USB only. Magnet in its cap on the shaft end, 1 to 3 mm from the chip, centred.
2. Send `{"id":1,"cmd":"status"}`. You want `"magnet":"OK"`.
   - `NONE`: no magnet seen or no I2C. Check the STEMMA QT cable and the magnet.
   - `WEAK`: move the magnet closer. `STRONG`: move it further away.
3. The wiper output cannot be turned by hand (its worm locks it). So for this check turn the magnet instead: before it is glued, hold it over the chip at 1 to 3 mm and turn it slowly (or turn the AS5600 board round the magnet). Watch `wiper_deg` in telemetry: it must change smoothly, about 360 per turn. Then fix the magnet in its cap.
4. Direction (needs the battery; done once in BENCH_TEST.md step 4, check it again in the base). Battery unplugged: check nobody's hands are near the shaft. Plug the battery in. Drum in NEUTRAL. Send:

   ```
   {"id":2,"cmd":"jog","motor":"wiper","dir":-1,"ms":500}
   ```

Dir -1 is BACKWARD. `wiper_deg` must go DOWN. If it goes UP, wait until it has stopped, then send:

```
{"id":3,"cmd":"set","key":"enc_sign","val":-1}
```

Jog again: now it must go down. (`BUSY` means it was still moving: send again.) The firmware also catches a wrong sign by itself while driving hard: `FAULT ANGLE_SENSOR` "AS5600 counts against the drive (enc_sign?)".

5. In `status`, `glitches` counts rejected AS5600 readings. A few are fine. If it climbs fast while the motor runs, route the AS5600 cable away from the motor wires.

(b) Wiper current

Current zero

1. Battery plugged in, wiper stopped (`"amps"` should be near 0 anyway).
2. Send `{"id":1,"cmd":"cal","what":"current"}`. `amps` now reads 0.0 when stopped.

Current scale (needs a multimeter with a 10 A range)

If WIRING.md section 3 found an onboard IS resistor, set the computed `amps_per_volt` first.

1. Battery unplugged. Put the meter in series with the motor + wire (BTS7960 M+ to the meter 10 A jack, meter COM to the motor red wire). In the MOTOR wire, not the battery wire. Meter on the 10 A DC range.
2. Plug the battery in. Drum in NEUTRAL (on the bench: the GPIO11 jumper). Jog backward for 1.5 s:

```
{"id":2,"cmd":"jog","motor":"wiper","dir":-1,"ms":1500}
```

Sending the same line again before it ends keeps it running (copy the line, then paste and Enter a few times).

3. Read the meter once it is steady, and `amps` in telemetry at the same moment.
4. `new value = old value x meter amps / shown amps`. The old value is 12.5 unless you changed it. Example: meter 1.8 A, shown 1.5 A: 12.5 x 1.8 / 1.5 = 15.0. Send `{"id":3,"cmd":"set","key":"amps_per_volt","val":15.0}`.
5. Jog again and check they now agree. Then battery unplugged, take the meter out, reconnect the motor wire directly. The 10 A range must never see a stall.

Free running current

The tension estimate uses the current above free running in REEL. Learn it with the wraps on and the line slack (after (c)).

1. Line slack, drum in REEL (after a `wrap`, see (c)).
2. Send `{"id":2,"cmd":"jog","motor":"wiper","dir":1,"ms":1500}`, then within the 1.5 s, after at least 0.8 s, send `{"id":3,"cmd":"cal","what":"free"}`. `NOT_RUNNING` means you were too early or too late: try again.
3. Easier way: jog, read `amps` in telemetry while it runs steady, then `{"id":4,"cmd":"set","key":"free_a","val":1.6}` (your number).

(c) Drum direction, modes, wrap and unwrap

The drum position comes from three code contacts (a Gray code, BENCH_TEST.md step 2). The code is absolute, so there is no home search: the base always knows which sector the drum is in, even after a power cut.

1. Battery unplugged. The drum N20 is in place and in mesh (n in telemetry `sw`), the three drum code contacts are wired (the bench jumpers are OFF), and the line is slack.
2. USB plugged in, battery still unplugged. `{"id":1,"cmd":"cal","what":"drum"}` replies `"ok":true` and sends a `MODE` event with the `drum_pos` the code shows. `POSITION_UNKNOWN` means the code is invalid (000, or a jump): check the code contacts (BENCH_TEST.md step 2).
3. Get the drum to NEUTRAL (`drum_pos NEUTRAL`, only b of the code closed) by hand, because the motor direction is not checked yet. Battery still unplugged: flip the hand latch (n disappears from `sw`), turn the drum with the manual lever until only b is closed, latch the N20 back in (n closed). Turning the drum while the board runs gives `FAULT DRUM_SENSOR` "drum code changed with the drum still": expected, send `{"id":2,"cmd":"clear"}` (twice if the fault comes back at once).
4. Direction check. Plug the battery in. Drum at NEUTRAL. Send a short drum jog toward REEL:

```
{"id":3,"cmd":"jog","motor":"drum","dir":1,"ms":800}
```

The drum must move into the next sector toward REEL: `sw` shows b and c closed (code 0 1 1, the wrap prep sector), `drum_pos BETWEEN`. Then go back with `{"id":4,"cmd":"jog","motor":"drum","dir":-1,"ms":800}`: only b again.

5. If instead `sw` shows a and b (code 1 1 0, the ramp toward LAUNCH), the drum turned the wrong way: battery unplugged, swap the two N20 wires at AOUT1 and AOUT2. Bring the drum back to NEUTRAL with the hand lever as in step 3, plug the battery in and repeat step 4.
6. Now try the modes and wait for each `MODE` event with `"ok":true`:

```
{"id":6,"cmd":"mode","to":"LAUNCH"}
{"id":7,"cmd":"mode","to":"NEUTRAL"}
```

After each one, telemetry `drum_pos` and `mode` must name that position, and the dog collar must sit where it should (look). In LAUNCH `l` must be closed; in NEUTRAL `l` and `r` open.

7. Wrap and unwrap. Line threaded as in the build, the dart off the rail, a little line pulled out and lying slack. Stand clear of the line.

```
{"id":8,"cmd":"wrap"}
```

The drum turns through the WRAP sector (the cup lays 7 turns on the capstan, `wraps` counts up in telemetry), then into REEL. Wait for `WRAPPED` and then `MODE` with `"mode":"REEL"` (about 15 s). `r` must be closed. Then:

```
{"id":9,"cmd":"unwrap"}
```

Wait for `UNWRAPPED` and `MODE` with `"mode":"NEUTRAL"` (about 16 s). `wraps` back to 0.

`mode REEL` is refused (`NOT_WRAPPED`) unless the wraps are on: always use `wrap`. And with the wraps on, `mode` is refused (`WRAPS_ON`): always use `unwrap`.

8. The wiper turns a little during these moves. Keep clear:
   - leaving LAUNCH it first turns 30 deg BACKWARD (the centering jog) so the dogs carry no load;
   - leaving REEL (start of `unwrap`) it first turns forward a little, then 30 deg back;
   - entering REEL it creeps forward slowly until `r` closes (the fly-in);
   - entering LAUNCH, if `l` does not close, it turns BACKWARD slowly (up to 40 deg) until the dogs drop in;
   - during `unwrap` it turns forward at 40 % while the drum is in the WRAP sector (the take-up winds the freed line).

If the dogs never drop in: `FAULT DRUM_TIMEOUT` "dogs did not engage (collar contact open)". Check the `l` / `r` contact closes when the collar is engaged.

9. If you get `SW_ARM counted n of 7 cup turns` (`DRUM_SENSOR`): the `SW_ARM` contact (`W`) must close once per cup turn. Check it with the drum still by watching `W` while the cup is at home.
10. The drum speed (`drum_dps`) is learned by itself between code edges. See it with `{"id":10,"cmd":"get","key":"drum_dps"}`. Nothing to do.
11. If you get `DRUM_TIMEOUT` or `DRUM_SENSOR`: read the `why`. Battery unplugged, check the code contacts close and open cleanly as the drum turns (turn it with the hand lever, `n` open), then `clear` and try again.

(d) Aim

You need a phone inclinometer app (any "level" app that shows degrees). Base assembled, no dart, nobody in front of the rail.

1. Battery unplugged. Fix the phone flat on the rail (tape or a rubber band), along the rail.
2. Plug the battery in. `{"id":1,"cmd":"mode","to":"LAUNCH"}`.
3. The launcher must be at rest: carriage fully forward, `H` and `G` in telemetry `sw`. On a new build, declare it (top of this file).
4. See the allowed range: `{"id":3,"cmd":"get","key":"pitch_range"}` (it replies `min` and `max`, about 6 and 47).
5. Aim at a middle pitch: `{"id":4,"cmd":"aim","deg":30}`. After every shift into LAUNCH the aim is unknown, so it first turns backward until `SW_RAIL_LOW` closes (home), then goes to 30. That can take up to about half a minute: one aim cycle is 10 wiper turns. Wait for the `AIMED` event with `"ok":true`.
6. Read the phone. Say it shows 33.4. Send `{"id":5,"cmd":"cal","what":"aim","deg":33.4}`. This sets `aim_offset` so the reported pitch matches the phone.
7. Check at 3 pitches: aim at a low, middle and high pitch inside the range (for example 15, 30, 42). At each, compare the phone with the `pitch_deg` in the `AIMED` event. Within about 1 deg is good.

If the error is different at different pitches

Then the offset alone cannot fix it. Most likely `SW_RAIL_LOW` closes at a different point of the aim train than the firmware assumes (`aim_home_deg`, the aim-train angle where `SW_RAIL_LOW` closes on the backward run).

1. Find the size of the error. First clear the offset: `{"id":1,"cmd":"set","key":"aim_offset","val":0}`. Jog backward in short steps: `{"id":1,"cmd":"jog","motor":"wiper","dir":-1,"ms":1500}`. Pick a pitch in the middle of the range where the rail moves quickly, for example 30. Write down `wiper_deg` when the PHONE reads 30, and `wiper_deg` when telemetry `pitch_deg` reads 30 (on the same up or down stroke).
2. D = the difference between the two `wiper_deg` numbers (as a positive number).
   - Telemetry reached 30 AFTER the phone did: the firmware is behind. New `aim_home_deg` = old + D.
   - Telemetry reached 30 BEFORE the phone did: new `aim_home_deg` = old minus D.

Get the old value with `{"id":2,"cmd":"get","key":"aim_home_deg"}` (default 3365), then set the new one, for example `{"id":3,"cmd":"set","key":"aim_home_deg","val":3340}`. The allowed range is -7200 to 7200.

3. Changing `aim_home_deg` does not re-home by itself. Send `{"id":4,"cmd":"cal","what":"aim_forget"}`: the next `aim` homes again on `SW_RAIL_LOW`.
4. Redo steps 5 to 7 above.

(e) Tension

`k_n_per_a` **(line newtons per amp, used without a load cell)**

You need a luggage scale. Do (b) free current first.

1. Battery unplugged. Tie the line end to the luggage scale. Hook the scale to something solid. Line slack.
2. Plug the battery in. Get the drum to NEUTRAL (`{"id":1,"cmd":"mode","to":"NEUTRAL"}`), then `{"id":2,"cmd":"wrap"}` and wait for `WRAPPED`. The capstan only pulls with the wraps on.
3. Stand to the side of the line, never in line with it. Jog in short steps: `{"id":3,"cmd":"jog","motor":"wiper","dir":1,"ms":300}`. Watch the scale.
4. When the scale reads about 20 N (2 kg), read `amps` in telemetry while it pulls, then let the jog end. (A jog trips at 3 A: if you get `FAULT OVERCURRENT`, `clear` and use a lower pull, for example 15 N.)
5. `k_n_per_a = 20 / (amps - free_a)`. Example: amps 2.6, free_a 1.5: 20 / 1.1 = 18.2.
6. To release: unhook the scale by hand (20 N is safe to hold). The capstan never turns back (sprag #2).
7. Do it 3 times. Use the average: `{"id":4,"cmd":"set","key":"k_n_per_a","val":18.2}` (your number).
8. Then `{"id":5,"cmd":"unwrap"}`.

HX711 load cell (only if fitted)

1. Check `HELLO` said `"hx711":true`, or `status` shows `"hx":true`.
2. Line slack, motor stopped: `{"id":1,"cmd":"cal","what":"tare"}`. `tension_n` reads about 0.
3. Hang a known weight on the line, for example 1 kg = 9.81 N. Read `tension_n`.
4. `new = old x 9.81 / shown`. Get the old value with `{"id":2,"cmd":"get","key":"hx_n_per_count"}` (default 0.0000476). Set it: `{"id":3,"cmd":"set","key":"hx_n_per_count","val":0.0000512}` (your number).
5. If `tension_n` goes negative when you pull: battery unplugged, swap the A+ and A- wires on the HX711.

(f) Wiper direction in the base and cock geometry check

This checks that FORWARD really cocks, that `SW_HOME` opens where the firmware expects, and that cocking stops before the release tooth. The springs are hooked, so treat it as loaded: no dart, nobody and no hands in front of the carriage or the rail.

1. Battery unplugged. Springs hooked, no dart. Carriage fully forward.
2. Plug the battery in. `{"id":1,"cmd":"mode","to":"LAUNCH"}`. Check `H` and `G` are in telemetry `sw`.
3. On a new build: `{"id":2,"cmd":"cal","what":"cock_rest"}`.
4. Aim first: `{"id":3,"cmd":"aim","deg":30}` and wait for `AIMED`. (After a shift into LAUNCH only an aim run tells the firmware where the dogs sit. Cocking straight after a shift can fault with `BAD_STATE` "carriage not drawn".)
5. `{"id":4,"cmd":"cock"}`. Watch the carriage and telemetry:
   - The carriage must move BACK (toward the springs' stretched side). If it does not move and you get `BAD_STATE` "carriage not drawn": the wiper turns the wrong way for FORWARD. Battery unplugged, swap M+ and M-, then redo (a) step 4 (`enc_sign`) and this step.
   - `H` must disappear almost at once: the first tooth takes the rack a few degrees after rest. If it opens too far from there you get `FAULT SWITCH_DISAGREE` "SW_HOME opened at the wrong angle": the contact sits in the wrong place, or the number in `config.h` needs changing (tell the firmware author).
   - `cock` rises to 1 and a `COCKED` event comes. `H` stays open.
6. Look: the carriage is drawn back and the last tooth still holds it, with clear margin before the relieved tooth. If it stops too early or too late, write down how many degrees and tell the firmware author (`cockEndDeg` in `config.h`; it is not a `set` key).
7. Let it down without firing: `{"id":5,"cmd":"cal","what":"decock"}`. The wiper runs BACKWARD slowly and the spring unwinds under the worm until `H` closes. A `RESET` event with `"how":"decock"` comes. This also turns the aim train, so the aim is unknown afterwards (the next `aim` homes again). Check `G` is closed again.

11. Bench tests

11.1 Base

This runs on the bench before the base is assembled (order of work step 7): wiper motor clamped in a vice, drum N20 loose. Where to type the commands: on the bench (ESP32 on the Mac's USB) in the Arduino Serial Monitor. Once the ESP32 is on the Jetson, on the Jetson in `~/GrappStar/jetson`: `python3 -m grappstar base cmd '<the same JSON>'`, with `python3 -m grappstar base monitor` in a second terminal for telemetry. If you installed the grappstar service, stop it first (`sudo systemctl stop grappstar`): it holds the serial port. Never move the USB plug with the battery in.

From `firmware/base/BENCH_TEST.md`*:*

Base station bench test

No-load checks BEFORE the wiper motor goes into the base. Nothing here has run on real hardware yet, so this is the first time the firmware meets the parts. Go one step at a time.

Each step says what to type, what you should see, and what to do if not. Type commands into the Serial Monitor (line ending "Newline"). Keep `{"id":9,"cmd":"stop"}` ready to paste.

Two rules for the whole test:

- **Battery unplugged** before you touch any wire, jumper or plug. Never pull a plug (not even the small sensor cable) while the battery is in.
- Never hold a turning shaft with your hands.

Set-up

1. Battery unplugged. Clamp the wiper motor firmly in a vice or to the bench. **Nothing attached to its shaft.** Put a strip of tape on the shaft as a flag so you can see it turn.
2. Battery unplugged. Fix the AS5600 board facing the magnet on the wiper shaft end, 1 to 3 mm away, centred (a temporary holder or tape is fine).
3. Battery unplugged. The drum N20 is OUT of the drum. Tape or clamp it down so it can spin freely. Tape flag on its shaft.
4. Battery unplugged. Contacts on their wires, loose on the bench. Put two jumper wires on:
   - GPIO11 (`SW_DRUM_B`) to GND. That makes the drum code read NEUTRAL. Without it the three drum contacts are all open (code 000), which the firmware treats as a wire off: `FAULT DRUM_SENSOR` "drum code 000 (wire off or bump missing)" right after start-up.
   - GPIO47 (`SW_N20`) to GND. That says the drum N20 is in mesh. Without it every drum move is refused with `HAND_MODE`.

Leave both jumpers on for the whole bench test unless a step says otherwise.

5. Battery unplugged. Wired as in WIRING.md, and the Part C multimeter checks done.

Step 1: USB only

Battery unplugged. Plug USB into the port labelled USB. Open the Serial Monitor.

- Type: `{"id":1,"cmd":"ping"}`
- You should see: `{"id":1,"ok":true,"fw":"base-1.0","t":...}`, and telemetry lines with `"state":"IDLE"`, `"mode":"NEUTRAL"`, `"sw":{"b":1,"n":1}` and `vbat` about 0 (no battery).
- If not: no output at all means wrong port or USB CDC On Boot not Enabled (README.md). Telemetry but no reply means the line ending is not "Newline". `BAD_JSON` means a typo (straight quotes only, no smart quotes).
- Type: `{"id":2,"cmd":"status"}`
- You should see: `"magnet":"OK"`.
- If not: `NONE`: check the STEMMA QT cable (3V3, GND, GPIO8, GPIO9) and that the magnet is there. `WEAK`: closer. `STRONG`: further away.

Step 2: contacts, one jumper at a time

USB only, battery unplugged. Telemetry `sw` lists only the CLOSED contacts. With the two jumpers on you already see `"b":1` and `"n":1`.

Use one spare jumper wire. For each row: battery still unplugged, put the jumper from the GPIO to GND (or press the screw head onto its nut), watch `sw`, then take it off again before the next row. Only one contact at a time.

Close	GPIO	You should see in `sw`
`SW_DOG_L`	13	`"l":1`
`SW_DOG_R`	14	`"r":1`
`SW_HOME`	21	`"H":1`
`SW_GAP`	39	`"G":1`
`SW_RAIL_LOW`	40	`"L":1`
`SW_SEATED`	41	`"S":1`
`SW_ARM`	42	`"W":1`

Then take the GPIO47 jumper off: `"n":1` must disappear. Put it back.

(`SW_INDEX` on GPIO35 is only used on a build without the magnet and does not show in `sw` by default.)

Never close `SW_DOG_L` and `SW_DOG_R` together: that is a fault (`SWITCH_DISAGREE`), because the collar cannot be in LAUNCH and REEL at once.

Drum code contacts

The drum reads its position as a 3-bit Gray code, one contact per bit. Neighbouring positions differ by one contact only. Walk through the rows in order, changing ONE jumper per row (GPIO10 = a, GPIO11 = b, GPIO12 = c), and check `drum_pos` in telemetry.

The real drum cannot turn by itself (its worm locks it), so the first change you make by hand raises `FAULT` `DRUM_SENSOR` "drum code changed with the drum still". That is expected and nothing moves. Carry on: telemetry `drum_pos` keeps following the code while the base sits in `FAULT`.

Row	Closed	`drum_pos`	sector
1	b	`NEUTRAL`	NEUTRAL
2	a b	`BETWEEN`	ramp LAUNCH to NEUTRAL
3	a	`LAUNCH`	LAUNCH
4	a b	`BETWEEN`	ramp
5	b	`NEUTRAL`	NEUTRAL
6	b c	`BETWEEN`	wrap prep
7	c	`BETWEEN`	WRAP sector
8	a c	`WRAPPED`	lock sector
9	a b c	`REEL`	REEL

Then walk back the same way (rows 8, 7, 6, 5) and finish with only b closed.

The `mode` field also needs the collar contacts: at row 3 it says `NONE` until you also close `SW_DOG_L` (GPIO13): then `LAUNCH`. At row 9 it says `NONE` until you close `SW_DOG_R` (GPIO14): then `REEL`. Take that extra jumper off again before the next row.

At the end, only b (and the n jumper) closed, send `{"id":3,"cmd":"clear"}`. You should see `"ok":true` and `"state":"IDLE"`. If the same `FAULT` comes back at once, send `clear` a second time (the firmware still remembered the sector from the first change). `STILL_PRESENT` means the code is not valid (000, or you changed two contacts at once): check the jumpers and send `clear` again.

- If a contact never shows: check its wire goes to the right GPIO and the other side to GND.
- If it shows when open: the two sides touch, or the GPIO wire touches GND somewhere.
- If it flickers on and off while held closed: the screw and nut do not touch firmly. Clean or tighten them.

Step 3: battery in, current zero

Battery unplugged. USB plugged in. Then plug the battery in, last. Nothing should move.

- Look: telemetry `vbat` about the same as your meter reads at the XT60 (within about 0.3 V).
- If `vbat` stays about 0: the 100 k / 22 k divider is not connected to GPIO2.
- Type: `{"id":4,"cmd":"cal","what":"current"}` (motor stopped). You should see `"ok":true` and `amps` 0.0.

Step 4: jog the wiper, and its direction

With the drum code at NEUTRAL a forward wiper jog only counts as take-up, so it runs at 40 % power. A backward jog runs at about 60 %.

- Type: `{"id":5,"cmd":"jog","motor":"wiper","dir":1,"ms":500}`

- You should see: the shaft turns for half a second, starting gently (300 ms soft start). Telemetry `state JOG`, then `IDLE`. `amps` shows a value while it runs (not calibrated yet, so only roughly right).
- Write down which way the shaft turned for dir 1: CW or CCW, looking at the shaft end.

Dir 1 is FORWARD. FORWARD must be the direction in which sprag #1 locks and draws the carriage back (the cock direction). Work it out on the parts: hold sprag #1 in its drive gear the way it will sit in the base, looking from the wiper end, and turn it by hand. One way it grips, the other way it spins free. The way it grips is FORWARD. Write it down as CW or CCW too.

- If dir 1 turned the other way than FORWARD: battery unplugged, swap the motor wires at M+ and M-, battery in, and jog again.
- Now check the angle sensor agrees: with dir 1, `wiper_deg` must go UP. If it went DOWN, wait until it has stopped, then `{"id":6,"cmd":"set","key":"enc_sign","val":-1}` and jog again.
- If it does not move but the reply was `"ok":true`: battery, fuse, B+/B- or the R_EN / L_EN wires. A longer jog that does not move ends in `FAULT STALL`, because the shaft did not turn.
- If the reply is `"err":"ANGLE_SENSOR"`: the AS5600 does not see the magnet. The wiper never starts without it.
- If the reply is `"err":"NO_POWER"`: the firmware does not see the battery (`vbat` under 6 V). Check the divider.

Now the other way:

- Type: `{"id":7,"cmd":"jog","motor":"wiper","dir":-1,"ms":500}`
- You should see: the shaft turns the other way. `wiper_deg` goes DOWN.

Longer run, current and speed:

- Type: `{"id":8,"cmd":"jog","motor":"wiper","dir":-1,"ms":1500}`, then `{"id":9,"cmd":"status"}` after it stops.
- You should see: `rpm` in telemetry steady while it runs. It is lower than the 45 rpm spec because a jog runs at part power. `peak_a` in `status` shows the highest current of that run. A free motor should draw a few amps at most. (A jog trips at 3 A, or 2.5 A forward here: if you get `FAULT OVERCURRENT` on the bare motor, write down `peak_a`, `clear` and tell the firmware author.)
- If the current is very high with nothing attached, or the motor gets hot: `stop`, battery unplugged, check the wiring.

Reverse pause:

- The firmware always stops the wiper for 200 ms before it changes direction. That is too short to time by hand (the PC tests check it). What you can check: start `{"id":10,"cmd":"jog","motor":"wiper","dir":1,"ms":1500}` and, while it runs, send `{"id":11,"cmd":"jog","motor":"wiper","dir":-1,"ms":500}`.
- You should see: the second one refused with `"err":"BUSY"`. The motor keeps going until the first jog ends. You never get a direct reversal.

Step 5: jog the drum N20

- Type: `{"id":12,"cmd":"jog","motor":"drum","dir":1,"ms":300}`, then the same with `"dir":-1`.
- You should see: the N20 turns one way, then the other. Telemetry `state JOG` then `IDLE`. (The drum code does not change: it comes from the jumper.)
- If the reply is `"err":"HAND_MODE"`: the GPIO47 jumper is missing.
- If it does not turn: buck output 9.0 V on DRV8833 VM? AIN1 on GPIO15, AIN2 on GPIO16? Common ground? (SLP stays unconnected: that is correct.)
- Which way is right is checked later with the drum fitted (CALIBRATION.md step c).

Step 6: fault test, AS5600

First without the sensor:

- Move the AS5600 board well away from the magnet. `status` shows `"magnet":"NONE"`.
- Type: `{"id":13,"cmd":"jog","motor":"wiper","dir":1,"ms":500}`
- You should see: `"ok":false,"err":"ANGLE_SENSOR"`. Nothing moves.

Then lose it while running:

- Put the board back. `status` shows `"magnet":"OK"`.

- Type: `{"id":14,"cmd":"jog","motor":"wiper","dir":-1,"ms":1500}` and, while it runs, slide the AS5600 holder away from the magnet. Keep your fingers away from the shaft. Do NOT pull the sensor plug.
- You should see: the motor stops at once. A line `{"evt":"FAULT",...,"code":"ANGLE_SENSOR","why":"AS5600 lost while the wiper runs"}`, then a `MODE` line with `"ok":true` (the drum code already says NEUTRAL, so the drum does not move), and telemetry `"state":"FAULT"`, `"fault":"ANGLE_SENSOR"`.
- Type: `{"id":15,"cmd":"clear"}` while the sensor is still away.
- You should see: `"err":"STILL_PRESENT"`.
- Put the sensor back, `clear` again. You should see `"ok":true` and `"state":"IDLE"`.
- If the motor did not stop: send `stop`, unplug the battery, and do not go on. Report it.

Step 7: fault test, stall (optional: skip if unsure)

Never hold the shaft with your hands or fingers. A wiper motor is strong enough to hurt you. Only do this with a proper stop. Skip it if you do not have one: the PC tests check stall detection.

1. Battery unplugged. Take the multimeter out of the motor wire if it is still there (a stall is too much for its 10 A range).
2. Battery unplugged. Fix a solid arm to the shaft (for example a wooden or printed lever on the shaft flat with the M8 nut). Clamp a padded block to the bench so the arm hits it after about a quarter turn of dir -1.
3. Plug the battery in. Stand clear. Type: `{"id":16,"cmd":"jog","motor":"wiper","dir":-1,"ms":1500}`
4. You should see: the arm hits the block, and within a fraction of a second the motor stops with `{"evt":"FAULT",...,"code":"OVERCURRENT",...}` (the jog trip is only 3 A) or `"code":"STALL"` followed by a `{"evt":"STALL",...}` line. Both are a correct stop.
5. `{"id":17,"cmd":"status"}` shows `peak_a`. Write it down.
6. `{"id":18,"cmd":"clear"}`. Battery unplugged before you remove the arm.

Step 8: stop and estop

- Type: `{"id":19,"cmd":"jog","motor":"wiper","dir":-1,"ms":1500}`, then at once `{"id":20,"cmd":"stop"}`.
- You should see: the motor stops at once. `{"evt":"ABORTED",...,"what":"JOG","why":"stop"}`.
- Same again with `{"id":21,"cmd":"estop"}`.
- You should see: the motor stops at once. `ABORTED` with `"why":"estop"`, then a `MODE` line with `"ok":true`: the drum code says NEUTRAL already, so the drum does not move. In the base, estop drives the drum to NEUTRAL when that is safe, and otherwise sends a `MODE` line with `"err":"DRUM_HELD"` and a `"why"`.
- If the motor keeps running: unplug the battery. Report it.

Step 9: brownout (optional)

This needs the battery below 12 V (check `vbat`). It raises the low-battery level for a moment so a normal battery looks low.

1. Type: `{"id":22,"cmd":"set","key":"vbat_low","val":12}`
2. Type: `{"id":23,"cmd":"jog","motor":"wiper","dir":-1,"ms":1500}`
3. You should see: after about 0.3 s the motor stops with `FAULT BROWNOUT` "battery sagged under load".
4. **Set it back first** (it is saved in flash): `{"id":24,"cmd":"set","key":"vbat_low","val":9.9}`. Check with `{"id":25,"cmd":"get","key":"vbat_low"}`.
5. Then `{"id":26,"cmd":"clear"}`. (Clearing before you set it back gives `STILL_PRESENT`.)

Done

Battery unplugged. Write down: which way dir 1 turns (CW or CCW from the shaft end), which way sprag #1 locks, `enc_sign`, the `peak_a` values, anything odd. Then build the base and go on with CALIBRATION.md.

11.2 Dart

The dart bench tests are in section 6 (`firmware/dart/BENCH_TEST.md` and the dart build order, steps 6, 7 and 11). Foot check: key 4 turns the foot auger clockwise seen from the motor end, looking toward the tip.

12. First tests, bench to field

From `docs/build/TEST_PLAN.md`*:*

First tests: bench to field

Do the stages in order. Do not skip ahead when a stage fails: fix it, then repeat the stage. Write the date and the result of each stage in a notebook (or `docs/build/test_log.md`).

How to send base commands: the operator page on the Jetson (jetson/README.md) has buttons for most of these. From a terminal on the Jetson, in `~/GrappStar/jetson`, send any command (firmware/base/PROTOCOL.md) with `python3 -m grappstar base cmd '{"cmd": "jog", "motor": "wiper", "dir": 1, "ms": 300}'` and watch telemetry with `python3 -m grappstar base monitor` in a second terminal. `'{"cmd": "estop"}'` stops everything and is always safe to send.

Safety for every stage:

- Battery unplugged before you touch any wire.
- Hands out of the gears, the drum and the rail whenever the battery is plugged in.
- From stage 5 on: nobody in front of the rail, safety glasses on, the launch area clear for 30 m.
- Never fire a dart (dummy or real) without the tether tied on.
- Stopping and approaching: build guide section 2 (`estop`, then lead #2's XT60, then the battery; and the checklist before you walk up to the base or the dart). Cutting power does not release a drawn spring or a taut line.

Stage 0. Risk coupons (before any big print)

Print the base fit coupon (`base/pack/fit_coupon/coupon_plate_1.3mf`, PLA; its checks are in `base/pack/fit_coupon/COUPON.md`) and the two day-one risk coupon plates (`base/pack/coupons/risk_plate_1_PLA.3mf` PLA and `risk_plate_2_PPA-CF.3mf` PPA-CF; settings in section 4 of the build guide). They test, in a few hours of printing, the things most likely to go wrong: the swing splitter, a printed contact, the dog clutch, the slip clutch, the bearing seats, heat-set inserts and nut traps, the key rib, the gear meshes and the shear pin. Work through the test sheet (`base/pack/coupons/COUPON_TEST.md` or `.pdf`).

Pass: every check on the coupon sheet passes. If it fails: write down the test and what you saw. First check the print itself (right material, settings as in section 4, spool dry). If the print is right, the design number the sheet names must change: ask a Claude Code session in the repo to change it and re-run the coupons, then reprint only that piece (`rcN_*.stl`). Do not start the big base parts until the coupons pass.

Stage 1. Power-on (no motors attached)

Follow SYSTEM_ELECTRICAL.md section 4, the first power-on sequence, steps 1 to 9. Both motors stay disconnected from their drivers until step 10.

Pass: no steady beeps on the short check, MP1584 #2 reads 9.0 V, the Jetson boots, `ping` replies, `vbat` within 0.3 V of the meter, `fault` is null. If it fails: a beep means a short (check the Y harness and the BTS7960 screws first). No reply: check the USB cable is a data cable and in the ESP32 port marked USB; see troubleshooting in the build guide.

Stage 2. Each motor alone, out of the base

Battery unplugged. Connect the wiper motor to BTS7960 M+ / M- and clamp the motor to the bench. Connect the drum N20 to DRV8833 #3 AOUT1 / AOUT2, loose on the bench. Battery in.

1. `jog` wiper dir 1 for 300 ms, then dir -1. Mark with a pen arrow on the motor which way the shaft turns for dir 1. That is FORWARD: on the built base it is the direction that draws the carriage back (cocks). Before the base exists it is only a label; once assembled, a short forward jog in LAUNCH must move the carriage BACK. If it moves forward, swap the wiper leads at M+ / M- (battery unplugged).
2. `jog` drum dir 1 for 500 ms, then dir -1. Mark the shaft direction.
3. Do the current-sense calibration now (MEASURE_LIST G1, CALIBRATION.md), then watch `amps` during a 1.5 s wiper jog (jogs are capped at 1.5 s; sending the same jog again extends it).

Pass: each motor turns both ways, stops when the jog ends, wiper free current about 1 to 3 A (A6 in MEASURE_LIST.md), no fault. If it fails: no movement on the wiper: check R_EN / L_EN wiring and the 20 A fuse. Wiper turns only one way: one of RPWM / LPWM is not connected. Drum does nothing: check 9.0 V on VM and the AIN1 / AIN2 / GND jumpers. If it still does nothing, check which board it is (MEASURE_LIST D3): a board that

does not pull SLP high by itself cannot be used as wired (decision D9); write it in the test log. Wrong direction against CALIBRATION.md: swap that motor's two leads (battery unplugged).

Stage 3. Sensors alone

1. Battery unplugged, ESP32 on USB only. Before the magnet holder is on the motor, turn the magnet by hand over the chip (the wiper worm locks its own shaft, so on the built base use short `jog`s instead): `wiper_deg` changes smoothly, no jumps, and goes up for the FORWARD way (the arrow you drew in stage 2).
2. Touch each printed contact closed with a finger: its entry in `sw` changes and changes back when released.
3. Load cell (if fitted): press it, `tension_n` rises.

Pass: every sensor responds and returns. If it fails: AS5600 not found: check SDA / SCL are not swapped and the STEMMA cable is pushed in; angle jumps: magnet too far (keep 1 to 2 mm) or off centre. Contact never changes: check the GND wire and that the screw head really touches the nut.

Stage 4. Base assembled, dry cycles, NO springs, no line

Springs off, no tether, no dart. Run CALIBRATION.md first (zeros and drum positions; part (f) waits for stage 5). With no dart, `arm` refuses (`NOT_SEATED`): for this stage and stage 5 send `{"cmd":"set","key":"require_seated","val":false}`, and set it back to `true` before stage 6.

1. `mode` LAUNCH, NEUTRAL, LAUNCH: 20 rounds, then every other mode the firmware offers, in the order PROTOCOL.md gives. Each change ends with the right `drum_pos`.
2. `aim` 15, 30, 45, then the minimum and maximum pitch: 5 rounds. Rail reaches each angle within 1 degree (`pitch_deg`) and holds with the motor off.
3. Cock and fire with no springs: `arm`, then `fire` with the token. The carriage travels back, releases, and the big gear re-engages: 10 cycles.
4. Wrap and unwrap, with a spare line through the capstan path and slack: from LAUNCH, `wrap`, `tidy`, `mode` REEL, then `unwrap` and `mode` LAUNCH (the stage 7 table without the shot): 10 cycles. Once wrapped and in REEL, send `reel` with duty 0.3, wait 3 s, send `stop`.
5. Send `estop` in the middle of each kind of move once. The wiper stops at once and the drum goes to NEUTRAL, except when the spring is drawn, the wraps are on or the drum itself faulted: then the drum holds (`DRUM_HELD`), which is correct (decision D27).
6. Fault test: with nothing moving, slide the AS5600 board away from its magnet (do not unplug anything). The base reports the magnet missing and refuses to move. Put it back, `clear`.

Pass: all cycles complete with no fault, no clicking or skipping teeth, no part warm to the touch, the drum never stops BETWEEN positions. If it fails: a STALL fault means something binds: find it by turning by hand with the battery unplugged. Skipped teeth: check the mesh spacing and the frame screws. Drum stops BETWEEN: re-run the drum calibration; check the drum contacts close cleanly.

Stage 5. Springs on, no dart

Fit both springs. Start at the lowest pitch, rail pointing at a clear area.

1. `aim` to the lowest pitch. `arm` and `fire` once. Look at every part of the launch train after the shot.
2. Five more shots. Check the stop bumpers, the carriage, the rack teeth and the big gear's last tooth after each.
3. Watch `amps` while cocking: note the peak (the physics expects about 5 A; decision D8 trips at 6.5 A while cocking).

Pass: the carriage stops on the bumpers, nothing cracks or loosens over 6 shots, cocking current stays under the stall value, the rail holds its pitch while cocking. If it fails: cracks at the bumpers: stop and report (no more dry shots). Rail drops while cocking: the aim worm is slipping, check its mesh. STALL while cocking: the springs are stronger than planned (redo B2) or something binds.

Stage 6. Dummy dart WITH the tether, first shots

Never fire a dart (dummy or real) without the tether tied on. The tether is what keeps it flying nose first; a shot with no line can tumble or land tail first.

Make the dummy: the plate A hull top and bottom, nose and tail cap (spare prints or the dart shells before the electronics go in), taped shut with M8 nuts or sand inside to 279 g including the 15 g nose ballast (decision D10). Paint the nose bright. Tie the line through the tail cap holes. Route the line as in the base assembly steps (for launch it bypasses the capstan). Set the payout brake with hanging weights (G4): 40 g does not pull line off, 50 g does.

1. Check `require_seated` is back to `true` (`{"cmd":"get","key":"require_seated"}`). `aim` 20 degrees. Load the dummy, check `SW_SEATED` is closed. Fire. Walk out to the dummy only after the approach checklist (section 2).
2. Film it side-on with the phone in slow motion, tape measure on the ground in view (muzzle speed, G5).
3. Measure the range. Repeat at 30 and 36 degrees (G6).
4. Check the line paid out with no loops or overrun on the storage reel.
5. Range calibration, after 2 or 3 shots on level ground: measure each range from the ground point under the rail pivot, then on the Mac or Jetson in `~/GrappStar/base/physics`: `python3 calib.py range 20:0.5:3.6 36:0.5:4.2` (pitch:brake N:measured range m, your numbers) fits a muzzle-speed factor; `python3 ballistics.py --v-scale <factor>` rewrites `base/out/ballistics.json`, which the Jetson uses to aim (base/physics/README.md has the details).

Pass: clean exit (no rubbing marks on the dummy), it flies nose first, payout is clean, the range is within 30 percent of the ballistics table at the same pitch (measured from the ground point under the rail pivot; the table is `base/out/ballistics.json`, shown on the operator page; best is about 5 m with the two springs and the 0.5 N brake). If it fails: short range: measure the springs (B2) and the muzzle speed, then re-run the physics. Rubbing marks: check the cradle and the barrel against the dart. Loops on the reel: raise the brake a little (never over 1 N). Big range loss with clean payout: the line catches somewhere; watch the slow-motion video.

Stage 7. Reel cycle with the dummy

The base follows one fixed command sequence (BASE_SPEC section 10.1, decision D35). The operator page runs it for you; by hand it is (each line: what you send, what to wait for):

Step	Send	Wait for
after the shot	`{"cmd":"set","key":"line_m","val":4.5}` (the measured distance)	reply
wrap at once, line still slack	`{"cmd":"wrap"}` (from LAUNCH or NEUTRAL)	`WRAPPED` (up to 60 s; the drum parks at 314: cup locked, collar NEUTRAL, clutch FIRM)
(real dart only: anchor)	dart `auto`	dart ANCHORED
tidy the slack	`{"cmd":"tidy"}`	`TIDIED`
into REEL	`{"cmd":"mode","to":"REEL"}`	`MODE` ok (REEL)
tow (stage 8 only)	`{"cmd":"reel","duty":1,"until":"tension"}`	`LIMIT` holding
(real dart: release)	dart `release`, then `{"cmd":"stop"}`	`ABORTED`
reel in	`{"cmd":"reel","until":"stop"}`, then `{"cmd":"stop"}` when `line_m` reads about 1.5	`ABORTED`
unwrap	`{"cmd":"unwrap"}`	`UNWRAPPED`, then `MODE` NEUTRAL
final approach	`{"cmd":"retrieve","duty":0.3}`	`SEATED` (never seat it on the capstan)
back to launch	`{"cmd":"mode","to":"LAUNCH"}`	`MODE` ok

1. After a stage 6 shot, run the table top to bottom, skipping the anchor, tow and release rows.
2. Check the line runs on the launch path again (not round the capstan). Fire again at 30 degrees.

Pass: the wrap lays 7 turns on the capstan, reel-in works, unwrap returns the line to the launch path, the dummy seats, and the next shot pays out cleanly. Repeat 5 times. If it fails: wrap misses the capstan: check the wrap cup position at the end of `wrap`. Line still round the capstan after `unwrap`: do not fire; unwrap again and check the drum position. `DART_STUCK` after 20 s of `retrieve`: the dummy snagged; clear it by hand after the approach checklist (section 2).

Stage 8. The anchor in soil

The real dart, built and tested to the dart run sheet section 10. Use real soil (moist loam is the target).

1. Place the dart on the soil by hand, tether tied, line slack. `wrap` now, before the dart anchors (decision D22, the stage 7 table). Then send `/auto` from the operator page (or key a).
2. When the dart reports ANCHORED: standing beside the line, not in line with it, glasses on, pull the tether by hand with the luggage scale, slowly, up to 50 N or until it moves (G7).
3. HARD PREREQUISITE for any tow: CALIBRATION.md (b) free running current (`free_a`) and (e) newtons per amp (`k_n_per_a`, MEASURE_LIST G9) are done. Why: with the factory values a simulated tow reached 61 N against a 40 N limit. Re-anchor (wrap first, as in step 1). Rover chocked, everyone beside the line. Then the stage 7 table from `tidy` on: `tidy`, `mode` REEL, then the tow with `max_n` 10 N under the hand result: `{"cmd":"reel","duty":1,"max_n":40,"until":"tension"}`.

4. Send release (operator page, or `python3 -m grappstar dart release`): drills out, pods up, foot out, kick back. Then finish the stage 7 table: `stop`, reel in to about 1.5 m, `unwrap`, `retrieve`, `mode` LAUNCH.

Pass: the dart anchors on its own, holds at least 20 N in loam, the base stops at its tension limit, the release sequence frees the dart, it reels home. If it fails: augers back out: swap that motor's leads (dart run sheet section 10). Pulls out at low force: try firmer soil, and report the force (it sets the reel limit). Base overshoots the limit: redo the current calibration (G1).

Stage 9. Full mission

Before the first mission: `free_a` and `k_n_per_a` are calibrated (stage 8 step 3), `limit_n` is set (50 N), and `require_seated` is `true`.

From the operator page on the Jetson (jetson/README.md): preflight, pick a target on the Kiyo view, aim, confirm the fire prompt, flight video from the dart, landing verdict, anchor, tow, release, reel home.

1. First run: a short target well inside the range the operator page offers (3 to 4 m: the minimum is about 2.9 m and the best about 5 m with the two springs), soft soil, open ground.
2. Watch every prompt: the software stops and asks before each dangerous step.

Pass: the whole sequence runs with only the expected operator confirmations, the dart lands within 2 m of the target, anchors, the rover is pulled toward the dart, the dart releases and is reeled home. If it fails: note the mission step and the fault code in the log (`mission.jsonl` on the operator page), then repeat the stage where that step was first tested.

Expected numbers (physics model)

Compare your test results with these. They are recomputed from params.py, so after you enter the measured spring and wiper numbers and re-run the physics, they update.

From `base/physics/SUMMARY.md`*:*

Base station physics: summary

Params: base/spec/params.py v1.2. Generated by base/physics/summary.py.

Spring (each, A228, SF 1.2 on Shigley static limits)

Item	Value
Rate used / by formula	0.125 / 0.117 N/mm
Initial tension used	7.0 N
Body coils, mass	98, 53 g
Safe force (governed by)	40.9 N (hook torsion)
Safe extension (wire) / spec cap	271 / 265 mm
Surge (fixed-fixed)	24 Hz

Launch (chain spring model)

Item	Value
Stroke, ratio, pitch	241 mm, 1.0:1, 35 deg
Spring extension full / rest	265 / 24 mm
Stored energy (2 springs)	12.1 J
Carriage force at full draw	80 N
Muzzle speed	7.41 m/s
Peak acceleration, stroke time	21 g, 55 ms
Efficiency (dart KE / stored)	63 %
Carriage KE at stop, pad peak	1.65 J, 267 N (19 mm pad)
Spring KE at stop, coil clash	0.89 J, 9.6 m/s

Flight (bead-chain tether + reel model, level ground)

Item	Value
Range at 0.5 / 0.75 / 1.0 N brake	4.83 / 4.39 / 3.99 m (pitch 36)
Same shot, no tether	5.86 m
Flight time, apex (0.75 N)	0.88 s, 1.28 m
Impact speed, angle (0.75 N)	6.2 m/s, 54 deg down
Ballistics table	6 to 47 deg, best 36.0 deg: 4.38 m

Storage reel payout (LIGHT 0.5 N at full reel)

Item	Value
Reel empty mass, inertia full	46 g, 31.4 kg mm2
Line radius full / core	30.7 / 25.0 mm (brake +23 % at core)
Line pull in the stroke (spin-up)	4.94 N
Reel rpm max	2304 rpm
Overrun after landing	0.65 m in 0.28 s

Capstan and tow

Item	Value
Wraps for tow limit (mu 0.15)	2.4 raw, 4 design
Take-up needed (design wraps)	0.07 N
Tow at limit: torque, speed, current	3.23 N m, 0.143 m/s, 5.05 A
Line pull at limiter (5 N m) (12.6 V)	84 N (break 667 N)
Line pull, motor stall (no limiter, 12.6 V)	254 N
Tow sensing: line N per wiper amp above free	17.0 N/A (line = 17.0 x (I - I_free) - 10.4 N)

Drivetrain (wiper at 11.1 V with sag)

Item	Value
aim: peak torque, current, time	0.32 N m, 1.9 A, 7 s
cock: peak torque, current, time	2.93 N m, 4.7 A, 3 s
reel: peak torque, current, time	0.82 N m, 2.4 A, 110 s
tow: peak torque, current, time	3.23 N m, 5.1 A, 35 s
Wiper at limiter (5 N m), 12.6 V (with sag)	5.0 N m, 7.0 A
Wiper motor stall (no limiter), 12.6 V (with sag)	14.1 N m, 17.0 A

Harry must measure

- Spring hang test: hang 1, 2, 3 kg from one spring, measure the length each time. Slope = rate, intercept = initial tension. Every range number scales with the stored energy.
- Wiper: free speed (turns in 30 s at 12.0 V), free current, stall torque (arm + luggage scale, 1 s) and stall current. Edit common.Wiper or spec WIPER.
- Dart mass on a kitchen scale with ballast and tether knot (spec 0.279 kg).
- Slip clutch: pull the line off the full reel with a luggage scale; set 0.4 to 0.5 N (FINDINGS F5).
- Rail friction: tilt the rail with the dart on it until it slides (mu = tan angle).

13. Troubleshooting

First move for any problem: send `estop` (or pull the battery plug), then read the `fault` field in telemetry.

Base

Symptom	Likely cause	Fix
No reply from the base on the Jetson	Charge-only USB cable; cable in the UART port; wrong serial device	Data cable in the port marked USB. On the Jetson, `ls -l /dev/grappstar-base` must show a link to ttyACM0 (jetson/README.md section 4)
ESP32 resets when the wiper starts	Ground or USB power dip	Check the ESP32 GND wire to the BTS7960 GND; short USB cable; report BROWNOUT faults
Wiper does nothing, no fault	R_EN / L_EN not wired, 20 A fuse blown	Battery unplugged, check the fuse and the two enable wires
Wiper turns one way only	RPWM or LPWM loose	Re-seat the Dupont jumper
20 A fuse blows	Stall into a hard stop, short on the wiper leads	Find the bind by turning by hand; never fit a bigger fuse
Wiper runs but nothing turns, after a jam	The coupler shear pin broke (it is the torque limiter, about 5 N m, decision D26)	Battery unplugged. Find and clear the jam first. Push the pieces of the old pin out of the coupler with a 3 mm rod, push a spare printed pin (d 4, six in the print pack) in until flush, then jog gently. Print more spares from the pack if you use them up. Never replace it with a metal pin: it protects the printed gears
Fault STALL or OVERCURRENT	Something binds, springs stronger than planned	Battery unplugged, turn the train by hand, find the tight spot; redo the spring measurement
Fault DRUM_TIMEOUT	Drum N20 not turning: no 9 V, board asleep, gear slipping	Meter on DRV8833 VM (9.0 V); check AIN1 / AIN2 / GND; check the board make (MEASURE_LIST D3); check the N20 gear set screw
Fault DRUM_SENSOR or SWITCH_DISAGREE	A drum contact does not close or stays closed	Battery unplugged, ESP32 on USB only (contacts read on USB power): watch `sw` while turning the drum by the hand lever; bend or re-screw the contact
Fault ANGLE_SENSOR	AS5600 cable out, magnet too far	Re-seat the STEMMA cable; magnet 1 to 3 mm from the chip, centred
`pitch_deg` wrong after a restart	Pitch reference lost	Run the pitch part of the calibration again (section 10)
Drum stuck between positions with the power off	Expected: the worm holds it	Use the hand lever on the drum shaft end, battery unplugged. Never use the hand lever while the carriage is drawn (`cock` above 0 or `SW_HOME` open) or while the line is under tension: shifting under load can dry fire the launcher or drop the line. De-cock and slacken the line first.
Base cocked and you need to unload without firing		Send `{"cmd":"cal","what":"decock"}`: the wiper runs backward slowly and the springs unwind under the worm until `SW_HOME` closes. If it fails: treat the launcher as loaded, rail pointed down range, and fire it with the tethered dummy into the clear zone. Never hand-release the carriage

Rover and video

Symptom	Likely cause	Fix
Jetson turns off under load	Battery low, or voltage dip	Charge the LiPo; check the barrel plug is tight; check `vbat`
No dart video	VTX and RC832 on different channels; RC832 not powered	Set the RC832 to the VTX channel (scan button); check its LED and the RCA lead
Dart video is snow	Range, antenna off, bad channel	Antenna on both ends; try another channel
Kiyo X shows nothing or errors	JPEG library mismatch on JetPack	The software forces YUYV or MJPEG (jetson/README.md); unplug and replug

Dart

Symptom	Likely cause	Fix
Serial Monitor blank	USB CDC On Boot disabled	Tools > USB CDC On Boot: Enabled, re-upload
No KEDGE WiFi	XIAO not powered or crashed	Loop plug in? 5 V at the XIAO? Press reset
A motor turns the wrong way	Leads reversed	Loop plug out, swap that motor's pair (run sheet section 10)
Current trip during anchoring	Stall on a stone, or the trip set too low	Re-measure stall currents (section 14 F3) and update the tuning
INA219 or BNO085 not found	I2C wiring	z key scans; SDA and SCL must not be swapped

14. Measure list

From `docs/build/MEASURE_LIST.md`*:*

What to measure or confirm

Everything nobody could know from here. Before printing the base, do A1 to A5, A8, group B, and H1, H3, H4 (all caliper and hang tests, no electronics needed): the base parts that depend on them should not be printed until those numbers are in `base/spec/params.py` and the pipeline has been re-run (see "After you measure" at the end). Tools: caliper, multimeter, kitchen scale, luggage scale, phone camera, tape measure.

Photo rule: for every caliper reading, take a photo with the caliper on the part and the reading visible. Put the photos in `originals/measure_2026-11/` so the numbers can be checked later.

A. Wiper motor (params.py `WIPER`, set `measured=True` when done)

Item	How	Changes	Reprint
A1 Output shaft diameter	Caliper across the round part of the shaft, 3 places, take the smallest	`WIPER.shaft_d`	Wiper shaft coupler (drum parts)
A2 Shaft flats or spline	Flats: caliper across the flats (`shaft_flat`). Spline: count the teeth, caliper the outside and root diameter, photo end-on	`WIPER.shaft_flat` (note a spline in REPORT)	Wiper shaft coupler
A3 Shaft end thread and length	Thread a nut you know (M6, M8) onto it. Caliper the shaft length from the housing face to the tip	`WIPER.shaft_thread`, `WIPER.shaft_len`	Wiper shaft coupler
A4 Mount hole pattern	Lay the motor face down on paper, press so the holes mark it (or trace with a pencil). Then caliper each hole centre from the shaft centre along two square directions and each hole diameter. Photo of the paper with a ruler	`WIPER.mount_holes` as (x, y, dia) from the shaft axis	`frame_motor_adapter` and `frame_motor_saddle`
A5 Housing size	Caliper the gearbox box (length, width, height) and the motor can (diameter, length), and how far the shaft sits from each edge	`WIPER.body_box`	Frame cheeks and guard if they clash (the audit says)
A6 Free speed and free current	After the first power-on and the current-sense calibration (G1, CALIBRATION.md (b)). Motor clamped, nothing on the shaft, AS5600 magnet on the shaft. Send `{"cmd":"jog","motor":"wiper","dir":1,"ms":1500}` and paste it again every second for about 10 s (each one extends the jog; it stops 1.5 s after the last). Read `rpm`, `amps` and `vbat` in telemetry while it runs steady. Check rpm by eye: tape flag on the shaft, count turns in 10 s, rpm = turns x 6. (Do not use the meter in series for this long run. CALIBRATION.md (b) puts it in series only for single 1.5 s jogs at jog power, which the 10 A range takes; never at full power or in a stall)	`WIPER.n0_rpm`, `WIPER.free_a`	Nothing; re-run physics
A7 Stall current and stall torque	Do NOT use the meter: stall is about 18 A, over the meter's 10 A range. After base calibration (firmware/base/CALIBRATION.md), use the `amps` telemetry. Torque: clamp a 300 mm bar on the shaft, hook the luggage scale at the end, scale pulling at 90 degrees to the bar, scale anchored to the bench. Jog (1.5 s at most, repeated) and read the peak; the firmware stall trip may cut it early: note if it does. A jog runs at reduced power (firmware/base/BENCH_TEST.md step 4 gives the duty); stall torque scales with the drive, so full stall torque is about the reading divided by that duty. Torque N m = kg x 9.81 x 0.30. `python3 base/physics/calib.py wiper --v <vbat> --rpm <A6> --i-free <A6> --stall-kg <kg> --arm-mm 300 --i-stall <amps>` prints the whole WIPER block	`WIPER.stall_a`, `WIPER.stall_nm`	Nothing; re-run physics and the ballistics table
A8 Mounting boss and hub details	Caliper the boss round the output shaft (diameter `boss_d`, height `boss_h`), the hub (`hub_d`, `hub_h`), the threaded length (`thread_len`), where the motor can starts from the shaft (`can_x0`), and the bolt head and nut sizes the motor takes (`bolt_*`, M6 assumed: head 10, nut 10 AF x 5). The motor sits gearbox above the main axis (decision D20, `WIPER.orient_deg` 90): check the can clears the frame in that position	`WIPER.boss_d`, `boss_h`, `hub_d`, `hub_h`, `thread_len`, `can_x0`, `bolt_*`	`frame_motor_adapter`, `frame_motor_saddle`

B. Launch springs (params.py `SPRING`, set `measured=True` when done)

The two springs are extension springs with initial tension: they need a small force before they stretch at all, so one weight is not enough. Use three loads. Every range number scales with the energy the springs store, so this is the

most important measurement.

Item	How	Changes	Reprint
B1 Free length L0	Steel rule or tape, hook to hook (inside of the hooks), no load (the spring is longer than a caliper)	`SPRING.free_len`	Nothing
B2 Rate k and initial tension F0	Use water bottles in a shopping bag, weighed on the kitchen scale: about 1, 2 and 3 kg (W1, W2, W3 in kg). Hang each from ONE spring and measure hook to hook (L1, L2, L3). Plot or compute: k (N/mm) = (W3 - W1) x 9.81 / (L3 - L1). F0 (N) = W1 x 9.81 - k x (L1 - L0). The three points should lie on a line; if L1 equals L0 (the spring did not move), drop W1 and add a 4 kg load, but only if L3 - L0 is under 160 mm. Do both springs. Never stretch a spring longer than L0 + 250 mm. Or let the computer fit it: `python3 base/physics/calib.py spring L0 W1:L1 W2:L2 W3:L3` (kg:mm pairs) prints the rate and initial tension	`SPRING.k_n_per_mm`, `SPRING.F0_n`	Nothing unless the stroke changes (physics says); re-run physics and the ballistics table
B3 Wire and outside diameter	Caliper	`SPRING.wire`, `SPRING.od`	Spring anchors only if OD differs by more than 0.5 mm
B4 Which preload hole	Decision D30: the springs are Century C-243, rated 38.4 N maximum safe load. Full cock is 265 mm extension (about 40 N each with the estimated rate; preload 23.8 mm, stroke 241.2 mm). A fallback anchor hole set gives 250 mm at full cock. After B2, re-run the physics: if the force at full cock is over 38.4 N, use the fallback hole set	assembly choice (spring anchor holes)	Nothing

C. Parts box: confirm you have these (no new purchases)

Item	How	Changes	Reprint
C1 608 bearings (buy 10)	Look in the parts box. Needed for: storage reel (2), aim pedestal worm wheel and worm shaft (4), 4 spares	If not: The only purchase: search "608ZZ bearing 8x22x7"	
C2 M8 bolts or 8 mm steel rod, and their lengths	Look in the parts box. Needed for: axles through the 608s	If not: Printed PPA-CF axles (tell the coordinator, it is a params switch)	
C3 Worm N20 count: you need 4 (dart kick, deploy, foot, and the base selector drum)	Look in the parts box. Needed for: dart and base	If not: The kedge notes said 2 in hand and one to buy; the August order listed 8 worm N20s. Count them	
C4 MP1584 #2 (the spare from the dart build; confirm it, decision D19)	Look in the parts box. Needed for: drum N20 supply at 9.0 V	If not: No other way to run the DRV8833 from the 3S: tell the coordinator	
C5 DRV8833 #3 (freed from the dart by the new pin map)	Look in the parts box. Needed for: drum N20		
C6 100 kg load cell + HX711 (August order)	Look in the parts box. Needed for: optional line tension reading	If not: Leave it out: the firmware uses wiper current instead	
C7 Resistors: 2 x 10 k, 1 x 1 k, 1 x 680 R, 1 x 100 k, 1 x 22 k	Look in the parts box. Needed for: BTS7960 enable pull-downs, IS divider, battery divider (firmware/base/WIRING.md)	If not: Any value within 20 percent works for the pull-downs; tell fw-base if the dividers differ	
C8 Spare XT60 plugs, 14 AWG wire, two small inline fuse holders with a 2 A and a 1 A fuse	Look in the parts box. Needed for: XT60 Y harness; fuses for the MP1584 and RC832 taps	If not: Without the small fuses: use 18 AWG for those taps and keep them under 10 cm	
C9 Barrel plug 5.5 x 2.5 mm with lead	Look in the parts box. Needed for: Jetson from the LiPo	If not: Run the Jetson from its own supply on the bench; the rover needs one	
C10 Yellow RCA lead	Look in the parts box. Needed for: RC832 AV out to the DIGITNOW		
C11 USB data cable for the DevKitC, STEMMA QT to Dupont cable	Look in the parts box. Needed for: base ESP32, AS5600		

Item	How	Changes	Reprint
C12 M3 screws (lengths from the base print list), M3 nuts, M3 heat-set inserts	Look in the parts box. Needed for: printed contacts, frame joints		
C13 AS5600 magnet (recommended): any small neodymium disc (6 to 10 mm, 2 to 3 mm thick, mounted edge-on) or a 6 x 2.5 mm diametric disc. The Adafruit board does not include one	Look in the parts box. Needed for: main shaft angle	If not: the firmware has a no-magnet mode (decision D12): print the 6-bump index cam, fit the SW_INDEX contact on GPIO35, switch SW_INDEX on in firmware/base config.h (WIRING.md section 1) and re-flash. It is less precise; a magnet is better	
C14 Optional: a second pair of the launch springs (Bunnings I/N 0487961)	Look in the parts box. Needed for: range: about 5 m with two springs, about 8.5 m with four	If not: Two springs work; the base has the provision built in	
C15 8 mm steel rod (or M8 bolts) for: reel shaft S, aim worm wheel axle, storage reel axle	Look in the parts box. Needed for: reel and aim	If not: Printed PPA-CF shafts (the reel worker's fallback); tell the coordinator	
C16 Hardware the CAD assumes: M3 x 4 x 5 heat-set inserts; M3 screws x 6, 8, 10, 12 mm (frame) and M3 x 25 cap screws + nylocs (rover mount); M6 bolts and nuts for the wiper (head 10, nut 10 AF); one M8 nut (drum coupler); 6 mm pins (spring anchors); a C-clip (reel cup head); cable ties, a hose clamp, glue (magnet)	Look in the parts box. Needed for: frame, drum, launch, reel	If not: Exact counts in the base print pack / assembly steps	
C17 JST SH 4-pin (STEMMA QT) cable 400 mm or longer for the AS5600	Look in the parts box. Needed for: the 200 mm one is too short	If not: Extend with 4 soldered wires and heat shrink	
C18 Carriage stop	Nothing to find: it is a printed PLA flexure with about 19 mm travel (decision D26). TPU pads are an optional upgrade if you get TPU	none	
C19 PETG filament (brake rocker)	Look in the parts box. Needed for: reel	If not: PLA works for the first tests	
C20 How many 693ZZ / F693ZZ bearings are left after the dart (the dart uses 5 F693ZZ)	Look in the parts box. Needed for: line pulleys on the base	If not: Tell the coordinator the count	
C21 Risk coupon extras (base/pack/coupons/COUPON_TEST.md): an O-ring 20 x 1.5 (swing splitter arm hub), an e-clip for an 8 mm pin, M3 screws x 10, 12, 16, 20, a jam nut, string	Look in the parts box. Needed for: the day-one coupons and the same parts in the base	If not: tell the coordinator (the O-ring gives the splitter arm its drag; a rubber band wrap may stand in for the coupon test)	

D. Electrical labels to read

Item	How	Changes	Reprint
D1 RC832 input voltage	Read the label or the listing. Most take 7 to 24 V. If it says 12 V only, it still runs from the 3S (12.6 V full) but report it	SYSTEM_ELECTRICAL.md run P8	
D2 Jetson DC input range	Label on the Jetson's own supply and the NVIDIA dev kit page. The 3S gives 9.9 to 12.6 V in use and sags during a wiper stall. If the minimum is above 10 V, charge earlier (3.7 V per cell at rest)	SYSTEM_ELECTRICAL.md run P7	
D3 DRV8833 carrier make	The order shows Pololu 2130 (x3). Confirm the board is marked pololu (pads VIN, GND, BIN, AIN, SLP). Pololu holds SLP high on the board, which is why the base leaves SLP unwired (D9)	TEST_PLAN stage 2 fallback if it is not	
D4 DevKitC board version	Printed on the back (v1.0 or v1.1). The RGB LED pin differs; the firmware avoids both	Nothing	
D5 Video standard	When the dart video shows on the Jetson, note the size (720 x 480 = NTSC, 720 x 576 = PAL)	jetson config	

E. Rover

Item	How	Changes	Reprint
E1 Deck size and mounting holes	Tape measure the free deck area; caliper the hole positions and diameters from one corner	params.py `FRAMEWORK` (rover mount)	Base deck / rover mount
E2 Drive train and whether the Jetson drives it	Tell the coordinator what drives the wheels and what controls it	jetson rover module	Nothing

Item	How	Changes	Reprint
E3 Kiyo X height and tilt on the rover	Tape measure lens to ground; phone level app on the camera for tilt	jetson camera model (target calibration)	Nothing
E5 Rover mass, wheelbase, centre of mass	Bathroom scale for the mass; tape for wheelbase and track; centre of mass: balance the rover on a broom handle, front to back	physics `recoil.py` ROVER block (recoil check)	Nothing
E4 Base launch height	Tape measure from the ground to the main shaft axis when the base is mounted	physics (ballistics table)	Nothing

F. Dart (from the KEDGE notes, still open)

Item	How	Changes	Reprint
F1 Dart v30 is the one being built	Confirm	print pack choice	
F2 Bought part weights and the finished dart weight	Kitchen scale	`DART.mass_kg`, dart physics	
F3 Stall current of each dart motor at 2S	The dart `i` key while holding the shaft with pliers for 1 s	firmware/dart tuning values (see firmware/dart/README.md)	
F4 OTOTEC BMS size and F693ZZ flange	Caliper (pocket is 40.8 x 8 x 2.1 plus 0.5 each way)	dart geometry if it does not fit	
F5 Nose ballast	Weigh it: 15 g	flight stability	

G. Bench and field numbers (measured during the TEST_PLAN stages)

Item	How	Changes	Reprint
G1 BTS7960 current sense scale	firmware/base/CALIBRATION.md (meter in series at low duty, compare with `amps`)	firmware `set` key (stored on the ESP32)	
G2 Battery voltage reading	Meter on the LiPo vs `vbat` telemetry	firmware `set` key	
G3 AS5600 zero and drum positions	firmware/base/CALIBRATION.md	stored on the ESP32	
G4 Storage reel payout drag	A luggage scale cannot read this low: use hanging weights in LAUNCH mode. Tie 40 g (coins in a bag, weighed) to the line end over the edge of the bench: it must NOT pull line off. 50 g must pull line off slowly. That sets the brake at 0.5 N (the design value). Above 1 N costs range, 3 N ruins the flight. Then in NEUTRAL the clutch is FIRM, 5 N (decision D24): with the luggage scale, line pulls off at about 0.5 kg	slip clutch preload (reel parts)	
G5 Muzzle speed	Phone slow-motion video side-on, tape measure laid in the flight line (same distance from the phone as the dart). Count the frames the nose takes to cross 0.5 m; speed m/s = 0.5 x slow-motion fps (240 or 120) / frames	physics model, ballistics table	
G6 Range at three pitches	Tape measure from the base to the dart at 3 pitches, tether on, brake unchanged	ballistics table check (jetson uses it)	
G9 Line tension per amp	Line hooked to the luggage scale anchored to a post, base in REEL, `reel` slowly: note scale newtons and `amps` at 3 loads. The firmware ships the physics model (decision D33): line N = 17.0 x (amps - free amps) - 10.4, so a 50 N tow draws about 5.05 A (hard trip 6.5 A). The 17 is a model, so this check matters before any tow	firmware `k_n_per_a` and its offset (CALIBRATION.md (e))	
G10 Tow limit (choose)	The firmware ships `limit_n` 50 N (decision D3). Lower it with `{"cmd":"set","key":"limit_n","val":40}`; raise it only if G7 shows the anchor holds well above it (keep it below the holding force)	firmware `limit_n`	
G11 Payout brake trim	If G4 is off: add or remove printed 0.4 mm shims under thrust ring T (reel assembly steps)	reel shims (print more)	
G12 Contact gaps	Each printed contact: the M3 screw head sits about 0.9 mm above the nut (risk coupon 2; half a turn of an M3 screw is 0.25 mm) and must close halfway up its 3 mm bump. Turn the screw to set it, watch `sw` in telemetry	nothing	
G13 AS5600 air gap	Magnet face to chip: 1.0 mm design, 1 to 2 mm is the target (params), 0.5 to 3 mm still reads. Feeler: a stack of paper	nothing	

Item	How	Changes	Reprint
G14 Wiper coupler shear pin	The coupler's torque limiter is a printed PLA pin (d 4) that SHEARS at about 5 N m (3.5 to 6 N m expected). Break one spare pin on the bench: pin in the coupler, coupler held in a vice by the hub, 300 mm bar on the output side, luggage scale at 90 degrees to the bar. Note the peak: N m = kg x 9.81 x 0.30. Six spare pins are in the print pack (decision D26)	pin diameter if it breaks well outside 3.5 to 6 N m (tell the coordinator)	spare shear pins
G7 Soil holding force	Dart anchored, luggage scale on the tether, pull slowly up to 50 N, note where it moves	reel tension limit	
G8 Rail friction	Before the rail is mounted: lay the rail part on a flat board, dart in the cradle, lift one end of the board slowly until the dart slides; phone level app on the board. Friction = tan(angle)	physics (launch efficiency)	

H. Other parts the CAD assumed

Item	How	Changes	Reprint
H1 Drum N20 output shaft	Caliper the diameter (3 mm assumed) and the D flat depth	drum N20 pinion (drum_NOTES)	`drum` N20 pinion
H2 Drum N20 stall torque at 9 V	50 mm lever on the shaft, pressing on the kitchen scale; jog the drum for at most 1 s. Torque N m = kg x 9.81 x 0.05. Estimate 0.22 N m (the drum gear is 12:1 for 2.16 N m at the drum). Important: laying the wraps uses 30 to 37 percent of an assumed 0.2 N m, so a weak N20 shows up here first	drum gear ratio if it is much weaker (tell the coordinator)	`drum_drum`, `drum_n20_cradle` if the ratio changes
H3 CSK20PP keyway depths	Caliper the inner keyway (2.8 assumed) and outer keyway (1.5 assumed) depths	capstan tube key rib, capstan block rib (reel_NOTES)	capstan tube and block
H4 BTS7960 module	Height of the heatsink under the board (22 assumed) and the 4 mounting hole spacing (40 x 40 assumed)	`frame_ebay` standoffs	electronics bay
H5 DevKitC USB socket	Micro-USB (official board) or USB-C (clone). The slot fits both: just confirm, and have the right cable	nothing	nothing

After you measure

1. Fill in `docs/build/MEASURE_RESULTS.md` and put the photos in `originals/measure_2026-11/` (create the folder).
2. Easy way: open Claude Code in the repo and ask it to enter MEASURE_RESULTS.md into `base/spec/params.py` (`measured=True` in `WIPER` and `SPRING`), re-run the base pipeline and regenerate the firmware numbers.
3. By hand, in Terminal on the Mac:

```
 cd ~/GrappStar
 bash kedge/setup_mac.sh                    # once: builds kedge/.venv (Python and the CAD
libraries)
 # edit base/spec/params.py: the WIPER and SPRING blocks, measured=True
 bash base/run_all.sh base                  # assembly, audit (must end CLEAN), print pack in base/
out/base/pack
 kedge/.venv/bin/python firmware/base/tools/gen_params.py   # firmware numbers, then re-flash the
base ESP32
 python3 docs/build/make_guide.py           # rebuild this guide
```

Fields params.py does not have yet (wiper boss and hub, N20 shaft, keyway depths, BTS7960 heatsink) go to the CAD owners through MEASURE_RESULTS.md; the Claude session maps them.

4. Reprint only the parts named in the "Reprint" column. If you have not printed them yet, print after step 3.

Numbers still assumed in params.py right now

params.py version: `1.2.5`.

params.py name	State	Who fixes it
WIPER	assumed, not measured yet	MEASURE_LIST
SPRING	assumed, not measured yet	MEASURE_LIST

15. Sources and appendices

This guide is built by `docs/build/make_guide.py` from the files below. A "NOT YET" row is a section that still shows a placeholder; re-run the script after it lands.

Source	Written by	In the repo
`base/spec/BASE_SPEC.md`	coordinator	yes
`base/pack`	cad-infra (print pack)	yes
`base/out`	cad-infra (assembly pipeline)	yes
`base/out/base/guide.pdf`	cad-infra (base assembly guide, final run about 18:00)	NOT YET
`base/out/base/pack/PRINT_SHEET.md`	cad-infra (base print sheet, final run about 18:00)	NOT YET
`base/out/base/BOM.md`	cad-infra (bill of materials)	NOT YET
`base/pack/fit_coupon/COUPON.md`	cad-infra (base fit coupon)	NOT YET
`base/pack/coupons/COUPON_TEST.md`	cad-infra (risk coupons)	yes
`kedge/pack_v30/KEDGE_v30_run_sheet.pdf`	dart v30 pack (done)	yes
`firmware/base/WIRING.md`	fw-base	yes
`firmware/base/README.md`	fw-base	yes
`firmware/base/CALIBRATION.md`	fw-base	yes
`firmware/base/BENCH_TEST.md`	fw-base	yes
`firmware/base/PROTOCOL.md`	fw-base	yes
`firmware/dart/WIRING.md`	fw-dart	yes
`firmware/dart/README.md`	fw-dart	yes
`firmware/dart/API.md`	fw-dart	yes
`firmware/dart/BENCH_TEST.md`	fw-dart	yes
`jetson/README.md`	jetson	yes

Appendices attached after this page (when present): the base assembly steps PDF from `base/guide`, then the KEDGE v30 dart run sheet. In the run sheet, follow section 6 of this guide for the new dart pin map.

Printable one-pagers next to this guide: `docs/build/FIRST_DAY.md`, `Wiring_Cheat_Sheet_Base.pdf`, `Wiring_Cheat_Sheet_Dart.pdf`, `Commands_Cheat_Sheet.pdf`, `MEASURE_RESULTS.pdf` (fill-in).

Other documents in the repo: `kedge/pack_v30/KEDGE_v30_engineering_report.pdf` (dart physics and loads), `base/spec/BASE_SPEC.md` and `base/spec/DECISIONS.md` (base design and the decisions behind it), `firmware/base/PROTOCOL.md` (base serial protocol), `firmware/dart/API.md` (dart HTTP API), `jetson/INTERFACES.md` (Jetson software).

16. Glossary

Word	Meaning here
3S, 2S	Battery cells in series: 3S LiPo = 3 cells, 9.9 to 12.6 V in use; 2S 18350 = 2 cells, 6.0 to 8.4 V
AF	Across flats: the spanner size of a nut or hex (M3 nut 5.5 AF)
AS5600	Magnetic angle sensor: reads a magnet on the end of the main shaft to know the wiper angle
AWG	Wire size: smaller number = thicker wire. 14 AWG for the wiper, 22 to 28 AWG for signals
Backlash	The small free play between two gears in mesh
BASE_SPEC, params.py	The base design description and the file with every shared number (`base/spec/`)
BTS7960	The big motor driver board that runs the wiper motor in both directions
Buck (MP1584)	Small board that turns a higher voltage into a lower one, set with its brass screw
Capstan	A drum the line wraps round several times; friction from the wraps lets it pull hard
Cock / de-cock	Draw the launch springs back / let them back down slowly without firing
Crush rib	A thin printed rib that squashes to hold a bearing firmly in its seat
CSK20PP, sprag	One-way bearing: turns freely one way, locks the other
D9, D12, D27 ...	Numbered design decisions in `base/spec/DECISIONS.md`; they override older notes
Deadman	A move that stops by itself unless the same command is sent again in time (the `jog` command)
Dog clutch, collar	A sliding ring with teeth that locks the main shaft to one gear or another
Drum (selector drum)	The N20-driven barrel with grooves that moves the dog collar and lays the wraps
DRV8833	Small motor driver board for the N20 motors
E-clip	A small spring-steel clip that snaps into a groove on a pin to stop it sliding out
estop	Emergency stop command: wiper off, drum to a safe position
Fly-in	Entering REEL with the wiper creeping forward so the dog teeth find their slots
Fuse	Thin link that melts and cuts the power if the current is far too high
Gray code	The three drum contacts read as a 3-digit code that changes one digit at a time
Heat-set insert	Brass M3 thread pressed into a printed hole with a hot soldering iron
Hole compensation	Bambu Studio setting that makes printed holes slightly bigger or smaller
IS	The BTS7960's current-sense output, read by the ESP32 to know the wiper current
Jam nut	A second nut tightened against the first so a screw cannot turn
JSON line	One command or reply as text in curly brackets, for example `{"cmd":"ping"}`
Module (m1.5, m2)	Gear tooth size: pitch diameter = module x number of teeth
N20	Small 12 mm gearmotor. "Worm" N20s are right-angle and hold their position unpowered
PPA-CF	Strong carbon-filled nylon filament, for loaded gears and keyed shafts
Printed contact	A switch made from an M3 screw head touching an M3 nut
pty	A pretend serial port on the Jetson, used by the fake base for tests
Pull-down / pull-up	A resistor that holds a pin low (or high) when nothing else drives it
Self-tapper	A screw that cuts its own thread into plastic
SHCS	Socket head cap screw (hex key head), ISO 4762
Shear pin	A printed pin that breaks on purpose to protect the gears from the wiper's full torque
Slip clutch	Friction clutch that slips above a set force: the payout brake and the take-up
STEMMA QT	Adafruit's small 4-pin plug and cable (JST SH) for I2C sensors such as the AS5600
Telemetry	The status line the base sends 10 times a second (`tel`)
Tether	The Dyneema line between the base and the dart
VTX	The dart's video transmitter (5.8 GHz). Never power it without its antenna
XT60	The yellow battery plug used on the LiPo and its leads

KEDGE dart v30: build day run sheet

Dart: Ø42 x 152 mm, 1.5 mm walls, PLA on the X2D. Kick leg 0 to 201.75°, drill pair 0 to 42.25°. Collision sweep clean (kick in 102 steps to 201.75°, drills in 1° steps to 42.25°, every sub-part, exact meshes). Printed volume 91.91 cm³ (about 114.0 g if solid; less at 40% infill). About 12 hours wall clock with the two plates printing in the background. Rules for the whole day: the power loop plug stays OUT while you solder, move a wire or plug in USB. Never let the two cells touch metal together. One step at a time; each step says what you should see before you move on.

1. What is in the pack

File	What it is
print/plate_A_hull.3mf	Print plate A: hull top, hull bottom, nose, tail cap, both couplers. Already in print orientation.
print/plate_B_legs_tray.3mf	Print plate B: tray, kick leg, both drill pods, three augers. Already in print orientation.
print/fit_coupon.stl	20 minute test print: checks every fit before the long plates (section 4).
print/*.stl, step/*.step	Every printed part on its own, oriented for printing. STEP is the editable CAD (augers are faceted in STEP).
docs/wire_cut_list.csv	All 53 wires, pad to pad, colour, gauge and cut length (also section 9 of this sheet).
firmware/kedge_dart/	Firmware v3: kedge_dart.ino + kedge_logic.h. Keyboard over USB and WiFi, telemetry /status for the rover, current trip, auto-anchor (foot spins while the kick plants it, drills spin while the pods deploy), auto-on-landing. Compiled on ESP32 core 2.0.17 and 3.3.12.
firmware/test/	PC simulation of the control logic (all tests pass).
firmware/reel/reel_tension_limit	Reel sketch for the DevKitC + BTS7960: reel-in speed tapers and stops at a set tether tension (motor current or the load cell).
firmware/jetson/kedge_client.py	Rover / laptop client: status, logging, hold-a-key, auto, terminal driving, FPV overlay.
docs/KEDGE_*_engineering_report.pdf	Flight, launch and landing loads, holding force by soil, reel limit, launcher silhouette, design versions.
launcher/barrel_profile.dxf / barrel_keepout.stl	What the launcher barrel has to clear, with 1 mm clearance.
source/	The parametric generator and the whole check pipeline (run_all.sh). Every number lives in P at the top; KOV overrides make variants.

2. Parts and tools to have on the bench

Item	Qty	Note
XIAO ESP32S3, DRV8833 x3, INA219, BNO085, MP1584 (the 5.04 V one)	1 each	Headers clipped off (flush cutters), INA219 screw terminal cut off. MP1584 #2 stays spare.
OTOTEC 2S BMS stick	1	Caliper it when it arrives: the pocket under the cells is 40.8 x 8 x 2.1 plus 0.5 each way.
18350 cells, charged	2	Charge both to 4.2 V in the XTAR first.
Worm N20 (kick, deploy) + third worm N20 (foot, buy)	3	Buy the foot one single-shaft if listed; otherwise cut its lower stub to 2 mm.
Drill motors (12 x 10 x 24.27, M3 x 56 shaft)	2	
F693ZZ flanged bearings	5	2 per pod + 1 in the kick ear (bag has 10).
M3 nuts / M3 nylocs	2 / 2	Nut against each pod's inner bearing, nyloc in each auger.
M3 x 8 screws	7 + 2	7 countersunk (flat head, DIN 7991) for the radial hull screws, they sit flush with the skin; 2 pan head for the pod retainers (with washers).
M3 x 12 screw, M3 x 10 screw	1 + 1	x12 goes through the ear root into tray disc 1; x10 is the kick hub screw.
M3 washers	3	2 pod retainers + 1 between kick hub and ear bearing.
M3 grub screw	1	Foot auger on the foot N20 shaft flat.
2xAA battery holders (for their contacts)	2	You need 2 springs and 2 flat plates. Launch throws the cells backwards, so springs go at the FRONT of the cell bay and flat plates at the BACK.
470 to 1000 µF capacitor, 10 V or more	1	Across the MP1584 5 V output: rides through contact bounce on landing.
Schottky diode 1N5817 or SS14	1	In wire 18 (5 V to the XIAO): stops back-feeding USB.
Nose ballast 15 g		Steel shot or 3 to 4 M6 nuts set in 5-minute epoxy in the nose cavity. Without it the dart tumbles unless the tether is taut (engineering report, section 3).
JST-XH 3-pin pair, JST-XH 2-pin pair + a 2-pin shorting plug	1 each	Charge socket and power loop in the tail window.

Item	Qty	Note
Silicone wire 22, 24, 26, 28 AWG		Totals per colour in section 9.
Zip ties 2.5 mm, medium threadlocker (or CA), double-sided foam tape, hot glue		
Already on your bench		Caddx Ant camera, Zeus VTX + u.FL antenna, 3S LiPo + XT60 lead #1, XTAR MC2 (charges the 18350s out of the dart), breadboard and jumpers.
Tools		Soldering iron, solder, flux, multimeter, wire strippers, flush cutters, small flat screwdriver (MP1584 trimmer), heat shrink + lighter or heat gun, JST-XH crimper or pre-crimped pigtails, 5-minute epoxy, hex keys, tweezers, luggage scale (pull test).

3. Timeline

Clock	Step	Printer
0:00	4. Fit coupon	coupon (20 min)
0:30	5. Start plate A, flash the firmware	plate A (about 3 h)
1:00	6. Prepare boards, set both MP1584s, cut and label all wires	plate A
2:00	7. Solder the bench harness, power-up test, motor directions	plate A
3:30	Start plate B. Clean plate A parts, test-fit the hull, nose ballast (8a)	plate B (about 2.5 h)
4:00	8b. Battery contacts and BMS wiring off the dart	plate B
6:00	8c. Pods, couplers, augers (plate B done)	
7:00	8d. Populate the tray, battery power-up check	
8:30	8e. Close the hull, couplers, pods	
9:30	8f. Kick leg and foot	
10:15	10. Function test and calibration	
12:00	Done. Charge the cells (section 10, Charging).	

Bambu Studio settings (both plates): PLA, 0.4 nozzle, 0.16 mm layers, 4 wall loops (the 1.5 mm walls come out solid), 40% gyroid infill, top/bottom 5 layers, supports OFF, brim ON (auto) for the augers and couplers, X-Y hole compensation from the coupon (section 4). Plate times above are estimates; Studio shows the real ones.

Part	Print pose	Size on bed mm	Volume cm³
hull_top	split face down (on the bed), saddle up	121 x 50 x 35	17.41
hull_bottom	split face down, belly up	121 x 42 x 21	11.5
nose	tip down on the bed (flat Ø22), spigot up	42 x 42 x 27	8.25
tail_cap	end face down, spigot up (no supports)	42 x 42 x 15	7.13
tray	keel down on the bed; discs stand up, decks bridge 26 mm between discs	109 x 39 x 36	15.98
kick_leg	on its side (pole axis horizontal, hub face down)	119 x 15 x 15	8.7
drill_leg_L	upright, motor pocket open to the top (as installed folded)	46 x 15 x 13	3.37
drill_leg_R	upright, motor pocket open to the top (as installed folded)	46 x 15 x 13	3.37
drill_leg_L_auger	base down, nut slot sideways	17 x 17 x 73	5.5
drill_leg_R_auger	base down, nut slot sideways	17 x 17 x 73	5.5
foot_auger	base down	17 x 17 x 40	3.06
coupler_L	standing on its socket end	7 x 6 x 36	1.24
coupler_R	standing on its socket end	7 x 6 x 27	0.9

4. Fit coupon (0:00, 20 minutes)

Print fit_coupon.stl. It has, left to right: the worm N20 pocket, the drill motor pocket, the F693ZZ seat with its flange recess, the hull boss bore, the N20 D-bore, an M3 pilot, an M3 clearance hole, the pod D-bore, the 3.8 shaft clearance, a coupler peg, and a hull ring with its spigot ring.

Check	Should feel	If not
Worm N20 into the square pocket	Slides in by hand, no wobble	Tight: hole compensation +0.05. Loose: -0.05.
Drill motor into its pocket	Slides in by hand	Same as above
F693ZZ into the seat	Firm thumb press, flange flush in the recess	Too tight: +0.05. Falls out: a drop of CA on assembly day.
Coupler peg into the boss bore	Turns freely, little play	Tight: sand the peg lightly
Coupler peg D-socket onto an N20 shaft	Pushes on firmly, no rotation slop	Loose: a drop of CA on assembly
Coupler peg into the pod D-bore	Slides in, no rotation slop	
M3 screw into the 2.5 pilot	Cuts its own thread, holds	
Spigot ring into the hull ring	Push fit, no rattle	Loose: one layer of tape on the spigots

Directions used below: left = the kick-leg side, seen from the tail with the saddle on top (y plus in the CAD). The left pod is the brighter red one in the viewer.

5. Start plate A and flash the firmware (0:30)

1. Send plate_A_hull.3mf to the X2D.
2. In the Arduino IDE: board XIAO_ESP32S3, Tools > USB CDC On Boot: Enabled (the sketch will not compile otherwise). Library Manager: install Adafruit INA219 and Adafruit BNO08x.

3. Nothing else connected to the XIAO. Plug it in by USB-C, open firmware/kedge_dart/kedge_dart.ino, Upload. Re-select the board if the IDE switches it to the wrong one.
4. Serial Monitor at 115200, 'No line ending'. You should see the KEDGE ready help line (INA219 and BNO085 'not found' is normal now). If the monitor stays blank: press the XIAO reset button once, check the port and USB CDC On Boot.
5. On your phone or laptop, join WiFi KEDGE (password grappstar) and open 192.168.4.1: you get the control page. From now on you can also upload over WiFi: Arduino IDE > Port > the network port called kedge. Unplug USB.

6. Prepare boards and wires (1:00)

1. Clip every header pin flush on the XIAO and the three DRV8833 boards (flush cutters, close to the board). Cut the INA219 screw terminal off. Tin each pad you will use.
2. MP1584s, with the 3S LiPo on XT60 lead #1 and the multimeter on the output, turning the small brass screw with a small screwdriver: the dart one to 5.04 V; the spare one to 8.0 V (this is your bench motor supply in step 7). Disconnect.
3. Cut all wires to the lengths in section 9. Strip 3 mm each end, tin, and put a tape flag with the wire number on each. Always slide heat shrink onto a wire before you solder its second end.
4. DRV8833 check before any 3V3 wire: the driver chip has no logic supply pin. The pin called VIN (or VCC on some red boards) is the MOTOR supply. The 3V3 wires (25 to 27) go only to the SLP / nSLEEP / EEP pad, which wakes the driver. Meter on beep: touch the pad you plan to use and the VIN/VM pin. If it beeps, it is the motor supply: do not put 3V3 on it, or the battery voltage reaches the XIAO.
5. Diode: wire 18 has a Schottky diode (1N5817 or SS14) in it, stripe toward the XIAO, in heat shrink. It stops the 5 V buck back-feeding your Mac when USB is plugged in. Still never plug USB in while the dart is powered.

7. Solder the bench harness and test it (2:00)

Lay the boards on the bench in the order they sit in the dart (picture in section 11): sled boards (MP1584, DRV#3), XIAO + DRV#1, DRV#2 + INA219, BNO085. Solder in this order and check after each group:

1. Power: wires 10 to 13 and 15 to 24, and wire 14 at its MP1584 end only (its BMS end comes in 8b). Fit the capacitor across MP1584 OUT+ / OUT-: long leg to OUT+, the striped leg to OUT-. Snap the u.FL antenna onto the VTX now: never power a VTX without its antenna. Also solder wire 9 at its INA219 VIN+ end only (its socket end is crimped in 8b). Meter on beep: red rail to black rail must NOT beep.
2. 3V3 and ground to the logic: wires 25 to 31.
3. I2C: wires 32 to 35. Motor control: wires 36 to 43. Bridge AIN1 to BIN1 and AIN2 to BIN2 on DRV#2 with a short wire offcut.
4. Motor leads: solder wires 44 to 53 to the DRV outputs only; leave the far ends free.
5. Power-up test with the bench supply (the 8.0 V MP1584 on the LiPo): its OUT+ to the INA219 VIN+ pad, OUT- to the MP1584 IN- pad (main ground). You should see about 4.7 V on the XIAO 5V pad (5.04 minus the diode), the VTX LED on, and on the WiFi page: i reads about 8 V; z finds 0x40 and 0x4a. Disconnect the bench supply.
6. Motor directions, bench supply on again. Twist each motor lead temporarily onto its wire (no solder yet: the kick, drill and foot leads are threaded through holes later). Hold each key half a second and check:

Key	Motor	Must turn so that	If not
1	deploy N20	the output shaft turns the way that swings the pods DOWN (mark the shaft with a pen and compare with the viewer)	swap the pair on wire 44 / 45
2	kick N20	the hub would swing the leg UP over the nose	swap 46 / 47
3	drills	each drill output shaft turns: left motor clockwise seen from behind the motor, right motor anticlockwise (the augers are mirror images, so both then screw in)	one wrong: swap that motor's pair; both wrong: swap 40 / 41
4	foot N20	the foot N20 output shaft turns clockwise, seen from the shaft end (that screws the right-hand foot auger in)	swap 52 / 53

Note the free current on i for each (October bench: worms 20 to 30 mA, drill pair 60 to 70 mA). Mark each motor's lead that goes to the lower wire number. Solder the deploy N20 now (it never goes through a hole). Disconnect the bench supply.

8. Mechanical assembly

8a. Nose ballast (3:30, plate A done)

Stand the nose on its tip. Drop 15 g of steel shot or 3 to 4 M6 nuts into the cavity around the camera tube (not into the camera pocket) and cover them with 5-minute epoxy. Leave it to set while you carry on.

8b. Battery contacts and BMS, off the dart (4:00)

1. Join the two springs with wire 2 (the series link, 22 AWG) and solder wire 3 (BMS BM) to that link. Solder wire 1 to one flat plate and wire 4 to the other.
2. On the bench, solder wires 1, 3 and 4 to the BMS B-, BM and B+ pads, wire 14 to P-, wire 8 to P+, and wires 5 to 7 to B-, BM, B+ for the charge socket. Crimp or solder the JST-XH sockets on wires 5 to 7 (3-pin) and 8 / 9 (2-pin power loop).

8c. Drill pods, couplers and augers (6:00, plate B done)

1. Press one F693ZZ into the inner seat from the motor pocket side, flange toward the motor. Press the other into the nose end from outside, flange on the nose face.
2. Thread an M3 nut onto the drill motor shaft, about 3 mm from the motor face. Feed the shaft through both bearings, drop the motor into its pocket. Threadlocker on the shaft, then hold the nut with tweezers and turn the motor until the nut seats against the inner bearing. Zip-tie the motor in its groove.
3. Push an M3 nyloc into the side slot of the auger (nylon ring toward the point). Augers are handed: the LEFT pod takes drill_leg_L_auger (right-hand flight), the RIGHT pod takes drill_leg_R_auger (left-hand flight). Threadlocker on the shaft end, screw the auger on until its base boss touches the outer bearing.
4. Check: each auger spins freely with the motor, no rub on the pod nose.

8d. Populate the tray (7:00)

1. Glue the joined springs into the long recess on the FRONT cell-bay disc (nose side), one spring in front of each cell position. Glue the wire 1 plate into the BACK disc recess on the right (cell 1 side) and the wire 4 plate on the left. Lay the BMS in the channel under the cell bay.
2. Deploy N20 into the sled cradle (worm box toward the tail, output shaft across), zip tie through the groove under the cradle.
3. Stick the boards on with foam tape: DRV#3 on the keel and MP1584 on the shelf in the sled; BNO085 on deck A; XIAO (USB toward the nose) and DRV#1 on deck B; DRV#2 and INA219 on deck C; VTX on the deck over the cells. Route bundles through the notches in the discs. Antenna lead to the tail.

4. Push both sockets into the tail cap window, antenna through the top slot (wire 9 and wire 14 are already soldered from 7.1 and 8b). Tape over the charge socket now: its pins are live as soon as the cells go in.
5. Cells in: cell 1 (right) button toward the nose, cell 2 (left) button toward the tail. Each pushes in sideways, squeezing its spring, and sits hard against its back plate.
5a. Loop still out. Meter on the charge socket pins (lift the tape corner): pin 1 to 2 reads 3.6 to 4.2 V, pin 2 to 3 reads 3.6 to 4.2 V, pin 1 to 3 reads 7.2 to 8.4 V. Any negative reading: pull the cells out and check their direction.
6. Battery power-up check: check the u.FL antenna is still clicked onto the VTX, then plug the loop in. WiFi page: i reads 7.4 to 8.4 V; z finds 0x40 and 0x4a; the deploy N20 runs on 1. Pull the loop plug.

8e. Close the hull (8:30)

1. Kick N20 into the saddle on the hull top, worm box toward the nose, output shaft through both side holes. Zip tie: down one slot beside the saddle, under the skin, up the other, over the motor. Its leads go down through the hole in the saddle floor.
2. Camera into the nose pocket from the back (lens into the hole), cable out the back. Tray into the bottom half, and seat the nose spigot in the bottom half at the same time: the groove on the spigot sits over the half-rib inside the hull.
3. Thread the leads before the top half goes on: kick leads (wires 46, 47) up through the saddle floor hole; foot leads (52, 53) out through the skin hole beside the saddle; drill leads (48 to 51) out through the two flank holes. Lower the top half on.
4. Radial screws into disc 1: M3 x 8 at left z -3, right z +3 and right z -3, and the M3 x 12 through the ear root at left z +3; four M3 x 8 into the tail spigot (z ±3 both sides). The top half's rib closes the nose groove, so the nose is locked.
5. Solder the kick N20 and the two drill motors to their leads (as marked in 7.6), heat shrink (slide it on before soldering; iron on each joint 3 s at most; shrink with a heat gun on low, no lighter near the PLA).
6. Couplers: slide coupler_L in through the left boss, coupler_R through the right, turning gently until each D-socket drops onto the deploy N20 stub. Pods onto the coupler ends (D-bore), then M3 x 8 + washer into each coupler end. Fold the pods along the flanks.

8f. Kick leg and foot (9:30)

1. Press an F693ZZ into the ear from outside, flange in the recess.
2. Foot N20 into the foot housing (opening on the inboard side), output shaft up through the top hole, zip tie. Foot auger onto the shaft, grub screw onto the flat.
3. Feed the foot leads from the foot pocket through the pole channel and out the small hole near the hub. Solder them to wires 52 and 53 (as marked in 7.6): heat shrink on first, iron 3 s at most per joint, heat gun on low, no lighter near the PLA. Leave the loop round the hub.
4. Push the hub onto the kick N20 stub (D flat), put the washer between hub and ear, M3 x 10 through the ear bearing into the hub. Plug the loop in and send @ until the leg rests folded on the hull.

10. Function test and calibration (10:15)

Use a tray of damp soil or sand. Laptop on the KEDGE WiFi page; hold a key to run, let go to stop. Space bar stops everything.

Key	Should happen	If it goes the wrong way
First, in the air	Hold each key for half a second: directions were fixed in 7.6	If one is still wrong, swap it at the DRV end (open the hull)
2 (hold)	Kick leg swings up over the nose and down; the foot auger tip meets the soil near 180°	Swap wires 46 and 47
2 and 4 (hold both)	Foot auger screws IN while the kick keeps pushing, until the foot housing sits on the soil	Foot backs out: swap wires 52 and 53
1 and 3 (hold both)	Both pods swing down and back while BOTH augers spin and cut in; the dart does not twist	Pods go up: swap 44 and 45. One auger backs out: swap that motor's pair (48/49 or 50/51). Both: swap 40 and 41 at the XIAO
i during each	Note the free current, the current when the foot touches, and the stall current	Put them in kedge_logic.h (kickContactMa, kickStallMa, deployStallMa) and upload over WiFi
b	Roll and pitch of the planted dart	
a	Full auto sequence, same order as above, by itself	Space aborts
A then throw	Arms auto-anchor on landing (the dart anchors 1.5 s after it comes to rest)	Press A again to disarm

Charging: either take the cells out and use the XTAR MC2, or plug a 2S balance charger (JST-XH 3-pin) into the charge socket in the tail. Loop plug OUT while charging.
Recovery: # (drills out), ! (pods up), $ (foot out), @ (kick back). The worms hold every position with the power off.
Note: STOP (space, /stop, or a client hold ending) also aborts a running auto sequence; that is deliberate.
Pin change from the October bench: the drill pair is now on D8/D9 and the foot on D6/D7. D6/D7 are the XIAO's serial pins and flicker at every reset; the slow foot worm does not care, the drills would twitch.

9. Wire cut list (pad to pad)


#	From	To	Colour	Gauge	Cut mm	Note
1	Rear plate, cell 1 (-)	BMS B-	black	22 AWG	45	solder to the plate tab before it goes in its recess
2	Front spring, cell 1 (+)	Front spring, cell 2 (-)	red	22 AWG	45	the series link: carries the full battery current; glue both springs in the front recess
3	Front spring pair (cell 1 + / cell 2 -)	BMS BM	white	26 AWG	55	the two springs are joined by a short wire; this is the midpoint sense
4	Rear plate, cell 2 (+)	BMS B+	red	22 AWG	45	
5	BMS B-	Charge socket pin 1 (tail window)	black	26 AWG	80	JST-XH 3-pin, balance charge
6	BMS BM	Charge socket pin 2	white	26 AWG	125	
7	BMS B+	Charge socket pin 3	red	26 AWG	80	
8	BMS P+	Power loop socket pin 1 (tail window)	red	22 AWG	80	JST-XH 2-pin; the shorting plug is the ON switch
9	Power loop socket pin 2	INA219 VIN+	red	22 AWG	95	main + after the loop
10	INA219 VIN+ (same pad)	MP1584 IN+	red	22 AWG	140	buck taps before the shunt, so INA219 reads motor current only
11	INA219 VIN-	DRV#1 VM	red	22 AWG	50	motor rail 6.0-8.4 V
12	DRV#1 VM	DRV#2 VM	red	22 AWG	65	daisy chain
13	DRV#2 VM	DRV#3 VM	red	22 AWG	155	forward into the sled (keel)
14	BMS P-	MP1584 IN-	black	22 AWG	130	main ground
15	MP1584 IN- (same pad)	DRV#1 GND	black	22 AWG	120	
16	DRV#1 GND	DRV#2 GND	black	22 AWG	65	
17	DRV#2 GND	DRV#3 GND	black	22 AWG	155	
18	MP1584 OUT+ (5.04 V)	XIAO 5V via a Schottky diode (stripe toward the XIAO)	orange	24 AWG	160	set and check 5.04 V BEFORE connecting; the diode stops the buck back-feeding USB (1N5817 or SS14, in heat shrink)
19	MP1584 OUT-	XIAO GND	black	24 AWG	160	
20	MP1584 OUT+	VTX 5V in	orange	26 AWG	95	
21	MP1584 OUT-	VTX GND	black	26 AWG	95	
22	VTX 5V in (same pad)	Camera + (red)	orange	28 AWG	105	runs forward along the top through the disc notches
23	VTX GND (same pad)	Camera - (black)	black	28 AWG	105	
24	Camera video (yellow)	VTX video in	yellow	28 AWG	105	twist with the camera ground
25	XIAO 3V3	DRV#1 SLP / nSLEEP / EEP pad (NOT VCC or VIN)	red/white	28 AWG	55	wakes the driver. Check first: if the pad you picked beeps to VIN/VM on the meter, it is the motor supply: do NOT connect 3V3 to it
26	DRV#1 SLP	DRV#2 SLP	red/white	28 AWG	65	
27	DRV#2 SLP	DRV#3 SLP	red/white	28 AWG	155	
28	XIAO 3V3	INA219 VCC	red/white	28 AWG	60	
29	INA219 VCC	BNO085 VIN	red/white	28 AWG	60	
30	XIAO GND	INA219 GND	black	28 AWG	60	
31	INA219 GND	BNO085 GND	black	28 AWG	60	
32	XIAO D4	INA219 SDA	blue	28 AWG	60	I2C SDA
33	INA219 SDA	BNO085 SDA	blue	28 AWG	60	
34	XIAO D5	INA219 SCL	green	28 AWG	60	I2C SCL
35	INA219 SCL	BNO085 SCL	green	28 AWG	60	
36	XIAO D0	DRV#1 AIN1	purple	28 AWG	55	deploy
37	XIAO D1	DRV#1 AIN2	grey	28 AWG	55	deploy
38	XIAO D2	DRV#1 BIN1	purple	28 AWG	55	kick
39	XIAO D3	DRV#1 BIN2	grey	28 AWG	55	kick
40	XIAO D8	DRV#2 AIN1 + BIN1 (bridge the two pads)	purple	28 AWG	45	drills (moved off D6/D7: those twitch at reset)
41	XIAO D9	DRV#2 AIN2 + BIN2 (bridge the two pads)	grey	28 AWG	45	drills
42	XIAO D6	DRV#3 AIN1	purple	28 AWG	145	foot (slow worm, harmless if it twitches at reset)
43	XIAO D7	DRV#3 AIN2	grey	28 AWG	145	foot

#	From	To	Colour	Gauge	Cut mm	Note
44	DRV#1 AOUT1	Deploy N20 + (red)	red	26 AWG	165	motor sits in the sled cradle
45	DRV#1 AOUT2	Deploy N20 - (black)	black	26 AWG	165	
46	DRV#1 BOUT1	Kick N20 + (red)	red	26 AWG	150	out through the hole in the saddle floor
47	DRV#1 BOUT2	Kick N20 - (black)	black	26 AWG	150	
48	DRV#2 AOUT1	Drill motor LEFT + (red)	red	26 AWG	195	out the left flank hole, 30 mm loop for the pod swing
49	DRV#2 AOUT2	Drill motor LEFT - (black)	black	26 AWG	195	
50	DRV#2 BOUT1	Drill motor RIGHT - (black) SWAPPED	black	26 AWG	170	reversed on purpose: the pair counter-rotates
51	DRV#2 BOUT2	Drill motor RIGHT + (red) SWAPPED	red	26 AWG	170	
52	DRV#3 AOUT1	Foot N20 + (red)	red	26 AWG	255	out the skin hole, 60 mm loop round the hub, through the pole channel
53	DRV#3 AOUT2	Foot N20 - (black)	black	26 AWG	255	silicone wire, it flexes every deploy


Totals by gauge and colour (mm): 22 AWG black 515, 22 AWG red 675, 24 AWG orange 160, 24 AWG black 160, 26 AWG white 180, 26 AWG black 1110, 26 AWG red 1015, 26 AWG orange 95, 28 AWG orange 105, 28 AWG black 225, 28 AWG yellow 105, 28 AWG red/white 395, 28 AWG blue 120, 28 AWG green 120, 28 AWG purple 300, 28 AWG grey 300

11. Pictures


Wiring (numbers match the cut list):

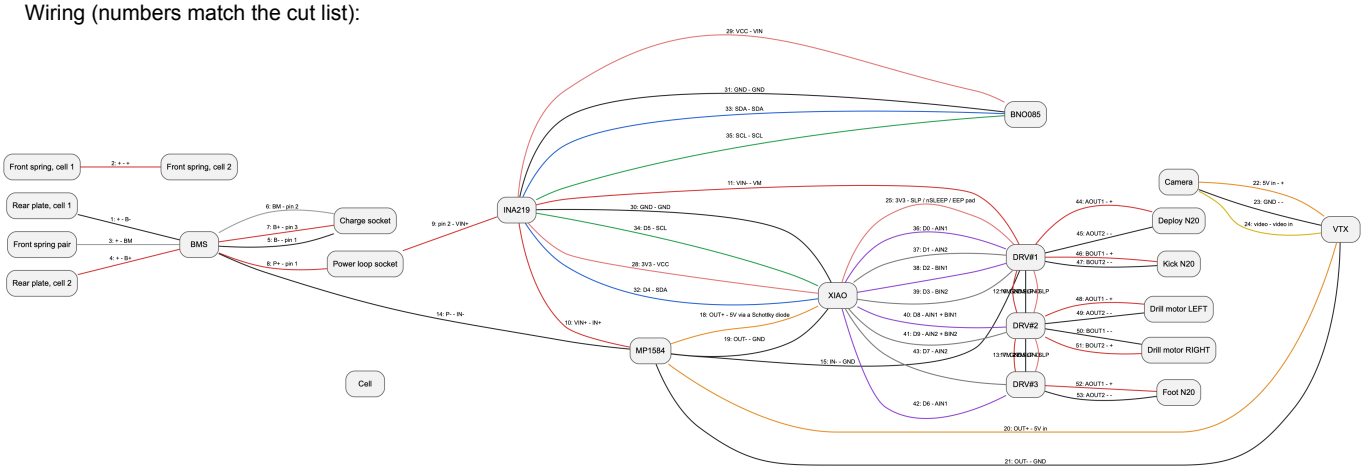


Exploded view and populated tray:

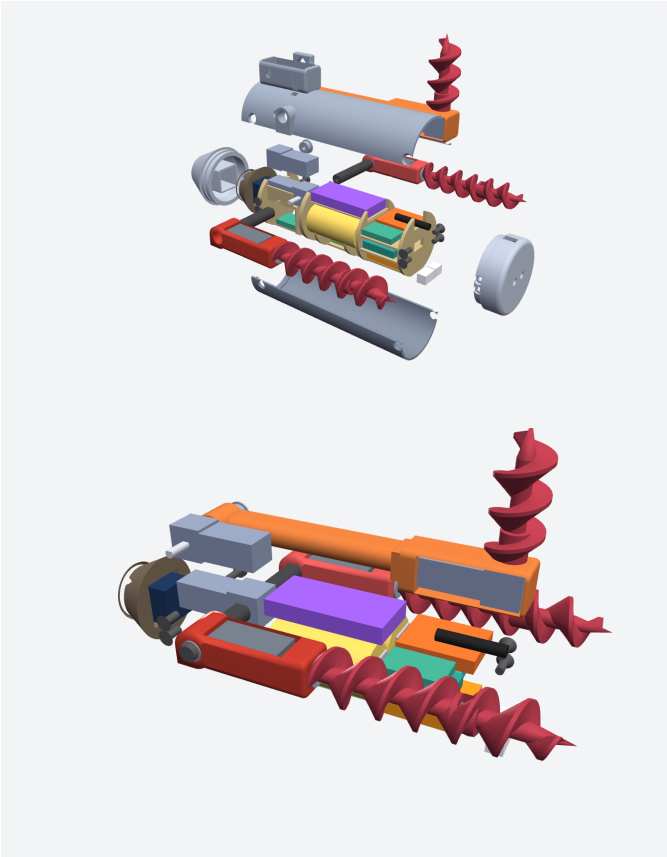

Audit sheet: 24 views of the exact print geometry (8 folded, 8 deployed, 6 mid-motion, top, under).

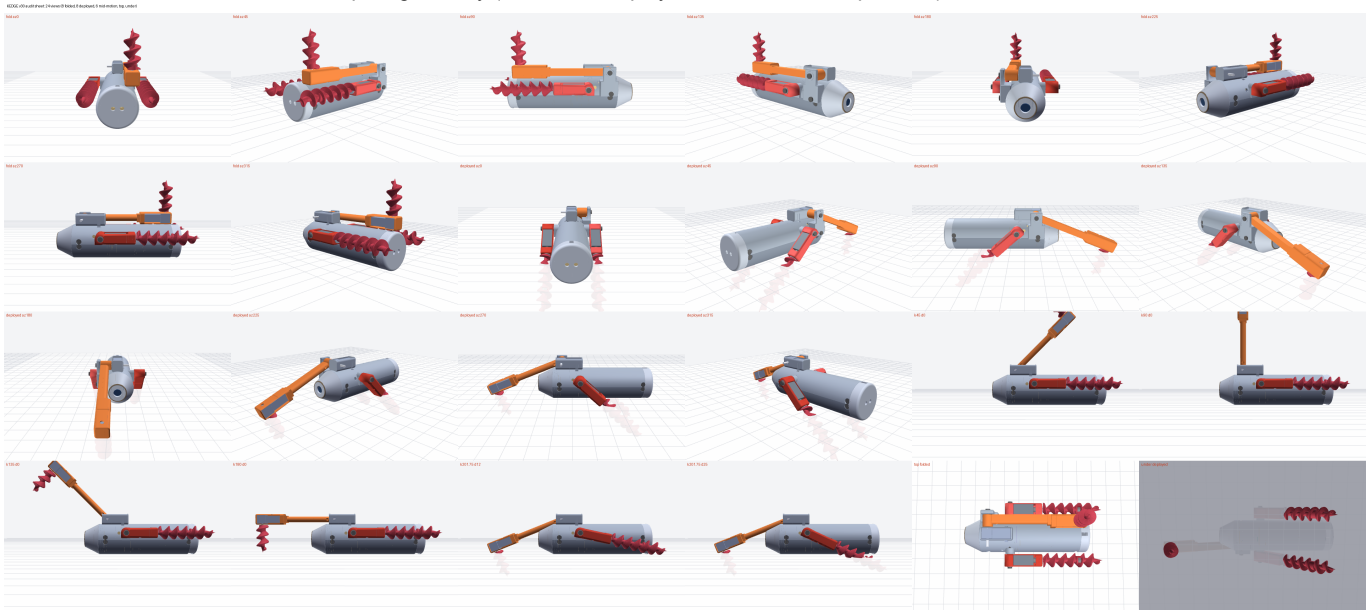

Section cuts:

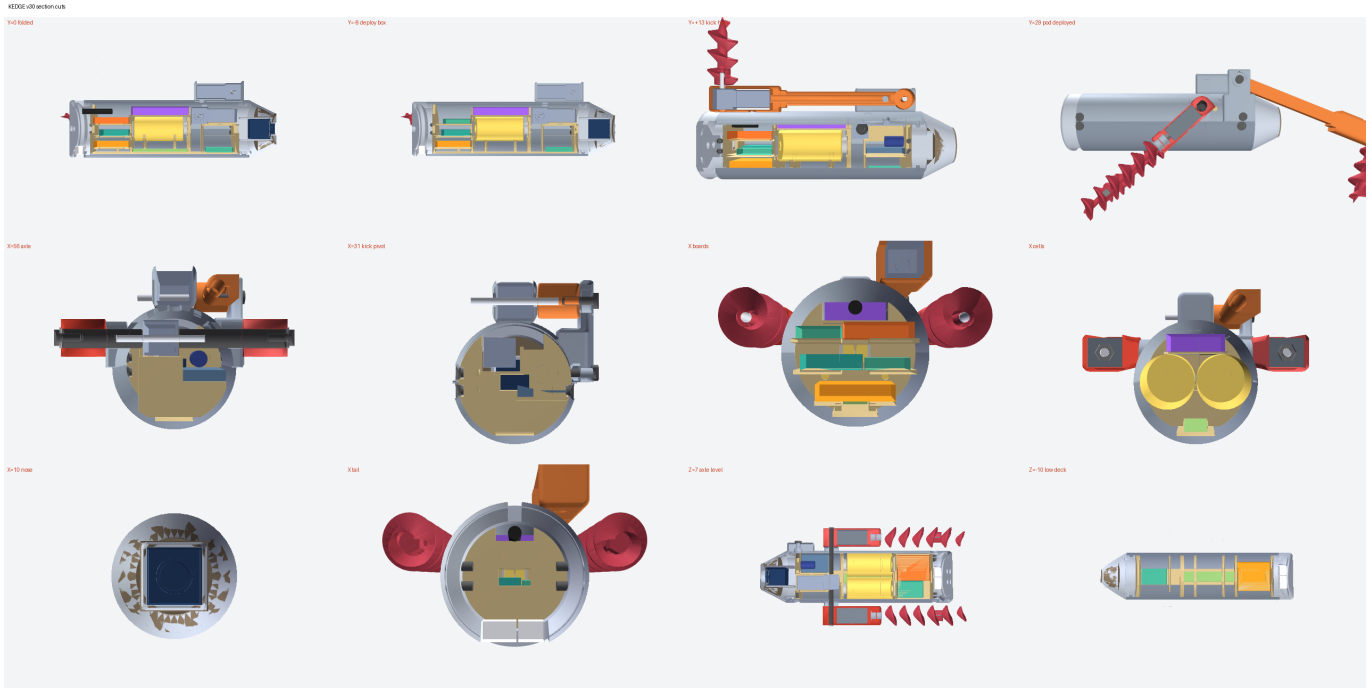

12. Design notes

• Pod thrust: the M3 nut against the inner bearing takes the auger's pull into the ground; the auger base against the outer bearing takes push. The gearbox only carries torque.
• The drill pair counter-rotates so the dart does not spin; the two augers are mirror images so both screw in.
• The deploy N20's own shaft stubs drive the pods through two printed Ø7 D couplers that run in the hull bosses.
• Tether load path: tail end wall, tail cap, 4 radial M3 into the hull. Tie the line through the two end holes round the web.
• Ground geometry: kick stops at 201.75° with the foot housing on the ground and the foot auger 35.5 mm in; drills stop at 42.25° with the pods 0.52 mm clear and the augers 44.8 mm in.
• Power: 2S straight to the DRV8833 motor rail through the INA219; one MP1584 at 5.04 V for the XIAO, VTX and camera.
• Below the centreline the hull is a plain Ø42 cylinder for the launcher cradle; the folded pods sit just above it.