KEDGE dart v34: build day run sheet

Dart: Ø42 x 152 mm, PLA on the X2D (couplers PPA-CF). Righting leg 0 to 178°, drill pods at the tail 0 to 46.75°. Collision sweep clean (leg in 179 steps, pods in 48 steps, every sub-part, exact meshes); hard stops checked (pods about 1° past 46.75° and past folded, the leg on its groove floor folded and in its bed at 179.5°). Mass about 248.0 g with the bought parts, centre of mass 0.44 mm from the hull axis (folded). Launcher fit: FITS.
Rules for the whole day: the power loop plug stays OUT while you solder, move a wire or plug in USB. Never let the two cells touch metal together. One step at a time; each step says what you should see before you move on.

1. What is new in v34 (read once)

• The drill pods moved to the TAIL. Folded they point forward along the flanks; deployed they swing down to a printed hard stop, so the drills go into the soil near the tail, under the tether.
• The tether is a short BRIDLE: one piece of the 1 mm Dyneema from the eye lug on one pod arm, through a small loop at the end of the rover line, to the eye lug on the other arm. The loop slides, so both legs share the pull. On the launcher each leg lies in a groove round the tail edge and across the flat tail face, and the loop sits in the pusher's middle hole.
• The kick leg and the foot auger are gone. A slim RIGHTING LEG lies flush in the groove along the top; its pad is the curved strip on the tail top. It swings over the nose to flip the dart upright. The foot N20 is a spare.
• 14.6 g of your ballast putty goes into the NOSE, round and under the camera tube (it helps the dart fly straight).
• Every coupler is a PRESS FIT with a drop of CA: no play between a motor and its pods or its leg. Even half a degree of play lets one pod load the worm alone.
• Both sockets are in the tail flanks under the pad: ON loop on the left, charge on the right. The USB-C window in the right flank is open down to the split so the hull top drops straight on.

2. Bought parts and consumables, in the order they go in

Part	Qty	Where it goes (step)
Seeed XIAO ESP32S3 (plain), flashed	1	deck 1, USB-C to the right flank window (5.4)
DRV8833 carrier	2	standing beside the deploy motor, left = DRV#1, right = DRV#2 (5.3)
INA219 (screw terminal removed)	1	deck 1 behind the XIAO (5.4)
BNO085	1	deck 1 behind the INA219, silkscreen arrow to the nose (5.4)
MP1584 set to 5.04 V + Schottky diode	1 each	buck on deck 2 behind the VTX; diode in the 5 V lead to the XIAO (5.4)
Electrolytic capacitor 470 to 1000 uF (up to Ø8 x 12)	1	standing on the tray's tail key behind the deploy motor, a dab of epoxy; leads to the MP1584 output (5.4)
OTOTEC 2S BMS stick	1	deck 1, left of the XIAO and INA219 (5.4)
HGLRC Zeus nano VTX + u.FL antenna	1	deck 2 (VTX), antenna along deck 1's left edge (5.4)
Caddx Ant camera	1	nose, from the back (5.6)
Lead/tungsten putty	14.6 g	pressed into the nose from the back, round and under the camera tube (5.6)
HIBATT 18350 cell	2	in line in the U saddles under deck 1: front spring, BM plate, rear plate (5.5)
Battery spring and the two flat contact plates from the AA holders	1 + 2	spring on disc 1; one plate (its solder tab up) between the cells as the BM tap; one plate on the rear disc (5.5)
Worm N20 (right-angle, self-locking)	2	leg motor in the front cradle (5.1), deploy motor in the rear cradle (5.2); motors point down
Drill gearmotor M3 x 56 threaded shaft	2	in the pod arms (6.1)
M3 nut	2	pressed in the auger hub hex pockets (6.1)
JST-XH 2-pin socket + shorting plug; JST-XH 3-pin socket	1 each	left and right flank seats, clamped by the two hull halves (6.2)
M3 x 8 countersunk screw	8	radial hull screws into the bosses on disc 1 and the rear disc (6.4)
M3 x 8 screw	2	pod caps into the pod couplers (6.5)
1 mm Dyneema (from the 20 m reel)	300 mm	the bridle (8)
CA glue, 5-minute epoxy, threadlocker, double-sided tape		every coupler fit and the skin plugs (CA); drill-lead holes and the capacitor (epoxy); drill shafts (threadlocker); DRV boards (tape)

Tools: soldering iron, flush cutters, small files, a hacksaw or a rotary tool with a cut-off disc for the leg N20 stubs (flush cutters will not cut the 3 mm steel shaft), a vice or clamp, a pencil (to press the putty), a luggage scale (bridle test), a multimeter.

3. Print

Bambu Studio: PLA, 0.4 nozzle, 0.16 mm layers, 4 wall loops (the 1.5 mm walls come out solid), 40% gyroid infill, top/bottom 5 layers. Plate C in PPA-CF (hardened nozzle, dried filament). Every STL is already in its print orientation. Print the fit coupon FIRST.

Fit coupon: fit_coupon.stl in PLA, fit_coupon_pegs.stl (two short D pegs) in PPA-CF. On the v34 row (the last row): the Ø7 peg goes into the Ø7.05 D hole (pod coupler in the arm head), the Ø6 peg into the Ø6.05 D hole (leg coupler in the cheek), and each peg's small D socket goes onto a real N20 stub (Ø3.05, flat at 1.03). Every one must press on by hand with a firm push, must not turn at all, and must not fall out. Also try the JST headers in the two seats (3-pin 10.2 tall, 2-pin 7.9). If a fit is too tight to press or it turns, tell Claude which one before printing the parts: that bore is changed and the parts reprinted.

Part	Print as	Supports	Box mm	cm3
hull_top	split face down (on the bed), crown up	tree supports ON, build plate only: the inner roof of the half shell and under the knuckle and groove floors; the pivot blocks print without (arc outlines)	132 x 55 x 21	15.64
hull_bottom	split face down, belly up	tree supports ON, build plate only: the inner roof of the half shell	132 x 42 x 21	14.16
nose	tip down on the bed (flat Ø22), spigot up	none (tip down: cone walls under 45 deg, the putty collar has a 45 deg underside)	40 x 42 x 27	7.98
tray	flat underside (z -16: saddle feet, disc bottoms, cradle tubes) on the bed; deck 1 bridges between the saddles and discs, deck 2 between its walls (enable thick bridges)	none (flat underside down: U saddle legs, disc bottoms, cradle tubes, the tail key's web); deck 1 and deck 2 bridge, enable 'thick bridges'	124 x 41 x 34	14.94
drill_leg_L	standing on the head's flat rear face (stop face) down, no supports	none (flat-bottomed head, D-bore roof bridges 5 mm)	19 x 19 x 33	3.56
drill_leg_R	standing on the head's flat rear face (stop face) down, no supports	none (flat-bottomed head, D-bore roof bridges 5 mm)	19 x 19 x 33	3.56
drill_leg_L_auger	standing on its base (point up), brim 5 mm	none (point up: 45 deg flight load faces, 45 deg roof inside the hub); brim 5 mm, the base is a thin ring	19 x 19 x 93	6.57
drill_leg_R_auger	standing on its base (point up), brim 5 mm	none (point up: 45 deg flight load faces, 45 deg roof inside the hub); brim 5 mm, the base is a thin ring	19 x 19 x 93	6.57
coupler_L	lying on its D flat (layers along the axle), PPA-CF	PPA-CF (hardened nozzle, dried filament), lying on the D flat, no supports; PLA only as a stopgap	7 x 28 x 6	0.93
coupler_R	lying on its D flat (layers along the axle), PPA-CF	PPA-CF (hardened nozzle, dried filament), lying on the D flat, no supports; PLA only as a stopgap	7 x 28 x 6	0.93
pod_cap_L	flat on the bed	none	10 x 10 x 2	0.1
pod_cap_R	flat on the bed	none	10 x 10 x 2	0.1
righting_leg	upside down (the blade crown on the bed, cheeks up), brim 5 mm (the crown touches the bed along a 5 mm strip only), tree supports under the ends of the pad arch	upside down (the blade crown on the bed, cheeks up); BRIM 5 mm (the crown touches the bed along a 5 mm strip only); tree supports under the two ends of the pad arch only; 4 walls	122 x 36 x 12	4.37
leg_coupler_L	lying on its D flat, PPA-CF	PPA-CF, lying on the D flat, no supports	6 x 7 x 6	0.15
leg_coupler_R	lying on its D flat, PPA-CF	PPA-CF, lying on the D flat, no supports	6 x 7 x 6	0.15
leg_plug_L	outer face up (a domed button), no supports	none (flat inner face down)	8 x 7 x 7	0.12
leg_plug_R	outer face up (a domed button), no supports	none (flat inner face down)	8 x 7 x 7	0.12

Plates: plate_A_hull: hull_top, hull_bottom, nose, pod_cap_L, pod_cap_R; plate_C_couplers_PPA-CF: coupler_L, coupler_R, leg_coupler_L, leg_coupler_R; plate_B_legs_tray: tray, righting_leg, drill_leg_L, drill_leg_R, drill_leg_L_auger, drill_leg_R_auger, leg_plug_L, leg_plug_R

4. Before the build

1. Flash the XIAO over USB with the firmware (firmware/dart). In v34 the kick channel drives the righting leg and the foot channel is not used.
2. Set MP1584 #2 to 5.04 V on the bench supply BEFORE it is connected to anything. Remove the INA219 screw terminal.
3. Bench-run each motor for a second on 8 V: both worm N20 (leg and deploy), both drill motors.
4. Trim BOTH output stubs of the leg N20 to 5.8 mm past the worm box faces (shaft tips 10.8 mm from the box centre) with the hacksaw or the cut-off disc: clamp the gearbox, cut slowly and let it cool. File the cut ends smooth; keep the D flats.
5. Print the plates. Check the tray's tongues (two small blocks on top of the front cradle) and the hull top's two stub slots under the knuckle: the tongues must slide into the slots.

5. Populate the tray (tray out of the hull: everything is open from above and from the sides)

5.1 Leg motor

1. Solder 26 AWG silicone leads (red +, black -) to the leg N20 end-cap tabs, bend the tabs flat.
2. Drop the motor, can first, into the FRONT cradle; the worm box rests on the cradle's front and back walls, the output shaft across the dart. The leads leave through the slot under the cradle.

5.2 Deploy motor

1. Leads on as 5.1. Drop it can first into the REAR cradle, output shaft across. Leads under the cradle.

5.3 Drivers

1. Solder the DRV8833 wires on the bench (cut list numbers), then stand DRV#1 on the left side and DRV#2 on the right side of the rear cradle, chips facing out, double-sided tape. Run the wires along the low corridors beside the cells.

5.4 Boards on the decks

1. Pre-wire each board on the bench, then slide it in from the side between deck 1 and deck 2 (there is no room for a soldering iron under deck 2).
2. Deck 1: XIAO at the front right with its USB-C at the right edge, sitting on the small tab at the deck edge (it must line up with the hull notch); INA219 behind it; BMS stick on the left; BNO085 behind the INA219, arrow to the nose.
3. Deck 2: VTX at the front, MP1584 behind it. Antenna along deck 1's left edge, XIAO FPC antenna flat on the right flank wall beside the BNO085.
4. Capacitor: stand it on the tray's tail key (the flat tongue behind the deploy motor), a dab of epoxy; long leg to MP1584 OUT+, striped leg to OUT-.

5.5 Cells

1. Glue the spring in disc 1's rear recess, its lead out through the hole in disc 1 (B-). Solder the BM wire to the solder tab of one AA-holder plate; pass the tab up through the slot in deck 1 at the cell joint.
2. Glue the other plate in the rear disc's front recess, lead through the hole (B+).
3. Turn the tray upside down. The four U saddles are open: lay cell 1 in, BASE forward against the spring; the BM plate against its button; then cell 2, base against the plate, button against the rear plate. The spring holds them. Check 7.4 to 8.4 V between B- and B+.

5.6 Camera, nose putty and harness

1. Camera into the nose from the back (lens into the 1.2 lip).
2. Nose putty: with the nose spigot up, press 14.6 g of putty in from the back with a pencil end, FRONT FIRST, round and under the camera tube (never into the camera pocket), up to the ring step about 13 mm from the tip. Press it firm: the step holds it at launch.
3. The camera's three wires go aft through the nose spigot, beside the leg cradle, through disc 1's left window to the VTX.
4. Solder the harness from the cut list (section 9), 45 wires, along the routes named there. Test with the power loop plug: XIAO boots, video on the receiver.
5. Motor direction check (now, while the drivers are reachable): put a marker dot on each motor stub. Seen from the LEFT side of the dart (nose to your right), key 1 must turn the deploy stub CLOCKWISE (that swings the drills DOWN) and key 2 must turn the leg stub CLOCKWISE (that lifts the leg off the tail and over the nose). If one turns the wrong way, swap that motor's two leads at DRV#1.

6. Close the hull, fit the pods and the leg

6.1 Drill pods (off the dart)

1. Push each drill motor into its arm's bushing, flats keying it; leads out of the neck top. A drop of CA on the can.
2. Press an M3 nut into each auger's hex pocket. Threadlocker on the shaft, screw the auger on until the hub touches the arm shoulder, back off half a turn. Left pod = right-hand flight (brighter red arm).

6.2 Hull bottom

1. Seat the two JST sockets in the lower halves of the flank seats (left = 2-pin ON loop, its seat sits a little low; right = 3-pin charge), pins inward.
2. Lower the populated tray, with the nose on its wires, straight down into the hull bottom: deck 1's edges drop into the seam groove, the tail key into the slot in the end wall, the nose spigot onto the lock rib, the cells onto the belly.

6.3 Drill leads

1. Pass each pod's two leads from outside in through the tight hole in the hull top just in front of its pivot block (before soldering), leave a 25 mm loop outside for the swing, then solder them to DRV#2 (right drill leads swapped). A dab of 5-minute epoxy seals each hole.

6.4 Hull top

1. Lower the hull top STRAIGHT DOWN: its two stub slots slide over the leg N20 stubs and onto the tray tongues, the USB-C notch drops over the XIAO receptacle onto the tray tab, the tail key goes into its end-wall slot, the rib locks the nose, the sockets are clamped. Nothing is trapped: look round the seam.
2. 8 radial M3 x 8 countersunk screws into the bosses, 4 at disc 1 and 4 at the rear disc. The heads sit flush. Do not over-tighten (they cut their own thread).

6.5 Pods on the dart (press fits, CA)

1. Dry run first: each Ø7 PPA-CF coupler must push onto the deploy stub and into its arm head with a firm push and no play. If a fit is loose, use the fit coupon to choose a reprint.
2. One side at a time: a drop of CA in the coupler's stub socket and a thin film on its D. Hold the arm FOLDED, ON ITS FOLD STOP (pod pointing forward along the flank, head down on the block). Push the coupler through the arm head and the block bore onto the stub (flat up) until it is home. Then the other side, the same way.
3. At once, while the CA is still setting: press key ! (pods up) and hold it for 2 s so the worm drives to stall toward fold with both pods on their fold stops. Leave it 5 minutes.
4. Pod cap + M3 x 8 into each coupler end.
5. Power the deploy motor slowly: both pods swing down together to the stop and back to folded. They must stop on the printed stops, not on the motor. Wiggle each pod by hand: nothing may move.

6.6 Righting leg (press fits, CA)

1. Lay the leg folded: cheeks into the two side pockets, blade flat on the groove floor (its fold stop), pad on the tail top.
2. A drop of CA in each Ø6 leg coupler's stub socket and on its D. Push each coupler (PPA-CF) in through the plug counterbore on the flank, through the cheek and the knuckle wall onto the leg N20 stub (flat up).
3. At once: press key @ (leg back) for 2 s so the worm drives to stall toward fold with the leg on its groove floor. Leave it 5 minutes.
4. Press the two skin plugs in flush (a drop of CA). Their blind bores hold the couplers and carry the leg.
5. Power the leg motor slowly: the leg swings over the top to its bed in the nose (about 178°) and back flush into the groove. Wiggle it: nothing may move.

7. Function test

1. ON plug: make its shorting loop from a short wire so it folds flat down against the flank, and tape it there (towed, the left bridle leg runs about 5 mm off the skin right over this socket; a loop sticking out could be pulled and switch the dart off). Plug in: XIAO and video up, IMU reads level.
2. Key 1: the drills swing DOWN, key 2: the leg lifts off the tail and swings over the nose (else swap that motor's leads at DRV#1, 5.6). Pods down to the stops with the drills spinning (left and right counter-rotate), then up.
3. Service: pry the two skin plugs, pull the leg couplers (CA: they may need a twist), remove the 8 radial screws and lift the hull top. Everything is reachable.

8. Bridle

1. Cut 300 mm of the 1 mm Dyneema. Tie the rover line's end into a small figure-8 loop (a loop the bridle slides through, about 5 mm inside).
2. Thread one end of the bridle through the left eye lug (the Ø3.2 hole low on the left arm head) and tie a BOWLINE with the knot on the OUTSIDE face of the lug, then a double overhand stopper on the tail. Trim the tail to 5 mm, a drop of CA on the knot. Keep the knot and tail clear of the auger hub just in front of the lug.

3. Pass the free end through the rover line's figure-8 loop, then through the right eye lug and tie it the same way, so that with the loop pulled to the middle each leg is 78 mm from its eye to the loop.
4. Test: hook a luggage scale into the figure-8 loop, hold the dart and pull 6 kg for a few seconds. Nothing may slip or stretch. Check the knots again.
5. Loading on the launcher: first press key ! (pods up) for 1 s so both pods sit hard on their fold stops. Put the dart on the cradle. Lay each leg from its eye aft past the OUTSIDE of the arm head, over the flank into the groove round the tail edge, and along the groove across the tail face to its end near the middle. Put the figure-8 loop into the pusher's middle hole (it sits about 26 mm behind the tail face), legs still in their grooves. Nothing may lie across the flat tail face outside the grooves: the pusher pushes there. The ON plug's loop stays flat under the left leg.

9. Wire cut list (pad to pad)


#	From	To	Colour	Gauge	mm	Note
1	Front spring (B-, cell 1 base)	BMS B-	black	22 AWG	80	through the lead hole in disc 1, up beside the leg cradle, onto deck 1
2	BM strip tab (between the cells)	BMS BM	white	26 AWG	85	the strip tab comes up through the slot in deck 1 at the cell joint; solder it before the cells go in
3	Rear plate (B+, cell 2 button)	BMS B+	red	22 AWG	120	through the lead hole in the rear disc, up behind it, forward on deck 1
4	BMS B-	Charge socket pin 1 (right flank seat)	black	26 AWG	160	JST-XH 3-pin, balance charge; right corridor, past DRV#2, into the seat
5	BMS BM	Charge socket pin 2 (right flank seat)	white	26 AWG	160	
6	BMS B+	Charge socket pin 3 (right flank seat)	red	26 AWG	160	
7	BMS P+	Power loop socket pin 1 (left flank seat)	red	22 AWG	140	JST-XH 2-pin; the shorting plug is the ON switch
8	Power loop socket pin 2	INA219 VIN+	red	22 AWG	175	main + after the loop
9	INA219 VIN+ (same pad)	MP1584 IN+	red	22 AWG	80	buck taps before the shunt (up to deck 2)
10	INA219 VIN-	DRV#1 VM	red	22 AWG	170	motor rail 6.0-8.4 V, left corridor
11	DRV#1 VM	DRV#2 VM	red	22 AWG	70	under the deploy cradle
12	BMS P-	MP1584 IN-	black	22 AWG	70	main ground
13	MP1584 IN- (same pad)	DRV#1 GND	black	22 AWG	115	
14	DRV#1 GND	DRV#2 GND	black	22 AWG	70	
15	MP1584 OUT+ (5.04 V)	XIAO 5V via a Schottky diode (stripe toward the XIAO)	orange	24 AWG	110	set and check 5.04 V BEFORE connecting; 1N5817 or SS14 in heat shrink
16	MP1584 OUT-	XIAO GND	black	24 AWG	110	
17	MP1584 OUT+	VTX 5V in	orange	26 AWG	50	both on deck 2
18	MP1584 OUT-	VTX GND	black	26 AWG	50	
19	VTX 5V in (same pad)	Camera + (red)	orange	28 AWG	140	forward through disc 1, beside the leg cradle into the nose
20	VTX GND (same pad)	Camera - (black)	black	28 AWG	140	
21	Camera video (yellow)	VTX video in	yellow	28 AWG	140	twist with the camera ground
22	XIAO 3V3	DRV#1 SLP / nSLEEP / EEP pad (NOT VCC or VIN)	red/white	28 AWG	170	wakes the driver; meter check first (WIRING.md step B6)
23	DRV#1 SLP	DRV#2 SLP	red/white	28 AWG	70	
24	XIAO 3V3	INA219 VCC	red/white	28 AWG	60	
25	INA219 VCC	BNO085 VIN	red/white	28 AWG	60	deck 1 neighbours
26	XIAO GND	INA219 GND	black	28 AWG	60	
27	INA219 GND	BNO085 GND	black	28 AWG	60	
28	XIAO D4	INA219 SDA	blue	28 AWG	60	I2C SDA
29	INA219 SDA	BNO085 SDA	blue	28 AWG	60	
30	XIAO D5	INA219 SCL	green	28 AWG	60	I2C SCL
31	INA219 SCL	BNO085 SCL	green	28 AWG	60	
32	XIAO D0	DRV#1 AIN1	purple	28 AWG	170	deploy
33	XIAO D1	DRV#1 AIN2	grey	28 AWG	170	deploy
34	XIAO D2	DRV#1 BIN1	purple	28 AWG	170	righting leg (was kick)
35	XIAO D3	DRV#1 BIN2	grey	28 AWG	170	righting leg (was kick)
36	XIAO D8	DRV#2 AIN1 (only AIN1: NO bridge to BIN1)	purple	28 AWG	155	drills
37	XIAO D9	DRV#2 AIN2 (only AIN2: NO bridge to BIN2)	grey	28 AWG	155	drills
38	DRV#1 AOUT1	Deploy N20 + (red)	red	26 AWG	50	down to the end-cap tabs under the deploy cradle
39	DRV#1 AOUT2	Deploy N20 - (black)	black	26 AWG	50	
40	DRV#1 BOUT1	Leg N20 + (red)	red	26 AWG	175	left corridor forward, through disc 1, to the end-cap tabs under the leg cradle
41	DRV#1 BOUT2	Leg N20 - (black)	black	26 AWG	175	
42	DRV#2 AOUT1	Drill motor LEFT + (red)	red	26 AWG	135	up in front of the deploy motor, out the left tight hole, 25 mm loop into the pod neck at the end cap (silicone wire)
43	DRV#2 AOUT2	Drill motor LEFT - (black)	black	26 AWG	135	


#	From	To	Colour	Gauge	mm	Note
44	DRV#2 AOUT1 (same pad as the LEFT red)	Drill motor RIGHT - (black) SWAPPED	black	26 AWG	115	reversed on purpose: the pair counter-rotates
45	DRV#2 AOUT2 (same pad as the LEFT black)	Drill motor RIGHT + (red) SWAPPED	red	26 AWG	115	


Totals by gauge and colour (mm): 22 AWG black 335, 22 AWG red 755, 24 AWG black 110, 24 AWG orange 110, 26 AWG black 685, 26 AWG orange 50, 26 AWG red 635, 26 AWG white 245, 28 AWG black 260, 28 AWG blue 120, 28 AWG green 120, 28 AWG grey 495, 28 AWG orange 140, 28 AWG purple 495, 28 AWG red/white 360, 28 AWG yellow 140


10. Pictures

Exploded view, and the build stages: populated tray, tray in the hull bottom, hull closed, complete.

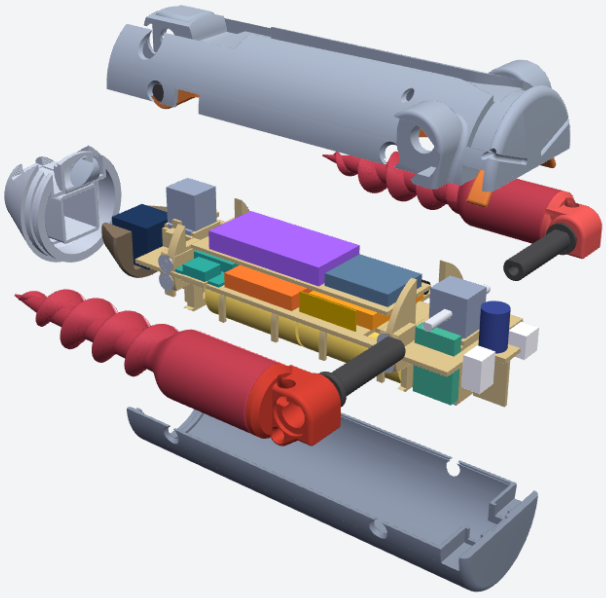


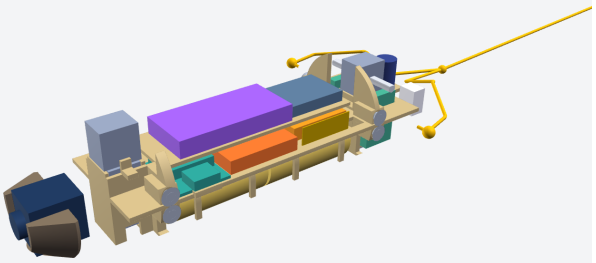

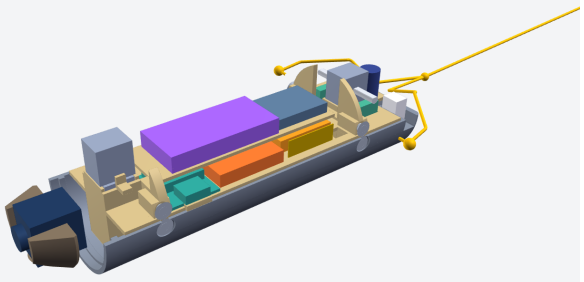


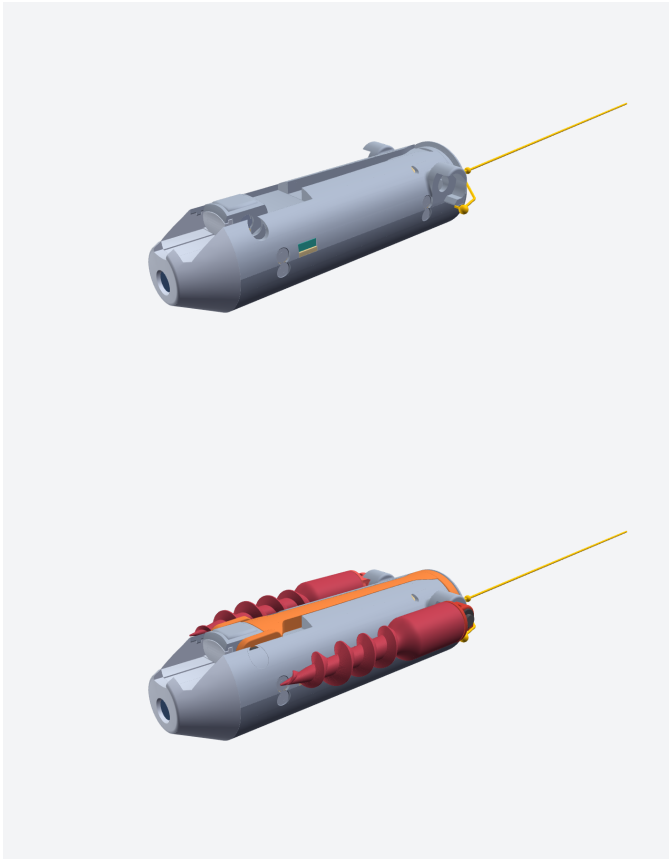

Wiring (numbers match the cut list):

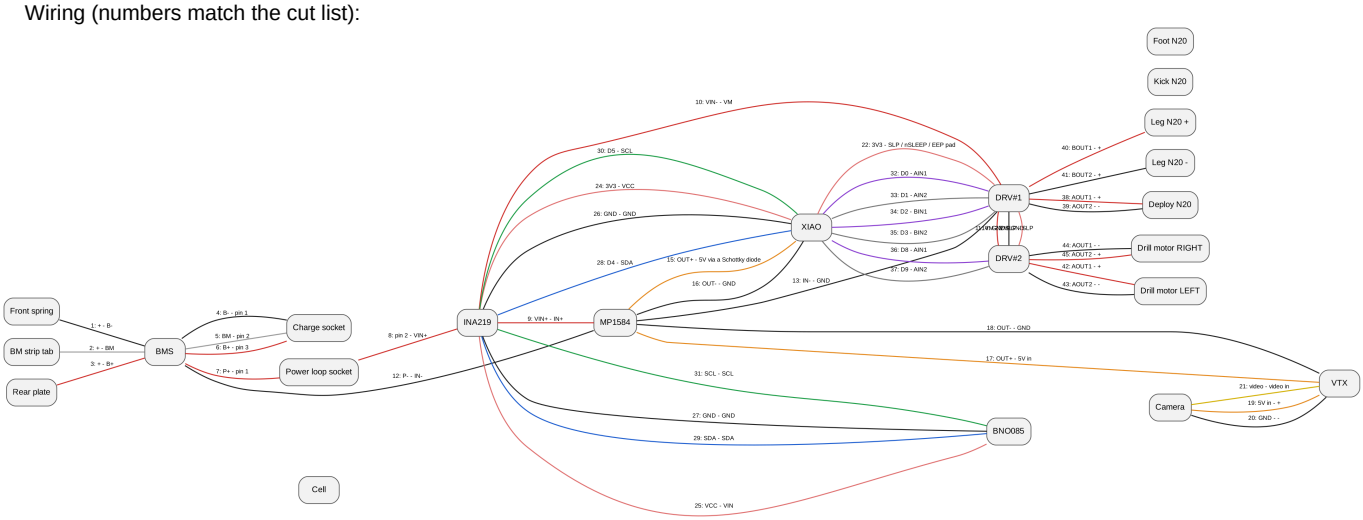

Audit sheet: 24 views of the exact print geometry.

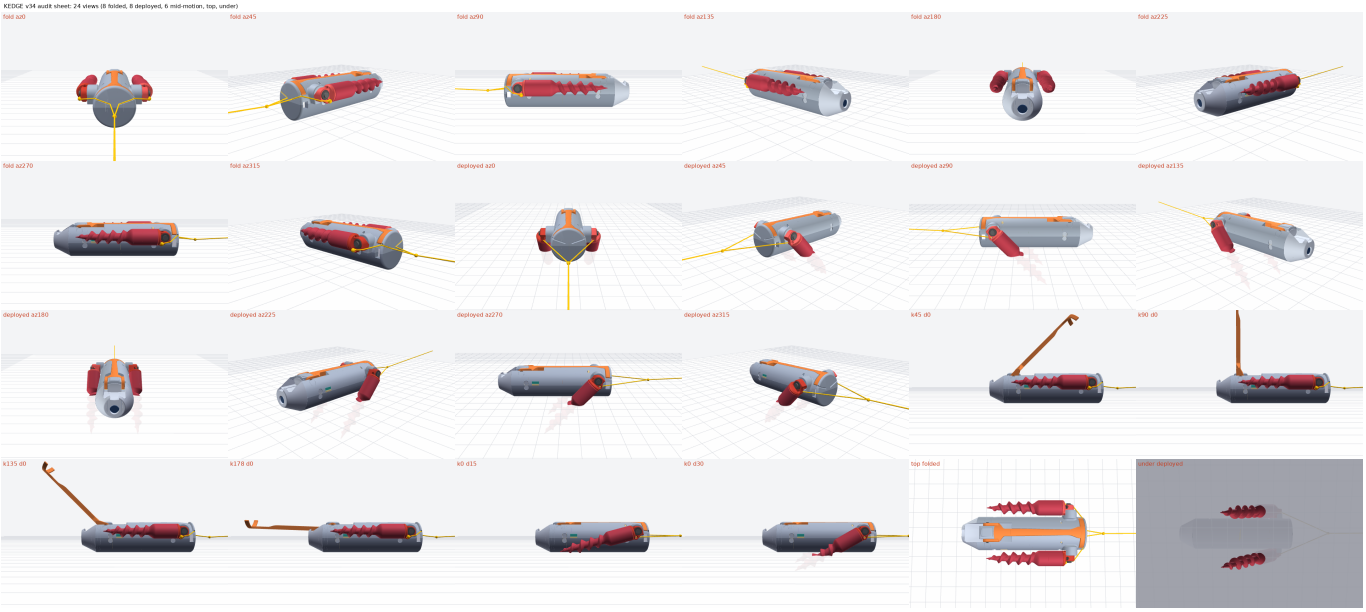

Section cuts:

