KEDGE dart v35: build day run sheet

Dart: Ø42 x 152 mm, PLA on the X2D (couplers PPA-CF). Righting leg 0 to 178°, drill pods hinged at the front, 0 to 46.75°. Collision sweep clean (leg in 179 steps, pods in 48 steps, every sub-part, exact meshes); hard stops checked (pods about 1° past 46.75° and past folded, the leg on its groove floor folded and in its bed at 179.5°). Mass about 249.6 g with the bought parts, centre of mass 0.39 mm from the hull axis (folded). Launcher fit: FITS.
Rules for the whole day: the power loop plug stays OUT while you solder, move a wire or plug in USB. Never let the two cells touch metal together. One step at a time; each step says what you should see before you move on.

1. What is new in v35 (read once)

• The drill pods hinge at the FRONT (just behind the leg hinge) and fold BACK along the flanks. Deployed they swing down to a printed hard stop and the drills rake BACK toward the tether, like tent pegs: the tips go into the soil near the tail, under the line. The tow pushes each pod onto its stop, so the deploy worm carries nothing in the tow.
• The pods are the v34 pods turned round and swapped over: the v34 RIGHT pod (arm, auger, motor, coupler, cap) is now the LEFT pod and the v34 left pod is the right one. So the LEFT pod has the left-hand auger and its drill leads are the swapped pair (cut list 44, 45).
• The deploy motor and the two drivers moved to the front, right behind disc 1; the cells sit further back. The deploy turns the OTHER way from v34: on a motor wired as v34, swap its two leads at DRV#1 AOUT1 / AOUT2 (5.6 checks it).
• The right pod covers the USB-C window, folded or deployed: flash over USB before the pods are fitted (4 and 6.4), then over WiFi (OTA, port kedge).
• Reprint from v34: hull_top, hull_bottom, tray, righting_leg. Everything else (nose, arms, augers, couplers, pod caps, leg couplers, skin plugs) is the same part.

Same as v34 (for a fresh build)

• The tether ties straight to the TAIL: the rover line goes in one of the two small holes in the middle of the tail face, out the other, and is tied to itself. It runs straight back through the launcher pusher's middle hole. (The small eye lugs on the pod arms are spare; leave them empty.)
• No kick leg and no foot auger: a slim RIGHTING LEG lies flush in the groove along the top; its pad is the curved strip on the tail top. It swings over the nose to flip the dart upright. The foot N20 is a spare.
• 14.6 g of your ballast putty goes into the NOSE, round and under the camera tube (it helps the dart fly straight).
• Every coupler is a PRESS FIT with a drop of CA: no play between a motor and its pods or its leg. Even half a degree of play lets one pod load the worm alone.
• Both sockets are in the tail flanks under the pad: ON loop on the left, charge on the right.

2. Bought parts and consumables, in the order they go in

Part	Qty	Where it goes (step)
Seeed XIAO ESP32S3 (plain), flashed	1	deck 1, USB-C to the right flank window (5.4)
DRV8833 carrier	2	standing beside the deploy motor behind disc 1, left = DRV#1, right = DRV#2 (5.3)
INA219 (screw terminal removed)	1	deck 1 behind the XIAO (5.4)
BNO085	1	deck 1 behind the INA219, silkscreen arrow to the nose (5.4)
MP1584 set to 5.04 V + Schottky diode	1 each	buck on deck 2 behind the VTX; diode in the 5 V lead to the XIAO (5.4)
Electrolytic capacitor 470 to 1000 uF (up to Ø8 x 12)	1	standing on the tray's tail key behind the rear disc, a dab of epoxy; leads to the MP1584 output (5.4)
OTOTEC 2S BMS stick	1	deck 1, left of the XIAO and INA219 (5.4)
HGLRC Zeus nano VTX + u.FL antenna	1	deck 2 (VTX), antenna along deck 1's left edge (5.4)
Caddx Ant camera	1	nose, from the back (5.6)
Lead/tungsten putty	14.6 g	pressed into the nose from the back, round and under the camera tube (5.6)
HIBATT 18350 cell	2	in line in the U saddles under deck 1: front spring, BM plate, rear plate (5.5)
Battery spring and the two flat contact plates from the AA holders	1 + 2	spring on disc 1b (the thin disc right behind the deploy motor); one plate (its solder tab up) between the cells as the BM tap; one plate on the rear disc (5.5)
Worm N20 (right-angle, self-locking)	2	leg motor in the front cradle (5.1), deploy motor in the second cradle right behind disc 1 (5.2); motors point down
Drill gearmotor M3 x 56 threaded shaft	2	in the pod arms (6.1)
M3 nut	2	pressed in the auger hub hex pockets (6.1)
JST-XH 2-pin socket + shorting plug; JST-XH 3-pin socket	1 each	left and right flank seats, clamped by the two hull halves (6.2)
M3 x 8 countersunk screw	8	radial hull screws into the bosses on disc 1 and the rear disc (6.4)
M3 x 8 screw	2	pod caps into the pod couplers (6.5)
1 mm Dyneema (from the 20 m reel)	the rover line	the tether (8)

Part	Qty	Where it goes (step)
CA glue, 5-minute epoxy, threadlocker, double-sided tape		every coupler fit and the skin plugs (CA); drill-lead holes and the capacitor (epoxy); drill shafts (threadlocker); DRV boards (tape)

Tools: soldering iron, flush cutters, small files, a hacksaw or a rotary tool with a cut-off disc for the leg N20 stubs (flush cutters will not cut the 3 mm steel shaft), a vice or clamp, a pencil (to press the putty), a luggage scale (tether test), a multimeter.

3. Print

Bambu Studio: PLA, 0.4 nozzle, 0.16 mm layers, 4 wall loops (the 1.5 mm walls come out solid), 40% gyroid infill, top/bottom 5 layers. Plate C in PPA-CF (hardened nozzle, dried filament). Every STL is already in its print orientation. Print the fit coupon FIRST.

Fit coupon: fit_coupon.stl in PLA, fit_coupon_pegs.stl (two short D pegs) in PPA-CF. On the v34 row (the last row): the Ø7 peg goes into the Ø7.05 D hole (pod coupler in the arm head), the Ø6 peg into the Ø6.05 D hole (leg coupler in the cheek), and each peg's small D socket goes onto a real N20 stub (Ø3.05, flat at 1.03). Every one must press on by hand with a firm push, must not turn at all, and must not fall out. Also try the JST headers in the two seats (3-pin 10.2 tall, 2-pin 7.9). If a fit is too tight to press or it turns, tell Claude which one before printing the parts: that bore is changed and the parts reprinted.

Part	Print as	Supports	Box mm	cm3
hull_top	split face down (on the bed), crown up	tree supports ON, build plate only: the inner roof of the half shell and under the knuckle and groove floors; the pivot blocks print without (arc outlines)	132 x 55 x 21	15.64
hull_bottom	split face down, belly up	tree supports ON, build plate only: the inner roof of the half shell	132 x 42 x 21	14.14
nose	tip down on the bed (flat Ø22), spigot up	none (tip down: cone walls under 45 deg, the putty collar has a 45 deg underside)	40 x 42 x 27	7.98
tray	flat underside (z -16: saddle feet, disc bottoms, cradle tubes) on the bed; deck 1 bridges between the saddles and discs, deck 2 between its walls (enable thick bridges)	none (flat underside down: U saddle legs, disc bottoms, cradle tubes, the tail key's web); deck 1 and deck 2 bridge, enable 'thick bridges'	124 x 41 x 33	16.51
drill_leg_L	standing on the head's flat rear face (stop face) down, no supports	none (flat-bottomed head, D-bore roof bridges 5 mm)	19 x 19 x 33	3.56
drill_leg_R	standing on the head's flat rear face (stop face) down, no supports	none (flat-bottomed head, D-bore roof bridges 5 mm)	19 x 19 x 33	3.56
drill_leg_L_auger	standing on its base (point up), brim 5 mm	none (point up: 45 deg flight load faces, 45 deg roof inside the hub); brim 5 mm, the base is a thin ring	19 x 19 x 93	6.57
drill_leg_R_auger	standing on its base (point up), brim 5 mm	none (point up: 45 deg flight load faces, 45 deg roof inside the hub); brim 5 mm, the base is a thin ring	19 x 19 x 93	6.57
coupler_L	lying on its D flat (layers along the axle), PPA-CF	PPA-CF (hardened nozzle, dried filament), lying on the D flat, no supports; PLA only as a stopgap	7 x 28 x 6	0.93
coupler_R	lying on its D flat (layers along the axle), PPA-CF	PPA-CF (hardened nozzle, dried filament), lying on the D flat, no supports; PLA only as a stopgap	7 x 28 x 6	0.93
pod_cap_L	flat on the bed	none	10 x 10 x 2	0.1
pod_cap_R	flat on the bed	none	10 x 10 x 2	0.1
righting_leg	upside down (the blade crown on the bed, cheeks up), brim 5 mm (the crown touches the bed along a 5 mm strip only), tree supports under the ends of the pad arch	upside down (the blade crown on the bed, cheeks up); BRIM 5 mm (the crown touches the bed along a 5 mm strip only); tree supports under the two ends of the pad arch only; 4 walls	122 x 36 x 12	4.09
leg_coupler_L	lying on its D flat, PPA-CF	PPA-CF, lying on the D flat, no supports	6 x 7 x 6	0.15
leg_coupler_R	lying on its D flat, PPA-CF	PPA-CF, lying on the D flat, no supports	6 x 7 x 6	0.15
leg_plug_L	outer face up (a domed button), no supports	none (flat inner face down)	8 x 7 x 7	0.12
leg_plug_R	outer face up (a domed button), no supports	none (flat inner face down)	8 x 7 x 7	0.12

Plates: plate_A_hull: hull_top, hull_bottom, nose, pod_cap_L, pod_cap_R; plate_C_couplers_PPA-CF: coupler_L, coupler_R, leg_coupler_L, leg_coupler_R; plate_B_legs_tray: tray, righting_leg, drill_leg_L, drill_leg_R, drill_leg_L_auger, drill_leg_R_auger, leg_plug_L, leg_plug_R

4. Before the build

1. Flash the XIAO over USB with the firmware (firmware/dart, pin map as v34): the kick channel drives the righting leg, the foot channel is not used. Check that OTA works (Arduino IDE, network port kedge): once the pods are on, the USB-C is covered.
2. Set MP1584 #2 to 5.04 V on the bench supply BEFORE it is connected to anything. Remove the INA219 screw terminal.
3. Bench-run each motor for a second on 8 V: both worm N20 (leg and deploy), both drill motors.
4. Trim BOTH output stubs of the leg N20 to 5.8 mm past the worm box faces (shaft tips 10.8 mm from the box centre) with the hacksaw or the cut-off disc: clamp the gearbox, cut slowly and let it cool. File the cut ends smooth; keep the D flats.
5. Print the plates. Check the tray's tongues (two small blocks on top of the front cradle) and the hull top's two stub slots under the knuckle: the tongues must slide into the slots.

5. Populate the tray (tray out of the hull: everything is open from above and from the sides)

5.1 Leg motor

1. Solder 26 AWG silicone leads (red +, black -) to the leg N20 end-cap tabs, bend the tabs flat.
2. Drop the motor, can first, into the FRONT cradle; the worm box rests on the cradle's front and back walls, the output shaft across the dart. The leads leave through the slot under the cradle.

5.2 Deploy motor

1. Leads on as 5.1. Drop it can first into the SECOND cradle (between disc 1 and disc 1b), output shaft across. Leads under the cradle.

5.3 Drivers

1. Solder the DRV8833 wires on the bench (cut list numbers), then stand DRV#1 on the left side and DRV#2 on the right side of the deploy cradle, chips facing out, double-sided tape. Their wires to the boards go back over disc 1b through its top window; the leg wires go forward through disc 1's left window.

5.4 Boards on the decks

1. Pre-wire each board on the bench, then slide it in from the side between deck 1 and deck 2 (there is no room for a soldering iron under deck 2).
2. Deck 1: XIAO at the front right with its USB-C at the right edge, sitting on the small tab at the deck edge (it must line up with the hull notch); INA219 behind it; BMS stick on the left; BNO085 behind the INA219, arrow to the nose.
3. Deck 2: VTX at the front, MP1584 behind it. Antenna along deck 1's left edge, XIAO FPC antenna flat on the right flank wall beside the BNO085.
4. Capacitor: stand it on the tray's tail key (the flat tongue behind the rear disc), a dab of epoxy; long leg to MP1584 OUT+, striped leg to OUT-.

5.5 Cells

1. Glue the spring in disc 1b's rear recess, its lead out through the hole in disc 1b (B-). Solder the BM wire to the solder tab of one AA-holder plate; pass the tab up through the slot in deck 1 at the cell joint.
2. Glue the other plate in the rear disc's front recess, lead through the hole (B+).
3. Turn the tray upside down. The four U saddles are open: lay cell 1 in, BASE forward against the spring; the BM plate against its button; then cell 2, base against the plate, button against the rear plate. The spring holds them. Check 7.4 to 8.4 V between B- and B+.

5.6 Camera, nose putty and harness

1. Camera into the nose from the back (lens into the 1.2 lip).
2. Nose putty: with the nose spigot up, press 14.6 g of putty in from the back with a pencil end, FRONT FIRST, round and under the camera tube (never into the camera pocket), up to the ring step about 13 mm from the tip. Press it firm: the step holds it at launch.
3. The camera's three wires go aft through the nose spigot, beside the leg cradle, through disc 1's left window to the VTX.
4. Solder the harness from the cut list (section 9), 45 wires, along the routes named there. Test with the power loop plug: XIAO boots, video on the receiver.
5. Motor direction check (now, while the drivers are reachable): put a marker dot on each motor stub. Seen from the LEFT side of the dart (nose to your right), key 1 must turn the deploy stub ANTICLOCKWISE (v35: that swings the drills DOWN; it is the other way from v34) and key 2 must turn the leg stub CLOCKWISE (that lifts the leg off the tail and over the nose). If one turns the wrong way, swap that motor's two leads at DRV#1.

6. Close the hull, fit the pods and the leg

6.1 Drill pods (off the dart)

1. Push each drill motor into its arm's bushing, flats keying it; leads out of the neck top. A drop of CA on the can.
2. Press an M3 nut into each auger's hex pocket. Threadlocker on the shaft, screw the auger on until the hub touches the arm shoulder, back off half a turn. v35: LEFT pod = LEFT-hand flight, right pod = right-hand (the v34 pods swapped over).

6.2 Hull bottom

1. Seat the two JST sockets in the lower halves of the flank seats (left = 2-pin ON loop, its seat sits a little low; right = 3-pin charge), pins inward.
2. Thread the tether through the two tail holes now (section 8, first step): once the tray is in you cannot reach the inside of the tail.
3. Lower the populated tray, with the nose on its wires, straight down into the hull bottom: deck 1's edges drop into the seam groove, the tail key into the slot in the end wall, the nose spigot onto the lock rib, the cells onto the belly.

6.3 Drill leads

1. Pass each pod's two leads from outside in through the tight hole in the hull top just BEHIND its pivot block (before soldering), leave a 25 mm loop outside for the swing, then solder them to DRV#2 (v35: the LEFT drill's leads are the swapped pair). A dab of 5-minute epoxy seals each hole.

6.4 Hull top

1. Lower the hull top STRAIGHT DOWN: its two stub slots slide over the leg N20 stubs and onto the tray tongues, the USB-C notch drops over the XIAO receptacle onto the tray tab, the tail key goes into its end-wall slot, the rib locks the nose, the sockets are clamped. Nothing is trapped: look round the seam.
2. 8 radial M3 x 8 countersunk screws into the bosses, 4 at disc 1 and 4 at the rear disc. The heads sit flush. Do not over-tighten (they cut their own thread).
3. Last chance for USB: plug the power loop in, check the boards, the video and both motors, flash over USB if needed. Power loop plug OUT again before the pods go on.

6.5 Pods on the dart (press fits, CA)

1. Dry run first: each Ø7 PPA-CF coupler must push onto the deploy stub and into its arm head with a firm push and no play. If a fit is loose, use the fit coupon to choose a reprint.
2. One side at a time: a drop of CA in the coupler's stub socket and a thin film on its D. Hold the arm FOLDED, ON ITS FOLD STOP (pod pointing BACK along the flank, head down on the block). Push the coupler through the arm head and the block bore onto the stub (flat up) until it is home. Then the other side, the same way.
3. At once, while the CA is still setting: press key ! (pods up) and hold it for 2 s so the worm drives to stall toward fold with both pods on their fold stops. Leave it 5 minutes.
4. Pod cap + M3 x 8 into each coupler end.
5. Power the deploy motor slowly: both pods swing down together to the stop and back to folded. They must stop on the printed stops, not on the motor. Wiggle each pod by hand: nothing may move.

6.6 Righting leg (press fits, CA)

1. Lay the leg folded: cheeks into the two side pockets, blade flat on the groove floor (its fold stop), pad on the tail top.
2. A drop of CA in each Ø6 leg coupler's stub socket and on its D. Push each coupler (PPA-CF) in through the plug counterbore on the flank, through the cheek and the knuckle wall onto the leg N20 stub (flat up).
3. At once: press key @ (leg back) for 2 s so the worm drives to stall toward fold with the leg on its groove floor. Leave it 5 minutes.
4. Press the two skin plugs in flush (a drop of CA). Their blind bores hold the couplers and carry the leg.
5. Power the leg motor slowly: the leg swings over the top to its bed in the nose (about 178°) and back flush into the groove. Wiggle it: nothing may move.

7. Function test

1. ON plug: make its shorting loop from a short wire so it folds flat down against the flank, and tape it there (a loop sticking out can snag and switch the dart off). Plug in: XIAO and video up, IMU reads level.
2. Key 1: the drills swing DOWN and back, key 2: the leg lifts off the tail and swings over the nose (else swap that motor's leads at DRV#1, 5.6). Pods down to the stops with the drills spinning (left and right counter-rotate; key 3 screws BOTH in, else swap the left drill's pair), then up.
3. Firmware updates from now on over WiFi (OTA): the right pod covers the USB-C.
4. Service: pry the two skin plugs, pull the leg couplers (CA: they may need a twist), remove the 8 radial screws and lift the hull top. Everything is reachable. (The pods are glued on their couplers: the hull top lifts off with them.)

8. Tether

1. BEFORE the tray goes into the hull bottom (6.2): push the end of the rover line in through one of the two small holes in the middle of the tail face (from outside), then back out through the other hole, so the line makes a small loop round the plastic between the holes on the inside. Pull 20 cm through. (Stiffen the line end with a drop of CA and let it dry first: it threads much more easily.)
2. Tie the end to the line itself right behind the tail with a BOWLINE, then a double overhand stopper on the tail end. Trim the tail to 5 mm.
3. Test: hook a luggage scale into the line, hold the dart and pull 6 kg for a few seconds. Nothing may slip.
4. Loading on the launcher: press key ! (pods up) for 1 s so both pods sit hard on their fold stops. Put the dart on the cradle; the knot goes into the pusher's middle hole and the line runs straight back.

9. Wire cut list (pad to pad)


#	From	To	Colour	Gauge	mm	Note
1	Front spring (B-, cell 1 base)	BMS B-	black	22 AWG	75	through the lead hole in disc 1b, up beside the deploy cradle, onto deck 1
2	BM strip tab (between the cells)	BMS BM	white	26 AWG	85	the strip tab comes up through the slot in deck 1 at the cell joint; solder it before the cells go in
3	Rear plate (B+, cell 2 button)	BMS B+	red	22 AWG	120	through the lead hole in the rear disc, up behind it, forward on deck 1
4	BMS B-	Charge socket pin 1 (right flank seat)	black	26 AWG	140	JST-XH 3-pin, balance charge; right corridor, through the rear disc, into the seat
5	BMS BM	Charge socket pin 2 (right flank seat)	white	26 AWG	140	
6	BMS B+	Charge socket pin 3 (right flank seat)	red	26 AWG	140	
7	BMS P+	Power loop socket pin 1 (left flank seat)	red	22 AWG	125	JST-XH 2-pin; the shorting plug is the ON switch
8	Power loop socket pin 2	INA219 VIN+	red	22 AWG	155	main + after the loop
9	INA219 VIN+ (same pad)	MP1584 IN+	red	22 AWG	75	buck taps before the shunt (up to deck 2)
10	INA219 VIN-	DRV#1 VM	red	22 AWG	120	motor rail 6.0-8.4 V, forward through disc 1b
11	DRV#1 VM	DRV#2 VM	red	22 AWG	70	under the deploy cradle
12	BMS P-	MP1584 IN-	black	22 AWG	65	main ground
13	MP1584 IN- (same pad)	DRV#1 GND	black	22 AWG	140	
14	DRV#1 GND	DRV#2 GND	black	22 AWG	70	
15	MP1584 OUT+ (5.04 V)	XIAO 5V via a Schottky diode (stripe toward the XIAO)	orange	24 AWG	105	set and check 5.04 V BEFORE connecting; 1N5817 or SS14 in heat shrink
16	MP1584 OUT-	XIAO GND	black	24 AWG	105	
17	MP1584 OUT+	VTX 5V in	orange	26 AWG	50	both on deck 2
18	MP1584 OUT-	VTX GND	black	26 AWG	50	
19	VTX 5V in (same pad)	Camera + (red)	orange	28 AWG	150	forward over disc 1b, through disc 1, beside the leg cradle into the nose
20	VTX GND (same pad)	Camera - (black)	black	28 AWG	150	
21	Camera video (yellow)	VTX video in	yellow	28 AWG	150	twist with the camera ground
22	XIAO 3V3	DRV#1 SLP / nSLEEP / EEP pad (NOT VCC or VIN)	red/white	28 AWG	95	wakes the driver; meter check first (WIRING.md step B6)
23	DRV#1 SLP	DRV#2 SLP	red/white	28 AWG	70	
24	XIAO 3V3	INA219 VCC	red/white	28 AWG	60	
25	INA219 VCC	BNO085 VIN	red/white	28 AWG	60	deck 1 neighbours
26	XIAO GND	INA219 GND	black	28 AWG	60	
27	INA219 GND	BNO085 GND	black	28 AWG	60	
28	XIAO D4	INA219 SDA	blue	28 AWG	60	I2C SDA
29	INA219 SDA	BNO085 SDA	blue	28 AWG	60	
30	XIAO D5	INA219 SCL	green	28 AWG	60	I2C SCL
31	INA219 SCL	BNO085 SCL	green	28 AWG	60	
32	XIAO D0	DRV#1 AIN1	purple	28 AWG	95	deploy
33	XIAO D1	DRV#1 AIN2	grey	28 AWG	95	deploy
34	XIAO D2	DRV#1 BIN1	purple	28 AWG	95	righting leg (was kick)
35	XIAO D3	DRV#1 BIN2	grey	28 AWG	95	righting leg (was kick)
36	XIAO D8	DRV#2 AIN1 (only AIN1: NO bridge to BIN1)	purple	28 AWG	80	drills
37	XIAO D9	DRV#2 AIN2 (only AIN2: NO bridge to BIN2)	grey	28 AWG	80	drills
38	DRV#1 AOUT1	Deploy N20 + (red)	red	26 AWG	50	down to the end-cap tabs under the deploy cradle. v35 deploys the OTHER way round from v34: key 1 must turn the stub COUNTER-clockwise seen from the left; if not (or on a motor wired as v34), swap 38 and 39
39	DRV#1 AOUT2	Deploy N20 - (black)	black	26 AWG	50	
40	DRV#1 BOUT1	Leg N20 + (red)	red	26 AWG	80	forward through disc 1's left window to the end-cap tabs under the leg cradle


#	From	To	Colour	Gauge	mm	Note
41	DRV#1 BOUT2	Leg N20 - (black)	black	26 AWG	80	
42	DRV#2 AOUT1	Drill motor RIGHT + (red)	red	26 AWG	135	up through disc 1b's top window, out the right tight hole, 25 mm loop into the pod neck at the end cap (silicone wire)
43	DRV#2 AOUT2	Drill motor RIGHT - (black)	black	26 AWG	135	
44	DRV#2 AOUT1 (same pad as the RIGHT red)	Drill motor LEFT - (black) SWAPPED	black	26 AWG	135	reversed on purpose: the pair counter-rotates (the left pod has the left-hand auger)
45	DRV#2 AOUT2 (same pad as the RIGHT black)	Drill motor LEFT + (red) SWAPPED	red	26 AWG	135	


Totals by gauge and colour (mm): 22 AWG black 350, 22 AWG red 665, 24 AWG black 105, 24 AWG orange 105, 26 AWG black 590, 26 AWG orange 50, 26 AWG red 540, 26 AWG white 225, 28 AWG black 270, 28 AWG blue 120, 28 AWG green 120, 28 AWG grey 270, 28 AWG orange 150, 28 AWG purple 270, 28 AWG red/white 285, 28 AWG yellow 150


10. Pictures

Exploded view, and the build stages: populated tray, tray in the hull bottom, hull closed, complete.

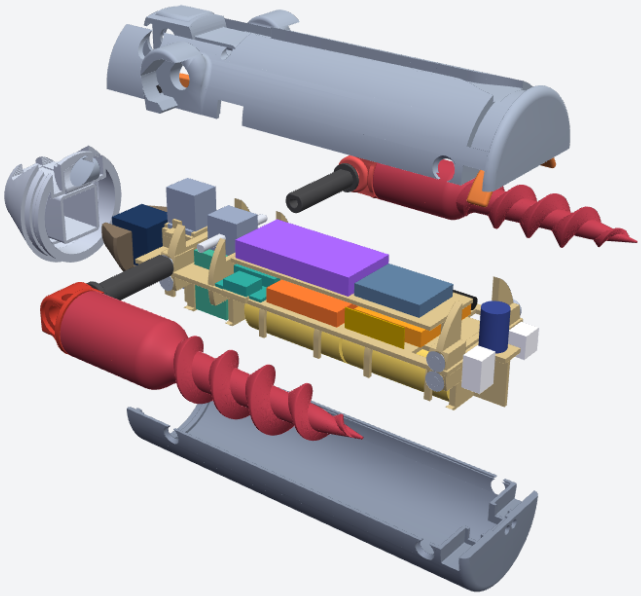


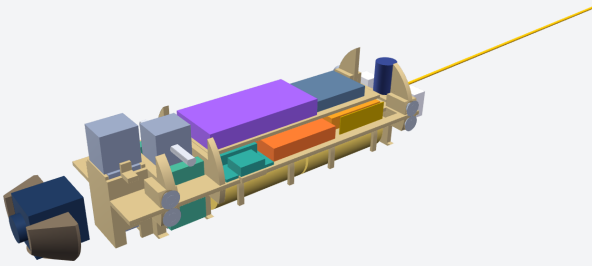

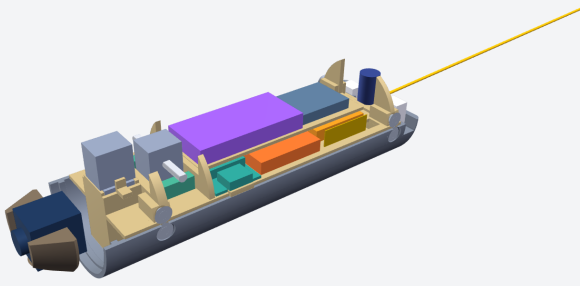


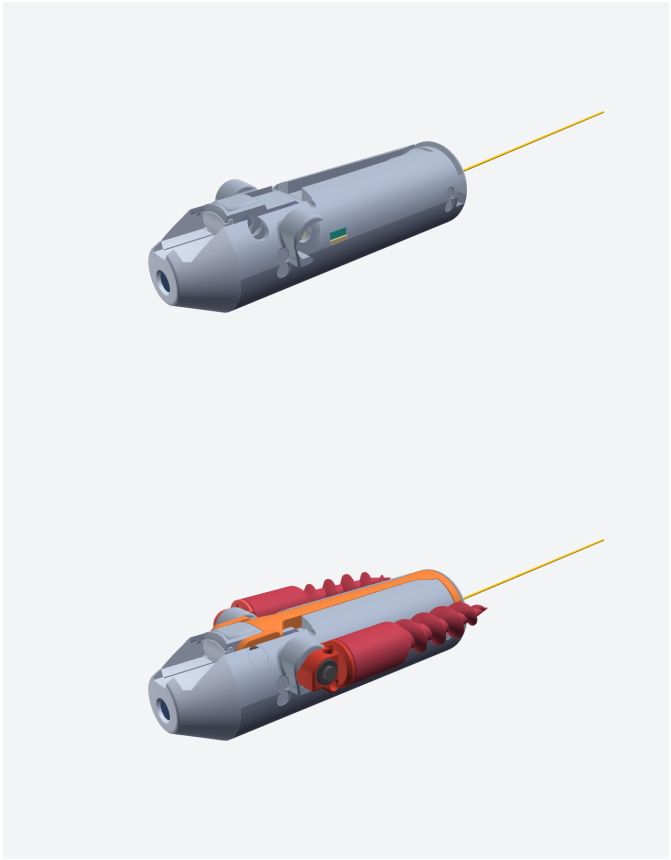

Wiring (numbers match the cut list):

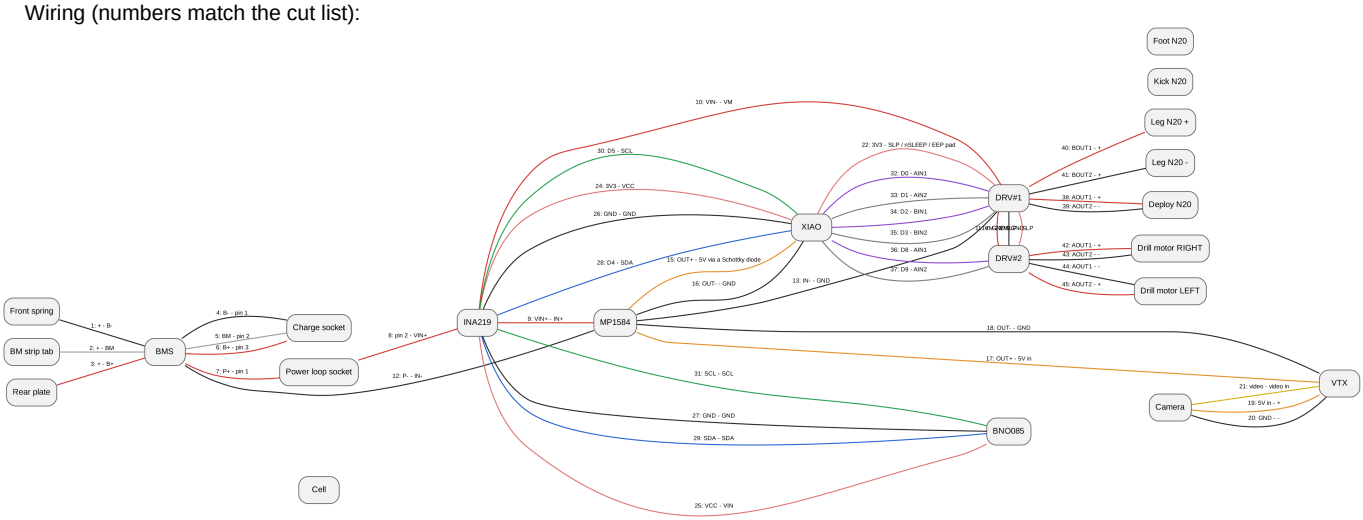

Audit sheet: 24 views of the exact print geometry.

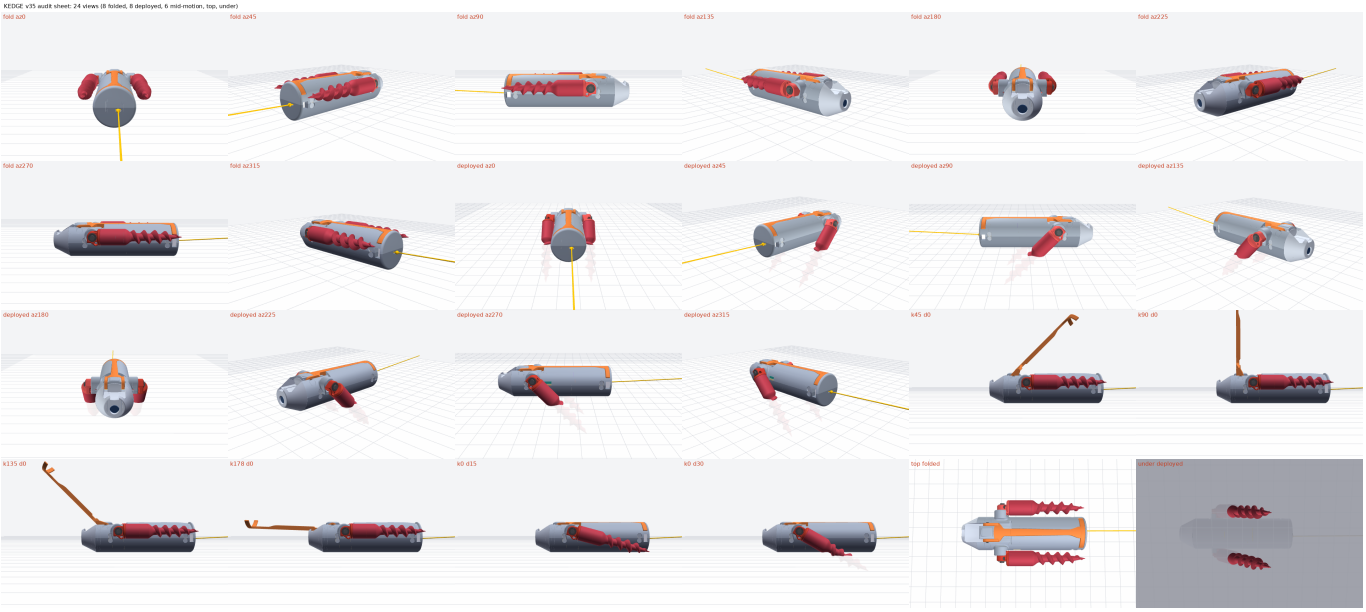

Section cuts:

