



For the base and L2/L4/L6 the appropriate motor was attached to the mounting plate with M3 bolts. Threaded inserts were then hammered into both the mounting plate and link body and M3 bolts were used to attach the mounting plate to the body.



The bearings were then inserted into the appropriate bearing housing for each of the links.

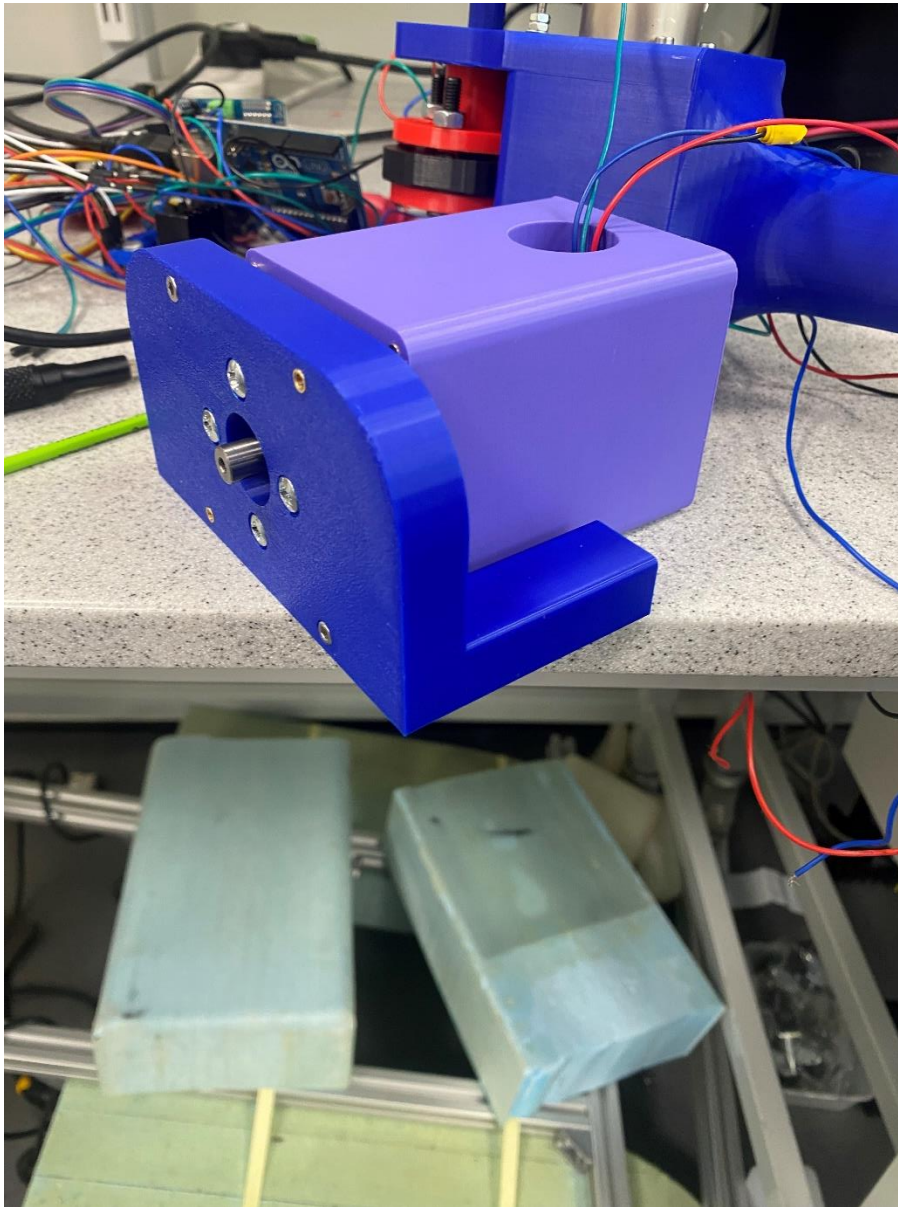

The appropriate motor was mounted into L1/L3/L5 using the M3 bolts. For L1 and L3 this was a motor with a 14 reduction planetary gearbox while L5 had no gearbox. The same exact process was followed for all 3 links.

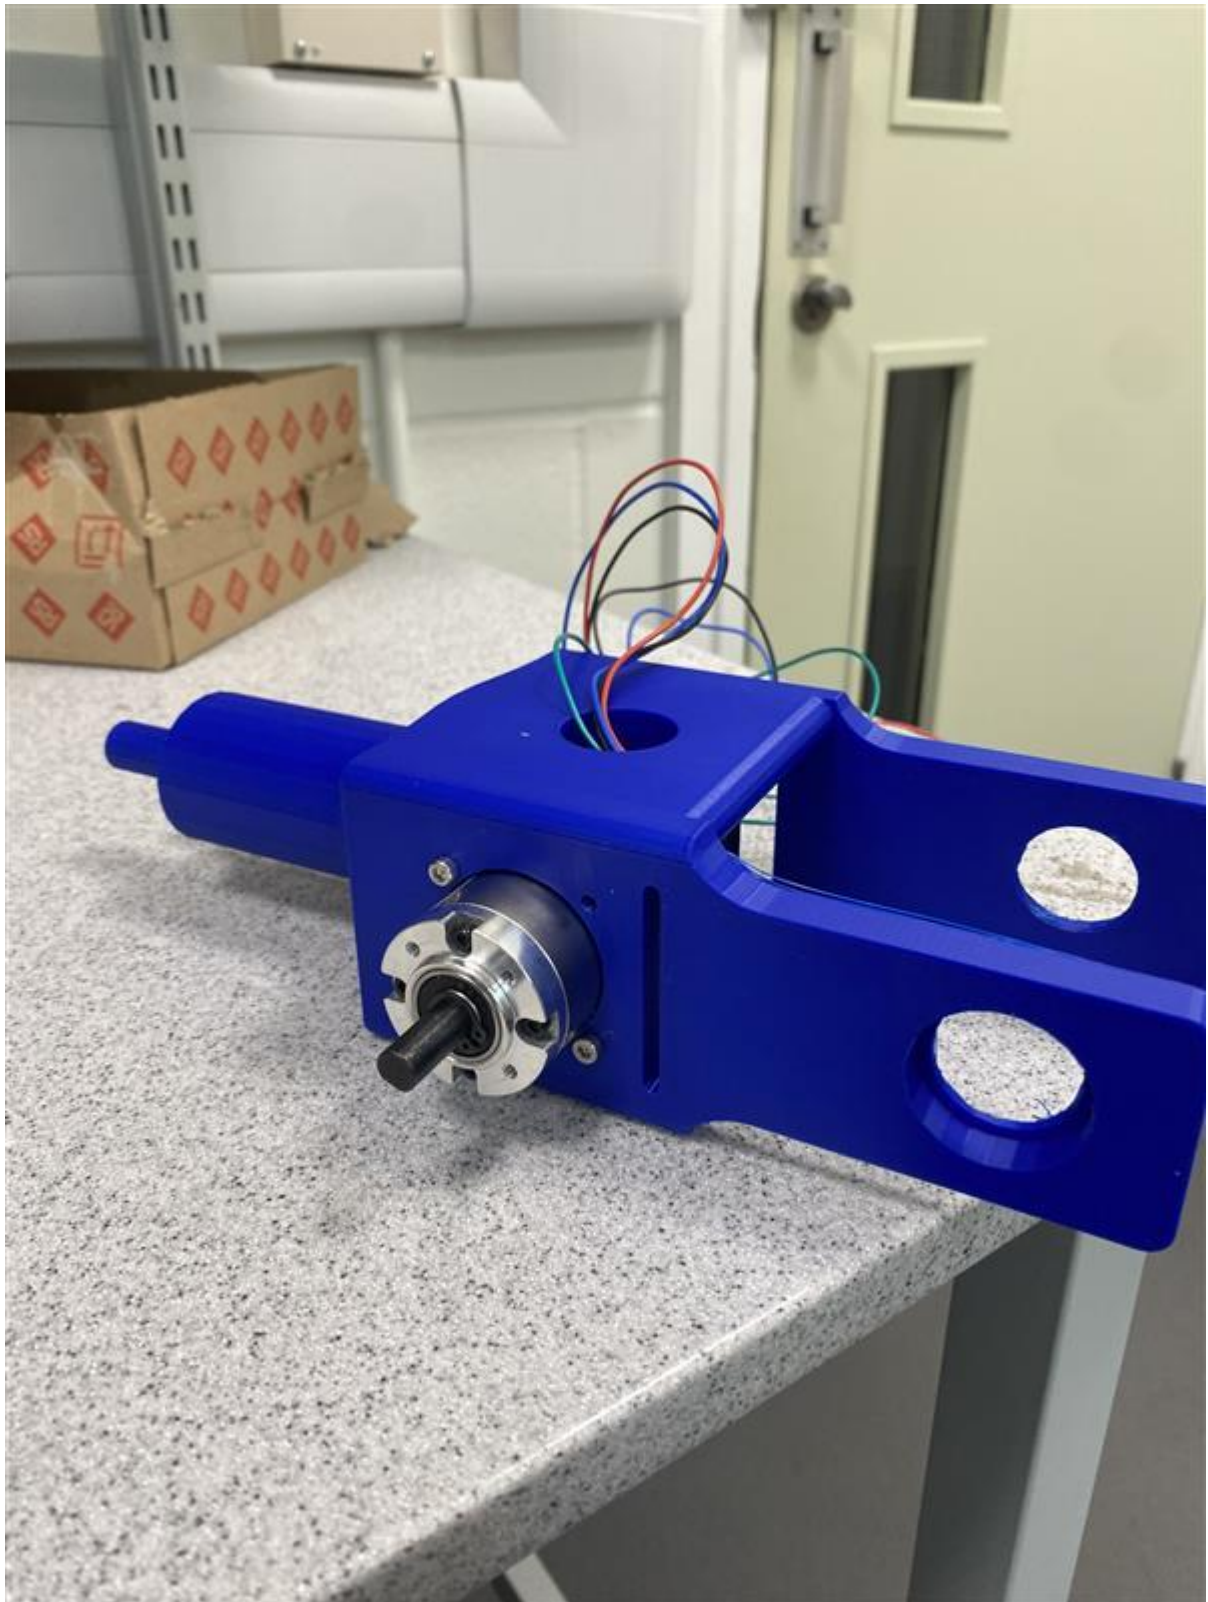

The coupling was then attached to the shaft of the link.






The bearings were then inserted with the use of a lubrication and a mallet.



The shaft was then inserted into one of the bearings again using lubrication and a mallet.

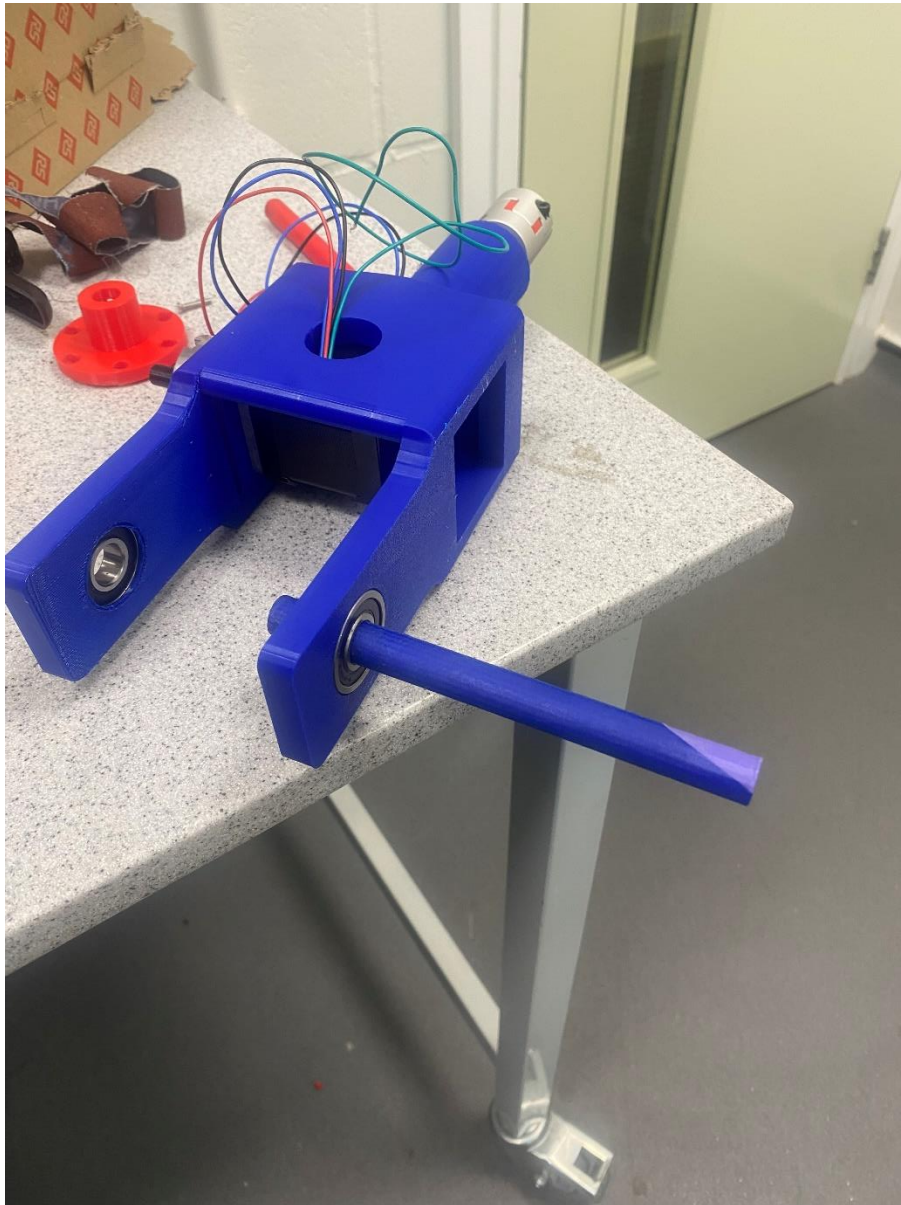


Threaded inserts were then hammered into all 6 of the clamping hubs.






The first clamping hub was mounted onto the shaft.

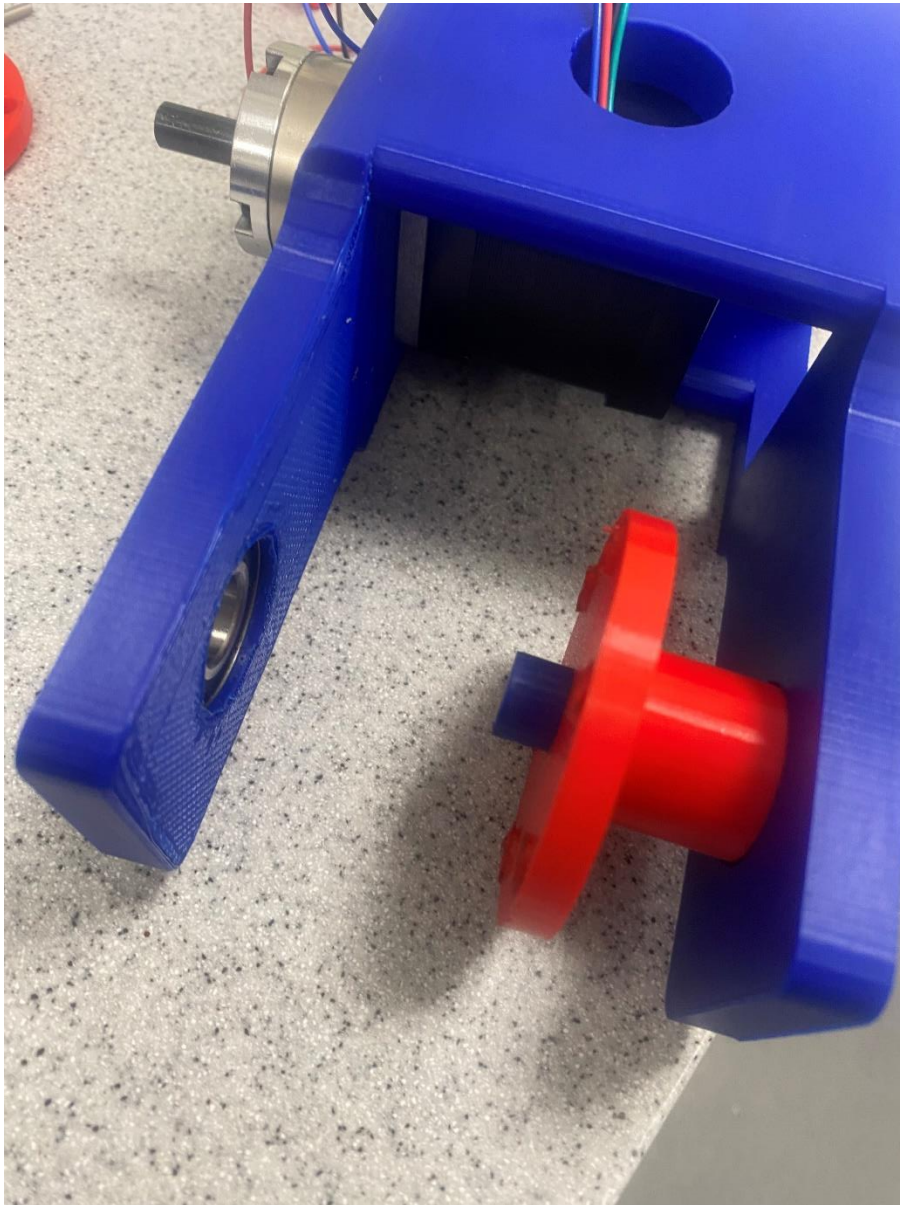


The fully assembled next link (L2/L4/L6) was then inserted onto the shaft.




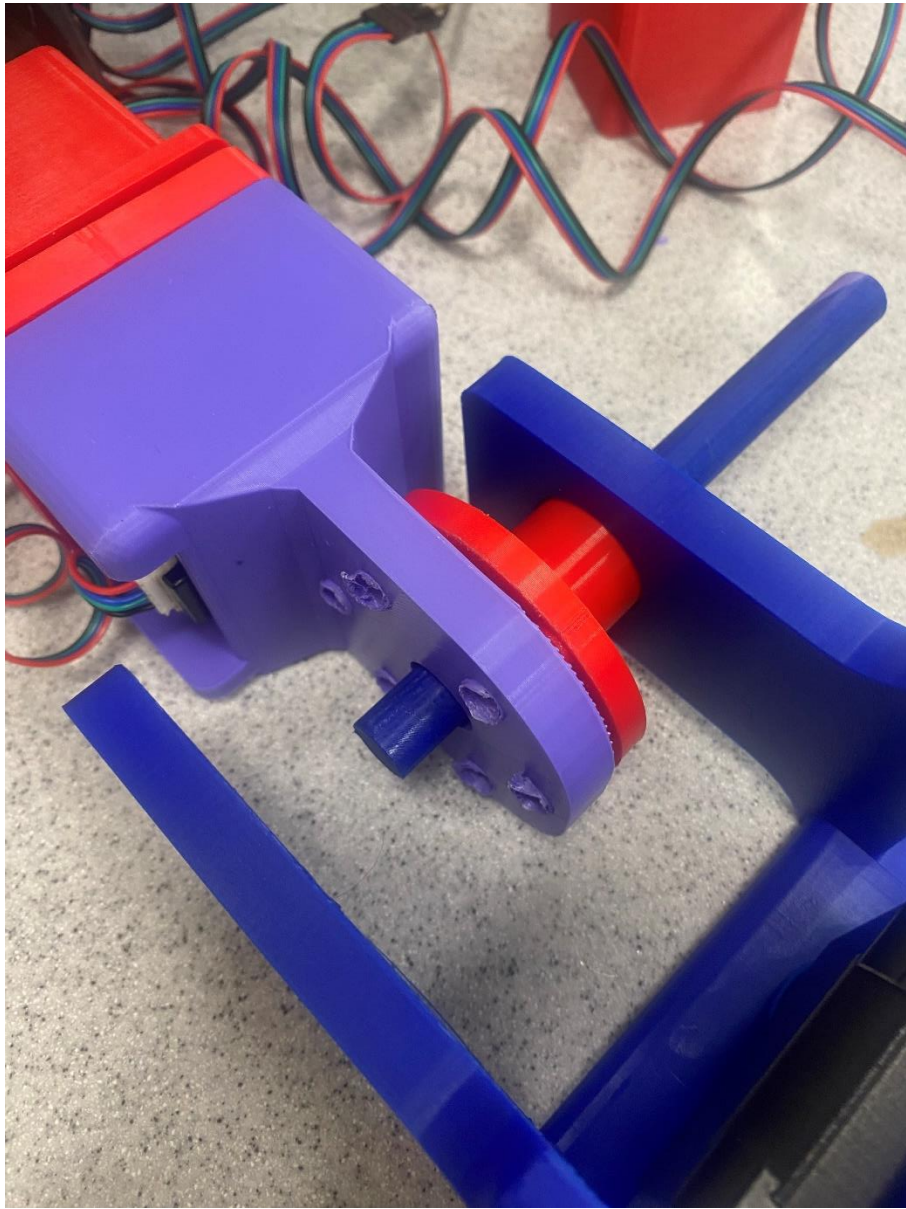

The M6 bolts were placed inside the mounting holes of the clamping hub.

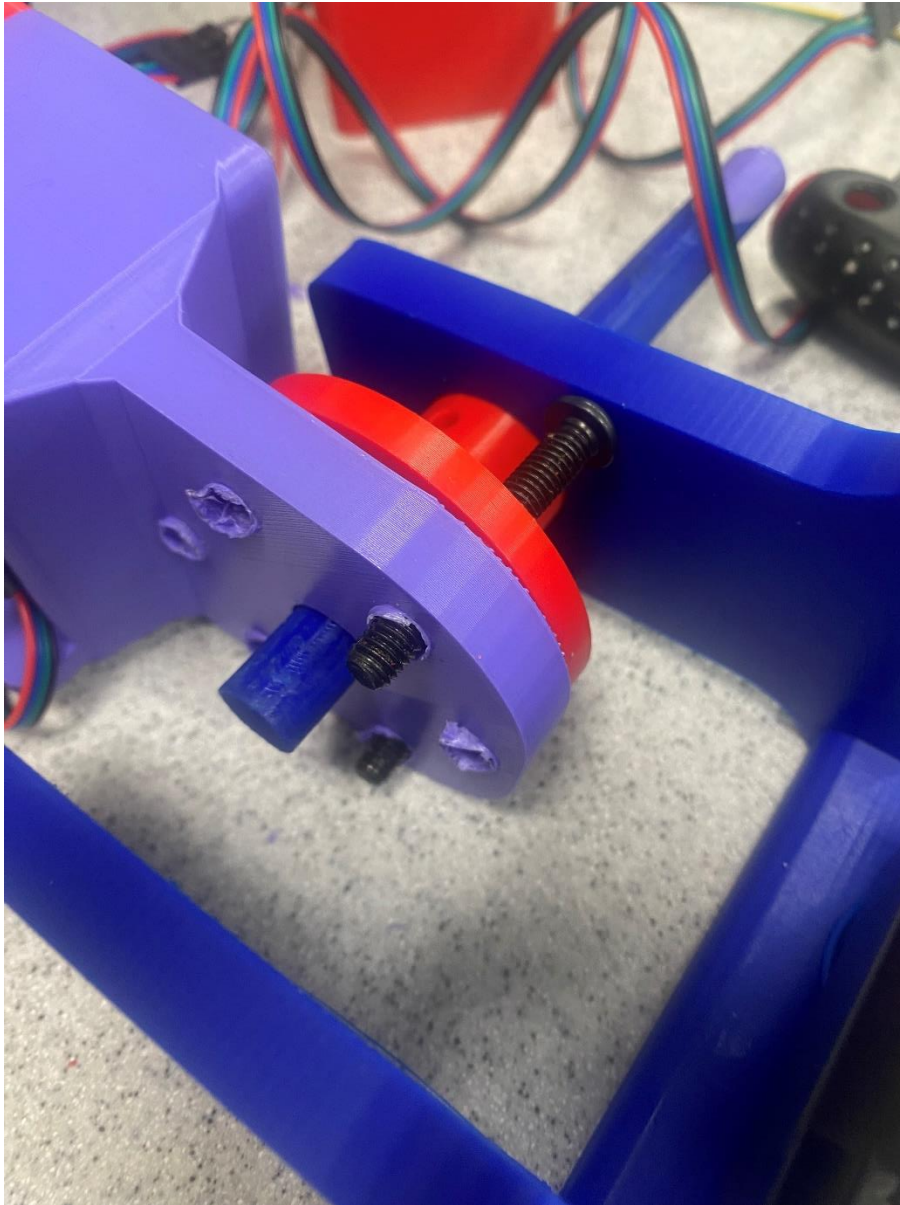


The second clamping hub was then inserted onto the other side of the shaft and M6 nuts were used to fasten everything securely.

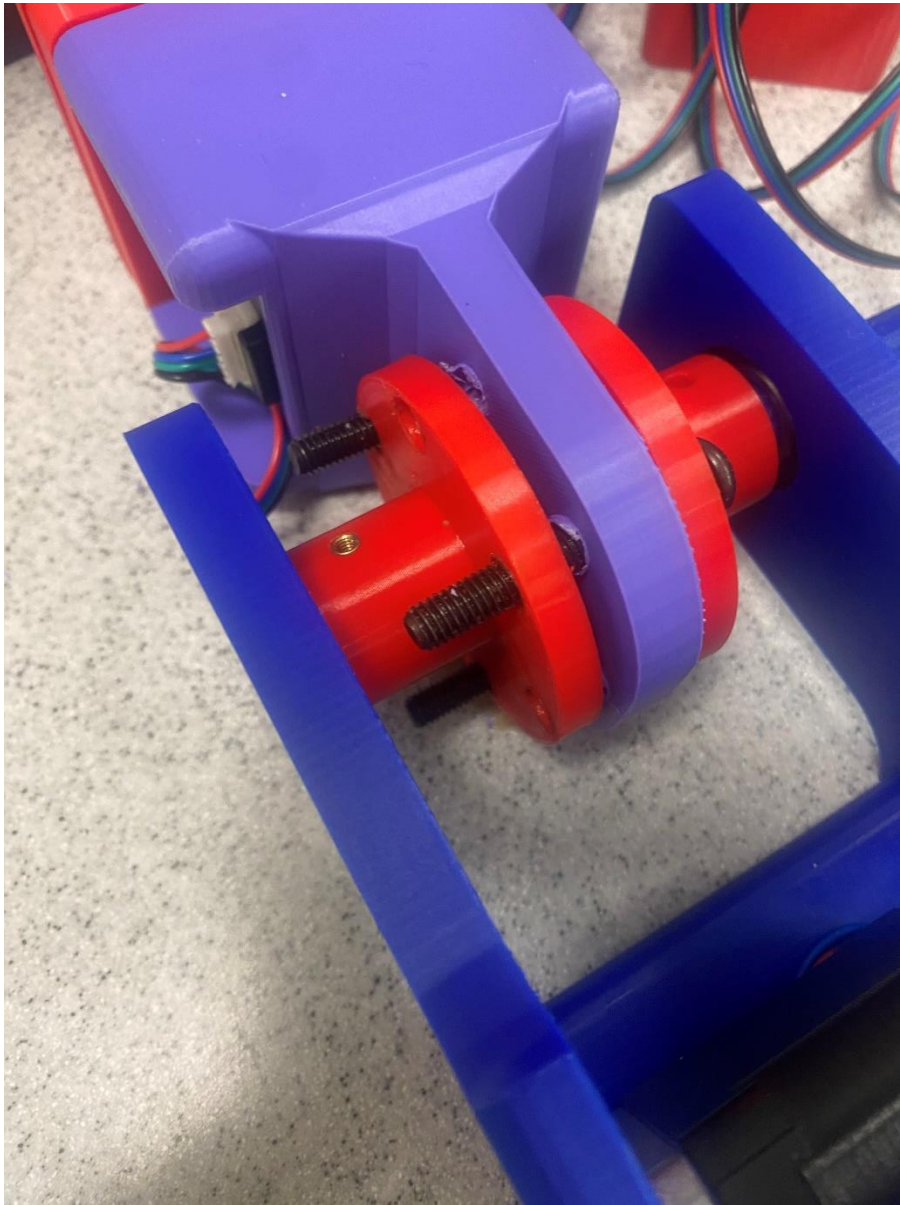


The GT2 pulleys were mounted onto the shaft and motor with a 3:1 reduction ratio.




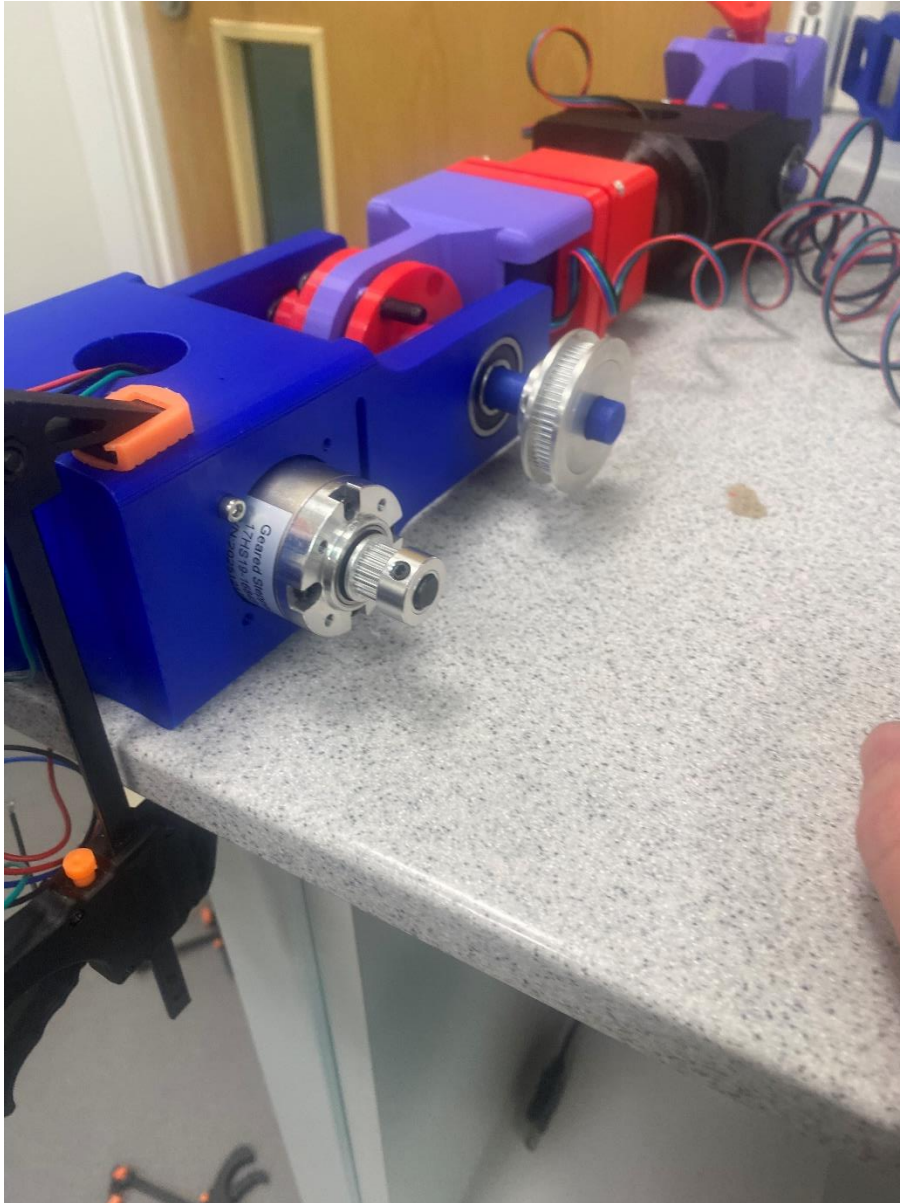

The threaded bars were inserted into the slot with idling pulleys mounted onto them. They were then adjusted to tension the belt.

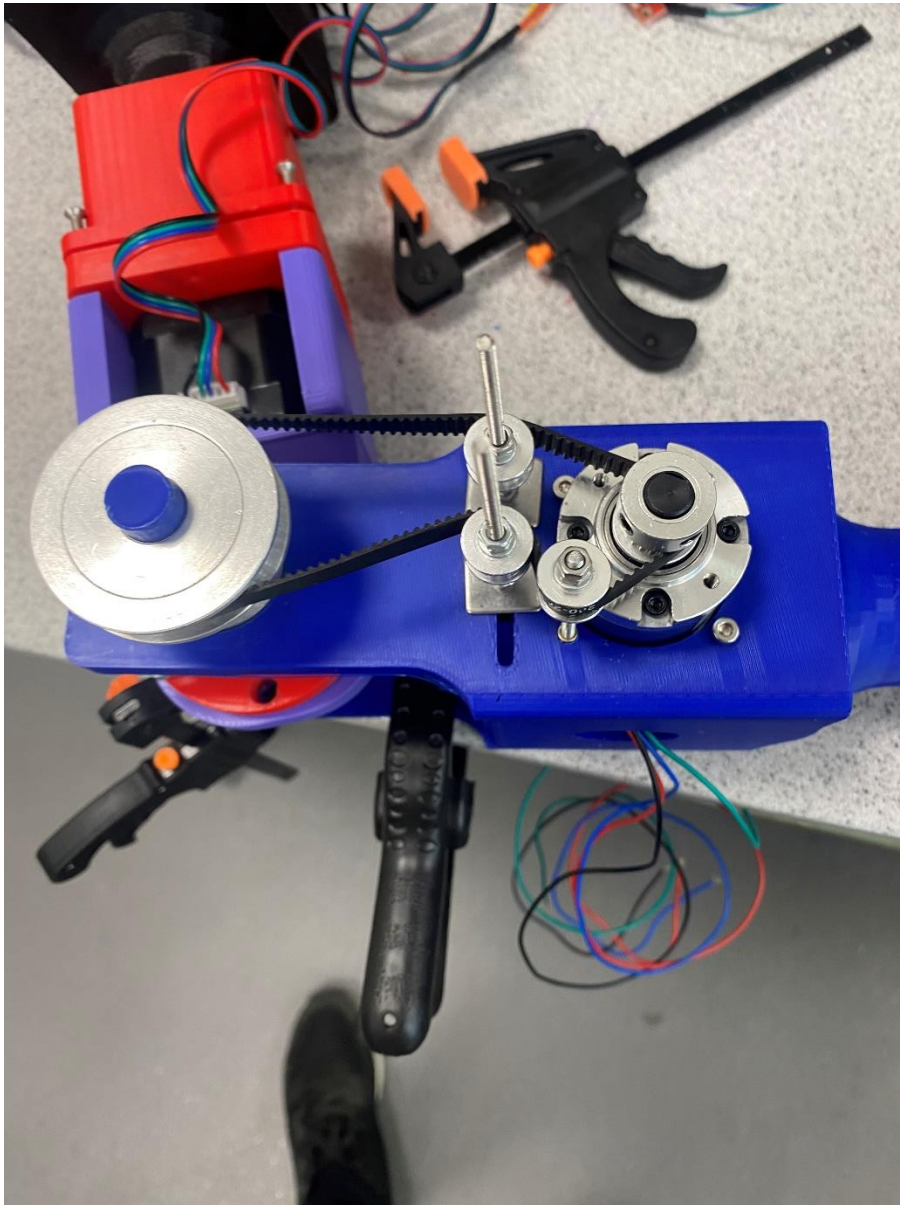


The bearing housing for the base, L2/L4/L6 was then inserted into the next link.

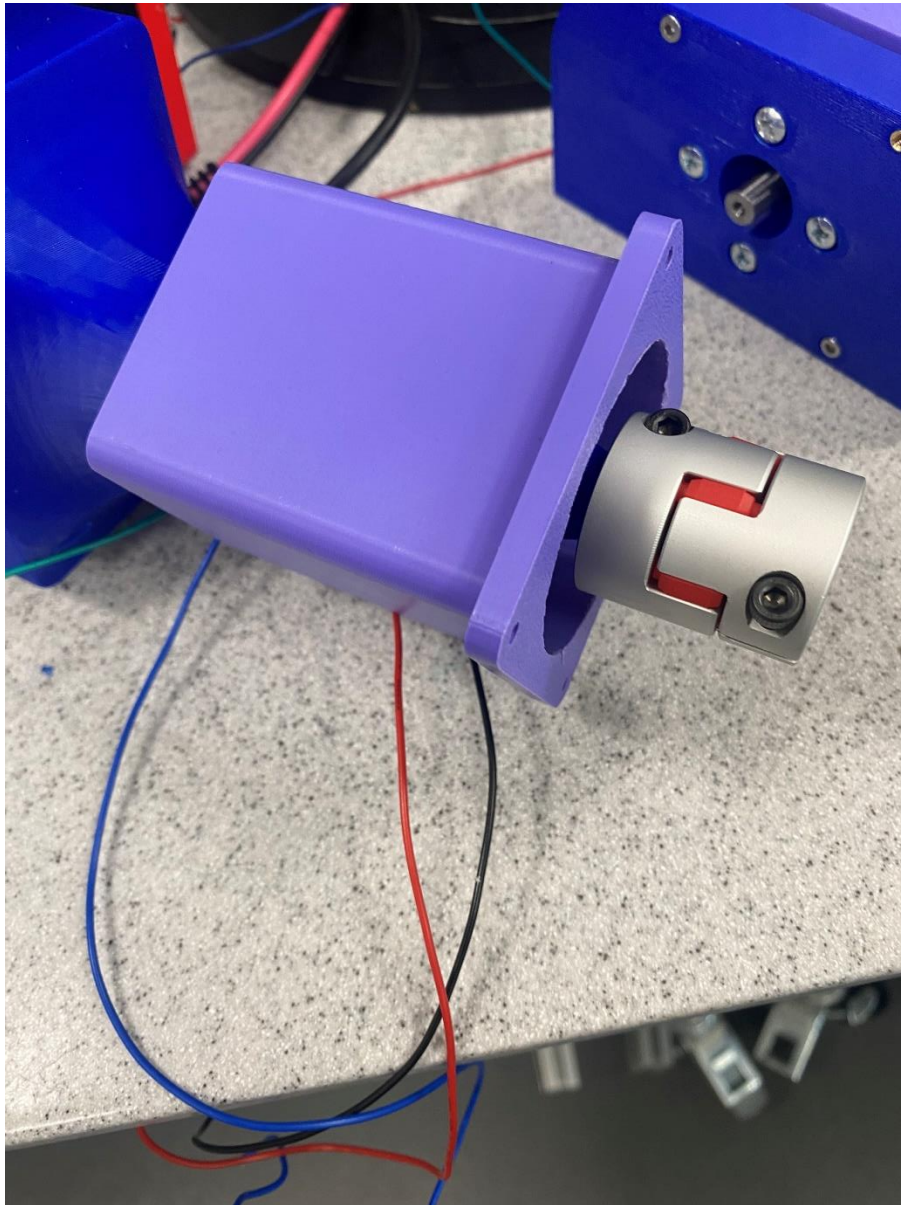


The coupling was then attached to the motor shaft of the previous link.



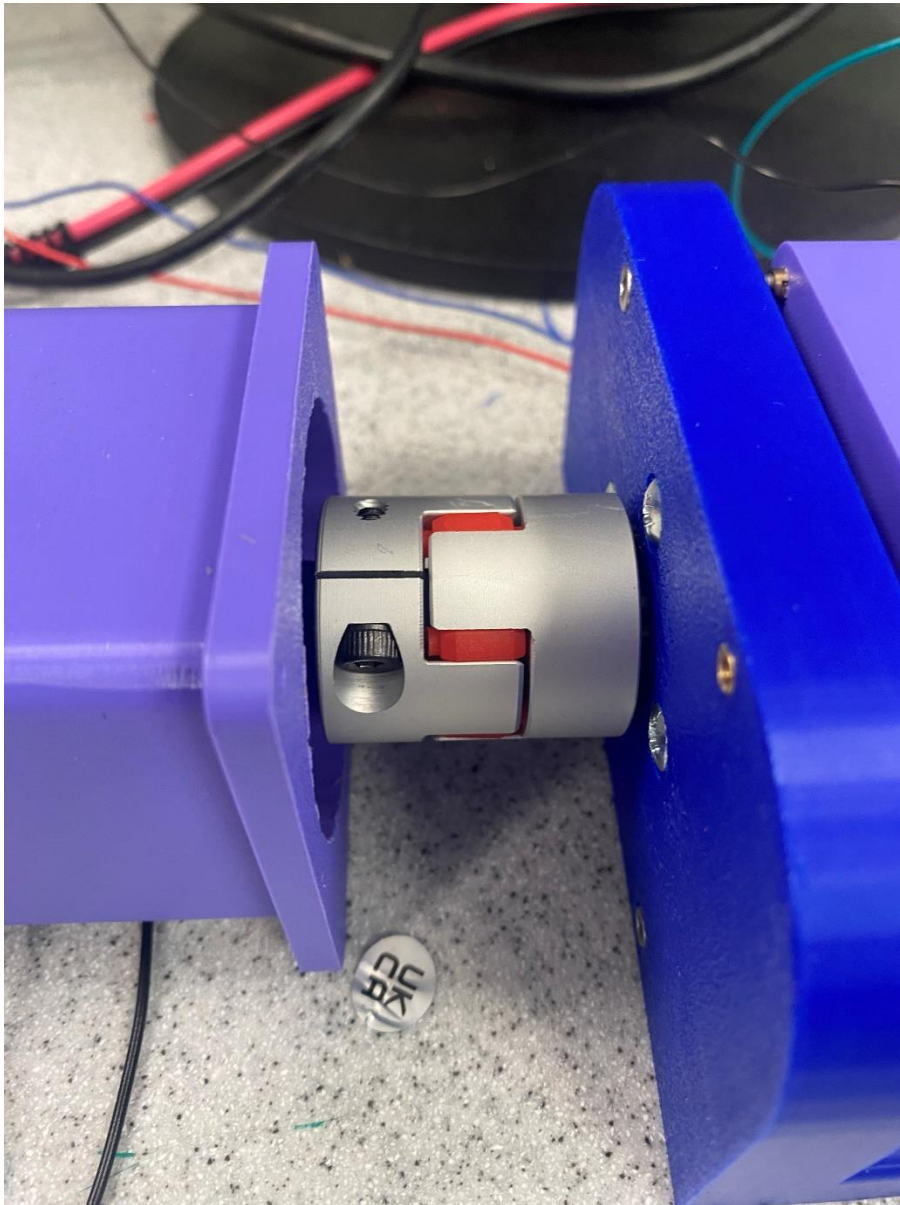

Finally the bearing housing was slid into place and mounted to the mounting plate using M3 bolts.

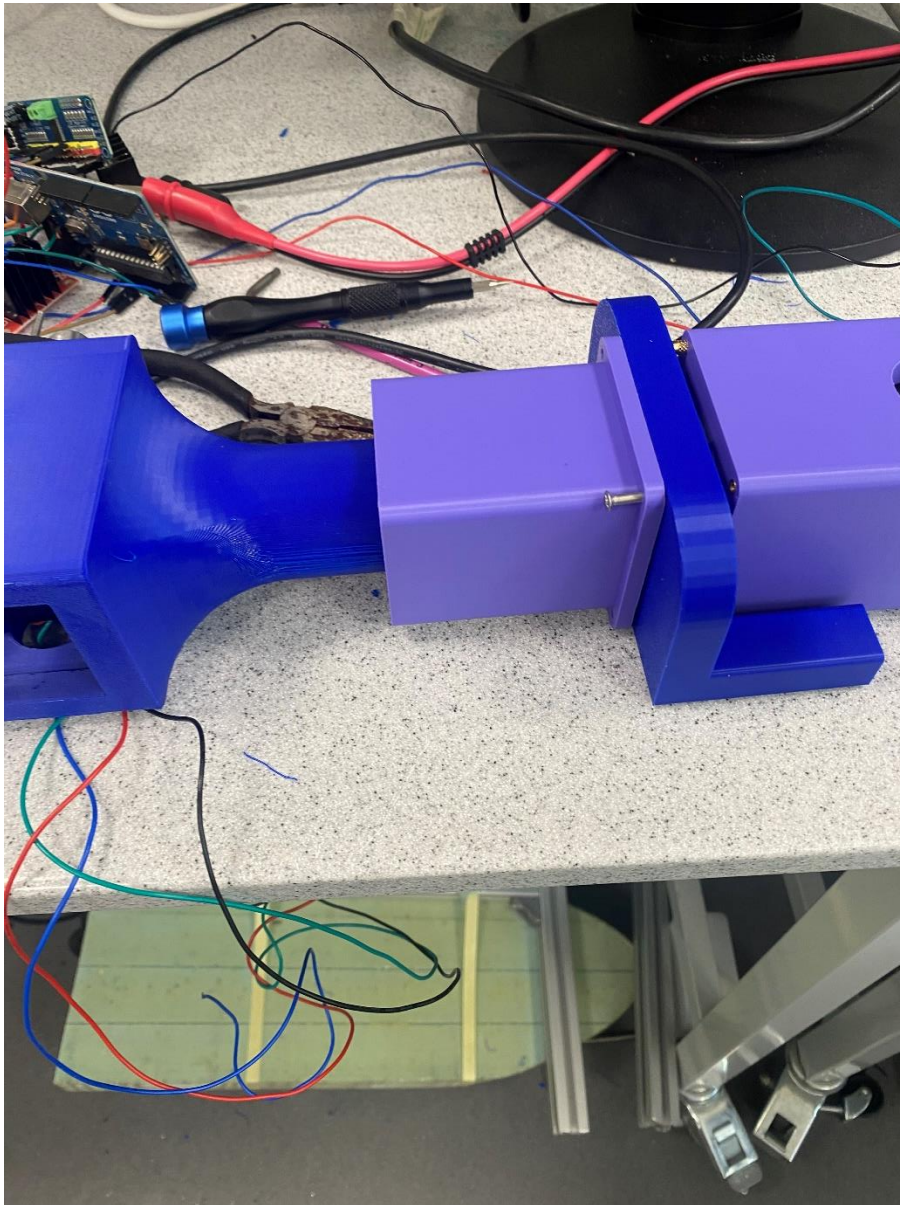

L7 is then mounted onto the final motor, creating the full assembly of the arm.

