Mold Busters

INDOOR ENVIRONMENTAL ASSESSMENT

Reference report - Sample Job 01

Prepared for: Sample Client 01

Property: Sample Property 01, Ontario

Inspection type: On-site inspection

Inspection date: October 6, 2026

Inspector listed in source report: Staff A, CMI

Report prepared by: Staff C - administrative client support

Report reviewed by: Staff D - administrative client support

HACKATHON SAMPLE
Direct client identifiers and identifying cover images have been removed. Staff names use stable aliases. The following pages retain the reference report content; source inconsistencies may remain.

www.bustmold.com

TABLE OF CONTENTS

01

COMPANY PROFILE

02

EQUIPMENT

03

VISUAL & DIAGNOSTIC RESULTS

04

PHOTOGRAPHIC EVIDENCE

05

CONCLUSION AND RECOMMENDATION

⚠ Disclaimer

The results and interpretation of our inspection and sampling procedures are based on conditions present at the time of the assessment. All efforts were made to ensure accuracy in the collection, and observation of relevant data within the inspected area(s). Unless otherwise stated, the assessment is non-invasive in nature, and inaccessible areas (i.e., behind wall cavities, under sub-floor materials, etc.) may contain concerns not presented in this report due to the restrictions and limitations of the assessment provided. The information and recommendations presented in this report are based on data available at the time of the inspection. Any recommendations made in this report are made, in good conscience and in accordance with the following guidelines:

- Residential Mold Removal Guidelines, 1st Edition, Mold Busters, 2019;
- S520 Standard and Reference Guide for Professional Mold Remediation, IICRC, 2015;
- Mould Guidelines for the Canadian Construction Industry, Canadian Construction Association, 2004;
- ANSI/ASHRAE 62.2-2010, Ventilation for Acceptable Indoor Air Quality in Low-Rise Residential Buildings, American Society of Heating, Refrigeration, and Air-Conditioning Engineers, 2010

Health Canada considers indoor mould growth to be a significant health hazard. The level of concern depends on the extent of mould, how long it has been present and the sensitivity and overall health of the residents. Some people are more susceptible than others. Health Canada recommends controlling dampness indoors and cleaning up any mould regardless of the type of mould present.

01

COMPANY PROFILE

Mold Busters: Decontamination Experts

Mold Busters is a Canadian-owned and operated mold inspection, testing, and removal company that has been established since 2005.

Based in Ottawa, Mold Busters have been servicing residential, commercial, and government clients, promptly dealing with their indoor environmental concerns with professionalism and precision. Their dedication to providing excellent service to their customers have allowed them to grow, opening locations across Ontario, Quebec and the Asia-Pacific.

MOLD BUSTERS SPECIALIZES IN THE FOLLOWING SERVICES:

- Visual & diagnostic mold assessments
- Mold testing
- Comprehensive reports

- Mold removal
- Remediation
- Disinfection

- Non-viable, and viable air quality testing

- Odor removal

- Asbestos testing

- Ventilation
- Duct cleaning
- Air exchanger installation

- Thermal imaging inspections

Mold Busters does not sub-contract any inspection or remediation work, unless otherwise stated. All Mold Busters inspectors are trained through the National Association of Mold Professionals, InterNACHI, IAQA, or the IICRC.

Please visit our website for more information: www.bustmold.com

02

EQUIPMENT

Mold Busters utilizes a variety of diagnostic and sampling equipment during the assessment. The type of equipment used for each assessment is determined by the technician conducting the inspection. All equipment is regularly calibrated to ensure accuracy in the results. Common diagnostic equipment utilized includes:

1. Precision Hygro-Thermometer - Extech RH490

This measures relative humidity, temperature, and dew point levels. As per ASHRAE guidelines, relative humidity levels above 65% are indicative of a potential for mold propagation.

2. Pinless Moisture Meter – Extech MO257

This non-invasive moisture meter measures the moisture content of a building material. Typically, the MC (moisture content) of wood & drywall should be below 16%.

3. FLIR One Pro

This is a thermal imaging camera attachment that assists in determining heat differentials, or thermal anomalies within building materials.

4. Particle Scan Pro - IQAir

This is an airborne laser particle counter which gives an instantaneous reading of solid particulates between

0.3µm and 5.0µm with a refresh rate of 0.025CFM.

5. Instant Swab Analysis

This is an instant swab analysis utilized to confirm or deny the presence of biological contaminants, such as bacteria, fungi (mold), etc., on a discolored surface area. This is a non-speciating diagnostic swab test.

6. Buck BioAire – Bioaerosol Sampling Pump B520 used with Air-O-Cell cassettes

This is a compact 5-20 LPM controlled flow sampling pump for bioaerosol sampling, which accommodates Air- O-Cell cassettes. This is utilized for air quality testing. All sampled cassettes are sent to an independent, government accredited laboratory that specializes in microbial analysis.

All technicians are equipped with the necessary PPE (Personal Protective Equipment), lighting, and accessibility tools required to perform most indoor assessments. Additional equipment or specialized diagnostics may be utilized on requested projects, as needed. The technician reserves the right to use any or none of the equipment listed or unlisted during the assessment process.

Although there have been many changes in the world due to COVID-19, our commitment to providing safe and effective services holds strong. As such, our highly trained and experienced staff are taking additional precautions to keep you safe during in-person appointments and remediation projects. To view all our Covid-19 Safety and Prevention Measures, please visit https://www.bustmold.com/covid-19/.

03

VISUAL & DIAGNOSTIC RESULTS

Objectives

Mold Busters conducted a visual and diagnostic inspection at Sample Property 01, Ontario , on October 6, 2026.

The objectives of the assessment were to:

1. Visually and/or diagnostically inspect areas of the property to identify any potential indoor environmental concerns;
2. Determine the source(s) and extent of these concerns, if present;
3. Establish an appropriate action plan and/or provide recommendations for improvement, if necessary.

Diagnostic Results

The technician made the following diagnostic observations during his inspection of the property Sample Property 01, Ontario , ON:

LOCATION:Throughout the property

GENERAL OBSERVATIONS:

► The client contacted Mold Busters to perform a Visual and Diagnostic mold inspection of the basement
► No odors were present during the inspection
► Some visible discoloration was observed in the basement, below the sink
► A swab test was performed and it came back positive for mold
► No thermal anomalies were detected in the basement
► Humidity readings were within standard
► No moisture issues were detected

After inspecting the basement, the rest of the property was inspected complimentary

► Multiple thermal anomalies were detected throughout the property, mainly on the top floor but also on the main floor in the living room below the roof
► Another thermal anomaly was detected in the laundry room on the ceiling

► Visible discoloration was observed in both washrooms upstairs
► Ceiling fans were functional during the inspection
► Standing water was observed in an en-suite washroom
► A ball-slope-test failed in the shower enclosure area
► The bathtub faucet was not fixed and the moisture content below was elevated
► Visible discoloration was observed around the grout and silicone sealant in the en-suite washroom
► Attic inspection was conducted and it was concluded that the insulation was unevenly distributed and heavily disturbed, leading to thermal inconsistencies
► Visible discoloration was present in the attic
► Exterior inspection concluded two main defects: drainage and depression around the main entrance

04

PHOTOGRAPHIC EVIDENCE

Photographs taken by the technician during the assessment

Location: Sample Property 01, Ontario

Date: October 6, 2026



No thermal anomalies in the basement #1



No thermal anomalies in the basement #2



Relative humidity detected to be within the ideal range at the time of the inspection



Swab test #1




Swab test #2




Swab test #3



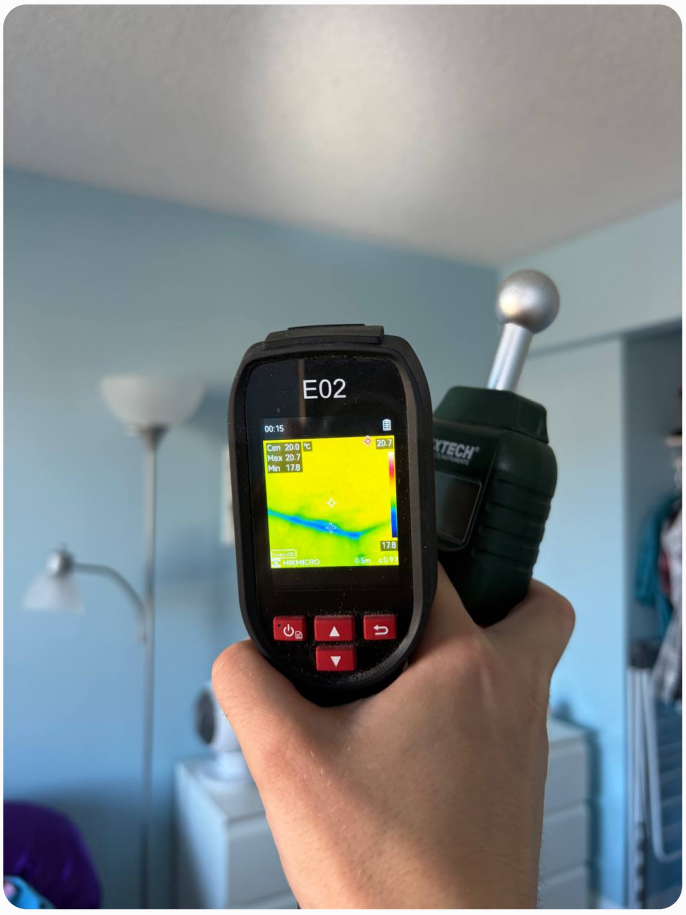

Instant swab test revealed positive results for biological contaminant

Thermal anomalies detected throughout the property #1

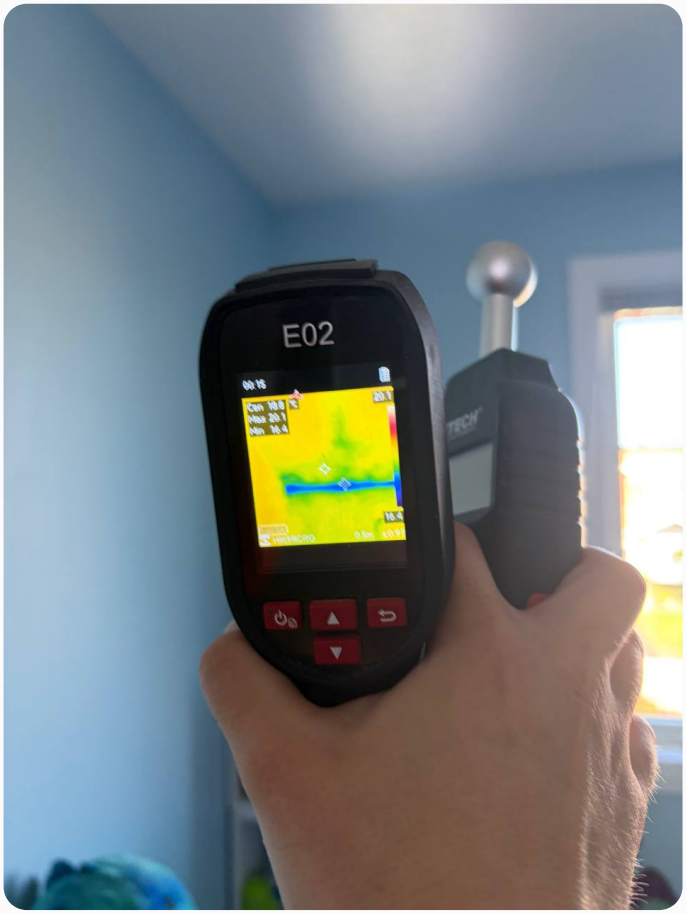

Thermal anomalies detected throughout the property #2




Thermal anomalies detected throughout the property #3





Thermal anomalies detected throughout the property #4

Ball slope test - failed

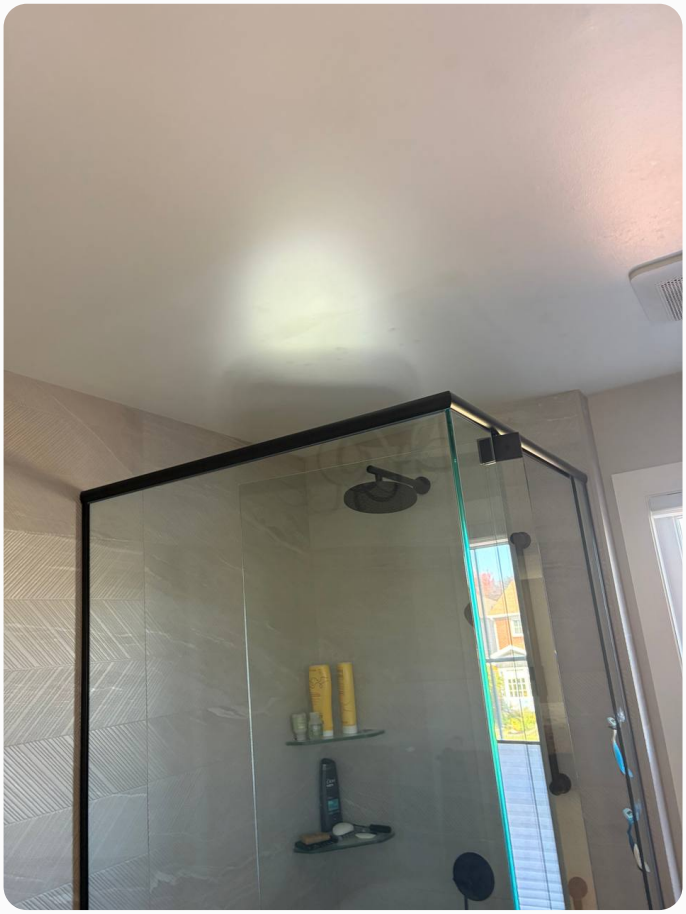

Visible discoloration in washrooms #1




Visible discoloration in washrooms #2





Elevated moisture around the faucet


Visible discoloration in washrooms #3

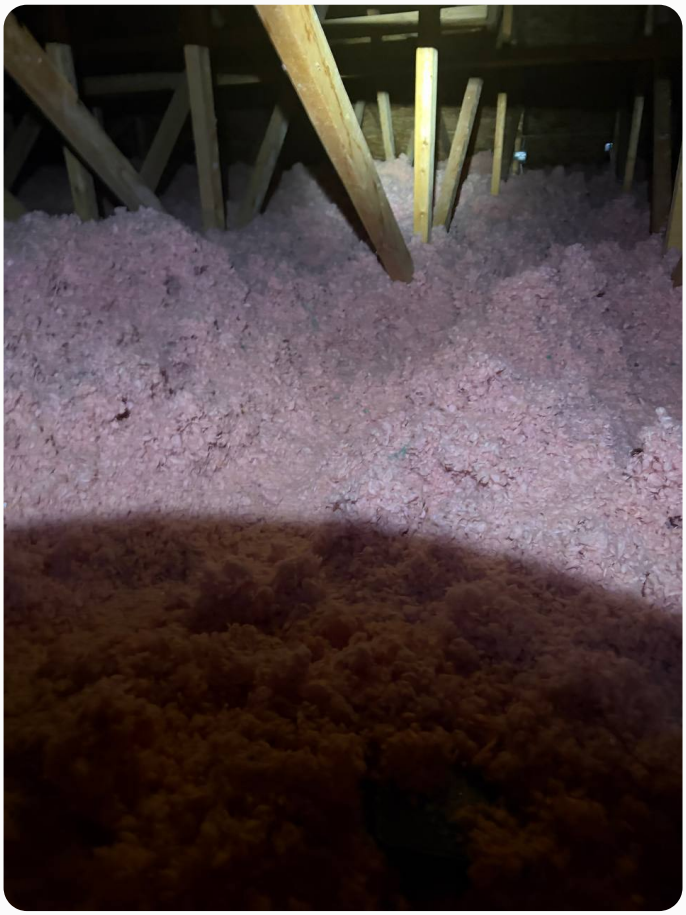

Attic inspection - disturbed insulation and visible discoloration #1



Attic inspection - disturbed insulation and visible discoloration #2

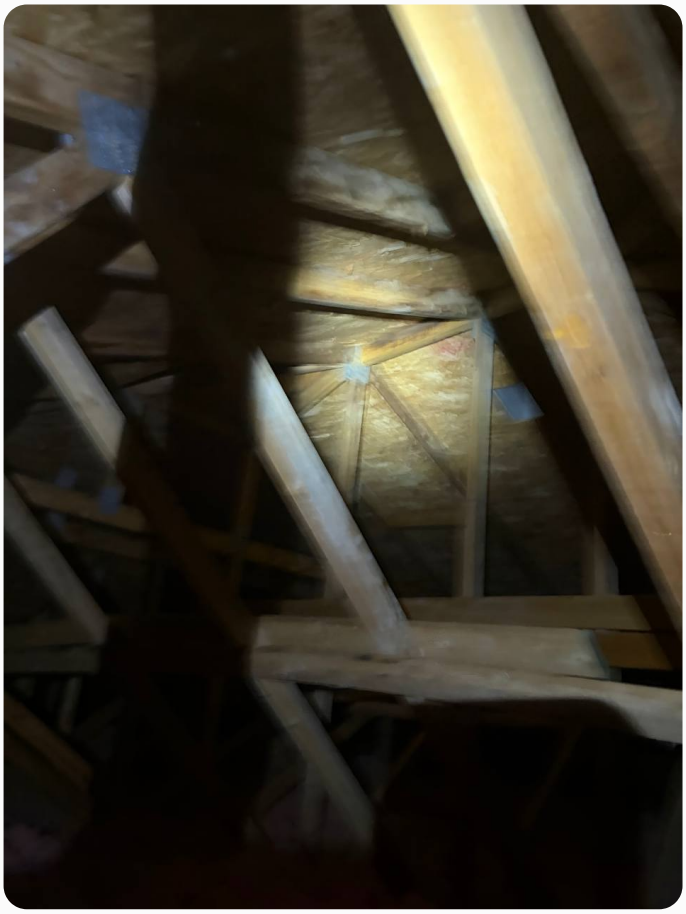



Attic inspection - disturbed insulation and visible discoloration #3

Attic inspection - disturbed insulation and visible discoloration #4



Exterior defects - drainage and depression

05

CONCLUSIONS & RECOMMENDATIONS

The following recommendations are based on the technician's visual and diagnostic observations at the time of the inspection within the property at Sample Property 01, Ontario .

► Professional Mold Remediation services

► Contact an insulation company to address the insulation issue in the attic

► Contact a roofer to inspect the roof above the living room area on the main floor


Please note that every individual will react differently to mold. The severity of the reaction will depend on factors such as the individual's immune system, exposure threshold, type of mold species present in the space, and the duration of exposure. Health Canada considers indoor mold growth to be a "**significant health hazard**" and recommends that all mold, regardless of the species, be cleaned and that the underlying water or humidity problem be dealt with quickly to prevent potential health issues. (Source: *Addressing moisture and mould in your home; Canada.ca*)

If you have any questions regarding this report and the findings therein, please contact **Mold Busters** at 1-877-566-6653.

As a local business, we really value our client's feedback. This helps us to improve as a team, and gives other, new clients the opportunity to see the value in hiring our company.

We kindly ask you to write an honest review of our services by visiting the link below:

Service Feedback and Insights Survey

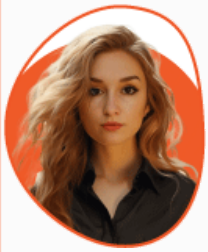

Staff A , CMI

Indoor Environmental Inspector

06

APPENDIX - KNOWLEDGE BASE



Everything You Need to Know About Mold



The Mold Library



Residential Mold Removal Guidelines



Asbestos in Canada: A Homeowner's Handbook



The Ultimate Mold Prevention Guide



Indoor Air Quality



Mold Videos

Copyright © 2026 Bust Mold Inc. All rights reserved.