

1.2.7 Exercise On Dimensioning:

Example – 1: Read the dimensioned drawing as shown in figure. Redraw the figure in full size. Dimension it as per BIS code. The following mistakes of dimensioning are noted as shown in figure.

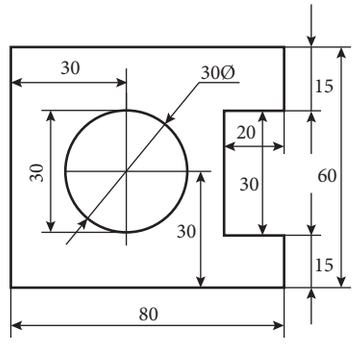


Incorrect

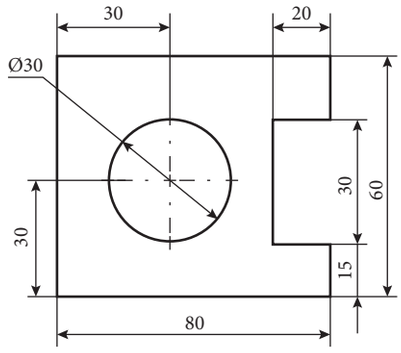


(ii) Correct

1. Most of the dimensions are placed inside the drawing. Place them outside the drawing.
2. Some of the dimension lines are crossing each other. It is not permitted.
3. Diameter of the circle is wrongly given as 30 Ø
4. Axis of the circle is not shown correctly.

Example – 2 : Redraw the figure in full size. Mark the dimensions as per BIS.

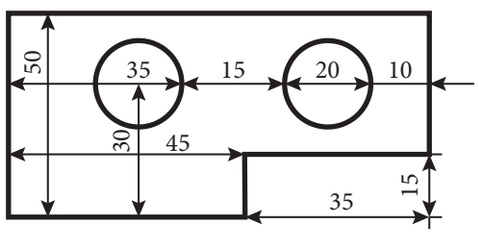

(i) Incorrect

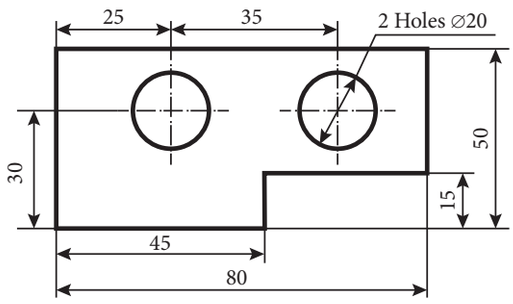

(ii) Correct

1. Many dimensions are placed inside the drawing. Mark them outside the drawing.
2. Dimension (50) Line is crossing the dimension (45) line. Also, dimensions (45) line and dimension (30) line cross each other. Also , dimension (50) and dimension (35) line cross each other. Dimension lines should not cross other dimension lines.
3. Dimensional value (50) should be placed in the middle of the dimension line.
4. Centre lines of both the holes should be drawn. Distance between center lines should be marked.
5. Diameters of the holes are not shown properly. Follow the convention of repeated features for the two holes using leader line and Notes (2xØ 20 or 2 holes Ø 20) written horizontally.
6. Extensions of outlines of the drawing are wrongly used as dimension (35 and 15) lines.
7. Dimension (15) line between outside the circles and also the dimension (10) line between the outline of the circle and outline of the drawing are not permissible.
8. Overall measurements should be given. But only overall width of the drawing is shown. Mark the overall length too.

Civil_English_Unit_1.indd 22 12/21/2019 1:06:39 PM