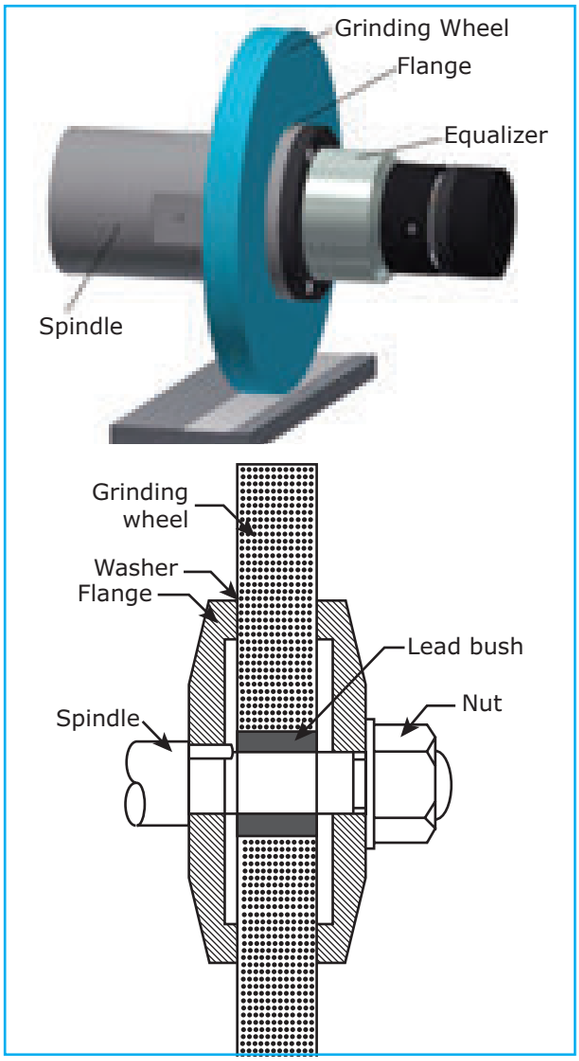


Method of Mounting Grinding Wheel

7. The inner flange should be keyed to the spindle, whereas the outer flange should have an easy sliding fit with the spindle.
8. The nut should be tightened to hold the wheel firmly.
9. Wheel guards should be fitted at required place before starting the grinding machine.
10. After mounting the grinding wheel, the wheel should be made to run idle for a period of about 10 to 15 minutes, grinding wheels must be dressed and trued before any work can be started.

4.13 Glazing, loading and chattering

Glazing

Glazing of the wheel is a condition in which the face cutting edge takes a glass like appearance. Glazing takes place if the wheel is rotated at very high speeds and is made with harder bonds. Rotating the wheel at lesser speeds and using soft bonds are the remedies. The glazed wheels are dressed to have fresh, sharp cutting edges.

Loading

The wheel is loaded in the particles of the metal being adhere to the wheel. The openings or pores of the wheel face are filled up with the metal. It is caused by grinding a softer material or by using a very hard bonded wheels and running it very slowly. It may also take place if very deep cuts are taken by not using the right type of coolant.

Chattering

Sometimes the way pattern of criss cross lines are visible on the ground surface. This condition is known as chattering. It takes place when the spindle bearings are not fitted correctly and because of the imbalance of the grinding wheel.

Dressing and truing of grinding wheel

If the grinding wheels are loaded or gone out of shape, they can be corrected by dressing or truing of the wheels.

Dressing

Dressing is the purpose of breaking away the glazed surface so that sharp particles

XII BME_English version CHAPTER 04.indd 91 1/8/2020 1:43:07 PM