
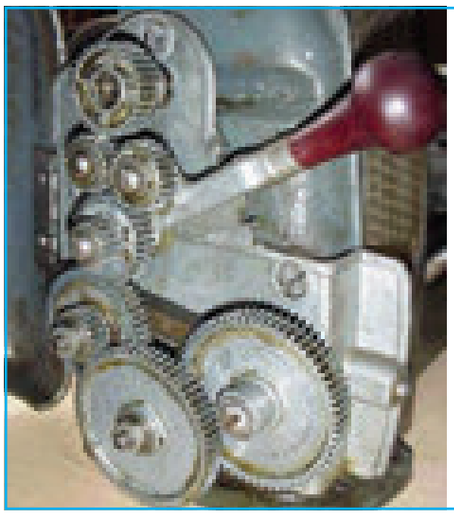


3D- Tumbler Gear

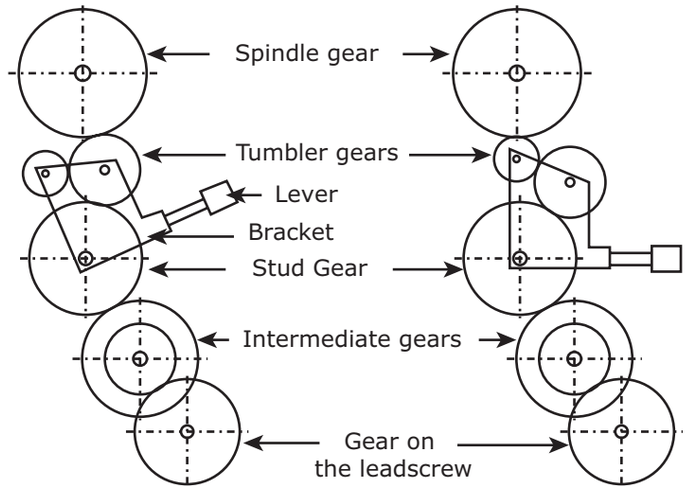

Tumbler Gear


leadscrew and feed rod receive rotational movement from spindle gear through tumbler gears. Hence, they rotate in opposite direction of the spindle rotation. So the carriage will move towards tailstock.

1.7 Apron Mechanism


Apron is attached to the carriage and hangs over the front side of the lathe bed. It is useful in providing power and hand feed to both carriage and cross-slide. It is also used to provide power feed to the carriage during thread cutting through two half nuts.

The gear attached to the spindle is called spindle gear. Feed rod (A) and lead screw (B) receives rotational movement from spindle gear through the tumbler gear. Worm (W) and worm gear (WG) mechanism is fixed in worm gear rod (A). One more gear (G) is fixed in worm gear shaft. Gear G_1 and G_2 is connected as shown in the figure. Gear G_4 is inserted in the rack gear. Gear G_3 is mounted on Gear G_4 axis. Handle (H) for longitudinal feed and gear G_5 are mounted on the same axis. Gears G_3 and G_5 are always connected each other.

There is a feed check lever (F), which can be adjusted into three positions

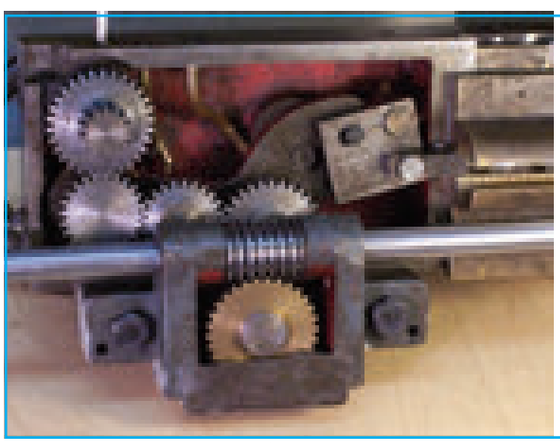

3D-Apron

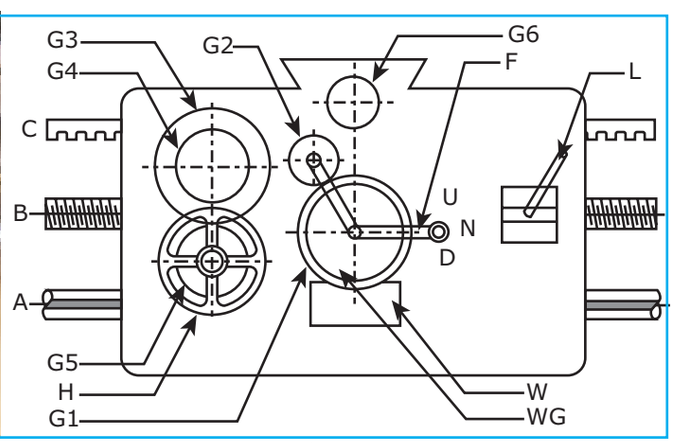

Apron

XII BME_English version CHAPTER 01.indd 8 1/8/2020 1:45:52 PM