

- 24-hour Telephone Number: (937) 847-3200

Use for urgent or emergency needs for technical support, service and/or replacement parts

- Routine Technical Inquiries: techsupport@motoman.com

Allow up to 36 hours for response

YASKAWA

YNX1000 Alarm Codes (Major Alarms)

-
- Upon receipt of the product and prior to initial operation, read these instructions thoroughly, and retain for future reference.
 - This instruction consists of “Major alarms” version and “Minor alarms” version.
-

Have the following information available when contacting the YASKAWA Representative:

- System
- Primary Application
- Software Version (*Located on Programming Pendant by selecting: {Main Menu} - {System Info} - {Version}*)
- Warranty ID (*Located on Robot Controller*)
- Robot Serial Number (*Located on Manipulator data plate*)
- Robot Sales Order Number (*Located on Robot controller data plate*)

This Page Intentionally Blank

Table of Contents

i.	Before Using the Product.	11
i.1	Introduction to This Manual	12
	Applicable Products	12
	Nameplate	12
	Intended Audience	13
	Related Manuals	13
i.2	Notes for Safe Operation	14
	Safety Information	14
	Visual Aids	14
	Important Safety Precautions	15
	Warning Label Attachment Locations	27
i.3	Using This Manual	30
	Terms	30
	Terms for Pendant Operation	30
	Trademarks	30
1.	Alarm List	31
1.1	Alarm Number (0000 to 0999)	32
	0011: CPU BOARD INSERTION ERROR (Safety)	32
	0012: CPU BOARD SETTING ERROR	32
	0020: CPU COMMUNICATION ERROR	33
	0021: COMMUNICATION ERROR(SERVO)	38
	0030: ROM ERROR	38
	0040: HARDWARE INITIALIZE ERROR	41
	0060: COMMUNICATION ERROR(I/O MODULE)	41
	0100: COMMUNICATION ERROR(SV#1)	49
	0200: MEMORY ERROR(PARAMETER FILE)	50
	0210: MEMORY ERROR(SYSTEM CONFIG-DATA)	55
	0220: MEMORY ERROR(JOB MNG DATA)	55
	0230: MEMORY ERROR (LADDER PRG FILE)	56
	0270: MEMORY ERROR(SD BACKUP FILE)	57
	0280: MEMORY ERROR(EX IO ALLOC FILE)	57
	0290: MEMORY ERROR(NETWORK SETUP)	57
	0300: VERIFY ERROR(SYSTEM CONFIG-DATA)	58
	0301: VERIFY ERROR(OVERRUN INPUT SET)	63
	0310: VERIFY ERROR(CMOS MEMORY SIZE)	63
	0320: VERIFY ERROR(I/O MODULE)	63
	0321: VERIFY ERROR(LAN BOARD)	71
	0330: VERIFY ERROR(APPLICATION)	72
	0340: VERIFY ERROR(SENSOR FUNCTION)	73
	0370: VERIFY ERROR(SPOT WELDER I/F)	73
	0390: VERIFY ERROR(SEGMENT CLOCK)	73
	0400: PARAMETER TRANSMISSION ERROR	74
	0410: MODE CHANGE ERROR	75
	0500: SEGMENT PROC NOT READY	76
	0510: SOFTWARE VERSION UNMATCH	76

0520: AXIS LIMIT OVER	77
0550: MECHATROLINK PARAMETER INITIALIZE ERROR (DEVICE 1)	77
0560: MODULE DETECTION ERROR	78
0561: EVENT DRIVEN CONNECT ERROR	78
0562: EVENT DRIVEN ID_RD ERROR	79
0563: EVENT DRIVEN MEM_RD ERROR	79
0564: EVENT DRIVEN TIMEOUT ERROR	80
0565: VENDOR ID CODE ERROR	81
0568: SUB DEVICE CODE ERROR	81
0569: SERIAL NUMBER ERROR	81
0570: MECHATROLINK DEVICE ERROR	82
0571: MECHATROLINK ADDRESS ERROR (SERVO AMPLIFIER)	82
0572: SERVO AMPLIFIER TYPE ERROR	83
0573: LOCAL DEVICE ERROR	83
0574: LOCAL DEVICE DUPLICATED ERROR	83
0575: PROFILE TYPE ERROR	84
0576: SIGMA-XMD NOT USED ERROR	84
0578: MECHATROLINK CABLE DISCONNECTION	85
0579: MECHATROLINK ADDRESS ERROR (PARAMETER)	85
0590: MECHATROLINK CYCLIC COMMUNICATIONS INITIALIZE ERROR	86
0591: MECHATROLINK EVENT DRIVEN COMMUNICATIONS INITIALIZE ERROR	86
0592: MECHATROLINK EVENT DRIVEN COMMUNICATIONS NETWORK RESET ERROR	87
0593: MECHATROLINK SLAVE SEARCH ERROR	87
0594: MECHATROLINK PRE-CYCLIC COMMUNICATIONS ERROR	88
0595: MECHATROLINK PRE-CYCLIC COMMUNICATIONS NETWORK RESET ERROR	88
0700: VERIFY ERROR(EX IO ALLOC FILE)	89
0710: LADDER INITIALIZE ERROR	89
0711: SLIO MODULE INIT ERROR	90
0720: LADDER PROGRAM ERROR	90
0730: COMMUNICATION ERROR (SKS-SERIAL)	96
0750: MECHATROLINK COM. ERROR (SLV#1)	98
0751: MECHATROLINK COM. ERROR (SLV#2)	98
0752: MECHATROLINK COM. ERROR (SLV#3)	99
0753: MECHATROLINK COM. ERROR (SLV#4)	99
0754: MECHATROLINK COM. ERROR (SLV#5)	100
0755: MECHATROLINK COM. ERROR (SLV#6)	100
0756: MECHATROLINK COM. ERROR (SLV#7)	101
0757: MECHATROLINK COM. ERROR (SLV#8)	101
0758: MECHATROLINK COM. ERROR (SLV#9)	102
0759: MECHATROLINK COM. ERROR (SLV#10)	102
0760: MECHATROLINK COM. ERROR (SLV#11)	103
0761: MECHATROLINK COM. ERROR (SLV#12)	103
0762: MECHATROLINK COM. ERROR (SLV#13)	104
0763: MECHATROLINK COM. ERROR (SLV#14)	104
0764: MECHATROLINK COM. ERROR (SLV#15)	105
0765: MECHATROLINK COM. ERROR (SLV#16)	105
0770: SAFETY FIELDBUS SET ERR(RC)	105
0771: SAFETY FIELDBUS SYS ERR(RC)	106
0772: DeviceNet Safety RESET REQUEST	106
0790: MEMORY BATTERY WEAK	107
0800: FILE BACKUP ERROR (RC SD)	107
0801: FILE LOAD ERROR (RC SD)	107
0802: FILE I/O ERROR (RC SD)	108
0803: FILE ERROR	109
0831: FORCE SENSOR COMMUNICATION ERROR	109
0900: WATCHDOG TIMER ERROR(RC)	110
0901: WATCHDOG TIMER ERROR(OPT#1)	110

0902: WATCHDOG TIMER ERROR(OPT#2)	111
0903: WATCHDOG TIMER ERROR(OPT#3)	111
0904: WATCHDOG TIMER ERROR(OPT#4)	112
0905: WATCHDOG TIMER ERROR(OPT#5)	112
0906: WATCHDOG TIMER ERROR(OPT#6)	113
0907: WATCHDOG TIMER ERROR(OPT#7)	113
0908: WATCHDOG TIMER ERROR(OPT#8)	114
0910: CPU ERROR(RC)	114
0911: CPU ERROR(OPT#1)	115
0912: CPU ERROR(OPT#2)	115
0913: CPU ERROR(OPT#3)	115
0914: CPU ERROR(OPT#4)	116
0915: CPU ERROR(OPT#5)	116
0916: CPU ERROR(OPT#6)	117
0917: CPU ERROR(OPT#7)	117
0918: CPU ERROR(OPT#8)	117
0920: WATCHDOG TIMER ERROR(MSF#1)	118
0921: WATCHDOG TIMER ERROR(MSF#2)	119
0931: CPU HANG UP ERROR(OPT#1)	119
0932: CPU HANG UP ERROR(OPT#2)	120
0933: CPU HANG UP ERROR(OPT#3)	120
0934: CPU HANG UP ERROR(OPT#4)	121
0935: CPU HANG UP ERROR(OPT#5)	121
0936: CPU HANG UP ERROR(OPT#6)	122
0937: CPU HANG UP ERROR(OPT#7)	122
0938: CPU HANG UP ERROR(OPT#8)	123
0939: CPU HANG UP ERROR(MP-PRESS)	123
0960: CPU ERROR(MSF#1)	124
0961: CPU ERROR(MSF#2)	125
0970: CPU ERROR(FSF01#1)	125
0971: CPU ERROR(FSF01#2)	126
0980: WATCHDOG TIMER ERROR(FSF01#1)	127
0981: WATCHDOG TIMER ERROR(FSF01#2)	127
0990: SYSTEM ERROR(RC)	128
0991: SYSTEM ERROR(OPT#1)	131
0992: SYSTEM ERROR(OPT#2)	131
0993: SYSTEM ERROR(OPT#3)	132
0994: SYSTEM ERROR(OPT#4)	132
0995: SYSTEM ERROR(OPT#5)	133
0996: SYSTEM ERROR(OPT#6)	133
0997: SYSTEM ERROR(OPT#7)	134
0998: SYSTEM ERROR(OPT#8)	134
0999: PCI-e COMMUNICATION ERROR	134
1.2 Alarm Number (1000 to 1999)	137
1000: ROM ERROR(RC)	137
1020: MotoPlus (APPLICATION LOAD ERROR)	137
1030: MEMORY ERROR(PARAMETER FILE)	139
1031: MEMORY ERROR(MOTION1)	143
1033: MEMORY ERROR(MODEL DATA FILE)	148
1034: MEMORY ERROR(F-CONDITION FILE)	148
1035: MEMORY ERROR(SYSTEM)	149
1050: SET-UP PROCESS ERROR(SYSCON)	149
1051: SET-UP PROCESS ERROR(MOTION)	150
1053: ACU SERVICE (SETUP ERROR)	152
1100: SYSTEM ERROR	153
1101: SYSTEM ERROR(MAN-MACHINE MECHA)	154
1102: SYSTEM ERROR(MAN-MACHINE APPLI)	154
1103: SYSTEM ERROR(EVENT)	154
1104: SYSTEM ERROR(CIO)	155
1105: SYSTEM ERROR(SERVO)	155

1109: SYSTEM ERROR(CONVEYOR)	156
1200: HIGH TEMPERATURE(IN CNTL BOX)	156
1204: COMMUNICATION ERROR(I/O MODULE)	156
1219: ENABLE SW STICKING	157
1220: LAN COMMUNICATION PARAMETER ERROR.....	157
1221: ETHERNET INITIAL PROCESS ERROR	161
1222: IP ADDRESS SET FAIL(DHCP)	174
1227: ENABLE SW DIAGNOSIS ERROR	175
1229: SLIO MODULE STATUS ERROR.....	175
1240: SAFETY FIELDBUS SETTING ERROR	175
1241: SAFETY FIELDBUS SYSTEM ERROR.....	176
1248: IOSPDCTRL SET ERROR	180
1300: SERVO CPU SYNCHRONIZING ERROR.....	181
1301: COMMUNICATION ERROR(SERVO)	181
1303: ARITHMETIC ERROR(SERVO).....	182
1307: ENCODER TYPE MISMATCH	182
1311: A/D DETECTION ERROR(CONVERTER).....	183
1313: SERVO AMPLIFIER COMMAND ERROR.....	183
1314: SERVO AMPLIFIER PRM VERIFY ERROR	183
1316: SERVO AMPLIFIER COMM WDT ERROR.....	184
1317: SERVO AMPLIFIER COMMAND TIMEOUT	184
1318: SERVO AMPLIFIER CANNOT EXEC CMD	185
1325: COMMUNICATION ERROR(ENCODER)	185
1326: DEFECTIVE ENCODER ABSOLUTE DATA	185
1327: ENCODER OVER SPEED	186
1328: DEFECTIVE ENCODER	186
1329: DEFECTIVE ENCODER COMMAND	186
1349: POWER LOST DETECTION	187
1355: ENCODER MULTITURN LIMIT ERR	187
1367: OVERVOLTAGE(CONVERTER)	188
1368: REGENERATIVE TROUBLE(CONVERTER)	189
1372: PARAMETER ERROR (CONVERTER)	190
1374: ENCODER MIXED ALLOCATION ERROR.....	190
1376: ENCODER SET AXES NUMBER OVER	190
1377: ENCODER CABLE DISCONNECTION(SV)	191
1388: SERVO OFF EXECUTION INCOMPLETE	191
1389: SERVO AMPLIFIER POSITION DATA ERROR	192
1393: SERVO AMPLIFIER COMM ERROR.....	193
1395: MOTOR TYPE MISMATCH.....	193
1398: SERVO AMPLIFIER SETUP ERROR	194
1400: ENCODER ERROR(CONVEYOR).....	194
1401: CANNOT CHANGE CONVEYOR MODE	195
1402: WORK IN/NOT DATA CNT. LMT. OVER	195
1403: WORK IN/NOT SHIFT DATA POS LMT.	195
1404: WORK ID. DATA CNT. LMT. OVER	195
1405: WORK ID. SHIFT DATA POS LMT.	196
1406: START SHIFT DATA CNT. LMT. OVER	196
1407: START SHIFT DATA POS LMT.	196
1437: PORT OPEN ERROR	196
1547: CURRENT FEEDBACK ERROR	197
1606: TORQUE SENSOR CABLE DISCONNECTION(SV)	198
1607: DEFECTIVE TORQUE SENSOR COMMAND	198
1608: TORQUE SENSOR CONNECTION ERR	199
1610: F-SAFE CPU SYNCHRO ERROR	199
1612: F-SAFE COMMUNICATION ERROR.....	199
1613: F-SAFE ENCODER COMM. ERR 1	201
1614: F-SAFE ENCODER COMM. ERR 2	202
1615: F-SAFE SYSTEM ERROR	202
1616: F-SAFE SYSTEM ERROR 1.....	203
1618: F-SAFE ARITHMETIC ERROR	203

1619: F-SAFE PARAMETER ERROR	203
1622: F-SAFE DEFECTIVE ENCODER.....	203
1623: F-SAFE ENCODER CORR. NUM OVER.....	204
1630: F-SAFE MUTUAL DIAG. ERR(WDT).....	204
1631: F-SAFE MUTUAL DIAG. ERR(HW SET).....	205
1632: F-SAFE MUTUAL DIAG. ERR(MONITOR)	205
1635: F-SAFE LOW VOLTAGE	205
1636: F-SAFE OVER VOLTAGE	206
1637: F-SAFE RAM DIAGNOSIS ERROR	207
1638: F-SAFE ROM DIAGNOSIS ERROR	207
1639: F-SAFE RAM AREA CONVERSION ERR.....	207
1640: F-SAFE REAL TIME MONITOR ERROR.....	208
1642: F-SAFE WATCHDOG SIGNAL ERROR	208
1643: F-SAFE SAFETY SIGNAL SET ERROR	209
1646: F-SAFE COMM.SETTING ERROR	209
1650: FILE TRANSFER DATA ERROR (SV)	210
1651: FILE TRANSFER DATA SIZE ERR (SV)	211
1657: AXIS ENDLESS SPECIFIC. ERR(SV).....	211
1658: REDUCTION STOP SPECIFIC. ERR(SV).....	212
1666: FILE RECEIVE INCOMPLETE (SERVO).....	212
1667: RESOLUTION CONVERSE CONST ERR(SV).....	212
1672: GRP CHANGE PG POWER ON ERR (SV).....	213
1673: GRP CHANGE SERVO ON ERROR (SV).....	213
1674: ARM CONTROL SEQUENCE ERR (SV).....	213
1678: MOTOR CMD POSITION ERROR (SV).....	213
1684: INSTANT POWER FAILURE(TRQ)(SV)	214
1685: INSTANT POWER FAILURE(TIME)(SV)	214
1688: MEMORY DATA FILE STORAGE ERROR	214
1690: PCI BOARD NOT DETECTED	214
1691: FORCE SENSOR BOARD UNMOUNTED	215
1696: F-SAFE ENCODER DIAG.ERROR	215
1700: PARAMETER CHECKSUM ERROR	215
1701: PARAMETER FORMAT ERROR	216
1702: SYSTEM CHECKSUM ERROR	216
1703: SYSTEM ALARM.....	216
1705: PARAMETER SETTING ERROR	217
1706: PARAMETER COMBINATION ERROR.....	217
1707: SIGMALINK II COMMAND/ RESPONSE PARAMETER SETTING ERROR	218
1708: PARAMETER SETTING ERROR 2	218
1709: UNSUPPORTED DEVICE ALARM	218
1710: MOTOR TYPE CHANGE DETECTED.....	219
1711: OVERCURRENT DETECTED	219
1712: MOTOR OVERCURRENT DETECTED.....	220
1713: INTERNAL TEMPERATURE SENSOR ERROR.....	221
1714: REFERENCE VOLTAGE ERROR 2	221
1715: MECHATROLINK INITIALIZATION TIMEOUT ERROR 1	222
1716: SEMI-CLOSED/FULLY-CLOSED LOOP CONTROL PARAMETER SETTING ERROR	222
1718: CURRENT DETECTION ERROR 3	223
1719: MECHATROLINK COMMUNICATIONS ASIC ERROR 1	223
1720: MECHATROLINK COMMUNICATIONS ASIC ERROR 2	223
1721: FIRMWARE ERROR	224
1722: SYSTEM ALARM 0	224
1723: SYSTEM ALARM 1	224
1724: SYSTEM ALARM 2	225
1725: SYSTEM ALARM 3	225
1726: SYSTEM ALARM 4	225
1727: SYSTEM ALARM 5	226
1728: SYSTEM ALARM 6	226
1729: SYSTEM ALARM 7	226

1730: SYSTEM ALARM 8	227
1731: SYSTEM ALARM D	227
1732: ENCODER CLEAR ERROR OR MULTITURN LIMIT SETING ERROR	227
1733: ENCODER COMMUNICATIONS POSITION DATA ACCELERATION RATE ERROR	228
1734: ENCODER COMMUNICAYTIONS TIMER ERROR	228
1735: ENCODER PARAMETER ERROR	229
1736: ENCODER ECHOBACK ERROR	229
1737: MULTITURN LIMIT DISAGREEMENT	229
1738: SIGMALINK II NODE CONFIGURATION ERROR	230
1739: SIGMALINK II POWER SUPPLY SHORT-CIRCUIT DETECTED	230
1740: SIGMALINK II CONFIGURATION DATA CHECKSUM ERROR	231
1741: SIGMALINK II NODE CHANGE DETECTED	231
1742: SIGMALINK II I/O DEVICE COMMUNICATION ERROR	231
1743: SIGMALINK II I/O DEVICE STATUS ERROR	232
1744: CONVETER TEMPERATURE SENSOR ERROR	232
1745: REFERENCE VOLTAGE ERROR 3	232
1746: DC POWER SUPPLY ERROR 1	232
1747: DC POWER SUPPLY ERROR 2	233
1748: DC POWER SUPPLY ERROR 3	233
1749: REFERENCE VOLTAGE ERROR 4	233
1750: SIGMALINK II POWER SUPPLY SHORT-CIRCUIT DETECTED 2	233
1751: MECHATROLINK INITIALIZATION TIMEOUT ERROR 2	234
1752: CONVERTER PARAMETER CHECKSUM ERROR	234
1753: CONVERTER PARAMETER FORMAT ERROR	235
1754: CONVERTER SYSTEM CHECKSUM ERROR	235
1755: CONVERTER SYSTEM ERROR 1	235
1756: CONVERTER SYSTEM ERROR 2	236
1757: CONVERTER SYSTEM ERROR 4	236
1758: CONVERTER SYSTEM ERROR 6	236
1759: SAFETY FUNCTION SIGNAL INPUT TIMING ERROR	237
1760: GATE DRIVE ERROR 1	237
1761: GATE DRIVE ERROR 2	237
1762: SAFETY ENCODER CONNECTED NUM ERR	238
1843: M-SAF EX I/O BOARD CONN ERROR	238
1860: M-SAFETY COMMUNICATE ERROR	239
1861: M-SAF SYSTEM ERROR	240
1863: M-SAF SETUP ERROR	240
1865: M-SAF CPU COMM ERROR	241
1866: M-SAF F-SAFETY COMM ERROR	242
1867: M-SAF ROM DIAG. ERROR	243
1868: M-SAF RAM DIAG. ERROR	244
1869: M-SAF STACK DIAG. ERROR	244
1870: M-SAF REGISTER DIAG. ERROR	245
1871: M-SAF SEQUENCE WATCH ERROR	245
1872: M-SAF WATCHDOG ERROR	246
1878: M-SAF VOLTAGE WATCH ERROR2	247
1879: M-SAF OPCODE ERROR	247
1887: F-SAFE RAM DIAG. ERROR(RD ADDR)	248
1888: F-SAFE RAM DIAG. ERROR(WT ADDR)	248
1889: F-SAFE OPCODE DIAG. ERROR	248
1890: F-SAFE M-SAFETY COMM ERROR	248
1891: F-SAFE OUTPUT SIGNAL UNMATCH	250
1892: F-SAFE COND FILE SETTING ERR	251
1894: F-SAFE STACK DIAG. ERROR	251
1895: F-SAFE REGISTER DIAG. ERROR	251
1896: F-SAFE SEQUENCE WATCH ERROR	252
1897: F-SAFE WATCHDOG ERROR	252
1898: F-SAFE ENCODER SELECT ERROR	252
1899: F-SAFE MONITOR EXECUTE TIME OVER	252

1915: CONTROLLER TYPE MISMATCH(SV)	253
1920: SYSTEM ERROR(PFL)	253
1923: TORQUE MUTUAL DIAG. ERR(PFL)	253
1924: FORCE MUTUAL DIAG. ERR(PFL)	253
1930: SYSTEM ERROR1(PFL)	254
1931: ARITHMETIC ERROR(PFL)	254
1946: API ERROR(PFL)	254
1947: TRQ SENSOR MUTUAL DIAG. ERR(PFL)	254
1950: MULTIDROP ENCODER COMMUNICATION SETUP COMPLETE	255
1951: MULTIDROP ENCODER COMMUNICATION SETUP ERROR	255
1952: MULTIDROP MASTER NUM ERROR	256
1953: MASTER PORT OVERLAP ERROR	256
1954: SGMLNK2 DATA COMMUNICATION ERROR	257
1955: INITIALIZE PG POSITION ERROR	257
1956: ENCODER INITIAL SEQUENCE TIMEOUT	257
1957: ENCODER BACK-UP RECONNECT ERROR	258
1958: SAFE ENCODER MULTURN KEEP ERR	258
1959: ENCODER CHECK ERR	258
1960: CONNECT (I/O) SETTING ERROR (MCON)	259
1961: CONNECT (I/O) SETTING ERROR (BOXFAN)	259
1962: CONNECT (I/O) SETTING ERROR (LAMP)	259
1963: CONNECT (I/O) SETTING ERROR (FANCTRL)	259
1964: CONNECT (I/O) SETTING ERROR (AXOUT)	260
1965: CONNECT (I/O) SETTING ERROR (MCONFB)	260
1966: CONNECT (I/O) SETTING ERROR (SHOCK)	260
1967: CONNECT (I/O) SETTING ERROR (ALMIN1)	260
1968: CONNECT (I/O) SETTING ERROR (ALMIN2)	261
1969: CONNECT (I/O) SETTING ERROR (ALMIN3)	261
1970: CONNECT (I/O) SETTING ERROR (DIN)	261
1971: CONNECT (I/O) SETTING ERROR (AXIN)	261
1975: SERVO AMPLIFIER VERSION ERROR	262
1976: CONVERTER VERSION ERROR	262
1977: SERVO AMPLIFIER UPDATE ERROR	262
1992: SAFE ENCODER MULTURN CHECK ERR	262
1993: SAFE ENCODER PRM ERR	263
1994: SAFE TORQUE SENSOR PRM ERR	263
1995: TORQUE SENSOR COMMUNICATION ERR	263
1996: TORQUE SENSOR ILLEGAL	264
1997: TORQUE SENSOR TEMPERATURE ERR	264
1998: TORQUE SENSOR CALCULATION ERR	264
1999: SERVO AMPLIFIER ALARM(SERVO)	265

Before Using the Product

i.1	Introduction to This Manual.....	12
i.2	Notes for Safe Operation	14
i.3	Using This Manual.....	30

i.1 Introduction to This Manual

This manual describes the relevant functions of the robot controller given in the title.

The robot controller is composed of multiple devices that have a wide variety of functions. Read this manual together with the manuals for the options and peripheral devices that make up the robot system in the relevant equipment or facility.

[Important]

- Read and understand this manual to ensure the correct usage of the product.
- Keep this manual in a safe place so that it can be referred to whenever necessary.
- Assume that items not described in this manual are either prohibited or not possible. General items related to safety are described in "Notes for Safe Operation" in this manual. Carefully read and understand these instructions and use the product correctly.


◆ Applicable Products

This manual provides information on the following robot controllers.

Applicable Manipulators	Specification	Robot Controller Type
MOTOMAN NEXT-NEX4 MOTOMAN NEXT-NEX7 MOTOMAN NEXT-NEX10	Specification for Japan	ERXR-1000-06VX10-A00
	Specification for Europe and North America	ERXR-1000-06VX10-G00
MOTOMAN NEXT-NEX20	Specification for Japan	ERXR-1000-06VX35-A00
	Specification for Europe and North America	ERXR-1000-06VX35-G00
MOTOMAN NEXT-NEX35	Specification for Japan	ERXR-1000-06VX35-A00
	Specification for Europe and North America	ERXR-1000-06VX35-G00
MOTOMAN NEXT-NHC12	Specification for Japan	ERXR-1000-06VXC12-A00
	Specification for Europe and North America	ERXR-1000-06VXC12-G00

◆ Nameplate

The nameplate is attached to the robot controller in the following location. The nameplate lists basic information about the product.

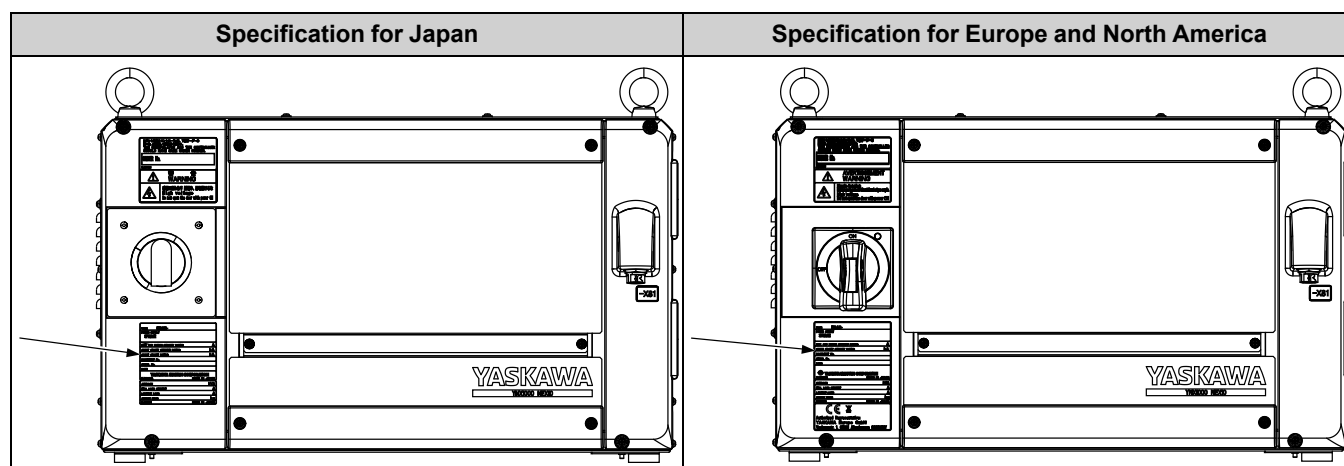

◆ Intended Audience

The following people are the intended audience for this manual.

- Managers and safety management supervisors
- Robot system designers
- Robot system programmers
- Robot system maintenance personnel
- Robot system users

◆ Related Manuals

Category	Manual Name	Manual No.
Manipulator	MOTOMAN NEXT-* Instructions ^{*1}	-
Robot controller	YNX1000 Instructions	RE-CTO-A226
	YNX1000 Quick Start Guide	HW2481225
	YNX1000 Instructions for Block Language	RE-CKI-A472
	YNX1000 Instructions for Concurrent I/O	RE-CKI-A473
	YNX1000 Maintenance Manual	RE-CHO-A118
	YNX1000 Alarm Codes	RE-CER-A603
	YNX1000 Instructions for Collaborative Operation	HW2403011
	YNX1000 Instructions for Functional Safety Function	HW2481604
	MOTOMAN NEXT Notes for Safe Operation	R-AN-A312
ACU application development environment	YNX1000 Instructions for Autonomous Control Unit	HW2481239
	YNX1000 Autonomous Control Unit Quick Start Guide for Application Development	HW2481227
	YNX1000 Autonomous Control Unit API Reference Manual for Robot Control Service	HW2481229
	YNX1000 Autonomous Control Unit Instructions for Machine Vision Service	HW2481231
	YNX1000 Autonomous Control Unit API Reference Manual for Machine Vision Service	HW2481233
	YNX1000 Autonomous Control Unit Instructions for Force Control Service	HW2481235
	YNX1000 Autonomous Control Unit API Reference Manual for Force Control Service	HW2481237
	YNX1000 Autonomous Control Unit API Reference Manual for AI Service	HW2481364
	YNX1000 Autonomous Control Unit API Reference Manual for Path Planning Service	HW2481368
	YNX Robot Simulator Operator's Manual	HW2481790
Options	YNX1000 Option Instructions for Conveyor Synchronization Function	HW2481333
	YNX1000 Option Instructions for EtherNet/IP Communications Function (For CM-EI01M)	HW2481642
	SLIO I/O Series Digital Input/Output Module Product Manual ^{*2}	-
	SLIO I/O Series Power Module / Power Distribution Module Product Manual ^{*2}	-

*1 Refer to the instructions for your manipulator.

*2 SLIO I/O series product manuals can be downloaded from the following website.
https://www.yaskawa.eu.com/products/plc-control-systems/seriesdetail/serie/slio_1447

i.2 Notes for Safe Operation

◆ Safety Information

Read this manual carefully before installation, operation, maintenance, or inspection of your product. In this manual, the Notes for Safe Operation are classified as “DANGER”, “WARNING”, “CAUTION”, or “NOTICE”.

DANGER

Indicates an imminently hazardous situation which, if not avoided, will result in death or serious injury. Safety Signs identified by the signal word DANGER should be used sparingly and only for those situations presenting the most serious hazards.

WARNING

Indicates a potentially hazardous situation which, if not avoided, will result in death or serious injury. Hazards identified by the signal word WARNING present less risk of injury or death than those identified by the signal word DANGER.

CAUTION

Indicates a hazardous situation, which if not avoided, could result in minor or moderate injury. It may also be used without the safety alert symbol as an alternative to “NOTICE”.

NOTICE

NOTICE is the preferred signal word to address practices not related to personal injury. The safety alert symbol should not be used with this signal word. As an alternative to “NOTICE”, the word “CAUTION” without the safety alert symbol may be used to indicate a message not related to personal injury.

◆ Visual Aids

The following aids are used to indicate certain types of information for easier reference.

- **[Important]**
Indicates precautions or restrictions that must be observed. Also indicates alarm displays and other precautions that will not result in machine damage.
- **[Term]**
Indicates definitions of difficult terms or terms that have not been previously explained in this manual.
- **[Information]**
Indicates supplemental information to deepen understanding or useful information.

◆ Important Safety Precautions

■ Overall Precautions

DANGER

This manual contains important information in order to use the product safely and correctly. A robot typically has characteristics that make it superior to other types of machinery: a wide range of motion when compared to its installation area, high-speed and high-output arm motion, and varied, autonomous operations. However, these characteristics also involve risks not found in typical machinery.

Before using the product (e.g., installation, operation, inspection, and maintenance), carefully read this manual, as well as all relevant instruction manuals and included documentation, and carefully study the information on devices, safety, and precautions. Afterward, make sure to use the product safely and correctly. Refer to "[Related Manuals on page 13](#)" for the relevant instruction manuals and confirm that they are readily accessible. If any manuals are missing, contact your YASKAWA representative.

Be sure to understand the residual risks shown on the warning labels before using this product. Do not remove any covers, cables, connectors, or optional devices while the product is powered.

There is a risk of electrical shock, termination of product operation, or burnout.

WARNING

An experienced engineer must install this product in an appropriate manner.

There is a risk of electrical shock or injury.

When starting operation with the product connected to the machine, make sure an emergency stop can be performed at all times.

There is a risk of injury.

If a momentary power interruption occurs during operation and then the power is restored, the product may restart operation suddenly. In this case, keep away from the machine. Implement measures that can ensure the safety of workers if the product restarts operation.

There is a risk of injury.

Do not touch the interior of the product under any circumstances.

There is a risk of electrical shock.

Do not damage cables, pull on cables with force, apply excessive force to cables, place heavy objects on cables, or crush cables.

There is a risk of electrical shock, termination of product operation, or burnout.

Use the product with the appropriate power supply specifications (AC, number of phases, voltage, and frequency).

There is a risk of burnout, electrical shock, or fire.

Do not disassemble, repair, or modify the product.

There is a risk of fire or failure. The warranty is not applicable to a product that has been disassembled, repaired, or modified.

■ For Ensuring Safety

Make sure to observe the national, municipal, and other laws and regulations related to safety and hygiene shown below.

DANGER

Robot teaching and maintenance should conform to the following laws and regulations: (Japan only)

- Industrial Safety and Health Act
- Order for Enforcement of Industrial Safety and Health Act
- Ordinance on Industrial Safety and Health
- Technical Standards for Electrical Facilities

The business operator (user) must create a manual of safe working procedures based on specific safety management guidelines according to all relevant laws and regulations and abide by these procedures.

Follow the requirements provided in "JIS B 8433-1: 2015 (ISO 10218-1:2011) Industrial robots: Safety requirements" to ensure robot safety. (Japan only)

Create a safety management system, such as by deciding on a designated worker and safety manager for the robot and ensuring that workers receive comprehensive safety training.

Robot teaching and maintenance correspond to dangerous work as specified in the Industrial Safety and Health Act (Japan only).

Workers employed to perform this dangerous work must attend special training for safety at YASKAWA.

■ Special Education

DANGER

Personnel who perform robot operation and administration must receive robot operation and maintenance training according to the following items (Japan only).

- Industrial Safety and Health Act, Chapter 6, Article 59, Section 3: Before assigning a worker to dangerous or hazardous operations, an employer must educate that worker in safety or health as it relates to the operations.
- A worker must attend and complete special education for industrial robot operation (e.g., teaching) and maintenance/repair (e.g., inspection) that corresponds to the following dangerous or harmful operation.

- Ordinance on Industrial Safety and Health, Chapter IV, Article 36 (Work Necessitating Special Education))

No. 31: Special Education Pertaining to the Work of Giving Instructions, Etc. to Industrial Robots

No. 32: Special Education Pertaining to the Work of Inspection, etc. of Industrial Robots ("Inspection, etc. of Industrial Robots" means the inspection, repair, and adjustment of industrial robots.)

MOTOMAN operation and maintenance training is provided at four locations in Japan. ("MOTOMAN operation and maintenance training" corresponds to "special education" as described in the Industrial Safety and Health Act (Japan only).)

- Kanto region (Saitama and Iruma, Saitama Prefecture)
- Chubu region (Miyoshi, Aichi Prefecture)
- Kansai region (Amagasaki, Hyogo Prefecture)
- Kyushu region (Kitakyushu, Fukuoka Prefecture)

Contact your YASKAWA representative for more information.

■ Safety Precautions for Workers

The manipulator moves through space, which means the space in its range of motion is considered a hazardous area in which there is a risk of an unforeseen accident. The safety manager and workers involved in the installation, operation, and maintenance of the manipulator must consider safety to be their first priority. This includes safety of related personnel and other people in addition to their own safety.

⚠ WARNING

Avoid hazardous actions in the area around the manipulator, such as entering the range of motion in a careless manner.

There is a risk of injury from contact with the manipulator and peripheral devices.

Always observe the instructions on safety signage in the factory, such as "NO OPEN FLAME," "HIGH VOLTAGE," "DANGER," and "AUTHORIZED PERSONNEL ONLY."

There is a risk of fire, electrical shock, or injury from contact with the product.

Make sure to observe the following items on clothing as a measure to prevent hazards.

- **Wear appropriate work clothes.**
- **Do not wear gloves when operating the manipulator because there is a risk of making mistakes in operation.**
- **Do not allow loose clothing (e.g. t-shirts, neckties, etc.) to stick out of work clothes.**
- **Do not wear jewelry or accessories, such as particularly large earrings or necklaces.**
- **Make sure to wear safety and protective equipment, such as safety shoes and a helmet.**


Inappropriate clothing is a cause of accidents.

Create a rule to keep workers other than the operator away from the installation site of the manipulator and have all workers follow that rule.

There is a risk of injury from contact with the manipulator, operation panel, workpiece, jig, or other equipment.

Do not force the manipulator to move, hang off the manipulator, or ride on the manipulator.

There is a risk of injury or equipment damage.

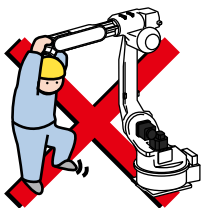

Do not stand, sit, or place heavy objects on the top side of the robot controller.

The top cover of the robot controller may be crushed and there is a risk of injury on protruding internal parts or product damage.

Do not accidentally press the switches and buttons on the robot controller, jig control panel, operation panel, and other equipment.

The manipulator may move in an unexpected manner, and there is a risk of injury or equipment damage.

⚠ WARNING

Only the predetermined worker in charge who has received special training may use the robot controller and pendant when the product is powered. Keep other workers from touching the robot controller and pendant.

The manipulator may move in an unexpected manner, and there is a risk of injury or equipment damage.

Ready the pendant or brake release unit in the work area so that the target axes of the manipulator can be moved without driving power to free it from a hazardous state in an emergency (e.g., a person is pinched, crushed, or trapped by the manipulator) or when there is an error.

Refer to "Brake Release" in "YNX1000 Instructions (RE-CTO-A226)" for the method to release the brakes using the pendant.

Refer to "How to manually release the brakes on the manipulator" in "YNX1000 Maintenance Manual (RE-CHO-A118)" for the method to release the brakes using the brake release unit.

■ Precautions during Storage and Transportation

⚠ DANGER

When the pendant is not being used, store it in an appropriate manner so it is clear the pendant is no longer connected to the robot controller.

(For example, store the pendant in a separate location away from the robot controller and manipulator.)

There is a risk of injury or equipment damage because the manipulator cannot be stopped during an emergency if the emergency stop button on the unconnected pendant is pressed by mistake.

⚠ WARNING

Transportation tasks that involve a sling, operating a crane or forklift, and other similar work must be performed by workers who have acquired the relevant national qualifications or workers approved by that company.

There is a risk of injury or equipment damage.

Transport the product in the correct manner according to its mass. Refer to the product instructions for the transportation methods.

There is a risk of injury or equipment damage.

As a basic rule, use a crane when transporting a heavy object (e.g., manipulator or robot controller).

- **Use the eye bolts or shipping brackets as specified in the product instructions, and hoist the product with a sling that has the specified number of legs.**
- **Check the mass of the product and select a sling suited to the mass before transport.**
- **Check that the eye bolts are fastened beforehand.**

There is a risk of injury or equipment damage from the product being dropped or falling over during transport.

Secure the manipulator with the shipping brackets and hoist it in the shipping posture listed in the instructions for each manipulator model.

There is a risk of injury or equipment damage from the manipulator falling over during transport.

If temporarily placing the manipulator in a location before installation, make sure it is done so in stable condition. Take measures so that unrelated personnel do not touch the manipulator, such as by posting an observer.

There is a risk of injury from the product falling over.

NOTICE

Transport the product so that it is not exposed to excessive vibration or shock.

Performance will be affected because this product is a precision machine.

Do not expose the connectors to shock.

There is a risk of a faulty connection or failure.

■ Precautions during Installation

Refer to the instructions for your manipulator together with this manual for information on installation and wiring. Perform all installation, wiring, and piping work by thinking about emergencies. Be careful not to allow cables and hoses to be crushed, and use caution so as not to trip over cables and hoses. In addition, install the manipulator, jig, and other equipment in a highly-visible and easy-to-operate location for safe operation.

[Important]

Article 150 of the Ordinance on Industrial Safety and Health mandates that the employer must take necessary measures, such as providing a railing or enclosure, to prevent workers from getting close to the manipulator and other equipment when there is a risk of contact during automatic operation of an industrial robot.

To prevent equipment damage and injury to workers and others during manipulator operation, make sure to install a safety fence that complies with (JIS B 9700 (ISO 12100) / JIS B 9716 (ISO 14120)).

When designing a robot system in which a worker and a robot perform collaborative work without installing a safety fence, a sufficient risk assessment must be conducted to prevent damage to equipment and to prevent accidents to the worker and other people in the surrounding area during manipulator operation (JIS B 8433-2 (ISO 10218-2)).

⚠ DANGER

Install a safety fence around the manipulator and ensure that workers cannot easily get close to the manipulator when it is powered. In addition, hang warning signage at the entrance/exit of the safety fence, such as "ENTRY PROHIBITED DURING OPERATION."

At the entrance/exit of the safety fence, install a safety plug that turns OFF the servo power when the door is opened, and make sure to check that the servo power turns OFF by pulling the safety plug before the start of operation.

For locations where a safety fence is not installed, have the manipulator stop when a worker enters the area of operation by using a device such as a phototube or light curtain.

There is a risk of a serious accident from contact with the manipulator.

⚠ WARNING

Select the following kind of location as the installation site for the manipulator.

- **A location where the tip of the tool or workpiece will not touch walls, the safety fence, the robot controller, or any other objects when the manipulator arm is fully extended while holding a workpiece.**

There is a risk of injury or equipment damage from contact with the manipulator.

Clearly identify the maximum range of motion of the manipulator, including the tip of the tool or workpiece, with a line or by changing the color of the floor.

Do not supply power and operate the manipulator unless it has been fixed to an object.

The manipulator may fall over and cause injury or damage.

For the ceiling-mounted and wall-mounted installation methods, secure the manipulator to a ceiling or wall with sufficient strength and rigidity. In addition, implement measures on the manipulator base part to prevent the manipulator from falling in case of an accident.

There is a risk of injury or damage.

⚠ WARNING

To install the manipulator, use the types and sizes of bolts described in the instructions for each manipulator model.

There is a risk of injury or equipment damage from the manipulator falling over.

Do not install or operate the manipulator when damaged or with missing parts.

There is a risk of injury or damage due to malfunction.

Make sure there is room to perform maintenance on the manipulator, robot controller, and other peripheral devices.

There is a risk of an unforeseen injury during maintenance.

Install the robot controller that operates the manipulator and the jig operation panel in a location where the movement of the manipulator can be easily seen and where the manipulator can be safely operated.

There is a risk of injury from mis-operation or other reasons.

Install the robot controller outside the safety fence for the manipulator.

There is a risk of injury from contact with the manipulator.

After the robot controller is installed, fix it to a secure object, such as the floor or a pedestal.


There is a risk of injury or equipment damage from the robot controller falling over.

Place cables and hoses for the robot controller, manipulator, peripheral devices, jig operation panel, and other devices in a pit so they are not directly exposed to workers, forklifts, or other equipment.

There is a risk of fall accidents from tripping over cables and hoses.

A cable break may also cause the manipulator to move in an unexpected manner, and there is a risk of injury or accident.

There is a risk of fire or electrical shock due to a cracked cable sheath or broken cable.

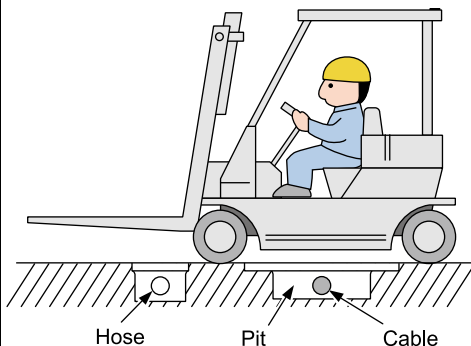

⚠ CAUTION

Do not block the air intake or exhaust ports. Do not allow foreign matter to get inside the product.

There is a risk of deterioration in the internal elements of the products, causing fire or failure.

NOTICE

Use the product in an environment that satisfies its specifications.

There is a risk of failure or damage if the product is used in an environment that exceeds its specifications.

After the manipulator is installed, make sure to remove the shipping brackets before turning ON the power supply for the first time.

There is a risk of damage to the main drive parts.

■ Precautions during Wiring

DANGER

Do not modify the wiring when the product is powered.

There is a risk of electrical shock or injury.

WARNING

Always ground the product. Additionally, protect the ground wire along its entire length to keep it safe from mechanical damage by placing it in a protective cover, duct, or other protective material.

There is a risk of fire or electrical shock.

Ground the product in accordance with all relevant local and national electrical codes.

There is a risk of electrical shock or fire.

Always turn OFF the power supply and tag out the system (e.g., using a "DO NOT POWER" sign) before maintenance, inspection, and wiring work.

There is a risk of electrical shock or injury.

When power is supplied, always attach the protective cover to the breaker, and attach the front panel of the robot controller back in its original location.

There is a risk of fire or electrical shock.

The user is responsible for wiring the emergency stop circuits. Always check the operation of the circuits after they are wired.

There is a risk of injury or failure.

Wiring and inspection must be performed by a specialized engineer.

There is a risk of electrical shock or product failure.

Connect the product to a power supply that satisfies the ratings.

There is a risk of fire or failure.

Ensure that the screws for the main circuit terminals and control circuit terminals are tightened in an appropriate manner.

There is a risk of fire or electrical shock.

Carefully study the connection diagrams before wiring the products, and connect the products according to those connection diagrams.

There is a risk of equipment damage from incorrect wiring or injury from the manipulator and machinery moving in an unexpected manner.

NOTICE

Do not directly touch the circuit boards with your fingers.

The ICs may fail due to static electricity.

■ Safety at the Work Site

Deficiencies at the work site may cause serious accidents.

To ensure safety, carefully manage and implement measures for the following items.

⚠ DANGER

When the manipulator and robot controller are first commissioned, confirm the following items: the correct operation of safety protection devices (e.g., emergency stop circuits and safety plug), the correct operation of each axis in teach mode, the correct operation of the manipulator at the speed limits (control point and flange speeds are 250 mm/s or less) in teach mode, and the correct operation of the teaching and playback functions.

The manipulator may stop because it is waiting for certain conditions to be satisfied, even during operation. In these cases, the manipulator moves immediately when those conditions are satisfied, so it is dangerous to get close to the manipulator in a careless manner just because it has stopped.

Implement measures to clearly indicate that the manipulator is in operation, such as with an indicator lamp and alarm, so that the operator can take action to stay away from the manipulator or to stop the manipulator if a worker gets too close.

Install a safety fence around the manipulator and ensure that workers cannot easily get close to the manipulator when it is powered. In addition, hang warning signage at the entrance/exit of the safety fence, such as "ENTRY PROHIBITED DURING OPERATION."

At the entrance/exit of the safety fence, install a safety plug that turns OFF the servo power when the door is opened, and make sure to check that the servo power turns OFF by pulling the safety plug before the start of operation.

For locations where a safety fence is not installed, have the manipulator stop when a worker enters the area of operation by using a device such as a phototube or light curtain.

There is a risk of a serious accident from contact with the manipulator.

⚠ CAUTION

Always store tools and other materials in a safe location outside the range of motion of the manipulator.

If tools or other materials are carelessly left in a location such as on the manipulator, jig, or floor, there is a risk of damage to the manipulator and jig from accidental contact.

When working in a dark environment, add appropriate lighting.

■ Precautions during Operation**⚠ DANGER**

When performing inspection, maintenance, wiring and connection work, when mounting the tool, and performing other work, first turn OFF the power supply to the robot controller and the tool, and lock the handles so that unauthorized personnel cannot inadvertently turn ON the power supply.

In addition, hang a "DO NOT POWER" sign.

If power is supplied accidentally during work, there is a risk of electrical shock or the manipulator moving in an unexpected manner and causing injury.

Do not use products outside the ranges listed in specifications in the instructions.

There is a risk of injury or equipment damage if products are used outside the ranges listed in the specifications.

Work in teach mode should be performed when personnel are outside the safety fence as much as possible.

As a general rule, work in teach mode should be performed outside the range of motion of the manipulator.

⚠ DANGER

Observe the following items if the manipulator must be taught inside its range of motion.

- Pull out and carry the safety plug when entering the inside of the safety fence. Or tag out the system by hanging a sign that indicates the programmer is operating the manipulator inside the safety fence and warn other people not to close the safety fence.
- Make sure to always view the manipulator from the front direction.
- Follow the predetermined operating procedures.
- Always think about how to respond to danger if the manipulator suddenly moves in your direction.
- Ensure there is a safe place to retreat in a worst case scenario. Limiting the motion of the manipulator by using the interference area function or another function is recommended to prevent the manipulator from entering the safe place to retreat.

There is a risk of injury from mis-operation and the manipulator moving in a manner the programmer does not intend.

Before manipulator operation, perform the following operations and confirm that the servo power turns OFF. If the servo power is turned OFF, [SERVO] is displayed in blue at the top of the screen on the pendant.

- Press the emergency stop button on the pendant and all other external operation devices. (Equipping the robot controller with an emergency stop button is available as an option.)
- Pull out the safety plug on the safety fence. (For play mode and remote mode)

There is a risk of injury or equipment damage if the manipulator cannot stop in an emergency.

Emergency Stop Button



Resetting the Emergency Stop State



Before starting a job in play mode, reset all safety protection devices to the active state.

When performing the following work, confirm that there are no people in the range of motion of the manipulator and perform the work from a safe area.

- When turning ON the power supply to the robot controller.
- When moving the manipulator with the pendant.
- When performing check mode operation.
- When performing automatic operation.

If a person carelessly enters the range of motion of the manipulator, there is a risk of injury from contact with the manipulator.

⚠ DANGER

Press the emergency stop button as quickly as possible when there is a problem.

The emergency stop button is equipped on the pendant adapter. (Equipping the robot controller with an emergency stop button is available as an option.)

If the pendant screen is not lit, the emergency stop button on the pendant adapter may be disabled.

If the emergency stop button on the pendant adapter is disabled, press the external emergency stop button.

- **Confirm the state of the pendant by tapping its screen.**
- **If the following error message is displayed on the pendant screen, the pendant cable is not connected, and there is a risk that the manipulator will not stop when the emergency stop button on the pendant adapter is pressed.**



Cannot Communicate with the Controller


[SHOW ALL](#)


Communication with the controller timed out. Please check the controller connection.

⚠ WARNING

Before performing teaching work for the manipulator, inspect the items listed below. If a problem is discovered, immediately correct the problem or take other necessary corrective actions.

- **Are there problems in the operation of the manipulator?**
- **Is there damage to the insulation and sheathing of external wires?**

Always return the pendant to its designated location after use.

If the pendant is carelessly placed in a location such as on the manipulator, jig, or floor, the uneven surface may activate the enable switch and turn ON the servo power. In addition, if the manipulator moves, there is a risk that the manipulator or the tool may crush the pendant, hurt a worker, or damage other devices.

After the following work, always perform initial operation at low speed and confirm there are no abnormal noises, vibrations, or abnormal movements.

- **Manipulator installation**
- **Change in part**
- **Change in teaching**
- **Change in the robot system, such as due to changing the tool or a peripheral device**

If a problem occurs, immediately turn OFF the power supply to the robot controller and contact the safety manager.

■ Precautions during Maintenance and Inspection

⚠ DANGER

Do not modify the wiring when the product is powered.

There is a risk of electrical shock or injury.

⚠ WARNING

Wiring and inspection must be performed by a specialized engineer.

There is a risk of electrical shock or product failure.

■ Precautions When Moving, Transferring, or Selling the Product

When moving, transferring, or selling the product, make sure to observe the following items for safety.

DANGER

When moving, transferring, or selling the product, always include the manuals and make sure they are delivered to the end user of the product.

Refer to "[Related Manuals on page13](#)" for the manuals included with the product.

Contact your YASKAWA representative if any manuals are missing.

Clean warning labels affixed to the manipulator and other products when dirty. If a warning label has peeled off, replace it with a new one in the same spot. Warning labels are available from your YASKAWA representative.

When the robot system that includes this product is moved, inspection by your YASKAWA representative is recommended.

There is a risk of injury or equipment damage from incorrect installation or wiring of devices.

■ Precautions during Disposal

In Japan, dispose of this product in an appropriate manner according to the local or regional ordinances of the location where the manipulator is used. Outside of Japan, dispose of this product according to the relevant national laws and regulations. As necessary, label or provide notification regarding disposal on the final product.



⚠ DANGER

Do not modify the product.

There is a risk of fire, failure, or injury and equipment damage from malfunction.

⚠ WARNING

Take measures to keep the manipulator from falling over, even when it is placed in a temporary location as waste.

There is a risk of injury from the manipulator falling over.

NOTICE

Dispose of used batteries according to all relevant local rules.

■ Safety Functions in This Product

This product has the safety functions listed below.

Note:

Equipping the robot controller with an emergency stop button is available as an option.

- Emergency stop button input (robot controller/pendant)
- Enable switch input (pendant)
- Safety fence interlock signal input (safety plug)
- External emergency stop button input
- Safety logic circuits

These safety functions comply with the following safety standards:

- EN ISO 13849-1: 2015 Cat.3/PLe
- IEC 61508 SIL3

The following functions are available as functional safety functions: ^{*1}

- Robot range limit
- Axis range limit
- Speed limit
- Axis speed monitor
- Tool angle monitor
- Tool change monitor
- Tool number select

In addition, when using a Collaborative AI Robot, the following function is available as safety functions for collaborative operation: ^{*2}

- PFL (Power and Force Limiting) function

These functional safety functions comply with the following safety standards:

- EN ISO 13849-1: 2015 Cat.3/PLd
- IEC 61508 SIL 2

Note:

The functional safety function can continue to be used even when collaborative operation is disabled.

The user must conduct a risk assessment before using this product.

The following table lists the expected usage frequency for switches used in the safety functions.

Switch Type	Usage Frequency
Emergency stop button	500 times per year
Enable switch (pendant)	2000 times per year

*1 Refer to the following manual for details on functional safety function.

YNX1000 Instructions for Functional Safety Function (HW2481604)

*2 Refer to the following manual for details on collaborative operation.

YNX1000 Instructions for Collaborative Operation (HW2403011)


■ General Precautions


- Figures provided in this manual are typical examples or conceptual representations. There may be differences between them and actual wiring, circuits, and products.
- The products shown in illustrations in this manual are sometimes shown with their covers or protective guards removed to illustrate detail. Always install all covers and protective guards before the product is used.
- If a new copy of this manual is required because it has been lost or damaged, contact your nearest YASKAWA representative or one of the offices, and inform them of the manual number.
- This manual is subject to change without notice for product improvements, specifications changes, and improvements to the manual itself. The manual number of this manual will be updated and revisions issued when changes are made.
- Any and all quality guarantees provided by YASKAWA are null and void if the customer modifies the product in any way. YASKAWA disavows any responsibility for damages or losses that are caused by modified products.

◆ Warning Label Attachment Locations

This section describes the safety symbols on the warning labels that are attached to the product. Be careful of the residual risks shown on the warning labels.

■ Front Side of Robot Controller

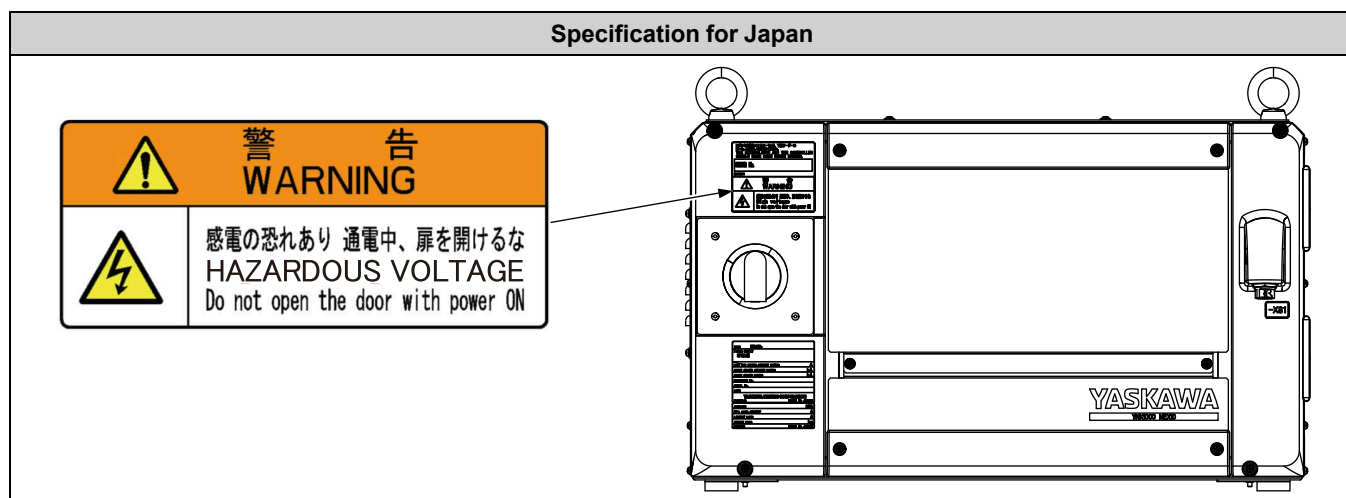


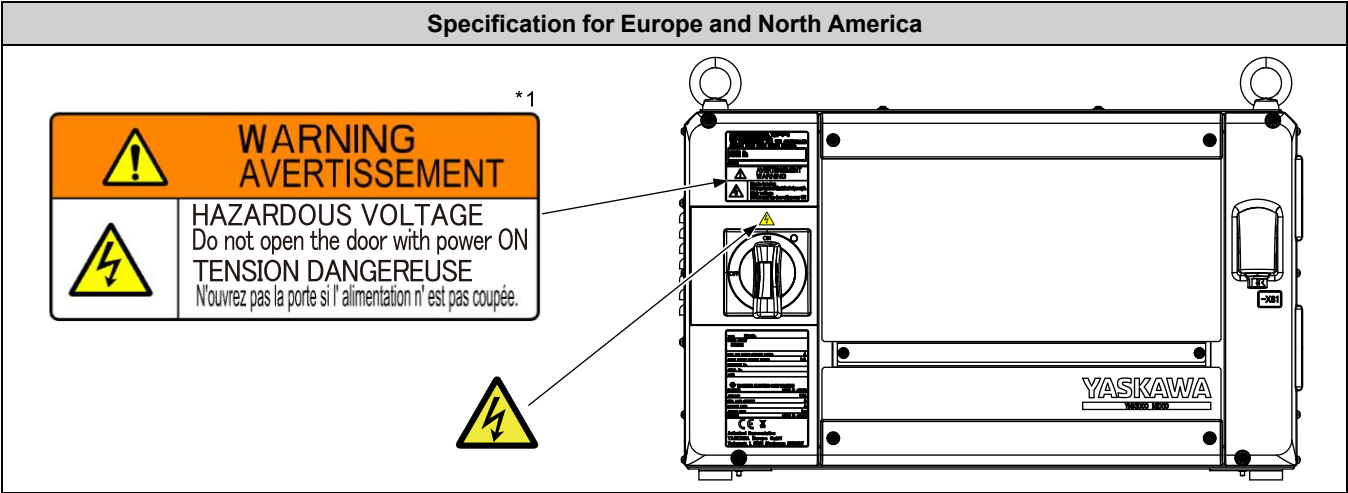

*1 Affixed to products shipped to North America.


■ Breaker and Protective Grounding Terminal inside Robot Controller

Specification for Japan

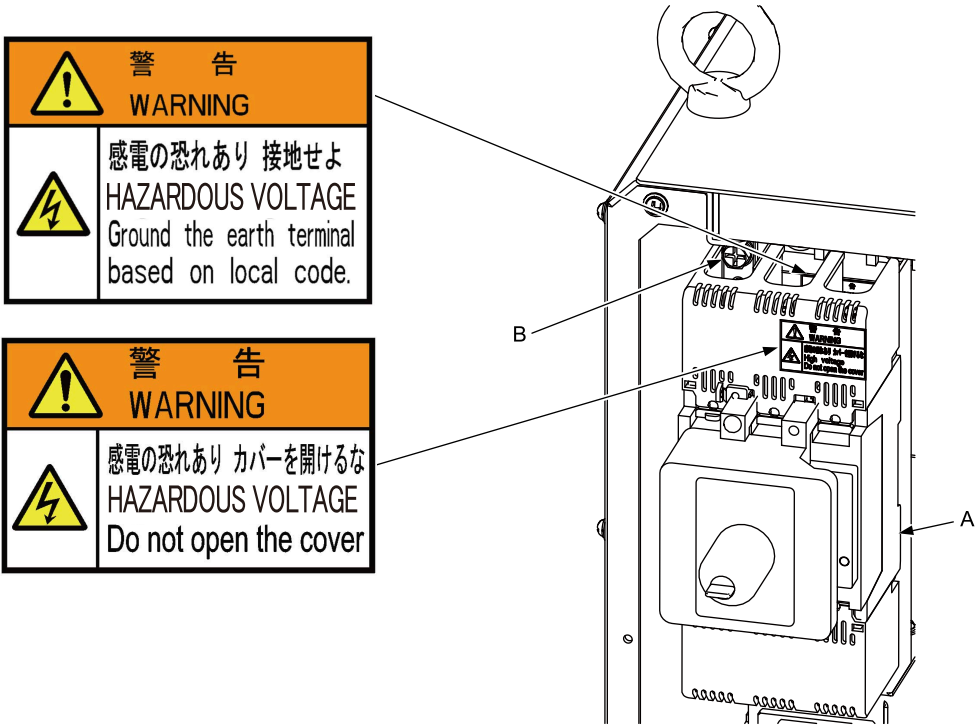

A	Breaker	B	Protective grounding terminal
---	---------	---	-------------------------------

Specification for Europe and North America

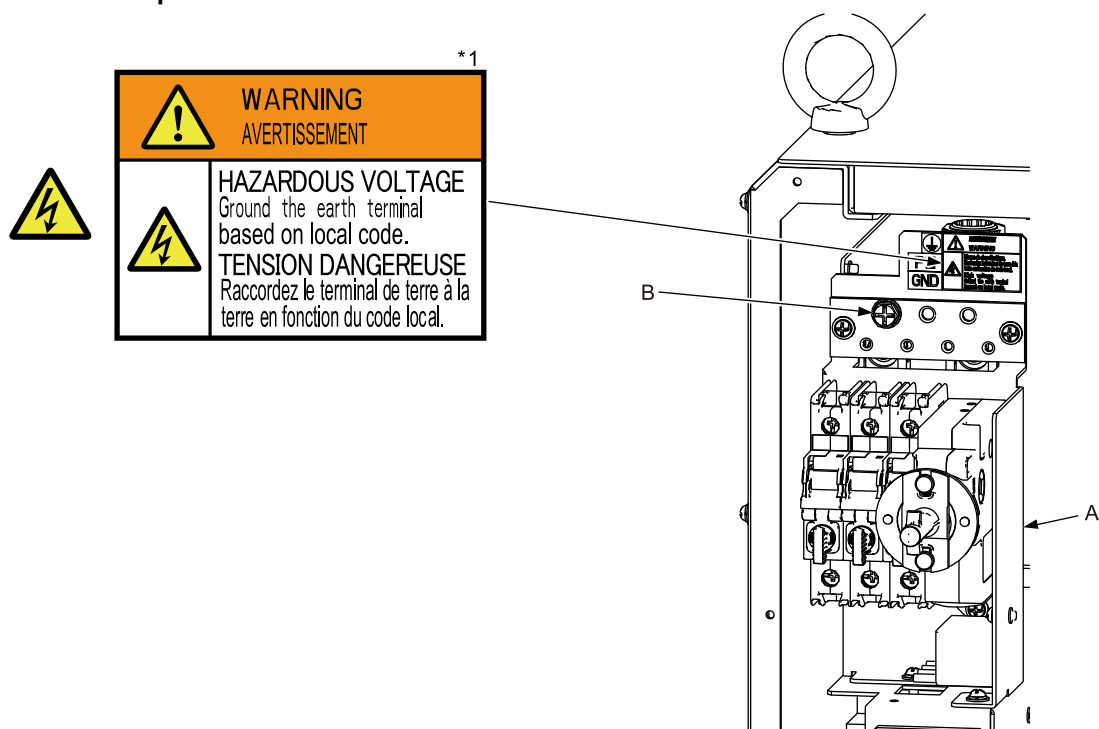

*1 Affixed to products shipped to North America.

A	Disconnect switch with fuse	B	Protective grounding terminal
---	-----------------------------	---	-------------------------------

i.3 Using This Manual

◆ Terms

"MOTOMAN NEXT" is the product name for industrial robots manufactured by YASKAWA.

MOTOMAN NEXT consists of a manipulator, a robot controller, a pendant, and a manipulator cable. Interpret the devices described in this manual as shown below.

Device	Name in This Manual
YNX1000 robot controller or control panel	Robot controller
Tablet-style pendant for the YNX1000	Pendant
Arm composed of multiple joints	Manipulator
Cable between the manipulator and the YNX1000	Manipulator cable

◆ Terms for Pendant Operation

This product uses a general-purpose tablet as the programming interface.

The following terms are used in the descriptions of operations in this manual.

Term	Description
Tap	Touching your finger lightly on a menu or icon displayed on the screen. This is equivalent to clicking the mouse on a personal computer.
Long press	Pressing and holding your finger on a menu or icon displayed on the screen for an extended length of time. Use this operation to display the sub menu of a detailed setting and to move an icon. Note: The pendant does not need to be pressed with force. Simply place your finger on the screen.
Drag	Sliding your finger around the screen while touching an icon displayed on the pendant. Release your finger at the desired position to complete the operation.

◆ Trademarks

The product names and company names used in this manual are the trademarks or product names of the respective company. TM and the ® mark do not appear with the trademarks of companies in this manual.

Alarm List

1.1	Alarm Number (0000 to 0999)	32
1.2	Alarm Number (1000 to 1999)	137

1.1 Alarm Number (0000 to 0999)

◆ 0011: CPU BOARD INSERTION ERROR (Safety)

Robot control module detects the connection and insertion board error of robot safety module when the control power turned ON.

Sub Code	Meaning	Cause	Remedy
	Robot control module was not able to recognize robot safety module when the control power turned ON. SubCode: Subcode shows the error part of robot safety module. (There is possibility of combination of follow boards) 0000_0001 : Robot safety module#1 0000_0010 : Robot safety module#2	Setting error	Check the following settings. Robot safety module not found (RSW=0). • The robot safety module rotary switch setting (0)
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0012: CPU BOARD SETTING ERROR

Robot control module detects the setting error of robot safety module when the control power turned ON.

Sub Code	Meaning	Cause	Remedy
1	Robot control module was not able to recognize robot safety module when the control power turned ON.	Setting error	Check the following settings. Robot safety module not found (RSW=0). • The robot safety module rotary switch setting (0)
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0012: CPU BOARD SETTING ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2	No response was sent from the robot safety module when the control power turned ON.	Setting error	Check the following settings. Robot safety module not found (RSW=0). • The robot safety module rotary switch setting (0)
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	No response was sent from the robot safety module when the control power turned ON.	Setting error	Check the following settings. Robot safety module not found (RSW=0). • The robot safety module rotary switch setting (0)
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0020: CPU COMMUNICATION ERROR

The YNX1000 previously stores the connected CPU boards, and checks if each board properly responds upon startup. This alarm occurs if any CPU board does not properly respond to the YNX1000.

Sub Code	Meaning	Cause	Remedy
1	No response was sent from the robot control module when the control power turned ON.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Robot control module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.

0020: CPU COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	No response was sent from the optional board #1 when the control power turned ON.	Setting error	Check the following settings. • Optional board setting in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Option module
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	No response was sent from the optional board #2 when the control power turned ON.	Setting error	Check the following settings. • The optional board setting in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Option module
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	No response was sent from the optional board #3 when the control power turned ON.	Setting error	Check the following settings. • Optional board setting in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Option module

0020: CPU COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	No response was sent from the optional board #4 when the control power turned ON.	Setting error	Check the following settings. • Optional board setting in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Option module
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	No response was sent from the optional board #5 when the control power turned ON.	Setting error	Check the following settings. • Optional board setting in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Option module
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.

0020: CPU COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	No response was sent from the optional board #6 when the control power turned ON.	Setting error	Check the following settings. • Optional board setting in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Option module
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	No response was sent from the optional board #7 when the control power turned ON.	Setting error	Check the following settings. • Optional board setting in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Option module
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
27	No response was sent from the optional board #8 when the control power turned ON.	Setting error	Check the following settings. • Optional board setting in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the insertion of the following board. • Option module

0020: CPU COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	No response was sent from the robot safety module #1 when the control power turned ON.	Setting error	Check the following settings. • Control group settings in maintenance mode • The robot safety module rotary switch setting (0) of the corresponding node number
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	No response was sent from the robot safety module #2 when the control power turned ON.	Setting error	Check the following settings. • Control group settings in maintenance mode • The robot safety module rotary switch setting (1) of the corresponding node number
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0020: CPU COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
50	No response was sent from the Robot control module (Servo processing) when the control power turned ON.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0021: COMMUNICATION ERROR(SERVO)

The YNX1000 transfers special commands to operate Robot control module (Servo processing) on its startup as well as its regular operation process. This alarm occurs if there is any communication failure in transferring the special commands.

Sub Code	Meaning	Cause	Remedy
50	The Robot control module detected an communication error for the Robot control module (Servo processing) when the control power turned ON.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0030: ROM ERROR

The YNX1000 system program (ROM) runs after RAM expansion executed upon startup. This alarm occurs if there is any failure in the RAM expansion.

Sub Code	Meaning	Cause	Remedy
1	The system program of robot control module is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	The system program of optional board #1 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module

0030: ROM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	The system program of optional board #2 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	The system program of optional board #3 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	The system program of optional board #4 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	The system program of optional board #5 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	The system program of optional board #6 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0030: ROM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	The system program of optional board #7 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
27	The system program of optional board #8 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	The system program of robot safety module #1 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	The system program of robot safety module #2 is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0040: HARDWARE INITIALIZE ERROR

An error was detected in the initialization with the hardware when the control power turned ON.

Sub Code	Meaning	Cause	Remedy
00000000	An error was detected in the initialization with MIII of robot safety module when the control power turned ON.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0060: COMMUNICATION ERROR(I/O MODULE)

The YNX1000 previously stores the connected I/O modules and checks the presence of each module upon startup. This alarm occurs if there is any module of which presence cannot be identified.

Sub Code	Meaning	Cause	Remedy
0	The IO module board connected with 0th serial bus exists.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the robot safety module.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
1	An error was detected in communications with the I/O module board connected with 1st serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error was detected in communications with the I/O module board connected with 2nd serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting

0060: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An error was detected in communications with the I/O module board connected with 3rd serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error was detected in communications with the I/O module board connected with 4th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.

0060: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	An error was detected in communications with the I/O module board connected with 5th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	An error was detected in communications with the I/O module board connected with 6th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	An error was detected in communications with the I/O module board connected with 7th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting

0060: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	An error was detected in communications with the I/O module board connected with 8th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	An error was detected in communications with the I/O module board connected with 9th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.

0060: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	An error was detected in communications with the I/O module board connected with 10th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	An error was detected in communications with the I/O module board connected with 11th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	An error was detected in communications with the I/O module board connected with 12th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting

0060: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	An error was detected in communications with the I/O module board connected with 13th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each I/O module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	An error was detected in communications with the I/O module board connected with 14th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.

0060: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	EtherNet/IP(CPU Board) processing could not be started normally when the control power turned ON.	Setting error	Check the following settings. - EtherNet/IP(CPU Board) setting in maintenance mode - LAN interface setting in maintenance mode (In particular, the IP address, subnet mask, default gateway are set correctly, and DHCP is not used) - IO module setting in maintenance mode - IP address setting of devices connected to the network (the same IP address does not exist).
		Robot control module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	An error was detected in communications with the I/O module board connected with 1st PCI connector when the control power turned ON.	Setting error	Check the following settings. - PCI slot number in which each PCI board is mounted - I/O module settings in maintenance mode Refer to the manual of each I/O module for the details of the setting
		Connection failure	- Turn the power OFF then back ON. - If the alarm occurs again, check the connection and insertion of the following connector. - The PCI connector of the corresponding I/O module
		I/O module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. - The corresponding I/O module (PCI board)
		PROFINET CP1616 board failure	For the CP1616(PROFINET) board, confirm the following communication configuration using SIEMENS manufactured setting tool (TIA Portal). Refer to the user manual of the CP1616 for more information on how to set. - Download the project file. - Assignment of IP address and device name.
		PROFINET SST-PN-2-PE board failure	For the SST-PN-2-PE(PROFINET) board, confirm communication configuration using Molex manufactured setting tool (Product Configuration Tool). Refer to the user manual of the SST-PN-2-PE for more information on how to set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	An error was detected in communications with the I/O module board connected with 2nd PCI when the control power turned ON.	Setting error	Check the following settings. - PCI slot number in which each PCI board is mounted - I/O module settings in maintenance mode Refer to the manual of each I/O module for the details of the setting

0060: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		PROFINET CP1616 board failure	For the CP1616(PROFINET) board, confirm the following communication configuration using SIEMENS manufactured setting tool (TIA Portal). Refer to the user manual of the CP1616 for more information on how to set. • Download the project file. • Assignment of IP address and device name.
		PROFINET SST-PN-2-PE board failure	For the SST-PN-2-PE(PROFINET) board, confirm communication configuration using Molex manufactured setting tool (Product Configuration Tool). Refer to the user manual of the SST-PN-2-PE for more information on how to set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	An error was detected in communications with the I/O module board connected with 3rd PCI when the control power turned ON.	Setting error	Check the following settings. • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		PROFINET CP1616 board failure	For the CP1616(PROFINET) board, confirm the following communication configuration using SIEMENS manufactured setting tool (TIA Portal). Refer to the user manual of the CP1616 for more information on how to set. • Download the project file. • Assignment of IP address and device name.
		PROFINET SST-PN-2-PE board failure	For the SST-PN-2-PE(PROFINET) board, confirm communication configuration using Molex manufactured setting tool (Product Configuration Tool). Refer to the user manual of the SST-PN-2-PE for more information on how to set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0060: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
19	An error was detected in communications with the I/O module board connected with 4th PCI when the control power turned ON.	Setting error	Check the following settings. • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		PROFINET CP1616 board failure	For the CP1616(PROFINET) board, confirm the following communication configuration using SIEMENS manufactured setting tool (TIA Portal). Refer to the user manual of the CP1616 for more information on how to set. • Download the project file. • Assignment of IP address and device name.
		PROFINET SST-PN-2-PE board failure	For the SST-PN-2-PE(PROFINET) board, confirm communication configuration using Molex manufactured setting tool (Product Configuration Tool). Refer to the user manual of the SST-PN-2-PE for more information on how to set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0100: COMMUNICATION ERROR(SV#1)

The YNX1000 uses software to mutually monitor that communication between processing tasks in the robot control module is being executed normally.

An error was detected in the communication with the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
1	The error was detected during the check of the communication watchdog data. Counter value received from Robot control module (Servo processing) is invalid.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0100: COMMUNICATION ERROR(SV#1) (continued)

Sub Code	Meaning	Cause	Remedy
3	The error was detected during the check of the communication watchdog data. Watchdog data cannot be received from Robot control module (Servo processing).	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0200: MEMORY ERROR(PARAMETER FILE)

The YNX1000 requires various types of parameters to operate, and performs a check sum during the startup process to ensure that the parameter files are properly retained. This alarm occurs if the YNX1000 detects an error in the check sum.

Sub Code	Meaning	Cause	Remedy
0	The RC parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The RO parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The SV parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0200: MEMORY ERROR(PARAMETER FILE) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The SVM parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The SC parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The SD parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The CIO parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0200: MEMORY ERROR(PARAMETER FILE) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The FD parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The AP parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The RS parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The SE parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0200: MEMORY ERROR(PARAMETER FILE) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The SVC parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The AMC parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	The SVP parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	The MF parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0200: MEMORY ERROR(PARAMETER FILE) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	The SVS parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
125	RE parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
126	FMS parameter is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0210: MEMORY ERROR(SYSTEM CONFIG-DATA)

The YNX1000 holds the information to start as a system in the SYSTEM CONFIG-DATA file, and performs a check sum during the startup process to ensure that these files are properly retained. This alarm occurs if the YNX1000 detects an error in the check sum.

Sub Code	Meaning	Cause	Remedy
	The system configuration information data are damaged.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0220: MEMORY ERROR(JOB MNG DATA)

The YNX1000 holds the user program as data files called JOB, and performs a check sum during the startup process to ensure that these files are properly retained. This alarm occurs if the YNX1000 detects an error in the check sum.

Sub Code	Meaning	Cause	Remedy
0	The management data of job files are damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the job file in maintenance mode, and then load the data (job, variable data, Robot calibration data) saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The job files are damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the job file in maintenance mode, and then load the data (job, variable data, Robot calibration data) saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0220: MEMORY ERROR(JOB MNG DATA) (continued)

Sub Code	Meaning	Cause	Remedy
2	The management data of position data files are damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the job file in maintenance mode, and then load the data (job, variable data, Robot calibration data) saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Memory and play back file is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0230: MEMORY ERROR (LADDER PRG FILE)

A program software PLC which runs in the YNX1000 is stored in the ladder program file. The YNX1000 performs a check sum during the startup process to ensure that these files are properly retained. This alarm occurs if the YNX1000 detects an error in the check sum.

Sub Code	Meaning	Cause	Remedy
	The CIO ladder file is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0270: MEMORY ERROR(SD BACKUP FILE)

To operate the YNX1000 properly, the settings of each file (backup file) that is remained even after turning OFF the YNX1000 power supply is needed.

Part of the backup files are stored in the SD card in robot control module. By retrieving these backup files from the SD card correctly when turning on the power supply, you can check if the backup files in the SD card are correct. This alarm occurs if this file is found to be incorrect.

Sub Code	Meaning	Cause	Remedy
	The system software version is inconsistent with the version when the internal storage data is set or the SD Card on the robot control module is damaged.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0280: MEMORY ERROR(EX IO ALLOC FILE)

The YNX1000 holds the information of EX IO function setting in the EX IO ALLOC FILE, and performs a check sum during the startup process to ensure that these files are properly retained. This alarm occurs if the YNX1000 detects an error in the check sum.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then set the IO module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0290: MEMORY ERROR(NETWORK SETUP)

The communication setting of the IP address needs to be recorded when using network function for YNX1000. The file with these records are called the network setting file.

By sum check which is performed when turning the power on, this network setting file is checked if it is correct. This alarm occurs if this file is found to be incorrect.

Sub Code	Meaning	Cause	Remedy
	The network setting file is damaged.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then set the network again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0300: VERIFY ERROR(SYSTEM CONFIG-DATA)

The YNX1000 holds the information to start as a system in the data files called "System Configuration Data", and performs a validity check on the data files if they are properly configured. This alarm occurs if the YNX1000 detects an error in the validity check.

Sub Code	Meaning	Cause	Remedy
2	CIO parameter error.	Setting error	Check the following settings. • I/O module settings in maintenance mode
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Axis-related parameter error.	Setting error	Check the following settings. • Control group settings in maintenance mode
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Sensor-use parameter error.	Setting error	Check the following settings. • The optional board setting in maintenance mode
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The set optional functions are different from those of the mounted optional board.	Setting error	Check the following settings. • The optional board setting in maintenance mode
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	IO type error (combination impossible to coexist).	Setting error	Check the following settings. • I/O module settings in maintenance mode

0300: VERIFY ERROR(SYSTEM CONFIG-DATA) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Safety board save data error	Setting error	1. Select the following menu. • [File]-[Initialize],[Safety Board FLASH Reset] in maintenance mode. 2. Turn the power OFF then back ON.
		Short circuit or ground fault	1. Check that the power is supplied to the robot safety module and that the error of the CPS unit(24V abnormality) is not lit. 2. If the alarm recurs, check that the 24V power supply of the connector below is connected and that there is no short circuit or ground fault. • IM-YE250 / 5-80P-CN220 (61,62,70,71,77,78: 24VAX) • IM-YE250 / 5-80P-CN220 (63,64,72,73: 024V2) • AIO-CN306, CN307, CN308, CN309
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Ex. AXIS INDIVIDUAL CONTROL Parameter Setting error (EX.TU# out of a range).	Setting error	Check the following settings. • [Option function] - [Ex. AXIS INDIVIDUAL CONTROL (SDA)] settings in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	Ex. AXIS INDIVIDUAL CONTROL Parameter Setting error (Difference in an Ex. AXIS INDIVIDUAL CONTROL Parameter and Physics TU# parameter).	Setting error	Check the following settings. • [Option function] - [Ex. AXIS INDIVIDUAL CONTROL (SDA)] settings in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	PFL board save data error	Setting error	1. Select the following menu. • [File]-[Initialize],[PFL Board FLASH Reset] in maintenance mode. 2. Turn the power OFF then back ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0300: VERIFY ERROR(SYSTEM CONFIG-DATA) (continued)

Sub Code	Meaning	Cause	Remedy
14	POWER REGENERATIVE FUNCTION Parameter Setting error.	Setting error	Check the following settings. • [Option function] - [POWER REGENERATIVE FUNCTION] settings in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	Parameter setting error of the robot detachment function or axes detachment function.	Setting error	Check the following settings. • [OPTION FUNCTION] - [ROBOT DETACHMENT] settings in maintenance mode, Reset the detachment group setting. • [OPTION FUNCTION] - [AXES DETACHMENT] settings in maintenance mode, Reset the detachment axis setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	The fast cycle DeviceNet communication cannot be available under this setting	Setting error	Check the fast cycle DeviceNet communication setting. • The Channel number for the fast cycle communication(Max channel number is 2). • The Communication IO number for the fast cycle communication(Max IO number is 64Byte).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	The fast cycle DeviceNet communication cannot be available under this setting	Setting error	Check the fast cycle DeviceNet communication setting. • The Channel number for the fast cycle communication(Only 1channel is available). • The Communication IO number for the fast cycle communication(Max IO number is 16Byte).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	The communication setting written to the EtherNet/IP board (AB3607) and the communication setting recorded in the robot controller do not match.	Setting error	1. Reconfigure the EtherNet/IP board (AB3607). 2. Reconfirm the setting contents of AB3607. • IP addresses are not duplicated • The sum of the IO sizes does not exceed the upper limit value • The IO input range is less than the communication data size
		AB3607 board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the AB3607 board. Save the CMOS.BIN before replacing the board to be safe. Replace the AB3607 board, and then reconfigure the AB3607 board.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0300: VERIFY ERROR(SYSTEM CONFIG-DATA) (continued)

Sub Code	Meaning	Cause	Remedy
19	Low priority DeviceNet communication cannot be used.	Setting error	Cannot be used simultaneously with the fast cycle DeviceNet communication of SST-DN4.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	Machine Safety board save data error	Setting error	- Select the following menu. [File]-[Initialize],[Safety Board FLASH Reset] - Turn the power OFF then back ON. - If the alarm occurs again, select the following menu. [File]-[Initialize]-[I/O Data],[YSF LOGIC FILE]
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	The combination of the software version and the version of driver for INPACT board (HMSAB.DRV) is incorrect.	Setting error	Try to update the software. In order to know the correct software version, contact your YASKAWA representative about occurrence status (operating procedure).
32	The fieldbus type of set optional function is not consistent with the fieldbus type of option board.	Setting error	Check the following settings. Fieldbus type setting of target INpact board in maintenance mode
		I/O module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. - The corresponding I/O module (PCIe board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
33	The combination of the software version and the version of driver for HMS board (HMSAB.DRV) is incorrect.	Setting error	Try to update the software. In order to know the correct software version, contact your YASKAWA representative about occurrence status (operating procedure).
34	The instance number set in EtherNet/IP communication is the same as the instance number used in EtherNet/IP Safety communication.	Setting error	Set an instance number (INPUT INSTANCE / OUTPUT INSTANCE / CONFIGURATION INSTANCE) other than the following for EtherNet/IP(CPU board) instance number. 768 to 776, 896 to 904, 1024 to 1032
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0300: VERIFY ERROR(SYSTEM CONFIG-DATA) (continued)

Sub Code	Meaning	Cause	Remedy
35	In the EtherNet/IP(CPU Board) EX. ADAPTER settings, the same instance number is used for multiple adapters.	Setting error	When using EtherNet/IP (CPU Board) in the EX.ADAPTER setting, do not duplicate the instance number used in the adapters.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
36	There is an error in the LAN interface settings used for EtherNet/IP (CPU Board).	Setting error	Check the LAN interface settings used for EtherNet/IP (CPU Board).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
37	An error occurred in the IP address setting process of the LAN interface used for EtherNet/IP (CPU Board).	Setting error	Check the following settings. 1. IP address setting of LAN interface in maintenance mode. (In particular, IP address, subnet mask, default gateway are set correctly, and DHCP is not used) 2. IP address setting of devices connected to the network (the same IP address does not exist).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
38	An error occurred in the CC-Link IE Field setting.	Setting error	Check the CC-Link IE Field settings. (Do not set remote register to disable when the IO size is set to 0 bytes.)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
40	The data output function for Self-Diagnosis System cannot be available under this setting	Setting error	Check the data output function setting for Self-Diagnosis System. • The number of Servo Control Board (Only 1 board is available).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0301: VERIFY ERROR(OVERRUN INPUT SET)

The YNX1000 verifies if the parameter specification is the same as the OT signal information. This alarm occurs if the YNX1000 detects an error in the verification process.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group Parameter specification and OT signal information are wrong	Setting error	Check the following settings. • Connection settings (OT) in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0310: VERIFY ERROR(CMOS MEMORY SIZE)

The YNX1000 verifies that the AIF01 board type (CMOS memory size) which is detected during the startup is the same as the type set at the time of system configuration. This alarm occurs if the YNX1000 detects an error in the verification process.

Sub Code	Meaning	Cause	Remedy
	The CMOS memory capacity is different from its initial setting.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0320: VERIFY ERROR(I/O MODULE)

The YNX1000 verifies that the I/O module which is detected during the startup is the same as the module set at the time of system configuration. This alarm occurs if the YNX1000 detects an error in the verification process.

Sub Code	Meaning	Cause	Remedy
0	The I/O module connected to the PCI express bus is different from the function of the set I/O module.	Setting error	Check the following settings. • The AIO board type connected to robot safety module. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.

0320: VERIFY ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot safety module, and then load the CMOS.BIN saved before alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The I/O module connected to the serial bus #1 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The I/O module connected to the serial bus #2 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0320: VERIFY ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
3	The I/O module connected to the serial bus #3 is different from the function of the set I/O module.	Setting error	Check the following settings. - The rotary switch setting which specifies slot numbers of each I/O module - I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	- Turn the power OFF then back ON. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - The MII communications cable which I/O module of the corresponding node number (For MII communications last station) Terminator 24V power of the corresponding I/O module
		I/O module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The I/O module connected to the serial bus #4 is different from the function of the set I/O module.	Setting error	Check the following settings. - The rotary switch setting which specifies slot numbers of each I/O module - I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	- Turn the power OFF then back ON. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - The MII communications cable which I/O module of the corresponding node number (For MII communications last station) Terminator 24V power of the corresponding I/O module
		I/O module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The I/O module connected to the serial bus #5 is different from the function of the set I/O module.	Setting error	Check the following settings. - The rotary switch setting which specifies slot numbers of each I/O module - I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	- Turn the power OFF then back ON. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - The MII communications cable which I/O module of the corresponding node number (For MII communications last station) Terminator 24V power of the corresponding I/O module

0320: VERIFY ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The I/O module connected to the serial bus #6 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The I/O module connected to the serial bus #7 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The I/O module connected to the serial bus #8 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting

0320: VERIFY ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The I/O module connected to the serial bus #9 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The I/O module connected to the serial bus #10 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.

0320: VERIFY ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The I/O module connected to the serial bus #11 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The I/O module connected to the serial bus #12 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	The I/O module connected to the serial bus #13 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting

0320: VERIFY ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	The I/O module connected to the serial bus #14 is different from the function of the set I/O module.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode Refer to the manual of each IO module for the details of the setting
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	The EtherNet/IP(CPU Board) settings and the function registered in the IO module are different.	Setting error	Check the following settings. • EtherNet/IP(CPU Board) setting in maintenance mode • LAN interface setting in maintenance mode • IO module setting in maintenance mode For details on the setting method, refer to the OPTIONS INSTRUCTIONS EtherNet/IP COMMUNICATION FUNCTION(FOR STANDARD LAN PORT).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0320: VERIFY ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
16	The I/O module mounted in option slot #1 is different from the I/O module configured in the settings.	Setting error	Check the following settings. - The option slot number where the I/O module is mounted - The I/O module settings in Maintenance Mode For detailed instructions on how to configure these settings, refer to the manual for each I/O module.
		Mounting Error	- Turn the power OFF then back ON. - If the alarm occurs again, check that the I/O module is properly mounted in the option slot.
		I/O module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the I/O module. Save the CMOS.BIN file before replacing the I/O module as a precaution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	The I/O module mounted in option slot #2 is different from the I/O module configured in the settings.	Setting error	Check the following settings. - The option slot number where the I/O module is mounted - The I/O module settings in Maintenance Mode For detailed instructions on how to configure these settings, refer to the manual for each I/O module.
		Connection failure	- Turn the power OFF then back ON. - If the alarm occurs again, check that the I/O module is properly mounted in the option slot.
		I/O module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the I/O module. Save the CMOS.BIN file before replacing the I/O module as a precaution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	The I/O module mounted in option slot #3 is different from the I/O module configured in the settings.	Setting error	Check the following settings. - The option slot number where the I/O module is mounted - The I/O module settings in Maintenance Mode For detailed instructions on how to configure these settings, refer to the manual for each I/O module.
		Connection failure	- Turn the power OFF then back ON. - If the alarm occurs again, check that the I/O module is properly mounted in the option slot.
		I/O module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the I/O module. Save the CMOS.BIN file before replacing the I/O module as a precaution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	The I/O module mounted in option slot #4 is different from the I/O module configured in the settings.	Setting error	Check the following settings. - The option slot number where the I/O module is mounted - The I/O module settings in Maintenance Mode For detailed instructions on how to configure these settings, refer to the manual for each I/O module.

0320: VERIFY ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check that the I/O module is properly mounted in the option slot.
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the I/O module. Save the CMOS.BIN file before replacing the I/O module as a precaution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0321: VERIFY ERROR(LAN BOARD)

The YNX1000 checks whether the settings of the option board detected at startup are the same as those at the time of system setting. If an error occurs in this check, this alarm will occur.

Sub Code	Meaning	Cause	Remedy
16	The settings of the option board connected to the first PCI bus and the settings managed by the system software are different.	Setting error	Check the following settings. • Turn off the power and insert / remove the optional board. • After starting maintenance mode select the option board and check the settings.
		Ethernet cable failure	1. Turn on the power again. 2. If the alarm recurs, check the connection / insertion status of the Ethernet cable. 3. After checking the connection / insertion status of the Ethernet cable, if the alarm recurs, replace the Ethernet cable.
		Option board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option board inserted in slot 1
		Option riser board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Corresponding option riser board (JANCD-ABB03-E or JANCD-ABB04-E board)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then load the CMOS.BIN saved before alarm occurred.
		ARK unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the ARK unit. Save the CMOS.BIN before replacing the board to be safe. Replace the ARK unit, and then load the CMOS.BIN saved before alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0321: VERIFY ERROR(LAN BOARD) (continued)

Sub Code	Meaning	Cause	Remedy
17	The settings of the option board connected to the first PCI bus and the settings managed by the system software are different.	Setting error	Check the following settings. • Turn off the power and insert / remove the optional board. • After starting maintenance mode select the option board and check the settings.
		Ethernet cable failure	1. Turn on the power again. 2. If the alarm recurs, check the connection / insertion status of the Ethernet cable. 3. After checking the connection / insertion status of the Ethernet cable, if the alarm recurs, replace the Ethernet cable.
		Option board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option board inserted in slot 2
		Option riser board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Corresponding option riser board (JANCD-ABB03-E or JANCD-ABB04-E board)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then load the CMOS.BIN saved before alarm occurred.
		ARK unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the ARK unit. Save the CMOS.BIN before replacing the board to be safe. Replace the ARK unit, and then load the CMOS.BIN saved before alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0330: VERIFY ERROR(APPLICATION)

The YNX1000 verifies that the application parameters are correctly set during a startup process. This alarm occurs if the YNX1000 detects an error in the verification process.

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0340: VERIFY ERROR(SENSOR FUNCTION)

The YNX1000 verifies that the sensor parameters are correctly set during a startup process. This alarm occurs if the YNX1000 detects an error in the verification process.

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0370: VERIFY ERROR(SPOT WELDER I/F)

The designation in the parameter is different from the connected welding timer.

Sub Code	Meaning	Cause	Remedy
	The designation in the parameter is different from the connected welding timer.	Setting error	Check the following settings. • The welding timer designation If the welding timer is set to NADEX or DENGENSHA, check that the EM item of the slave station corresponding to the NADEX timer is 'o' in the master setting of the Molex DeviceNet board (SST-DN4).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0390: VERIFY ERROR(SEGMENT CLOCK)

Illegal instruction cycle is set.

Sub Code	Meaning	Cause	Remedy
	Illegal instruction cycle is set.	Setting error	Check the following settings. • Instruction execution cycle
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0400: PARAMETER TRANSMISSION ERROR

The parameters required for the Robot safety module or Robot control module (Servo processing) or Option module operation are transferred from the robot control module. This alarm occurs if the parameters are not successfully transferred.

Sub Code	Meaning	Cause	Remedy
20	An error occurred during the parameter/file transfer to the option module.	Insert failure	1. Turn on the power again. 2. If the alarm recurs, check the insertion status of the option module.
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the option module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then load the CMOS.BIN saved before alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	An error occurred during the parameter/file transfer to the robot safety module #1.	Setting error	Check the following settings. • Control group settings in maintenance mode • The robot safety module (#1) rotary switch setting (0)
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	An error occurred during the parameter/file transfer to the robot safety module #2.	Setting error	Check the following settings. • Control group settings in maintenance mode • The robot safety module (#2) rotary switch setting
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
50	An error occurred during the parameter/file transfer to the Robot control module (Servo processing).	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0410: MODE CHANGE ERROR

The YNX1000 changes its operation modes during a startup process from the power-on operation until the startup process completion. Since mode change is required for the peripheral CPU boards as well as the robot control module, the YNX1000 simultaneously performs a process as the mode change process. This alarm occurs if the mode change is not successfully performed.

Sub Code	Meaning	Cause	Remedy
30	An error occurred during startup sequence processing with the robot safety module #1, and the system did not startup normally.	Setting error	Check the following settings. - Control group settings in maintenance mode - The robot safety module rotary switch setting (0) of the corresponding node number
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	An error occurred during startup sequence processing with the robot safety module #2, and the system did not startup normally.	Setting error	Check the following settings. - Control group settings in maintenance mode - The robot safety module rotary switch setting (1) of the corresponding node number
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
50	An error occurred during startup sequence processing with the Robot control module (Servo processing), and the system did not startup normally.	Robot control module failure	- Turn OFF the power supply to the robot controller, then back ON. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0500: SEGMENT PROC NOT READY

To properly operate the manipulator, it is required to complete the processing of operation instructions within the specified time. This alarm occurs if the processing of operation instructions is not completed within the specified time.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Instruction execution cycle
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0510: SOFTWARE VERSION UNMATCH

The combination of the robot control module program and the robot safety module/option board program is incorrect.

Sub Code	Meaning	Cause	Remedy
20	1st option board's interface version is not corresponding to robot control module.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	2nd option board's interface version is not corresponding to robot control module.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	Robot safety module connected to the 1st servo board's software version is not corresponding to robot control module.	Software error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the robot safety module version and then consult your YASKAWA representative.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.

0510: SOFTWARE VERSION UNMATCH (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	Robot safety module connected to the 2nd servo board's software version is not corresponding to robot control module.	Software error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the robot safety module version and then consult your YASKAWA representative.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0520: AXIS LIMIT OVER

The number of axes exceeds the permissible value.

Sub Code	Meaning	Cause	Remedy
0		Setting error	Check the following settings. • Control group settings in maintenance mode
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0550: MECHATROLINK PARAMETER INITIALIZE ERROR (DEVICE 1)

An error occurred when initializing servo amplifier parameters.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Station address of servo amplifier in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN04 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.

0550: MECHATROLINK PARAMETER INITIALIZE ERROR (DEVICE 1) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0560: MODULE DETECTION ERROR

No module detected.

Sub Code	Meaning	Cause	Remedy
		Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.

◆ 0561: EVENT DRIVEN CONNECT ERROR

An error was detected when executing the event-driven communication CONNECT command.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN04 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0562: EVENT DRIVEN ID_RD ERROR

An error was detected when executing the event-driven communication ID_RD command.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN04 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0563: EVENT DRIVEN MEM_RD ERROR

An error was detected when executing the event-driven communication MEM_RD command.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN04 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.

0563: EVENT DRIVEN MEM_RD ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0564: EVENT DRIVEN TIMEOUT ERROR

An event-driven communication timeout was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN04 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0565: VENDOR ID CODE ERROR

An error was detected in the vender ID code.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0568: SUB DEVICE CODE ERROR

An error was detected in the sub- device code.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0569: SERIAL NUMBER ERROR

Servo amplifiers with different serial numbers were connected than the last boot.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Normal operation	This alarm occurs when the servo amplifier is replaced. Turn OFF the power supply to the robot controller, then back ON.
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.

0569: SERIAL NUMBER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0570: MECHATROLINK DEVICE ERROR

The number of devices is abnormal.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0571: MECHATROLINK ADDRESS ERROR (SERVO AMPLIFIER)

An error was detected in the station address of the servo amplifier.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Station address of servo amplifier in which the alarm occurred.	Station address setting error	Check that the station address setting (rotary switch) matches the connection setting.
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0572: SERVO AMPLIFIER TYPE ERROR

Servo amplifiers not registered in the robot controller were connected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0573: LOCAL DEVICE ERROR

An error was detected in the local device number.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0574: LOCAL DEVICE DUPLICATED ERROR

A duplicate local device number was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0575: PROFILE TYPE ERROR

An error was detected in the profile type.

Sub Code	Meaning	Cause	Remedy
	Sub Code: axes in which the alarm occurred.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0576: SIGMA-XMD NOT USED ERROR

The multi-axis servo amplifier is not connected.

Sub Code	Meaning	Cause	Remedy
		Multi-axis servo amplifier connect error	Connect the multi-axis servo amplifier.
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0578: MECHATROLINK CABLE DISCONNECTION

MECHATROLINK cable is not connected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Station address of servo amplifier in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN04 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0579: MECHATROLINK ADDRESS ERROR (PARAMETER)

An error was detected in the station address parameter of the servo amplifier.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Station address of servo amplifier in which the alarm occurred.	Station address setting error	Check that the station address setting (rotary switch) matches the connection settings.
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0590: MECHATROLINK CYCLIC COMMUNICATIONS INITIALIZE ERROR

An error was detected in MECHATROLINK cyclic communication initialization.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0591: MECHATROLINK EVENT DRIVEN COMMUNICATIONS INITIALIZE ERROR

An error was detected in MECHATROLINK event-driven communication initialization.

Sub Code	Meaning	Cause	Remedy
0x110 C1016	An error was detected in node address sorting.	Setting error	See troubleshooting for AL0571 or AL0579 that occur simultaneously.
0x140 C0000	An error in the servo amplifier connection order was detected.	Setting error	Check that the servo amplifier connection order matches the connection settings.
0x150 B100B	An error in the station address setting was detected.	Setting error	Check whether the station address setting (rotary switch) is set to the appropriate value (03 to EF).
0x160 B100B	Duplicate station address was detected.	Setting error	Check whether there are any duplicate station address settings (rotary switches) between the servo amplifiers to be connected.
0x170 B100B	MECHATROLINK cable is not connected.	Setting error	See troubleshooting for AL0578, that occurs simultaneously.
Others		Setting error	If there are alarms occurring simultaneously, see troubleshooting for the alarms (excluding AL1050).
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0592: MECHATROLINK EVENT DRIVEN COMMUNICATIONS NETWORK RESET ERROR

An error was detected in MECHATROLINK event-driven communication reset.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0593: MECHATROLINK SLAVE SEARCH ERROR

An error was detected in MECHATROLINK slave search.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0594: MECHATROLINK PRE-CYCLIC COMMUNICATIONS ERROR

An error was detected in MECHATROLINK precyclic communication initialization.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0595: MECHATROLINK PRE-CYCLIC COMMUNICATIONS NETWORK RESET ERROR

An error was detected in MECHATROLINK precyclic communication reset.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0700: VERIFY ERROR(EX IO ALLOC FILE)

The YNX1000 verifies that the EX IO file are correctly set during a startup process. This alarm occurs if the YNX1000 detects an error in the verification process.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD Card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0710: LADDER INITIALIZE ERROR

The ladder program could not be initialized successfully.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0711: SLIO MODULE INIT ERROR

Failed to initialize SLIO modules.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred. 0xAABBCCCC AA: • 01:Address mapping has failed • 02:Initialization has failed • 03:Modules have not been detected • 04:IO map config has failed • 05:Communication has not started. • 06:Output activation has failed BB: • 01:SliceBus initialize error • 02:Number of SliceBus modules has been over • 03:Undefined SliceBus module ID has been detected CCCC:Slot no.	Software error	Check the following settings. • IO module setting in maintenance mode.

◆ 0720: LADDER PROGRAM ERROR

This alarm occurs if the relay number of ladder program specification is wrong.

Sub Code	Meaning	Cause	Remedy
1	An error was found in the relay No. specification.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error was found in the register No. specification.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0720: LADDER PROGRAM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An incorrect instruction was set.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Output register is used redundantly.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Output relay is used redundantly.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Unconnected relay exists.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0720: LADDER PROGRAM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The STR instructions are overused.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The AND-STR instructions are overused.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	A syntax error was found in the CNT instruction.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The head of the block starts with an instruction other than the STR instruction.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0720: LADDER PROGRAM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Excessive machine codes	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The last instruction is not the END instruction.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	An error was found in the PART instruction.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	An error was found in the GOUT instruction.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0720: LADDER PROGRAM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	The No. of operand is incorrect.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	The constant value is incorrect.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	The step capacity exceeds the memory capacity.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	The number of operation instructions exceed the permissible value.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.

0720: LADDER PROGRAM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	A syntax error was found in the CNT instruction or TMR instruction.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	A syntax error was found in the JMP-LABEL instructions.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	The label of JMP destination does not exist.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0730: COMMUNICATION ERROR (SKS-SERIAL)

An error occurred when performing serial communication with SKS welder.

Sub Code	Meaning	Cause	Remedy
0	Welder power serial I/F task cannot be created.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	Incorrect values are set for the communication frame number with the welder power.	Setting error	Check the following setting. • The number of communication frames for Welder power serial communication (RS262)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Incorrect values are set for the number of the sending bytes per frame with the welder power.	Setting error	Check the following setting. • The number of the sending bytes for Welder power serial communication (RS260)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Incorrect values are set for the number of the receiving bytes per frame with the welder power.	Setting error	Check the following setting. • The number of the receiving bytes for Welder power serial communication (RS261)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0730: COMMUNICATION ERROR (SKS-SERIAL) (continued)

Sub Code	Meaning	Cause	Remedy
10	The binary semaphore to start up event for Welder power serial I/F task cannot be created.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The event resource for Welder power serial I/F task cannot be created.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The completion notification mail of Welder power serial I/F task cannot be created.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Welder power serial I/F task cannot be created.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0750: MECHATROLINK COM. ERROR (SLV#1)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0751: MECHATROLINK COM. ERROR (SLV#2)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0752: MECHATROLINK COM. ERROR (SLV#3)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0753: MECHATROLINK COM. ERROR (SLV#4)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0754: MECHATROLINK COM. ERROR (SLV#5)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0755: MECHATROLINK COM. ERROR (SLV#6)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0756: MECHATROLINK COM. ERROR (SLV#7)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0757: MECHATROLINK COM. ERROR (SLV#8)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0758: MECHATROLINK COM. ERROR (SLV#9)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0759: MECHATROLINK COM. ERROR (SLV#10)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0760: MECHATROLINK COM. ERROR (SLV#11)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0761: MECHATROLINK COM. ERROR (SLV#12)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0762: MECHATROLINK COM. ERROR (SLV#13)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0763: MECHATROLINK COM. ERROR (SLV#14)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0764: MECHATROLINK COM. ERROR (SLV#15)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0765: MECHATROLINK COM. ERROR (SLV#16)

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred.	Setting error	Turn off DipSw1-1 on the front of the robot control module and turn off the power supply to the robot controller, then back on.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0770: SAFETY FIELD BUS SET ERR(RC)

Setting of the Safety Fieldbus function is incorrect.

Sub Code	Meaning	Cause	Remedy
1	Safety slave and standard master are used simultaneously in one channel of the DeviceNet board.	Setting error	Check the following settings. • Select [SYSTEM] - [SETUP] - [OPTION BOARD] settings in maintenance mode. Display the slot(channel) that is configured with DeviceNet Safety, set to slave mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0770: SAFETY FIELD BUS SET ERR(RC) (continued)

Sub Code	Meaning	Cause	Remedy
2	Board that cannot be used with DeviceNet Safety is set.	Setting error	Check the following settings. • Insert the SST-DN4-PCIE board to the slot to be used in the DeviceNet Safety. Select [SYSTEM] - [SETUP] - [OPTION BOARD] settings in maintenance mode, set the DeviceNet Safety.
		SST-DN4-PCU board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the SST-DN4-PCIE board. Save the CMOS.BIN before replacing the board to be safe. Replace the SST-DN4-PCIE board, and then load the CMOS.BIN saved before alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0771: SAFETY FIELD BUS SYS ERR(RC)

An error occurred in the Safety Fieldbus function.

Sub Code	Meaning	Cause	Remedy
10000	The error was detected by the safety fieldbus process (robot control module). Subcode shows the error part of software.	SST-DN4-PCU board failure	For the DeviceNet Safety, check the following. 1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the SST-DN4-PCIE board. Save the CMOS.BIN before replacing the board to be safe. Replace the SST-DN4-PCIE board, and then load the CMOS.BIN saved before alarm occurred.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0772: DeviceNet Safety RESET REQUEST

Sub Code	Meaning	Cause	Remedy
	Safety reset request was received from the safety PLC in communication.	Operation failure	Turn the power OFF then back ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0790: MEMORY BATTERY WEAK

Sub Code	Meaning	Cause	Remedy
	The AIF01 battery is exhausted.	Connection failure	Check if the battery is correctly connected to CN110/BAT on the AIF01 board.
		Battery failure	Refer to "Replacing the Battery" in YNX1000 Maintenance manual (RE-CHO-A108) and replace the battery.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0800: FILE BACKUP ERROR (RC SD)

The YNX1000 saves a part of data needed for system operations on the SD Card in the robot control module. When the data is changed, the new data is written on the SD Card. This alarm occurs if this data writing cannot be done correctly. Since this alarm occurs due to SD Card access failure, it is not recorded in the alarm history.

Sub Code	Meaning	Cause	Remedy
	The management area (FAT) of SD Card in robot control module is damaged.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0801: FILE LOAD ERROR (RC SD)

The YNX1000 saves a part of data needed for system operations on the SD Card in the robot control module. The data is read out when the controller power is turned ON. This alarm occurs if this data reading cannot be done correctly. Since this alarm occurs due to SD Card access failure, it is not recorded in the alarm history.

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3000	PANELBOX.LOG file broken	DATA failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, select the following menu. • [SYSTEM]-[DATA REBUILD]

0801: FILE LOAD ERROR (RC SD) (continued)

Sub Code	Meaning	Cause	Remedy
		SD card failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the SD card. Save the CMOS.BIN before replacing the board to be safe. Replace the SD card , and then load the CMOS.BIN saved before alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3435	MAINTE.LOG file broken	DATA failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, select the following menu. • [SYSTEM]-[DATA REBUILD]
		SD card failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the SD card. Save the CMOS.BIN before replacing the board to be safe. Replace the SD card , and then load the CMOS.BIN saved before alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0802: FILE I/O ERROR (RC SD)

The YNX1000 saves a part of data needed for system operations on the SD Card in the robot control module. This alarm occurs if it cannot access to the robot control module correctly.

Usually, this alarm occurs accAL-0800 and AL-0801 occurs simultaneously.

Since this alarm occurs due to SD Card access failure, it is not recorded in the alarm history.

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0803: FILE ERROR

The YNX1000 software controls the detailed data of robot or motor at the extra file called [MECHA.ROM]. This alarm occurs if this file cannot be read correctly.

Sub Code	Meaning	Cause	Remedy
	An error occurred during the parameter of Manipulator Model (mecha.rom) loading.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0831: FORCE SENSOR COMMUNICATION ERROR

Communication error of the force sensor board happen.

Sub Code	Meaning	Cause	Remedy
	Sub Code: 1000 +channel*100 +factor: 0 send complete error 1 receive time out 2 receive break letter 3 framing error 4 parity error 5 over run error 6 receive length error 7 no STX control letter 8 no ETB control letter 9 BCC error 10 sequence number error 11 sensor detection error	Hardware failure	1. After checking the following two items, turn the power OFF then back ON. • the connection status • the sensor type 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)
		Fuse failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check if the fuse (-F71) attached to the cable of CPS01 unit - CN156 is not broken. 3. If the fuse is broken, confirm that there is no cable failure (such as broken line, short circuit, ground fault) in the cable connected between CPS01 unit and sensor, and then replace the fuse.

0831: FORCE SENSOR COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, Check the connection/insertion status of the following connector and also check if there is no failure (such as broken line, short circuit, ground fault) in the cable connected to the following connector. • communication board-CN1 • connector -X75, -X76 • CPS01 unit -CN156 3. If there is no failure in the sensor cable above, check if there is no failure (such as short circuit, ground fault) on the 24V line of the I/O cable of the following connectors. • AIO board -CN306,CN307,CN308,CN309
		communication board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the communication board.

◆ 0900: WATCHDOG TIMER ERROR(RC)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the robot control module.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the robot control module.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0901: WATCHDOG TIMER ERROR(OPT#1)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the option module #1.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the option module #1.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module

0901: WATCHDOG TIMER ERROR(OPT#1) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0902: WATCHDOG TIMER ERROR(OPT#2)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the option module #2.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the option module #2.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0903: WATCHDOG TIMER ERROR(OPT#3)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the option module #3.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the option module #3.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module

0903: WATCHDOG TIMER ERROR(OPT#3) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0904: WATCHDOG TIMER ERROR(OPT#4)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the option module #4.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the option module #4.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0905: WATCHDOG TIMER ERROR(OPT#5)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the option module #5.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the option module #5.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module

0905: WATCHDOG TIMER ERROR(OPT#5) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0906: WATCHDOG TIMER ERROR(OPT#6)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the option module #6.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the option module #6.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0907: WATCHDOG TIMER ERROR(OPT#7)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the option module #7.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the option module #7.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module

0907: WATCHDOG TIMER ERROR(OPT#7) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0908: WATCHDOG TIMER ERROR(OPT#8)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the option module #8.

Sub Code	Meaning	Cause	Remedy
	A Watchdog timeout was detected in the option module #8.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0910: CPU ERROR(RC)

An unexpected error was detected in robot control module.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU. 0-255:error code detected by robot control module 1000-: internal error of software	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0911: CPU ERROR(OPT#1)

An error was detected in the CPU of the optional module #1.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0912: CPU ERROR(OPT#2)

An error was detected in the CPU of the optional module #2.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0913: CPU ERROR(OPT#3)

An error was detected in the CPU of the optional module #3.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module

0913: CPU ERROR(OPT#3) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0914: CPU ERROR(OPT#4)

An error was detected in the CPU of the optional module #4.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0915: CPU ERROR(OPT#5)

An error was detected in the CPU of the optional module #5.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0916: CPU ERROR(OPT#6)

An error was detected in the CPU of the optional module #6.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0917: CPU ERROR(OPT#7)

An error was detected in the CPU of the optional module #7.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0918: CPU ERROR(OPT#8)

An error was detected in the CPU of the optional module #8.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module

0918: CPU ERROR(OPT#8) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0920: WATCHDOG TIMER ERROR(MSF#1)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the robot safety module#1.

Sub Code	Meaning	Cause	Remedy
0	A Watchdog timeout was detected in the robot safety module#1 (CPU1).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	A Watchdog timeout was detected in the robot safety module#1 (CPU2).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0921: WATCHDOG TIMER ERROR(MSF#2)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the robot safety module#2.

Sub Code	Meaning	Cause	Remedy
0	A Watchdog timeout was detected in the robot safety module#2 (CPU1).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	A Watchdog timeout was detected in the robot safety module#2 (CPU2).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0931: CPU HANG UP ERROR(OPT#1)

An error was detected in the CPU of the optional module #1.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.

0931: CPU HANG UP ERROR(OPT#1) (continued)

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0932: CPU HANG UP ERROR(OPT#2)

An error was detected in the CPU of the optional module #2.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0933: CPU HANG UP ERROR(OPT#3)

An error was detected in the CPU of the optional module #3.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.

0933: CPU HANG UP ERROR(OPT#3) (continued)

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0934: CPU HANG UP ERROR(OPT#4)

An error was detected in the CPU of the optional module #4.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0935: CPU HANG UP ERROR(OPT#5)

An error was detected in the CPU of the optional module #5.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.

0935: CPU HANG UP ERROR(OPT#5) (continued)

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0936: CPU HANG UP ERROR(OPT#6)

An error was detected in the CPU of the optional module #6.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0937: CPU HANG UP ERROR(OPT#7)

An error was detected in the CPU of the optional module #7.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.

0937: CPU HANG UP ERROR(OPT#7) (continued)

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0938: CPU HANG UP ERROR(OPT#8)

An error was detected in the CPU of the optional module #8.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0939: CPU HANG UP ERROR(MP-PRESS)

A CPU error on the MP-PRESS board (MC2110) has been detected.

Sub Code	Meaning	Cause	Remedy
	An error was detected in the CPU.	Setting error	Check the following settings. • Optional board in maintenance mode
		MC2110 board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • MC2110 board
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.

0939: CPU HANG UP ERROR(MP-PRESS) (continued)

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0960: CPU ERROR(MSF#1)

The YNX1000 can safely stop the system even when an unexpected processing occurs on each board. This alarm occurs if an unexpected error occurs in robot safety module #1.

Sub Code	Meaning	Cause	Remedy
0	An error was detected in the CPU of robot safety module #1 (CPU1).	Robot safety module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	An error was detected in the CPU of robot safety module #1 (CPU2).	Robot safety module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0961: CPU ERROR(MSF#2)

The YNX1000 can safely stop the system even when an unexpected processing occurs on each board. This alarm occurs if an unexpected error occurs in robot safety module #2.

Sub Code	Meaning	Cause	Remedy
0	An error was detected in the CPU of robot safety module #2 (CPU1).	Robot safety module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	An error was detected in the CPU of robot safety module #2 (CPU2).	Robot safety module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0970: CPU ERROR(FSF01#1)

The YNX1000 can safely stop the system even when an unexpected processing occurs on each board. This alarm occurs if an unexpected error occurs in robot safety module#1.

Sub Code	Meaning	Cause	Remedy
0	An error was detected in the CPU of robot safety module #1 (CPU1).	Robot safety module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0970: CPU ERROR(FSF01#1) (continued)

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of robot safety module #1 (CPU2).	Robot safety module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0971: CPU ERROR(FSF01#2)

The YNX1000 can safely stop the system even when an unexpected processing occurs on each board. This alarm occurs if an unexpected error occurs in robot safety module#2.

Sub Code	Meaning	Cause	Remedy
0	An error was detected in the CPU of robot safety module #2 (CPU1).	Robot safety module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	An error was detected in the CPU of robot safety module #2 (CPU2).	Robot safety module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0980: WATCHDOG TIMER ERROR(FSF01#1)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the robot safety module#1.

Sub Code	Meaning	Cause	Remedy
0	A Watchdog timeout was detected in the Safety board #1 (CPU1).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	A Watchdog timeout was detected in the Safety board #1 (CPU2).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0981: WATCHDOG TIMER ERROR(FSF01#2)

The YNX1000 can safely stop the system with a watchdog function when an error occurred. This alarm occurs if a watchdog timeout is detected in the robot safety module#2.

Sub Code	Meaning	Cause	Remedy
0	A Watchdog timeout was detected in the Safety board #2 (CPU1).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	A Watchdog timeout was detected in the Safety board #2 (CPU2).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.

0981: WATCHDOG TIMER ERROR(FSF01#2) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0990: SYSTEM ERROR(RC)

This alarm occurs if an unexpected error occurs in the robot control module.

Sub Code	Meaning	Cause	Remedy
1	Robot control module detects the Controller power off signal (Power lost signal) of the robot control module when the control power turned ON. This alarm may occur, when the control power turned OFF before an online screen is displayed by a programming pendant.	Execute condition failure	Turn the power OFF after the online window appears on the programming pendant.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Power supply contactor unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the power supply contactor unit. Save the CMOS.BIN before replacing the unit to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Robot control module detects the WATCHDOG TIMER ERROR of the robot control module when the control power turned ON.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Power supply contactor unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the power supply contactor unit. Save the CMOS.BIN before replacing the unit to be safe.

0990: SYSTEM ERROR(RC) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Robot control module detects the Servo IF Initialize error of the robot control module when the control power turned ON.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Power supply contactor unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the power supply contactor unit. Save the CMOS.BIN before replacing the unit to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Robot control module detects the IO IF Initialize error of the robot control module when the control power turned ON.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Power supply contactor unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the power supply contactor unit. Save the CMOS.BIN before replacing the unit to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Processing time error of the IO processing	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Power supply contactor unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the power supply contactor unit. Save the CMOS.BIN before replacing the unit to be safe.

0990: SYSTEM ERROR(RC) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Processing time error of the SV communication.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Power supply contactor unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the power supply contactor unit. Save the CMOS.BIN before replacing the unit to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	It was detected that AC power supply became less than the specified voltage.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The cable of CPS01 unit connector CN158/159 • The CN5 connector of the ABB01 back board. • Cable replace between the CPS01 unit and the ABB01 back board.
		Power supply contactor unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the power supply contactor unit. Save the CMOS.BIN before replacing the unit to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0991: SYSTEM ERROR(OPT#1)

An error was detected in the CPU of the optional module #1.

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of the optional module #1.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0992: SYSTEM ERROR(OPT#2)

An error was detected in the CPU of the optional module #2.

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of the optional module #2.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0993: SYSTEM ERROR(OPT#3)

An error was detected in the CPU of the optional module #3.

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of the optional module #3.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0994: SYSTEM ERROR(OPT#4)

An error was detected in the CPU of the optional module #4.

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of the optional module #4.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0995: SYSTEM ERROR(OPT#5)

An error was detected in the CPU of the optional module #5.

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of the optional module #5.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0996: SYSTEM ERROR(OPT#6)

An error was detected in the CPU of the optional module #6.

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of the optional module #6.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0997: SYSTEM ERROR(OPT#7)

An error was detected in the CPU of the optional module #7.

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of the optional module #7.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0998: SYSTEM ERROR(OPT#8)

An error was detected in the CPU of the optional module #8.

Sub Code	Meaning	Cause	Remedy
1	An error was detected in the CPU of the optional module #8.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 0999: PCI-e COMMUNICATION ERROR

An error was detected in the PCI-e Communication

Sub Code	Meaning	Cause	Remedy
20	An error was detected in the PCI-e Communication of the optional Option module #1.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	An error was detected in the PCI-e Communication of the optional Option module #2.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module

0999: PCI-e COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	An error was detected in the PCI-e Communication of the optional Option module #3.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	An error was detected in the PCI-e Communication of the optional Option module #4.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	An error was detected in the PCI-e Communication of the optional Option module #5.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	An error was detected in the PCI-e Communication of the optional Option module #6.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	An error was detected in the PCI-e Communication of the optional Option module #7.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
27	An error was detected in the PCI-e Communication of the optional Option module #8.	Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • Option module
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	An error was detected in the PCI-e Communication of robot safety module #1.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

0999: PCI-e COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
31	An error was detected in the PCI-e Communication of robot safety module #2.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1.2 Alarm Number (1000 to 1999)

◆ 1000: ROM ERROR(RC)

A checksum error occurred in the ROM of robot control module.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1020: MotoPlus (APPLICATION LOAD ERROR)

Failed at loading MotoPlus application.

Sub Code	Meaning	Cause	Remedy
1	Number of the Application files on the robot control module SD card is over the limit.	Setting error	Delete unnecessary application files "*.out" in order not to exceed the file number limitation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Insufficient memory space. At the loading time, remaining CPU memory is less than 2MByte (Stipulated memory size for MotoPlus) .	Setting error	Under current system configuration and option function combination, there is not enough memory to run MotoPlus application. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure). It may be necessary to replace the robot control module with the one with larger memory.
3	MotoPlus application folder "/Application" cannot be found.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	Memory size (Code area + static variable area) required by MotoPlus Application is over the limit(2Mbyte).	Setting error	1. Check the static memory definition of the application program. 2. Redesign the application program in order not to exceed the memory size limitation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	Undefined symbols are included in the application. The Symbols are not included in the MotoPlus API library or standard function library.	Setting error	Check that the application program doesn't include any undefined symbols such as function and constant that are not provided by the system.

1020: MotoPlus (APPLICATION LOAD ERROR) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	Load failure (The application cannot be loaded since the memory (program area + static variable area) that the MotoPlus application requires exceeds the specified value (2MByte).)	Setting error	1. Check if the static variables are correctly defined in the MotoPlus application. 2. Review the MotoPlus application program so that the memory used for it doesn't exceed the specified value. 3. Check if the object files are correctly created by MotoPlusIDE.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
7	API library initialization failure because of Insufficient system memory to load MotoPlus API library	Setting error	Under current system configuration and the combination of optional functions, the robot control module doesn't have enough memory to run MotoPlus application. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure). It may be necessary to change the robot control module to the one with a large-capacity memory.
8	User root task "mpUsrRoot()" not included in the application	Setting error	Check if mpUsrRoot() is described in the application program.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
9	User root task generation failure	Setting error	Under current system configuration and the combination of optional functions, the robot control module doesn't have enough memory to run MotoPlus application. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure). It may be necessary to change the robot control module to the one with a large-capacity memory.
10	RAM-Disk generation failure	Setting error	Under current system configuration and the combination of optional functions, the robot control module doesn't have enough memory to run MotoPlus application. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure). It may be necessary to change the robot control module to the one with a large-capacity memory.
16	Same name application files exist.	Setting error	Delete the same name application file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1030: MEMORY ERROR(PARAMETER FILE)

This alarm occurs when an error is detected during total check of parameters.

Sub Code	Meaning	Cause	Remedy
0	RCD, RCxG parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1	ROxG parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	SVD, SVxG parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	SVMxG parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

1030: MEMORY ERROR(PARAMETER FILE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	S1CxG, S2C, S3C, S4C parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	S1D, S2D, S3D, S4D parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	CIO parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
7	FD parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

1030: MEMORY ERROR(PARAMETER FILE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
8	A1P, A2P, ..., A8P parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
9	RS parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
10	S1E, S2E, ..., S8E parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
11	SVCxB parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

1030: MEMORY ERROR(PARAMETER FILE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
12	AMCxG parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
13	SVPxG parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
14	MFxG parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
15	SVSxB parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

1030: MEMORY ERROR(PARAMETER FILE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
16	RExG parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
17	FMSxB parameter error	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate parameter file in maintenance mode, and then load the parameter file saved in the external memory device.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1031: MEMORY ERROR(MOTION1)

Data error occurred in the file data used by MOTION section.

Sub Code	Meaning	Cause	Remedy
0	"GET FILE" instruction, "SET FILE" instruction execution target file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1	Home position calibration file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1031: MEMORY ERROR(MOTION1) (continued)

Sub Code	Meaning	Cause	Remedy
2	Tool file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	User coordinates file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	Robot calibration file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	Tool calibration file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	Weaving amplitude condition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
7	Home position correction data file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
8	Conveyor calibration file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1031: MEMORY ERROR(MOTION1) (continued)

Sub Code	Meaning	Cause	Remedy
9	Arm and tool interference prevention file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
20	Weaving file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
27	Path correction condition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
32	Sensor monitoring condition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
34	Conveyor condition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
36	Servo float condition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
42	Anticipation OT# output file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1031: MEMORY ERROR(MOTION1) (continued)

Sub Code	Meaning	Cause	Remedy
43	Anticipation OG# output file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
44	Handling condition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
45	Form cut file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
47	Linear servo float condition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
48	Macro definition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
53	Job registration table	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
64	Conveyor condition auxiliary file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1031: MEMORY ERROR(MOTION1) (continued)

Sub Code	Meaning	Cause	Remedy
67	Palletizing condition file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
69	Mastering registration position	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
91	Svclamp file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
93	Tool confirmation file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
102	Device calibration config file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
103	Correction table config file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
107	Csync interference file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1031: MEMORY ERROR(MOTION1) (continued)

Sub Code	Meaning	Cause	Remedy
108	Absolute position calibration file	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
109	2nd encoder origin positioning data	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1033: MEMORY ERROR(MODEL DATA FILE)

The module data file is abnormal

Sub Code	Meaning	Cause	Remedy
	Sub;Model file number	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data, and then load the data saved in the external memory device.

◆ 1034: MEMORY ERROR(F-CONDITION FILE)

The force condition file is abnormal

Sub Code	Meaning	Cause	Remedy
	Sub;force condition file number	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, initialize the appropriate data, and then load the data saved in the external memory device.

◆ 1035: MEMORY ERROR(SYSTEM)

An error has been detected in the internal memory of the robot control module.

Sub Code	Meaning	Cause	Remedy
1	Management data area error	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
2	Write address error in setting data area	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
3	Failed writing in setting data area	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

◆ 1050: SET-UP PROCESS ERROR(SYSCON)

The system software monitors if the setup of MOTION section software is properly completed when the power turned ON. This alarm occurs if the MOTION section software fails to properly complete the setup.

Note that the alarm AL-1051 (SET-UP PROCESS ERROR) occurs in conjunction with this alarm. (For details, refer to AL-1051.)

The error and message of interior temperature error and interior fan error might be complicated because it doesn't starting up normally in this state.

Sub Code	Meaning	Cause	Remedy
1	Motion instruction setup incomplete.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Online error	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

1.2 Alarm Number (1000 to 1999)

1050: SET-UP PROCESS ERROR(SYSICON) (continued)

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	SPOT management file setup incomplete.	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Welder I/F board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the Welder I/F board. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1051: SET-UP PROCESS ERROR(MOTION)

Setup process of MOTION section was not properly completed when the power turned ON.

Sub Code	Meaning	Cause	Remedy
1	Unable to properly activate the servo control	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The position data of when the power supply was turned OFF cannot be transmitted to the servo control section	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The servo control section cannot receive the position data of when the power supply was turned OFF	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.

1051: SET-UP PROCESS ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Unable to send a request to turn ON the PG power supply for the mounted (PICK) axis	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Unable to turn ON the PG power supply for the mounted (PICK) axis	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Unable to send a request to prepare a feedback pulse	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Unable to prepare a feedback pulse	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Unable to send a request to initialize the arithmetic section (ARITH)	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1051: SET-UP PROCESS ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
10	Unable to initialize ARITH	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Unable to send a request to prepare the current position	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	Unable to prepare the current position	Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
254	Occurs when an error is detected in the initialization process when the power is turned on.	Software operation error occurred	Take corrective action for the alarm that is occurring at the same time and indicates the cause of the error.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1053: ACU SERVICE (SETUP ERROR)

Setup process of ACU Service section was not properly completed when the power turned ON.

Sub Code	Meaning	Cause	Remedy
0	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1053: ACU SERVICE (SETUP ERROR) (continued)

Sub Code	Meaning	Cause	Remedy
2	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
7	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
8	Setup process of ACU Service section was not properly completed when the power turned ON.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1100: SYSTEM ERROR

An unknown alarm was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code C, B, F : Subcode of unknown alarm	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
		RAM software data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1101: SYSTEM ERROR(MAN-MACHINE MECHA)

An error occurred during the system control check.

Sub Code	Meaning	Cause	Remedy
	Sub Code 0 to 19: Internal control error in software	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1102: SYSTEM ERROR(MAN-MACHINE APPLI)

An error occurred during the system control check.

Sub Code	Meaning	Cause	Remedy
	Sub Code 0 to 16383: Internal control error in software	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1103: SYSTEM ERROR(EVENT)

An error occurred during the system event data control check.

Sub Code	Meaning	Cause	Remedy
	Sub Code 1to8: Internal control error in software	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1104: SYSTEM ERROR(CIO)

An error occurred during the system I/O control check.

Sub Code	Meaning	Cause	Remedy
	Sub Code 1000_0000: I/O module setting error	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • CN300 communications connector of YIU unit • CN304 power supply connector • Cable of the YIU unit and the expanded I/O board
		Setting error	1. Turn the power OFF then back ON. 2. If the error occurs again, set the I/O module again in maintenance mode. 3. If the error occurs again though the previous measures were executed, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1105: SYSTEM ERROR(SERVO)

An error occurred in the program operation check of the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Indicates alarm factors.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8501	robot safety module Pullback signal not detected	Setting error	1. Check the following settings. Pullback signal

1.2 Alarm Number (1000 to 1999)

1105: SYSTEM ERROR(SERVO) (continued)

Sub Code	Meaning	Cause	Remedy
		robot safety module failure	If robot safety module is used, need to confirm the following. 1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the module to be safe.
		Other	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1109: SYSTEM ERROR(CONVEYOR)

System error occurred in the sensor process.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1200: HIGH TEMPERATURE(IN CNTL BOX)

Temperature sensor inside the controller (the CPS01K* unit) is activated, and then error was detected.

Sub Code	Meaning	Cause	Remedy
		The temperature rises in the controller	If the LED (OHT) on the CPS01K* unit lights up, wait until the inside of the controller has got cool and then turn the power OFF then back ON.
		CPS01K* unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following unit. • CPS01K* unit
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1204: COMMUNICATION ERROR(I/O MODULE)

Communication error occurred in the I/O module.

Sub Code	Meaning	Cause	Remedy
	The communication error slot (Serial-bus-connected I/O module communication station No.) is displayed by the bit. 0: correct / 1: incorrect	Connection failure	Check the insertion and connection of the following. • The MII communications cable which I/O module of the corresponding sub code • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		IO module failure	Replace the I/O module of the corresponding station number.

1204: COMMUNICATION ERROR(I/O MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Power supply broken	Replace the 24V power supply supplied to the I/O module of the corresponding station number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1219: ENABLE SW STICKING

Sticking of enable SW was detected.

Sub Code	Meaning	Cause	Remedy
		Programming pendant failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the programming pendant.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1220: LAN COMMUNICATION PARAMETER ERROR

An error occurred in parameter which is used in the Ethernet function.

Sub Code	Meaning	Cause	Remedy
1	Incorrect setting of the IP address which is used in the Ethernet function.(LAN interface 2)	Setting error	Check the following settings. • IP address setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Incorrect setting of the subnet mask which is used in the Ethernet function.(LAN interface 2)	Setting error	Check the following settings. • Subnet mask of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Incorrect setting of the default gateway which is used in the Ethernet function.	Setting error	Check the following settings. • Default gateway of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	Incorrect setting of the host address which is used in the Ethernet function.	Setting error	Check the following settings. • Server (host) of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1220: LAN COMMUNICATION PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
5	Incorrect setting of the static route which is used in the Ethernet function.(LAN interface 2 route 1)	Setting error	Check the following settings. • Static route of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
30	Incorrect setting of the parameter which is used for the SNTP of the Ethernet function.	Setting error	Check the following settings. • SNTP setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
31	Incorrect setting of the IP address of the SNTP server which is used in the Ethernet function of the SNTP.	Setting error	Check the following settings. • SNTP setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
32	Incorrect setting of the IP address of the SNTP server which is used in the Ethernet function of the SNTP.	Setting error	Check the following settings. • SNTP setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
33	Incorrect setting of the DHCP parameter which is used in the Ethernet function of the SNTP.	Setting error	Check the following settings. • SNTP setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
70	Incorrect setting of the host name which is used in the Ethernet function.	Setting error	Check the following settings. • Host name of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
71	Incorrect setting of the IP address of the DNS server which is used in the Ethernet function of the DNS.	Setting error	Check the following settings. • DNS setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
73	Incorrect setting of the parameter which is used in the Ethernet function of the DNS and the domain.	Setting error	Check the following settings. • DNS setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1220: LAN COMMUNICATION PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
74	Incorrect setting of the DHCP parameter which is used in the Ethernet function of the DNS and the domain.	Setting error	Check the following settings. DNS setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
75	Incorrect setting of the domain which is used in the Ethernet function.	Setting error	Check the following settings. Domain name of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
105	Incorrect setting of the static route which is used in the Ethernet function.(LAN interface 2 route 2)	Setting error	Check the following settings. Static route of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1001	Incorrect setting of the IP address which is used in the Ethernet function.(LAN interface 3)	Setting error	Check the following settings. IP address setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1002	Incorrect setting of the subnet mask which is used in the Ethernet function.(LAN interface 3)	Setting error	Check the following settings. Subnet mask of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1005	Incorrect setting of the static route which is used in the Ethernet function.(LAN interface 3 route 1)	Setting error	Check the following settings. Static route of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1105	Incorrect setting of the static route which is used in the Ethernet function.(LAN interface 3 route 2)	Setting error	Check the following settings. Static route of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2001	Incorrect setting of the IP address which is used in the Ethernet function.(LAN interface 4)	Setting error	Check the following settings. IP address setting of LAN interface in maintenance mode

1220: LAN COMMUNICATION PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2002	Incorrect setting of the subnet mask which is used in the Ethernet function.(LAN interface 4)	Setting error	Check the following settings. • Subnet mask of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2005	Incorrect setting of the static route which is used in the Ethernet function.(LAN interface 4 route 1)	Setting error	Check the following settings. • Static route of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2105	Incorrect setting of the static route which is used in the Ethernet function.(LAN interface 4 route 2)	Setting error	Check the following settings. • Static route of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3001	Incorrect setting of the IP address which is used in the Ethernet function.(LAN interface 5)	Setting error	Check the following settings. • IP address setting of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3002	Incorrect setting of the subnet mask which is used in the Ethernet function.(LAN interface 5)	Setting error	Check the following settings. • Subnet mask of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3005	Incorrect setting of the static route which is used in the Ethernet function.(LAN interface 5 route 1)	Setting error	Check the following settings. • Static route of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3105	Incorrect setting of the static route which is used in the Ethernet function.(LAN interface 5 route 2)	Setting error	Check the following settings. • Static route of LAN interface in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1221: ETHERNET INITIAL PROCESS ERROR

An error occurred in the initialization of the Ethernet function.

Sub Code	Meaning	Cause	Remedy
1	An error occurred in the device initialization process of the Ethernet function.(LAN interface 2)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error occurred in the IP address setting process of the Ethernet function.	Setting error	Check the following settings. • IP address setting of LAN interface in maintenance mode"
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An error occurred in the subnet mask setting process of the Ethernet function.	Setting error	Check the following settings. • Subnet mask of LAN interface in maintenance mode
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error occurred in the default gateway setting process of the Ethernet function.	Setting error	Check the following settings. • Default gateway of LAN interface in maintenance mode
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
5	An error occurred in the host name setting process of the Ethernet function.	Setting error	Check the following settings. • Server (host) of LAN interface in maintenance mode
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	An error occurred in the MAC address getting process of the Ethernet function.(LAN interface 2)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	IP address duplication was detected.	Setting error	Check the following settings. • IP address setting of LAN interface in maintenance mode • IP addresses of other devices in the network.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	IP address duplication was detected.	Setting error	Check the following settings. • IP address setting of LAN interface in maintenance mode • IP addresses of other devices in the network.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	The Ethernet function is enabled in the LAN interface 2 is invalid state.	Setting error	Check the following settings. • LAN interface in maintenance mode

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	An error occurred in the Web server task creating process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	An error occurred in the FTP server task creating process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	An error occurred in the FTP client task creating process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
29	An error occurred in the network task generation process.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	An error occurred in the semaphore generation process for access exclusion of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
50	An error occurred in the Web server task management ID getting process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
51	An error occurred in the FTP server task management ID getting process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
59	An error occurred in the DHCP acquisition item setting process of the Ethernet function.(LAN interface 2)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
60	An error occurred in the DHCP initialization process of the Ethernet function.(LAN interface 2)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
61	An error occurred in the DHCP interface of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
62	The data acquisition process from the server did not complete within regulated time.	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
63	The data acquired from the server were found illegal in the DHCP of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
64	An error occurred in the subnet mask acquisition process in the DHCP of the Ethernet function. (LAN interface 2)	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
65	An error occurred in the DNS server address acquisition process in the DHCP of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
66	An error occurred in the Ethernet function DNS domain getting process in the DHCP of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
67	An error occurred in the SNTP server address acquisition process in the DHCP of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
68	An error occurred in the IP address acquisition process in the DHCP of the Ethernet function.(LAN interface 2)	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
69	An error occurred in the DHCP interface structure object mapping process of the Ethernet function.(LAN interface 2)	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
70	An error occurred in the DNS resolver initialization process of the Ethernet function.	Setting error	Check the following settings. • The domain name • The DNS related settings • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
71	An error occurred in the DNS resolver setting of the Ethernet function.	Setting error	Check the following settings. • The domain name • The DNS related settings • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
72	The parameter setting error occurred in the DNS resolver setting of the Ethernet function.	Setting error	Check the following settings. • The domain name • The DNS related settings • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
73	The mode error occurred in the DNS resolver setting of the Ethernet function.	Setting error	Check the following settings. • The domain name • The DNS related settings • The DHCP server operation • The network status

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
80	An error occurred in the basic library initialization process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
81	An error occurred in the initialization process other than basic library of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
100	An error occurred in the IP address acquisition process in the DHCP of the Ethernet function.(LAN interface 2)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
240	An error occurred in the start process of the Ethernet function Telnet (for onboard).	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
241	An error occurred in the start process of the Ethernet function Telnet (for expand).	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
1001	An error occurred in the device initialization process of the Ethernet function.(LAN interface 3)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1006	An error occurred in the MAC address getting process of the Ethernet function.(LAN interface 3)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1010	An error occurred in the stop process of the Gratuitous ARP. (LAN interface 3)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1014	An error occurred in the initializing process of the IP address duplication check setting.(LAN interface 3)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1016	Failed in IP address and subnet mask setting.(LAN interface 3)	Software operation error occurred	Check the following settings. • IP address and subnet mask settings of LAN interface in maintenance mode
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
1059	An error occurred in the DHCP acquisition item setting process of the Ethernet function.(LAN interface 3)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1060	An error occurred in the DHCP initialization process of the Ethernet function.(LAN interface 3)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1064	An error occurred in the subnet mask acquisition process in the DHCP of the Ethernet function. (LAN interface 3)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1068	An error occurred in the IP address acquisition process in the DHCP of the Ethernet function.(LAN interface 3)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1069	An error occurred in the DHCP interface structure object mapping process of the Ethernet function.(LAN interface 3)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1100	An error occurred in the IP address acquisition process in the DHCP of the Ethernet function.(LAN interface 3)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2001	An error occurred in the device initialization process of the Ethernet function.(LAN interface 4)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2006	An error occurred in the MAC address getting process of the Ethernet function.(LAN interface 4)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2010	An error occurred in the stop process of the Gratuitous ARP. (LAN interface 4)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2014	An error occurred in the initializing process of the IP address duplication check setting.(LAN interface 4)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2016	Failed in IP address and subnet mask setting.(LAN interface 4)	Software operation error occurred	Check the following settings. • IP address and subnet mask settings of LAN interface in maintenance mode
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2059	An error occurred in the DHCP acquisition item setting process of the Ethernet function.(LAN interface 4)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2060	An error occurred in the DHCP initialization process of the Ethernet function.(LAN interface 4)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2064	An error occurred in the subnet mask acquisition process in the DHCP of the Ethernet function. (LAN interface 4)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2068	An error occurred in the IP address acquisition process in the DHCP of the Ethernet function.(LAN interface 4)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2069	An error occurred in the DHCP interface structure object mapping process of the Ethernet function.(LAN interface 4)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2100	An error occurred in the IP address acquisition process in the DHCP of the Ethernet function.(LAN interface 4)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3001	An error occurred in the device initialization process of the Ethernet function.(LAN interface 5)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
3006	An error occurred in the MAC address getting process of the Ethernet function.(LAN interface 5)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3010	An error occurred in the stop process of the Gratuitous ARP. (LAN interface 5)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3014	An error occurred in the initializing process of the IP address duplication check setting.(LAN interface 5)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3016	Failed in IP address and subnet mask setting.(LAN interface 5)	Software operation error occurred	Check the following settings. • IP address and subnet mask settings of LAN interface in maintenance mode
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3059	An error occurred in the DHCP acquisition item setting process of the Ethernet function.(LAN interface 5)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3060	An error occurred in the DHCP initialization process of the Ethernet function.(LAN interface 5)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1221: ETHERNET INITIAL PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
3064	An error occurred in the subnet mask acquisition process in the DHCP of the Ethernet function. (LAN interface 5)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3068	An error occurred in the IP address acquisition process in the DHCP of the Ethernet function. (LAN interface 5)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3069	An error occurred in the DHCP interface structure object mapping process of the Ethernet function. (LAN interface 5)	Software operation error occurred	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3100	An error occurred in the IP address acquisition process in the DHCP of the Ethernet function. (LAN interface 5)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1222: IP ADDRESS SET FAIL(DHCP)

The IP address acquired in the DHCP of the Ethernet function is not enabled.

Sub Code	Meaning	Cause	Remedy
	IP address could not be obtained at DHCP.	Setting error	Check the following settings. • The DHCP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1227: ENABLE SW DIAGNOSIS ERROR

In the programming pendant, signal judgment and safety diagnosis of two Enable Switches are carried out. An error occurred during enable switch operation or safety diagnosis.

Sub Code	Meaning	Cause	Remedy
		Programming pendant failure	1. Turn on the main power supply again with the enable switch released. 2. If the alarm occurs again, replace the programming pendant.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1229: SLIO MODULE STATUS ERROR

Status of SLIP modules has been detected. If plural modules have errors, the information which has been detected first will output.

Sub Code	Meaning	Cause	Remedy
	Sub Code: processing code in which the error occurred. 0x000A0000B A:Status • d0:Module was not accessed within the specified time • d1:Settings between configuration and hardware has not been matched. • d2:SliceBus fault has occurred • d3:Module has been removed during operation B:Slot no.(0-F)	Software error	Check the following settings. • IO module setting in maintenance mode.

◆ 1240: SAFETY FIELD BUS SETTING ERROR

An error occurred in parameter which is used in the Safety Fieldbus function.

Sub Code	Meaning	Cause	Remedy
1	Machine Safety doesn't correctly read the value of the processing start wait time.	Data error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the following parameter file in online mode. Initialize the following parameter file in maintenance mode, and then load the parameter file saved in the external memory device. • SD.PRM
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.

1240: SAFETY FIELD BUS SETTING ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1241: SAFETY FIELD BUS SYSTEM ERROR

An error occurred in the Safety Fieldbus function.

Sub Code	Meaning	Cause	Remedy
1	The error was detected by the PROFIsafe stack.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The error was detected by the CIP Safety stack (CH1). Subcode shows the error part of software.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The error was detected by the CIP Safety stack (CH2). Subcode shows the error part of software.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Processing of safety field bus was not completed to the default time.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The error was detected with the status check of safety field bus communication.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	Invalid processing was detected by the safety field bus.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Invalid processing was detected by the safety field bus.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.

1241: SAFETY FIELD BUS SYSTEM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	Virtual communication mode was switched to virtual from safety during the communication of safety field bus.	Software operation error occurred	Set the following item in maintenance mode. - For PROFIsafe, set the virtual communication to "safety" in the CP1616 board setting screen. - For EtherNet/IP Safety, set the virtual communication to "safety" in the EtherNet/IP (CPU board) setting screen. - For DeviceNet Safety, set the virtual communication to "safety" in the DN4 board setting screen.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Robot control module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	The error was detected with the watchdog processing of safety field bus (PROFIsafe).	Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	The error was detected with the communication status check processing of safety field bus (PROFIsafe).	Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
101	The error was detected with the communication status check processing of safety field bus (PROFIsafe).	Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
102	Invalid processing status was detected by the safety field bus (PROFIsafe).	Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	The error was detected with the initializing processing of safety field bus (PROFIsafe).	Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.

1241: SAFETY FIELD BUS SYSTEM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
104	Invalid processing status was detected by the safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	The error was detected with the F_Dest_Add acquisition processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
106	The error was detected with the F-Parameter check processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
107	The error was detected with the Config processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
108	The error was detected with the cyclic execution processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
109	The error was detected with the Output data reception processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
110	The error was detected with the Output data acquisition processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
111	The error was detected with the Input data setting processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.

1241: SAFETY FIELD BUS SYSTEM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
112	The error was detected with the Input data transmission processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
113	The error was detected with the cyclic stop processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
114	The error was detected with the F-Parameter acquisition processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
115	The error was detected with the cyclic execution processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
116	The error was detected with the diagnostic information acquisition processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
117	The error was detected with the alarm processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
200	The error was detected with the config processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
201	The error was detected with the output data acquisition processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.

1241: SAFETY FIELD BUS SYSTEM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
202	The error was detected with the F-Parameter acquisition processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
203	The error was detected with the diagnostic information acquisition processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
204	The error was detected with the alarm processing of safety field bus (PROFIsafe).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3000000	The error was detected by the PROFIsafe stack. Subcode shows the error part of software.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1248: IOSPDCTRL SET ERROR

IOSPDCTRL setting is abnormal.

Sub Code	Meaning	Cause	Remedy
	Nine or more IOSPDCTRL are set. Sub code: The setting number of IOSPDCTRL	Setting error	Modify the setting number of IOSPDCTRL to less than 9 in maintenance mode. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1300: SERVO CPU SYNCHRONIZING ERROR

An error occurred in the number of executions of real-time processing in the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1301: COMMUNICATION ERROR(SERVO)

An error occurred in data transfer between the motion and servo processing in the robot control module.

Sub Code	Meaning	Cause	Remedy
0	Communication status error	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1	Watchdog timer error	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Communication status error	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1303: ARITHMETIC ERROR(SERVO)

An error occurred in control arithmetic process or parameter arithmetic process in Robot control module (Servo processing).

This alarm occurs when the control parameters calculated from the robot dynamics model or the input parameters (tool file) are not within the specified range.

Sub Code	Meaning	Cause	Remedy
	The subcode represents the following for each digit. The data [X____] indicates the generation process. 10000: Observer control 20000: High-precision path control 30000: Dynamics 40000: Disturbance observer control 500000 : New Disturbance observer control The data [_YYY_] indicates the additional information for each occurring process. The data [____Z] indicates the physical axis number.	Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1307: ENCODER TYPE MISMATCH

When the controller power turned ON, the YNX1000 system checks the encoder type of the manipulator. This alarm occurs if there is a difference between the set value and the mounted encoder.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	Check the following settings. • Check the encoder type before and after the replacement. • When the external axis is mounted, check if there is no difference between the encoder selected at configuration and the encoder that is actually mounted.
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1311: A/D DETECTION ERROR(CONVERTER)

Converter A/D detection is incorrect.

Servo amplifier alarm A.b39

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the converter in which the alarm occurred	Module failure(converter)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the converter.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1313: SERVO AMPLIFIER COMMAND ERROR

An error occurred in communication between the robot control module and the servo amplifier.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1314: SERVO AMPLIFIER PRM VERIFY ERROR

An error occurred in the servo amplifier parameter data check.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1316: SERVO AMPLIFIER COMM WDT ERROR

Communication error occurred between the Robot control module (Servo processing) and the Servo Amplifier.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1317: SERVO AMPLIFIER COMMAND TIMEOUT

Communication error occurred between the Robot control module (Servo processing) and the Servo Amplifier.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1318: SERVO AMPLIFIER CANNOT EXEC CMD

Communication error occurred between the Robot control module (Servo processing) and the Servo Amplifier.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1325: COMMUNICATION ERROR(ENCODER)

The servo amplifier performs serial communications between controller and encoder. This alarm occurs if the system fails to establish the communications.

Servo amplifier alarm A.C90

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1326: DEFECTIVE ENCODER ABSOLUTE DATA

When the controller power turned ON, the servo amplifier checks the encoder data. This alarm occurs if there is an error in the encoder data.

Servo amplifier alarm A.840

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1327: ENCODER OVER SPEED

When the controller power turned ON, the servo amplifier checks the encoder data. This alarm occurs if any axis moves (i.e. falls by its own weight), or an encoder rotation speed of 400 rpm or more is detected during the power-ON process.

Servo amplifier alarm A.850

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(encoder)	1. Check the power is turned on while the encoder is stopped. 2. If the alarm occurs again, replace the encoder.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1328: DEFECTIVE ENCODER

The servo amplifier performs serial communications between controller and encoder. This alarm occurs if there is an error in the internal data of the encoder.

Servo amplifier alarm A.820

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1329: DEFECTIVE ENCODER COMMAND

The YNX1000 system performs serial communications between controller and encoder. This alarm occurs if the operation in response to the encoder command is a malfunction.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F - Single-axis servo amplifier -CN2 - Robot control module -CN3 - Multi-axis servo amplifier -CN6A,CN6B - Single-axis servo amplifier -CN6A,CN6B
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.

1329: DEFECTIVE ENCODER COMMAND (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1349: POWER LOST DETECTION

The Robot control module has detected a power lost.

Sub Code	Meaning	Cause	Remedy
		primary power supply failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check if the primary power supply voltage is dropping or missing phases.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1355: ENCODER MULTITURN LIMIT ERR

When the controller power turned ON, the YNX1000 system checks the encoder multi-turn quantity. This alarm occurs if the multi-turn quantity data is not within the normal range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Module failure(servo amplifier)	1. Run servo amplifier PRM_INIT function. 2. Run servo amplifierMUL_LIMIT function. 3. If the alarm occurs again, replace the servo amplifier.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1367: OVERVOLTAGE(CONVERTER)

The DC voltage supplied to the Servo Amplifier exceeded stipulated voltage. This alarm occurs if the regenerative energy during the motor deceleration is too much that it cannot be processed in the regenerative circuit of Servo Amplifier.

Servo amplifier alarm A.400

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the physical No. of converter in which the alarm occurred	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Software setting failure	Check the load mounted on the manipulator.
		Voltage failure	Modify the primary breaker voltage to the voltage specified for the power supply on the rated label on the door of the controller.
		Regenerative resistor failure	1. Disconnect the Multi-axis servo amplifier -CN116 to check if there is no cable disconnection. 2. If disconnected, replace the regenerative resistor.
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1368: REGENERATIVE TROUBLE(CONVERTER)

This alarm occurs if the converter regenerative resistor cable is disconnected or short-circuited.

The regenerative energy at motor deceleration exceeded the allowable limit.

The regenerative energy at motor deceleration is too large.

The primary power supply voltage is too high.

Servo amplifier alarm A.300

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B,CN116 • Single-axis servo amplifier -CN6A,CN6B,B1,B2
		Regenerative resistor failure	Replace the regenerative resistor.
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Overloading	Check that the load does not exceed the allowable limit.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1372: PARAMETER ERROR (CONVERTER)

Parameter error occurred in converter.

Servo amplifier alarm A.04b

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1374: ENCODER MIXED ALLOCATION ERROR

Encoder-axis allocation is mismatched.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the parameter setting value.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1376: ENCODER SET AXES NUMBER OVER

Encoder-axis allocation is mismatched.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the parameter setting value.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1377: ENCODER CABLE DISCONNECTION(SV)

Communication between the controller and encoder is not possible when the control power is turned on, and address setting cannot be performed for the multi-drop encoder.

This alarm occurs only when the control power is turned on.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder. 3. If the alarm recurs after taking the measures described in 2. above, replace the encoder one position before the axis where the alarm occurred.
		Servo Amplifier failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo ample.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1388: SERVO OFF EXECUTION INCOMPLETE

Servo OFF processing has been executed, but the servo amplifier status is not in Servo OFF state.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.

1388: SERVO OFF EXECUTION INCOMPLETE (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1389: SERVO AMPLIFIER POSITION DATA ERROR

The alarm occurs when the servo amplifier cannot create the current position.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the motor.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1393: SERVO AMPLIFIER COMM ERROR

An error has occurred in communication between the Robot control module and the servo amplifier.
(Communication profile status error)

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 • Cable between encoders.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1395: MOTOR TYPE MISMATCH

The motor type is recorded in the encoder. This alarm occurs if there is a mismatch with the motor type used by the robot controller.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1398: SERVO AMPLIFIER SETUP ERROR

Servo amplifier setup processing time exceeded the allowable time when the robot controller control power is turned on.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 • Cable between encoders.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1400: ENCODER ERROR(CONVEYOR)

The encoder is abnormal.

Sub Code	Meaning	Cause	Remedy
1	Conveyor encoder 1 is abnormal.	Connection failure, Module failure(encoder)	Replace the cable of the conveyor encoder 1 or encoder.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Conveyor encoder 2 is abnormal.	Connection failure, Module failure(encoder)	Replace the cable of the conveyor encoder 2 or encoder.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Conveyor encoder 3 is abnormal.	Connection failure, Module failure(encoder)	Replace the cable of the conveyor encoder 3 or encoder.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1401: CANNOT CHANGE CONVEYOR MODE

The encoder mode "Encoder / Virtual encoder" was switched by the general input while performing conveyor synchronized function.

Sub Code	Meaning	Cause	Remedy
		Input error	Do not switch "Encoder / Virtual encoder" with the general signal while performing the conveyor synchronized function.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1402: WORK IN/NOT DATA CNT. LMT. OVER

An arithmetic error occurred for the current position pulse of Work IN/NOT Shift Data.

Sub Code	Meaning	Cause	Remedy
		Work status error	Check the work in/not shift data and actual the work status within the shift area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1403: WORK IN/NOT SHIFT DATA POS LMT.

An arithmetic error occurred for the current travel length of Work IN/NOT Shift Data.

Sub Code	Meaning	Cause	Remedy
		Work status error	Check the work in/not shift data and actual the work status within the shift area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1404: WORK ID. DATA CNT. LMT. OVER

An arithmetic error occurred for the current position pulse of Work ID Shift Data.

Sub Code	Meaning	Cause	Remedy
		Work status error	Check the work in/not shift data and actual the work status within the shift area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1405: WORK ID. SHIFT DATA POS LMT.

An arithmetic error occurred for the current travel length of Work ID Shift Data.

Sub Code	Meaning	Cause	Remedy
		Work status error	Check the work in/not shift data and actual the work status within the shift area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1406: START SHIFT DATA CNT. LMT. OVER

An arithmetic error occurred for the current position pulse of Start Shift Data.

Sub Code	Meaning	Cause	Remedy
		Work status error	Check the start shift data and actual the work status within the shift area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1407: START SHIFT DATA POS LMT.

An arithmetic error occurred for the current travel length of Start Shift Data.

Sub Code	Meaning	Cause	Remedy
		Work status error	Check the start shift data and actual the work status within the shift area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1437: PORT OPEN ERROR

Failed to open the communication port.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1547: CURRENT FEEDBACK ERROR

This alarm occurs if an excessive current is applied for motor.

Servo amplifier alarm A.102

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Ground fault	Check if a ground fault has not occurred in the U-, V-, and W-phase of motor power line, or short circuit has not occurred between these phases.
		Setting error	1. Check the load mounted on the manipulator. 2. Check the JOB. • Reduce the speed in the step where the alarm occurred. • Adjust the acceleration/deceleration by ACC and DEC for the teaching position. • Change the move instruction to joint interpolation (MOVJ). 3. Turn the power OFF then back ON. * Be careful to the peripheral interference since its movement changes.
		Module failure(amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the amplifier.
		Servo motor failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo motor.
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1606: TORQUE SENSOR CABLE DISCONNECTION(SV)

Communication between the controller and lotus is not possible when the control power is turned on, and address setting cannot be performed for the multi-drop lotus.

This alarm occurs only when the control power is turned on.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders and lotus
		Module failure(LOTUS)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the LOTUS. 3. If the alarm recurs after taking the measures described in 2. above, replace the lotus one position before the axis where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1607: DEFECTIVE TORQUE SENSOR COMMAND

The command to do setting initial for lotus failed when the control power is turned on.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders and lotus
		Module failure(LOTUS)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the LOTUS. 3. If the alarm recurs after taking the measures described in 2. above, replace the lotus one position before the axis where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1608: TORQUE SENSOR CONNECTION ERR

The connection order of the torque sensor is abnormal.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	check the connector order of the cables connected to the torque sensor.

◆ 1610: F-SAFE CPU SYNCHRO ERROR

The CPU timer and the communication interruption timing are checked by the function safety board when performing the serial communication between robot control module and robot safety module. This alarm occurs if the timing becomes off.

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN515 • Robot control module and robot safety module - CNBX
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1612: F-SAFE COMMUNICATION ERROR

The CPU timer and the communication interruption timing are checked by the function safety board when performing the serial communication between robot control module and robot safety module. This alarm occurs if the timing becomes off.

Sub Code	Meaning	Cause	Remedy
0	Communication status error	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN515 • Robot control module and robot safety module - CNBX
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
1	Watchdog timer error	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN515 • Robot control module and robot safety module - CNBX

1612: F-SAFE COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	JL0101 alarm	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN515 • Robot control module and robot safety module - CNBX
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Communication status error	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN515 • Robot control module and robot safety module - CNBX
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	Data consistency error	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN515 • Robot control module and robot safety module - CNBX
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	CRC error	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN515 • Robot control module and robot safety module - CNBX

1612: F-SAFE COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	CRC error	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
7	CRC error	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1613: F-SAFE ENCODER COMM. ERR 1

Communication error occurred between the encoder and the robot safety module.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders [External axis] • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.

1613: F-SAFE ENCODER COMM. ERR 1 (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1614: F-SAFE ENCODER COMM. ERR 2

Communication error occurred between the encoder for all axes on the robot safety module.

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders [External axis] • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1615: F-SAFE SYSTEM ERROR

System error occurred in the robot safety module.

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, confirm the following connector's connection and insertion. [Robot axis] • Cable between encoders [External axis] • Cable between encoders
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1616: F-SAFE SYSTEM ERROR 1

System error occurred in the robot safety module.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1618: F-SAFE ARITHMETIC ERROR

Arithmetic error occurred in the robot safety module.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1619: F-SAFE PARAMETER ERROR

Parameter setting value error occurred in the robot safety module.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1622: F-SAFE DEFECTIVE ENCODER

The robot safety module has detected a malfunction of the encoder diagnostic data.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders [External axis] • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.

1622: F-SAFE DEFECTIVE ENCODER (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1623: F-SAFE ENCODER CORR. NUM OVER

The robot safety module monitors position information sent from the encoder. If communication error occurs during a control cycle, it monitors based on the last position data. At that time, if the correction data exceeds the specified value, the alarm occurs.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders [External axis] • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1630: F-SAFE MUTUAL DIAG. ERR(WDT)

The robot safety module is configured by duplicated systems to check operations each other. Either of the duplicated systems operates abnormally, watchdog check failed.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1631: F-SAFE MUTUAL DIAG. ERR(HW SET)

The robot safety module is configured by duplicated systems to check operations each other. Either of the duplicated systems has detected hardware setting error of the other system.

Sub Code	Meaning	Cause	Remedy
		Setting error	Confirm that the rotary switch on the robot safety module[#1-8] is set to [0-7].
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1632: F-SAFE MUTUAL DIAG. ERR(MONITOR)

The robot safety module is configured by duplicated systems to check operations each other. A safety monitoring error occurred in either of the duplicated systems.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1635: F-SAFE LOW VOLTAGE

The robot safety module is configured by duplicated systems to check operations each other. Either of the duplicated systems has detected abnormal voltage of the other system.

Sub Code	Meaning	Cause	Remedy
1	Low voltage error detected in the 1.0V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Low voltage error detected in the 1.5V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Low voltage error detected in the 1.8V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1635: F-SAFE LOW VOLTAGE (continued)

Sub Code	Meaning	Cause	Remedy
4	Low voltage error detected in the 3.3V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	Low voltage error detected in the 5.0V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	Low voltage error detected in the 24.0V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1636: F-SAFE OVER VOLTAGE

The robot safety module is configured by duplicated systems to check operations each other. Either of the duplicated systems has detected abnormal voltage of the other system.

Sub Code	Meaning	Cause	Remedy
1	Over voltage error detected in the 1.0V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Over voltage error detected in the 1.5V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Over voltage error detected in the 1.8V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	Over voltage error detected in the 3.3V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

1636: F-SAFE OVER VOLTAGE (continued)

Sub Code	Meaning	Cause	Remedy
5	Over voltage error detected in the 5.0V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	Over voltage error detected in the 24.0V supply line.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1637: F-SAFE RAM DIAGNOSIS ERROR

The robot safety module has detected RAM diagnosis error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1638: F-SAFE ROM DIAGNOSIS ERROR

The robot safety module has detected ROM diagnosis error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1639: F-SAFE RAM AREA CONVERSION ERR

The robot safety module has detected processing error of mirror area used for RAM diagnosis.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1640: F-SAFE REAL TIME MONITOR ERROR

The robot safety module has detected processing error of real time monitor.

Sub Code	Meaning	Cause	Remedy
1	Failed in the realtime monitor	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Failed to initialize realtime monitor	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Failed to initialize realtime monitor	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	Process in the realtime monitor (RTP) error occurred	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	Process in the realtime monitor (NRTP) error occurred	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
7	Process in the realtime monitor (NRTP) error occurred	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1642: F-SAFE WATCHDOG SIGNAL ERROR

The robot safety module has detected watchdog signal error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1643: F-SAFE SAFETY SIGNAL SET ERROR

Safety signal configuration data of safety monitoring conditions file is abnormal.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Code [X _ _ _] indicates the abnormal content. 1000:Input/output signal number in conditionfile is abnormal. 2000:Functional safety general input signal that is not available is set in condition file. 3000:Functional safety general output signal that is not available is set in condition file. 4000:Safety fieldbus input signal that is not available is set in condition file. 5000:Safety fieldbus output signal that is not available is set in condition file. 6000:File valid condition data is abnormal. Code [_ Y _ _] indicates the type of condition file abnormality occurs. 100:Axis range limit function 200:Axis speed monitor function 300:Speed limit function 400:Robot range limit function 500:Tool angle monitor function 600:Tool change monitor function Code [_ _ Z Z] indicates the number of condition file abnormality occurs.	Data error	If the alarm occurs again, check the configuration of condition file abnormality occurs.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1646: F-SAFE COMM.SETTING ERROR

The rotary switch setting on the robot safety module has an error.

Sub Code	Meaning	Cause	Remedy
	Sub Code: The rotary switch number recorded in the robot safety module is shown.	Setting error	1. Select the following menu. • [File]-[Initialize],[Safety Board FLASH Reset] in maintenance mode. 2. Turn the power OFF then back ON.
		Setting error	Confirm that the rotary switch on the robot safety module[#1-8] is set to [0-7].

1646: F-SAFE COMM.SETTING ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1650: FILE TRANSFER DATA ERROR (SV)

An error occurred in the file transfer sequence at execution of file transfer command to the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
1	The previous file transfer process has not been completed when the first data of the file transfer command is received.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The first data is not received when the intermediate data of the file transfer command is received.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	The first data has not been received when the final data of the file transfer command was received.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1651: FILE TRANSFER DATA SIZE ERR (SV)

File transfer data size is abnormal when executing a file transfer command to the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
1	The overall file size received by the file transfer command is calculated, it does not match the expected received data size.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	The overall file size received by the file transfer command exceeds the buffer size.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1657: AXIS ENDLESS SPECIFIC. ERR(SV)

An unusable function was executed for the axis which the deceleration stop alarm function was enabled.

Sub Code	Meaning	Cause	Remedy
1	The home position detecting function was used for the axis for which the axis endless function was enabled. The home position detecting function cannot be used for the axis which the axis endless function was enabled.	Software setting failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The servo float function was used for the axis for which the axis endless function was enabled. The servo float function cannot be used for the axis which the axis endless function was enabled.	Software setting failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1658: REDUCTION STOP SPECIFIC. ERR(SV)

An unusable function was executed for the axis for which the deceleration stop alarm function was enabled.

Sub Code	Meaning	Cause	Remedy
1	The servo float function was used for the axis for which the deceleration stop function was enabled. The servo float function cannot be used for the axis which the deceleration stop function was enabled.	Software setting failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The specified axis speed control function was executed for the axis which the deceleration stop function was enabled. Specified axis speed control function cannot be used for the axis which the deceleration stop function was enabled.	Software setting failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1666: FILE RECEIVE INCOMPLETE (SERVO)

An attempt was made to execute a function which use the file, the transfer file was not successfully completed.

Sub Code	Meaning	Cause	Remedy
	Subcode means error cause.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1667: RESOLUTION CONVERSE CONST ERR(SV)

A logical error occurred in the parameter for modification of resolution which was calculated by the parameter specified by CMOS.BIN.

Sub Code	Meaning	Cause	Remedy
		Software setting failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1672: GRP CHANGE PG POWER ON ERR (SV)

Group change processing was attempted for an axis for which the encoder power supply is already on.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Check the JOB. 2. Turn the power OFF then back ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1673: GRP CHANGE SERVO ON ERROR (SV)

Group change processing was attempted for an axis that is in servo on.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Check the JOB. 2. Turn the power OFF then back ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1674: ARM CONTROL SEQUENCE ERR (SV)

An error occurred in the motor control mode switching process.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1678: MOTOR CMD POSITION ERROR (SV)

The motor command position is incorrect.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1684: INSTANT POWER FAILURE(TRQ)(SV)

The instant power failure occurred and then the torque was saturated.

Sub Code	Meaning	Cause	Remedy
	The instant power failure occurred and then the torque was saturated.	Voltage failure	1. Check if the primary power supply voltage is dropping. 2. Turn the power OFF then back ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1685: INSTANT POWER FAILURE(TIME)(SV)

The instant power failure occurred for longer than the certain time period.

Sub Code	Meaning	Cause	Remedy
	The instant power failure occurred for longer than the certain time period.	Voltage failure	1. Check if the primary power supply voltage is dropping. 2. Turn the power OFF then back ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1688: MEMORY DATA FILE STORAGE ERROR

The model file is not saved normally.

Sub Code	Meaning	Cause	Remedy
1	Storage file number is inconsistent	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Start index is inconsistent	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1690: PCI BOARD NOT DETECTED

AD board connection error

Sub Code	Meaning	Cause	Remedy
		AD board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1691: FORCE SENSOR BOARD UNMOUNTED

Force sensor board is not mounted.

Sub Code	Meaning	Cause	Remedy
	Force sensor board could not be found	Force sensor board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1696: F-SAFE ENCODER DIAG.ERROR

The robot safety module has detected the encoder diagnosis error.

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders [External axis] • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Setting error	Check the parameter setting value.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1700: PARAMETER CHECKSUM ERROR

Internal parameter data of the servo amplifier is abnormal.

Servo amplifier alarm A.020

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1701: PARAMETER FORMAT ERROR

Internal parameter data of the servo amplifier is abnormal.

Servo amplifier alarm A.021

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1702: SYSTEM CHECKSUM ERROR

Internal parameter data of the servo amplifier is abnormal.

Servo amplifier alarm A.022

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1703: SYSTEM ALARM

Internal program error has occurred in the servo amplifier.

Servo amplifier alarm A.024, A.025

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1705: PARAMETER SETTING ERROR

The set parameter exceeds the data setting range of the internal parameter of the servo amplifier.

Servo amplifier alarm A.040

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Hardware combination error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the combination of the servo amplifier and servo motor capacity. 3. Change to the appropriate configuration.
		Servo Amplifier setting error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the setting range of the changed parameter of the servo amplifier. 3. Change to the appropriate setting value.
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN and replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1706: PARAMETER COMBINATION ERROR

The combination data of several internal parameters of the servo amplifier is abnormal.

Servo amplifier alarm A.042

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN and replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1707: SIGMALINK II COMMAND/ RESPONSE PARAMETER SETTING ERROR

This alarm occurs if the settings of SigmaLINK II command & response are different

Servo amplifier alarmA.046

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo amplifier setting error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, run servo amplifier PRM_INIT function.

◆ 1708: PARAMETER SETTING ERROR 2

There is an error in the bank members, bank data.

Servo amplifier alarmA.04A

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1709: UNSUPPORTED DEVICE ALARM

A device not supported by the servo amplifier was connected.

Servo amplifier alarmA.051

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Hardware combination error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check that an unsupported serial conversion unit or encoder (e.g., an external encoder) is connected to the servo amplifier.
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1710: MOTOR TYPE CHANGE DETECTED

This alarm occurs if the motor of a different type (rotary or linear) is connected to the previously connected motor.
Servo amplifier alarm A.070

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo amplifier setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, run servo amplifier PRM_INIT function.

◆ 1711: OVERCURRENT DETECTED

An overcurrent flowed through the power transistor or the heatsink overheated.
Servo amplifier alarm A.100

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F • Single-axis servo amplifier -U, V, W, B1/+, B2
		Short circuit or ground fault of cable	1. Reset the alarm. 2. If the alarm occurs again, check if a ground fault has not occurred in the U-, V-, and W-phase of motor power line, or short circuit has not occurred between these phases. 3. If there is a problem, replace cable. • Internal cables (Robot axis, external axis) (Power wire) • Power supply cable (Robot axis, external axis) (Power wire)
		Short circuit or ground fault inside servo motor	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check if a ground fault has not occurred in the U-, V-, and W-phase of motor power line, or short circuit has not occurred between these phases at the motor terminals. 3. If there is a problem, replace the servo motor.
		Short circuit or ground fault inside servo amplifier	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check if a ground fault has not occurred in the U-, V-, and W-phase of motor power line, or short circuit has not occurred between these phases at the servo amplifier terminals. 3. If there is a problem, replace the servo amplifier.
		Frequent use of dynamic brake(DB)	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check to see if AL6204 DYNAMIC BRAKE OVERLOAD has occurred. 3. If AL6204 is occurring, check the servo amplifier model, operating methods, or the mechanisms so that the dynamic brake does not need to be used so frequently.

1711: OVERCURRENT DETECTED (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN and replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1712: MOTOR OVERCURRENT DETECTED

The current to the motor exceeded the allowable current.

Servo amplifier alarm A.101

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F • Single-axis servo amplifier -U, V, W
		Short circuit or ground fault of cable	1. Reset the alarm. 2. If the alarm occurs again, check if a ground fault has not occurred in the U-, V-, and W-phase of motor power line, or short circuit has not occurred between these phases. 3. If there is a problem, replace cable. • Internal cables (Robot axis, external axis) (Power wire) • Power supply cable (Robot axis, external axis) (Power wire)
		Short circuit or ground fault inside servo motor	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check if a ground fault has not occurred in the U-, V-, and W-phase of motor power line, or short circuit has not occurred between these phases at the motor terminals. 3. If there is a problem, replace the servo motor.
		Short circuit or ground fault inside servo amplifier	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check if a ground fault has not occurred in the U-, V-, and W-phase of motor power line, or short circuit has not occurred between these phases at the servo amplifier terminals. 3. If there is a problem, replace the servo amplifier.

1712: MOTOR OVERCURRENT DETECTED (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN and replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1713: INTERNAL TEMPERATURE SENSOR ERROR

An error occurred in the temperature sensor circuit of servo amplifier.

Servo amplifier alarm A.7A3

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1714: REFERENCE VOLTAGE ERROR 2

The reference voltage (3.3 V) of the servo amplifier is abnormal.

Servo amplifier alarm A.bdC

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1715: MECHATROLINK INITIALIZATION TIMEOUT ERROR 1

Communications initialization failed between the servo control module and the MECHATROLINK communications module.

Servo amplifier alarm A.E00

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1716: SEMI-CLOSED/FULLY-CLOSED LOOP CONTROL PARAMETER SETTING ERROR

This alarm occurs if the settings of SEMI-CLOSED/FULLY-CLOSED LOOP CONTROL are different.

Servo amplifier alarm A.044

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the parameter setting value.
		Servo amplifier setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, run servo amplifier PRM_INIT function.
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F [External axis] • Cable between encoders • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.

◆ 1718: CURRENT DETECTION ERROR 3

An error occurred in the current detection circuit of servo amplifier.

Servo amplifier alarm A.b33

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1719: MECHATROLINK COMMUNICATIONS ASIC ERROR 1

MECHATROLINK communication ASIC error occurred in the servo amplifier.

Servo amplifier alarm A.b6A

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1720: MECHATROLINK COMMUNICATIONS ASIC ERROR 2

MECHATROLINK communication ASIC error occurred in the servo amplifier.

Servo amplifier alarm A.b6b

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1721: FIRMWARE ERROR

A servo amplifier firmware error has occurred.

Servo amplifier alarm A.bE2

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1722: SYSTEM ALARM 0

Internal program error 0 of the servo amplifier occurred.

Servo amplifier alarm A.bF0

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1723: SYSTEM ALARM 1

Internal program error 1 of the servo amplifier occurred.

Servo amplifier alarm A.bF1

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1724: SYSTEM ALARM 2

Internal program error 2 of the servo amplifier occurred.

Servo amplifier alarm A.bF2

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1725: SYSTEM ALARM 3

Internal program error 3 of the servo amplifier occurred.

Servo amplifier alarm A.bF3

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1726: SYSTEM ALARM 4

Internal program error 4 of the servo amplifier occurred.

Servo amplifier alarm A.bF4

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1727: SYSTEM ALARM 5

Internal program error 5 of the servo amplifier occurred.

Servo amplifier alarm A.bF5

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1728: SYSTEM ALARM 6

Internal program error 6 of the servo amplifier occurred.

Servo amplifier alarm A.bF6

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1729: SYSTEM ALARM 7

Internal program error 7 of the servo amplifier occurred.

Servo amplifier alarm A.bF7

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1730: SYSTEM ALARM 8

Internal program error 8 of the servo amplifier occurred.

Servo amplifier alarm A.bF8

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1731: SYSTEM ALARM D

Internal program error D of the servo amplifier occurred.

Servo amplifier alarm A.bFd

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1732: ENCODER CLEAR ERROR OR MULTITURN LIMIT SETING ERROR

The servo amplifier and encoder each create multiturn limit data. This alarm occurs if this data setting fails.

Servo amplifier alarm A.C80

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. Run servo amplifierMUL_LIMIT function. 3. Run servo amplifierMUL_CLR function. 4. If the alarm occurs again, replace the servo amplifier.

◆ 1733: ENCODER COMMUNICATIONS POSITION DATA ACCELERATION RATE ERROR

This alarm occurs if the calculation of encoder position data is abnormal.

Servo amplifier alarm A.C91

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F [External axis] • Cable between encoders • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.

◆ 1734: ENCODER COMMUNICATIONS TIMER ERROR

An error occurred in the communications timer between the encoder and servo amplifier.

Servo amplifier alarm A.C92

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Effects of noise	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the following • Provide noise suppression for encoder wiring.
		Encoder failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo motor.
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1735: ENCODER PARAMETER ERROR

This alarm occurs if the encoder parameter data is corrupted.

Servo amplifier alarm A.CA0

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the parameter setting value.
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.

◆ 1736: ENCODER ECHOBACK ERROR

Communication data between the servo amplifier and encoder is incorrect.

Servo amplifier alarm A.Cb0

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F - Single-axis servo amplifier -CN2 - Cable between encoders.
		Encoder failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo motor.
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1737: MULTITURN LIMIT DISAGREEMENT

The servo amplifier and encoder each create multiturn limit data. This alarm occurs if this data does not match.

Servo amplifier alarm A.CC0

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo amplifier setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, Run servo amplifierPRM_INIT function. 3. If the alarm occurs again, Run servo amplifierMUL_LIMIT function.

◆ 1738: SIGMALINK II NODE CONFIGURATION ERROR

This alarm occurs if the servo amplifier detects a configuration in which communication cannot be established.
Servo amplifier alarm A.Cd1

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred. This alarm occurs on all axes with C1 master.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F [External axis] • Cable between encoders • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.

◆ 1739: SIGMALINK II POWER SUPPLY SHORT-CIRCUIT DETECTED

This alarm occurs if there is error occurs in the power supply (5V) connected to SigmaLINK II.
Servo amplifier alarm A.Cd2

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred. This alarm occurs on all axes with C1 master.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the motor.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1740: SIGMALINK II CONFIGURATION DATA CHECKSUM ERROR

The servo amplifier saves the SigmaLINK II connection configuration. This alarm occurs if an error occurs in the saved data.

Servo amplifier alarm A.Cd3

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred. This alarm occurs on all axes with C1 master.	Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1741: SIGMALINK II NODE CHANGE DETECTED

The servo amplifier saves the SigmaLINK II connection configuration. This alarm occurs if the saved contents and the actual state are different.

Servo amplifier alarm A.Cd4

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred. This alarm occurs on all axes with C1 master.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F [External axis] • Cable between encoders • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.

◆ 1742: SIGMALINK II I/O DEVICE COMMUNICATION ERROR

This alarm occurs if an error occurs in communication between the servo amplifier and SigmaLINK II I/O device.

Servo amplifier alarm A.Cd7

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred. This alarm occurs on all axes with C1 master.	Servo amplifier setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, run servo amplifier PRM_INIT function.

◆ 1743: SIGMALINK II I/O DEVICE STATUS ERROR

This alarm occurs if the SigmaLINK II I/O device detects an error.

Servo amplifier alarm A.Cd8

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred. This alarm occurs on all axes with C1 master.	Servo amplifier setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, run servo amplifier PRM_INIT function.

◆ 1744: CONVETER TEMPERATURE SENSOR ERROR

An error occurred in the temperature sensor circuit of converter of servo amplifier.

Servo amplifier alarm A.7bb

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1745: REFERENCE VOLTAGE ERROR 3

The power supply voltage(24V) for IO drive of servo amplifier is abnormal.

Servo amplifier alarm A.bdE

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1746: DC POWER SUPPLY ERROR 1

Servo amplifier brake power supply (26V) overvoltage has occurred.

Servo amplifier alarm A.bd7

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Power supply failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the power supply system.

◆ 1747: DC POWER SUPPLY ERROR 2

Servo amplifier brake power supply (26V) undervoltage has occurred.

Servo amplifier alarm A.bd8

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Power supply failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the power supply system.

◆ 1748: DC POWER SUPPLY ERROR 3

Servo amplifier brake power supply (12V) undervoltage has occurred.

Servo amplifier alarm A.bd8

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Power supply failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the power supply system.

◆ 1749: REFERENCE VOLTAGE ERROR 4

The power supply (24V2) for supplying the servo amplifier FAN and the safe brake control board is abnormal.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1750: SIGMALINK II POWER SUPPLY SHORT-CIRCUIT DETECTED 2

An error has occurred in the power supply (24V) system of the SigmaLINK II connection of the Multi-axis servo amplifier.

Servo amplifier alarm A.Cdf

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F
		Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the following • Cable between encoders.

1750: SIGMALINK II POWER SUPPLY SHORT-CIRCUIT DETECTED 2 (continued)

Sub Code	Meaning	Cause	Remedy
		Encoder failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo motor.
		Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1751: MECHATROLINK INITIALIZATION TIMEOUT ERROR 2

Communications initialization failed between the servo control module and the MECHATROLINK communications module.

Servo amplifier alarm A.EA0

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1752: CONVERTER PARAMETER CHECKSUM ERROR

Converter internal parameter data of the Multi-axis servo amplifier is abnormal.

Servo amplifier alarm A.02C

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1753: CONVERTER PARAMETER FORMAT ERROR

Converter internal parameter data of the Multi-axis servo amplifier is abnormal.

Servo amplifier alarm A.02d

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1754: CONVERTER SYSTEM CHECKSUM ERROR

Converter internal parameter data of the Multi-axis servo amplifier is abnormal.

Servo amplifier alarm A.02E

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1755: CONVERTER SYSTEM ERROR 1

Converter internal program error 1 has occurred in the Multi-axis servo amplifier.

Servo amplifier alarm A.bEA

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1756: CONVERTER SYSTEM ERROR 2

Converter internal program error 1 has occurred in the Multi-axis servo amplifier.

Servo amplifier alarm A.bEb

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1757: CONVERTER SYSTEM ERROR 4

Converter internal program error 1 has occurred in the Multi-axis servo amplifier.

Servo amplifier alarm A.bEd

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1758: CONVERTER SYSTEM ERROR 6

Converter internal program error 1 has occurred in the Multi-axis servo amplifier.

Servo amplifier alarm A.bEF

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1759: SAFETY FUNCTION SIGNAL INPUT TIMING ERROR

The input signal(/HWBB1, /HWBB2) of the hardwire base block function was mismatched for more than the specified time.

Servo amplifier alarm A.Eb1

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN8 • Single-axis servo amplifier -CN8

◆ 1760: GATE DRIVE ERROR 1

An error occurred in the gate drive circuit of servo amplifier.

Servo amplifier alarm A.EC8

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1761: GATE DRIVE ERROR 2

An error occurred in the gate drive circuit of servo amplifier.

Servo amplifier alarm A.EC9

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1762: SAFETY ENCODER CONNECTED NUM ERR

There is too much number of safety sensors.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	Check the following settings • Check the encoder and lotus before and after the replacement..
		Servo Amplifier failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1843: M-SAF EX I/O BOARD CONN ERROR

The connection error occurred between the robot safety module and the extention safety I/O unit.

Sub Code	Meaning	Cause	Remedy
1	The connection error occurred between the robot safety module (CN1A) and the extention safety I/O unit.	Setting error	Check the following settings. • Rotary switch settings for the extension safety I/O unit connected to the robot safety module (CN1A)
		Connection failure	Check the connection and insertion of the following boards. • Robot safety module • Extention safety I/O unit
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The connection error occurred between the robot safety module (CN1B) and the extention safety I/O unit.	Setting error	Check the following settings. • Rotary switch settings for the extension safety I/O unit connected to the robot safety module (CN1B)
		Connection failure	Check the connection and insertion of the following boards. • Robot safety module • Extention safety I/O unit
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The connection error occurred between the robot safety module (CN1A, CN1B) and the extention safety I/O unit.	Setting error	Check the following settings. • Rotary switch settings for the extension safety I/O unit connected to the robot safety module (CN1A, CN1B)
		Connection failure	Check the connection and insertion of the following boards. • Robot safety module • Extention safety I/O unit
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1860: M-SAFETY COMMUNICATE ERROR

The communication error occurred between the robot control module and the robot safety module.

Sub Code	Meaning	Cause	Remedy
0	There was no response from robot safety module within the time limit.	Connection failure	Check the connection and insertion of the following boards. • Robot control module • AIF01 board • Robot safety module
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD card that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The reset of Machine-Safety alarm was not properly completed.	Connection failure	Check the connection and insertion of the following boards. • Robot control module • AIF01 board • Robot safety module
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD card that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Calculation results do not match the receive data.	Connection failure	Check the connection and insertion of the following boards. • Robot control module • AIF01 board • Robot safety module
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD card that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1861: M-SAF SYSTEM ERROR

An error occurred in a process of Machine-Safety system.

Sub Code	Meaning	Cause	Remedy
	Sub code indicates where the error occurred.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1863: M-SAF SETUP ERROR

The parameter setting do not match to system configuration setting.

Sub Code	Meaning	Cause	Remedy
2	Parameter setting does not match the number of robot safety modules.	Setting error	In maintenance mode, check that the control group setting is appropriate for the system.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The parameter setting is incorrect.	Setting error	In the control group setting window of maintenance mode, check that the following items are appropriate for the system configuration. 1. For STO connection: • Servo board which connects to each control group • The number of axis which connects to connector of each servo board • Contactor unit which connects the brake • Converter which connects the axis • ON_ENABLE signal (or TU) which connects to each control group • The setting of overrun signal 2. For Contactor connection: • Servo board which connects to each control group. • The number of axis which connects to connector of each servo board • Axis number to be connected to the connector of the servo board • Converter which connects the axis • Contactor unit which connects the brake • The setting of overrun signal
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1863: M-SAF SETUP ERROR (continued)

Sub Code	Meaning	Cause	Remedy
13	The parameter setting is incorrect.	Setting error	In the control group setting window of maintenance mode, check that the following items are appropriate for the system configuration. - For STO connection: - Servo board which connects to each control group - The number of axis which connects to connector of each servo board - Contact unit which connects the brake - Converter which connects the axis - ON_ENABLE signal (or TU) which connects to each control group - The setting of overrun signal - For Contactor connection: - Servo board which connects to each control group. - The number of axis which connects to connector of each servo board - Axis number to be connected to the connector of the servo board - Converter which connects the axis - Contact unit which connects the brake - The setting of overrun signal
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2000	The error of rotary switch setting is detected in robot safety module.	Setting error	- Select the following menu. [File]-[Initialize],[Safety Board FLASH Reset] - Turn the power OFF then back ON.
		Setting error	Check the rotary switch of robot safety module(#1-8)
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1865: M-SAF CPU COMM ERROR

The communication error was detected at Machine Safety Software.

Sub Code	Meaning	Cause	Remedy
1	Incorrect data was detected on communication between robot safety modules.	Connection failure	Check the connection between robot safety modules.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1.2 Alarm Number (1000 to 1999)

1865: M-SAF CPU COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2	Communication error was detected (RSF - RSF).	Connection failure	Check the connection between robot safety modules.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Communication error was detected (RSF - RSF).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
102	Incorrect data was detected on communication between robot safety module and robot control module.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD CARD that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	Incorrect data was detected on communication between robot safety module and robot control module.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD CARD that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1866: M-SAF F-SAFETY COMM ERROR

The communication error is detected between the M-SAF and the F-SAF.

Sub Code	Meaning	Cause	Remedy
201	The communication error is detected in the robot safety module.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1866: M-SAF F-SAFETY COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
202	The CRC error is detected in the robot safety module.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1867: M-SAF ROM DIAG. ERROR

An error is detected in the ROM diagnosis function of Machine Safety.

Sub Code	Meaning	Cause	Remedy
0	An error is detected in the ROM diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	An error is detected in the ROM diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error is detected in the ROM diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	A time over is detected in the ROM diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An unexpected case is detected in the ROM diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	A CRC error is detected in the ROM diagnosis function of Functional Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	An online ROM error is detected in the ROM diagnosis function of Functional Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.

1867: M-SAF ROM DIAG. ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	A flash ROM error is detected in the ROM diagnosis function of Functional Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	A RAM area error is detected in the ROM diagnosis function of Functional Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	A timeout occurred in the ROM diagnostic function of Functional Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1868: M-SAF RAM DIAG. ERROR

An error is detected in the RAM diagnosis function of Machine Safety.

Sub Code	Meaning	Cause	Remedy
4	Machine Safety software detected failure with RAM diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1869: M-SAF STACK DIAG. ERROR

An error is detected in the stack diagnosis function of Machine Safety.

Sub Code	Meaning	Cause	Remedy
1	An error is detected in the stack diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error is detected in the stack diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.

1869: M-SAF STACK DIAG. ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An error is detected in the stack diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1870: M-SAF REGISTER DIAG. ERROR

An error is detected in the register diagnosis function of Machine-Safety.

Sub Code	Meaning	Cause	Remedy
9999	An error is detected in the register diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10000	An error is detected in the register diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11000	An error is detected in the register diagnosis function of Machine Safety.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1871: M-SAF SEQUENCE WATCH ERROR

Sequence diagnosis function of Machine Safety board detected a failure.

Sub Code	Meaning	Cause	Remedy
	Subcode means error data.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1872: M-SAF WATCHDOG ERROR

An error is detected in the watch dog check of Machine Safety.

Sub Code	Meaning	Cause	Remedy
102	CPU1 of robot safety module detected an error of itself.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	CPU1 of robot safety module detected an error of CPU2.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
104	CPU1 of robot safety module detected an error of CPU2 in start up process.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	CPU1 of robot safety module detected an error of CPU2 in online start up process.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
202	CPU2 of robot safety module detected an error of CPU1.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
203	CPU2 of robot safety module detected an error of CPU1.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
204	CPU2 of robot safety module detected an error of CPU1 in start up process.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
205	CPU2 of robot safety module detected an error of CPU1 in online start up process.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1878: M-SAF VOLTAGE WATCH ERROR2

An error is detected in process to check the voltage of the robot safety module.

Sub Code	Meaning	Cause	Remedy
	subcode: cause of alarm (cause) 0.75 V out of range. 1.1 V out of range. 1.5 V out of range. 1.8 V out of range. 2.5 V out of range. 3.3 V out of range. 2.048V out of range. 24V1 out of range. 24V2 out of range.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot safety module -CN1A, CN1B • Extension safety I/O unit -CN1, CN3
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Extension safety I/O unit failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1879: M-SAF OPECODE ERROR

The robot safety module has detected OPECODE diagnosis error.

Sub Code	Meaning	Cause	Remedy
10000	An OPECODE diagnosis error was detected while an online mode.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
11000	An OPECODE diagnosis error was detected during startup.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1887: F-SAFE RAM DIAG. ERROR(RD ADDR)

The robot safety module has detected RAM diagnosis error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1888: F-SAFE RAM DIAG. ERROR(WT ADDR)

The robot safety module has detected RAM diagnosis error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1889: F-SAFE OPCODE DIAG. ERROR

The robot safety module has detected OPCODE diagnosis error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1890: F-SAFE M-SAFETY COMM ERROR

The communication error occurred between the robot safety module and the robot safety module.

Sub Code	Meaning	Cause	Remedy
1	Machine safety did not come by an online mode.	Setting error	Confirm that the rotary switch on the robot safety module[#1-8] is set to [0-7].
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Functional safety received an offline command.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.

1890: F-SAFE M-SAFETY COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	There was no response from machine safety board within the time limit.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	Functional safety board was not able to detect the first of the sequential number.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	Functional safety board detected CRC error.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
6	Functional safety board detected sequential number error.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
7	Interrupt signal does not occur from the machine safety board.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
8	Communication data error of Machine Safety was detected. (Running number over)	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
9	Communication data error of Machine Safety was detected. (Running number don't change)	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
10	Communication data of CPU1 and CPU2 is mismatch.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.

1890: F-SAFE M-SAFETY COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
11	Allocation requests of safety field bus signal is abnormal.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
12	The error of JL098 communication data was detected.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
14	The communication error is detected in the robot safety module.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1891: F-SAFE OUTPUT SIGNAL UNMATCH

Output data from CPU1 and CPU2 is mismatch.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1892: F-SAFE COND FILE SETTING ERR

The robot safety module has detected the condition file abnormality.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Indicates the type of condition file abnormality occurs. 0:Axis range limit function 1:Axis speed monitor function 2:Speed limit function 3:Robot range limit function 4:Tool angle monitor function 5:Tool change monitor function	Setting error	Check condition file that is indicated in the sub code is set correctly.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1894: F-SAFE STACK DIAG. ERROR

The robot safety module has detected stack diagnosis error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1895: F-SAFE REGISTER DIAG. ERROR

The robot safety module has detected register diagnosis error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1896: F-SAFE SEQUENCE WATCH ERROR

The robot safety module has detected sequence monitor error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1897: F-SAFE WATCHDOG ERROR

The robot safety module has detected watchdog monitor error.

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1898: F-SAFE ENCODER SELECT ERROR

The Change of encoder communication of Function Safety ERROR was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1899: F-SAFE MONITOR EXECUTE TIME OVER

The diagnosis processing of Function Safety was not completed in the definite time.

Sub Code	Meaning	Cause	Remedy
		Setting error	Reduce the condition file.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1915: CONTROLLER TYPE MISMATCH(SV)

The connected robot does not support this controller.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	The robot which did not support this controller was connected.	Connect the robot which a controller supports.
		A motor used in the robot which did not support the controller was connected.	When replacing the motor, note the TYPE on the nameplate of the controller and manipulator and contact our service department.

◆ 1920: SYSTEM ERROR(PFL)

Process is not performed properly on the robot safety module.

Sub Code	Meaning	Cause	Remedy
		robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the module to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1923: TORQUE MUTUAL DIAG. ERR(PFL)

Difference of Calculated external force torque result exceeds the threshold on robot safety module's duplex CPU.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the module to be safe.
		Torque sensor failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the torque sensor.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1924: FORCE MUTUAL DIAG. ERR(PFL)

Difference of calculated external force result exceeds threshold on robot safety module's duplex CPU.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the direction in which the alarm occurred	robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the module to be safe.
		Torque sensor failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the torque sensor.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ **1930: SYSTEM ERROR1(PFL)**

Process is not performed properly on the robot safety module.

Sub Code	Meaning	Cause	Remedy
		robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the module to be safe.

◆ **1931: ARITHMETIC ERROR(PFL)**

Process is not performed properly on the robot safety module.

Sub Code	Meaning	Cause	Remedy
		robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the module to be safe.

◆ **1946: API ERROR(PFL)**

Detects API(PFL) error.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ **1947: TRQ SENSOR MUTUAL DIAG. ERR(PFL)**

Detected torque sensor error between CH1 and CH2.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	A software settings failure	1. Confirm that the workpiece and tool is match the current tool number. 2. Re-calibrate torque sensor origin position. 3. Turn the power OFF then back ON. 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Interference with peripheral devices	1. If an external force is applied to the manipulator due to a collision with the surroundings or other causes, move the manipulator according to the manual. 2. Turn the power OFF then back ON.
		Torque sensor failure	1. Reset the alarm. 2. If the alarm occurs again, replace the torque sensor.

1947: TRQ SENSOR MUTUAL DIAG. ERR(PFL) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1950: MULTIDROP ENCODER COMMUNICATION SETUP COMPLETE

This alarm occurs if the encoder configuration setting to the servo amplifier is successful.

Sub Code	Meaning	Cause	Remedy
2	Completed self-configuration function.	Servo amplifier setting error	Turn the power OFF then back ON.
		Setting error	Check the parameter setting value.
4	Completed network initialization function.	Servo amplifier setting error	Turn the power OFF then back ON.
		Setting error	Check the parameter setting value.
100	Completed setting the multidrop master configuration parameters.	Servo amplifier setting error	Turn the power OFF then back ON.
		Setting error	Check the parameter setting value.
101	Completed setting of axis assignment parameters.	Servo amplifier setting error	Turn the power OFF then back ON.
		Setting error	Check the parameter setting value.

◆ 1951: MULTIDROP ENCODER COMMUNICATION SETUP ERROR

This alarm occurs if the encoder configuration setting to the servo amplifier is fails.

Sub Code	Meaning	Cause	Remedy
16	Node not supported.	Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
17	combination error.	Setting error	Check the parameter setting value.
18	Encoder setting error.	Software operation error occurred	Turn the power OFF then back ON.
19	Excessive total power consumption.	Excessive power consumption.	Calculate your power consumption.
32	Node address overlap error.	Software operation error occurred	Turn the power OFF then back ON.
48	Transmission cycle error.	Software operation error occurred	Turn the power OFF then back ON.
49	Multiple transmission cycle setting error.	Setting error	Check the parameter setting value.
50	Node transmission cycle setting error.	Software operation error occurred	Turn the power OFF then back ON.
51	Command transmission band error.	Software operation error occurred	Turn the power OFF then back ON.

1951: MULTIDROP ENCODER COMMUNICATION SETUP ERROR (continued)

Sub Code	Meaning	Cause	Remedy
64	Nodes that do not support multicast transmission.	Software operation error occurred	Turn the power OFF then back ON.
65	Multicast function setting error.	Software operation error occurred	Turn the power OFF then back ON.
80	Command sending size error.	Software operation error occurred	Turn the power OFF then back ON.
96	Format selection error.	Setting error	Check the parameter setting value.
112	Slave communication error.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] • Cable between encoders • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F [External axis] • Cable between encoders • Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Cable between encoders
		Module failure(encoder)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the encoder.

◆ 1952: MULTIDROP MASTER NUM ERROR

This alarm occurs if an error occurs in the multidrop master settings.

Sub Code	Meaning	Cause	Remedy
0	The number of multidrop masters has exceeded the maximum value (18).	Setting error	Check the parameter setting value.
1	The number of M-4 slaves has exceeded the maximum value (16).	Setting error	Check the parameter setting value.
2	Misconfigured or unsupported slave.	Setting error	Check the parameter setting value.
3	Mismatch between device and number of axes.	Setting error	Check the parameter setting value.

◆ 1953: MASTER PORT OVERLAP ERROR

This alarm occurs if setting up where two or more sensors are connected to the same location.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the encoder master in which the alarm occurred.	Setting error	Check the parameter setting value.

◆ 1954: SGMLNK2 DATA COMMUNICATION ERROR

This alarm occurs if the configuration so that communication cannot be established.

Sub Code	Meaning	Cause	Remedy
0**	Unable to find multidrop master. ** : The encoder master number.	Setting error	Check the parameter setting value.
1**	The next master could not be found inside the servo amplifier board. ** : The encoder master number.	Setting error	Check the parameter setting value.
2**	The next master could not be found outside the servo amplifier board. ** : The encoder master number.	Setting error	Check the parameter setting value.
3**	An unused master could not be found. ** : The encoder master number.	Setting error	Check the parameter setting value.

◆ 1955: INITIALIZE PG POSITION ERROR

The servo amplifier and YNX1000 each create position data. This alarm occurs if this data does not match.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis number in which the alarm occurred.	Software operation error occurred	Turn the power OFF then back ON.
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.

◆ 1956: ENCODER INITIAL SEQUENCE TIMEOUT

Encoder initialization processing failed due to timeout.

Sub Code	Meaning	Cause	Remedy
0****	M-4 command to servo amplifier timed out. **** : Sequence number.	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • M-4Cable
		Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.
1****	Register command timed out. **** : Sequence number.	Module failure(servo amplifier)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifier.
2****	Sequence transition timed out. **** : Sequence number.	Software operation error occurred	Turn the power OFF then back ON.

1956: ENCODER INITIAL SEQUENCE TIMEOUT (continued)

Sub Code	Meaning	Cause	Remedy
3****	P0 command to encoder timed out. **** : Sequence number.	Connection failure	- Turn the power OFF then back ON. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. [Robot axis] - Cable between encoders - Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F [External axis] - Cable between encoders - Single-axis servo amplifier -CN2 - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Cable between encoders
		Module failure(encoder)	- Turn the power OFF then back ON. - If the alarm occurs again, replace the encoder.
4****	P0 command to encoder error. **** : Sequence number.	Module failure(encoder)	- Turn the power OFF then back ON. - If the alarm occurs again, replace the encoder.

◆ 1957: ENCODER BACK-UP RECONNECT ERROR

Encoder resetting (initialization) not completed.

The position data in the encoder was lost due to the voltage drop of encoder backup battery.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Module failure(encoder battery)	- Turn the power OFF then back ON. - If the alarm occurs again, replace the encoder battery. - Perform the origin position setting. - If the alarm occurs again, replace the encoder.

◆ 1958: SAFE ENCODER MULTURN KEEP ERR

A error occurred in the safety encoder multi turn data. The position data in the encoder was lost due to initialization.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	The firmware version number of the encoder is incorrect.	- Turn the power OFF then back ON. - Perform the origin position setting. - If the alarm occurs again, replace the encoder.

◆ 1959: ENCODER CHECK ERR

The servo amplifier performs serial communications between controller and encoder. This alarm occurs if there is an error in the internal data of the encoder.

Servo amplifier alarm A.820

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(encoder)	- Turn the power OFF then back ON. - If the alarm occurs again, replace the encoder.

◆ 1960: CONNECT (I/O) SETTING ERROR (MCON)

A IO that control this function is duplicated with a IO of other function.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the contactor number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1961: CONNECT (I/O) SETTING ERROR (BOXFAN)

A IO that control this function is duplicated with a IO of other function.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the BOXFAN number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1962: CONNECT (I/O) SETTING ERROR (LAMP)

A IO that control this function is duplicated with a IO of other function.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the LAMP number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1963: CONNECT (I/O) SETTING ERROR (FANCTRL)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the FANCTRL number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1964: CONNECT (I/O) SETTING ERROR (AXOUT)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the AXOUT number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1965: CONNECT (I/O) SETTING ERROR (MCONFB)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the contactor number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1966: CONNECT (I/O) SETTING ERROR (SHOCK)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the SHOCK number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1967: CONNECT (I/O) SETTING ERROR (ALMIN1)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the ALMIN1 number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1968: CONNECT (I/O) SETTING ERROR (ALMIN2)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the ALMIN2 number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1969: CONNECT (I/O) SETTING ERROR (ALMIN3)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the ALMIN3 number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1970: CONNECT (I/O) SETTING ERROR (DIN)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the DIN number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1971: CONNECT (I/O) SETTING ERROR (AXIN)

IO set by this function is duplicated with IO set by other functions.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the AXIN number in which the alarm occurred.	A software settings failure	1. Turn OFF the power supply of a robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1975: SERVO AMPLIFIER VERSION ERROR

A servo amplifier version error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Run servo amplifier firmware update function. 2. If AL1977SERVO AMPLIFIER UPDATE ERROR occurs when executing servo amplifier firmware update function, save CMOS.BIN and then contact your YASKAWA representative.
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1976: CONVERTER VERSION ERROR

A converter version error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1977: SERVO AMPLIFIER UPDATE ERROR

Detected that the base version is not updatable firmware.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 1992: SAFE ENCODER MULTURN CHECK ERR

A error occurred in the safety encoder multi turn data.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Encoder data failure	1. Turn the power OFF then back ON. 2. Check position after alarm.If the position cannot be checked, perform the origin position setting. 3. If the alarm occurs again, replace the motor.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1993: SAFE ENCODER PRM ERR

A error occurred in the safety encoder parameter.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	In a state effective in function safety. Set Safety Address again.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1994: SAFE TORQUE SENSOR PRM ERR

A error occurred in the lotus parameter.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	In a state effective in function safety. Set Safety Address again.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1995: TORQUE SENSOR COMMUNICATION ERR

The servo amplifier performs serial communications between controller and lotus. This alarm occurs if the system fails to establish the communications.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F - Single-axis servo amplifier -CN2 3. If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Cable between encoders and lotus
		Module failure(LOTUS)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the LOTUS. 3. If the alarm recurs after taking the measures described in 2. above, replace the lotus one position before the axis where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1996: TORQUE SENSOR ILLEGAL

A error occurred in the lotus parameter.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(LOTUS)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the LOTUS.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1997: TORQUE SENSOR TEMPERATURE ERR

A error occurred in the lotus.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	LOTUS overheated	1. Turn the power OFF then back ON. 2. If the alarm occurs again, turn OFF the power supply to the robot controller for about 10 minutes to lower the motor temperature.
		Ambient temperature abnormal	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the following • Check the ambient temperature is compatible with the installation temperature of Robot controller.
		Module failure(LOTUS)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the LOTUS.
		Servo Amplifier failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1998: TORQUE SENSOR CALCULATION ERR

A error occurred in the lotus.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(LOTUS)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the LOTUS.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 1999: SERVO AMPLIFIER ALARM(SERVO)

A servo amplifier alarm was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the servo amplifier alarm code.	Setting error	1. Run servo amplifier firmware update function. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

YNX1000

Alarm Codes

(Major Alarms)

YASKAWA

YASKAWA ELECTRIC CORPORATION

©2024 YASKAWA ELECTRIC CORPORATION
Published by YASKAWA

MANUAL NO. RE-CER-A603 
July 2026 24-06
Major Alarms

YNX1000 Alarm Codes (Minor Alarms)

-
- Upon receipt of the product and prior to initial operation, read these instructions thoroughly, and retain for future reference.
 - This instruction consists of “Major alarms” version and “Minor alarms” version.
-

This Page Intentionally Blank

Table of Contents

i.	Before Using the Product.	15
i.1	Introduction to This Manual	16
	Applicable Products	16
	Nameplate	16
	Intended Audience	17
	Related Manuals	17
i.2	Notes for Safe Operation	18
	Safety Information	18
	Visual Aids	18
	Important Safety Precautions	19
	Warning Label Attachment Locations	31
i.3	Using This Manual	34
	Terms	34
	Terms for Pendant Operation	34
	Trademarks	34
1.	Alarm List	35
1.1	Alarm Number (4000 to 4999)	36
	4000: MEMORY ERROR(TOOL FILE)	36
	4001: MEMORY ERROR(USER COORD FILE)	36
	4002: MEMORY ERROR(SV MON SIGNAL FILE)	37
	4003: MEMORY ERROR(WEAVING FILE)	37
	4004: MEMORY ERROR(HOME POS FILE)	38
	4005: MEMORY ERROR(SECOND HOME POS)	38
	4011: MEMORY ERROR(FILE DATA)	39
	4012: MEMORY ERROR(LINK SERVOFLOAT)	47
	4013: MEMORY ERROR(LINEAR SERVOFLOAT)	47
	4014: MEMORY ERROR(ROBOT CALIB FILE)	48
	4018: MEMORY ERR(LADDER PRG FILE)	48
	4019: MEMORY ERROR(CUTTING COND FILE)	49
	4020: MEMORY ERROR(OPERATION ORIGIN)	49
	4021: MEMORY ERROR(CONVEYOR COND FILE)	50
	4024: MEMORY ERR(WRIST WEAV AMP FILE)	50
	4025: MEMORY ERROR(INTERRUPT JOB FILE)	51
	4028: MEMORY ERR(SENSOR MON COND FILE)	51
	4034: MEMORY ERR(ANTICIPATION OT FILE)	52
	4035: MEMORY ERR(ANTICIPATION OG FILE)	52
	4039: MEMORY ERROR(FORM CUT FILE)	53
	4040: MEMORY ERROR(SHOCK LEVEL FILE)	53
	4042: MEMORY ERROR(VISION FILE)	54
	4043: MEMORY ERROR(VISION CALIBRATION)	54
	4046: MEMORY ERR(CONVEYOR CALIB FILE)	55
	4047: MEMORY ERROR(MACRO DEFINITION FILE)	55
	4050: MEMORY ERR(AXIS I/O ALLOC FILE)	56
	4052: MEMORY ERROR(TOOL INTERFERENCE)	56
	4061: MEMORY ERROR(GAUGE SENSOR FILE)	57

4062: MEMORY ERROR(LNR SCALE FILE)	57
4063: MEMORY ERR(CONVEYOR COND SUPP.)	58
4065: MEMORY ERROR(I/F PANEL FILE)	58
4069: MEMORY ERR(PALLETIZE COND FILE)	59
4080: MEMORY ERR(MUTUAL WAIT SET FILE)	59
4084: MUTUAL WAIT ERROR	60
4085: MEMORY ERR(INTERF. HISTORY FILE)	61
4086: MEMORY ERROR(SAFETY SET FILE)	62
4087: MEMORY ERROR(TMR FILE)	62
4088: MEMORY ERROR(SAFETY LOGIC FILE)	63
4091: 24V FUSE BLOWN(GENERAL I/O EXP.)	63
4092: 24V CIRCUIT ERR(GENERAL I/O EXP.)	64
4093: EXT. POWER ERR(GENERAL I/O EXP.)	64
4095: PULLBACK ERROR (PFL)	65
4099: DC 24V POWER SUPPLY FAILURE(CPS)	65
4102: SYSTEM DATA HAS BEEN CHANGED	65
4103: PARALLEL START INSTRUCTION ERROR	66
4104: WRONG EXECUTION OF LOAD INST	68
4105: WRONG EXECUTION OF SAVE INST	69
4106: WRONG EXECUTION OF DELETE INST	69
4107: OUT OF RANGE(ABSO DATA)	69
4109: DC 24V POWER SUPPLY FAILURE(I/O)	70
4110: SHOCK SENSOR ACTION	70
4112: DATA SENDING ERROR	71
4113: DATA RECEIVING ERROR	71
4114: TRANSMISSION HARDWARE ERROR	73
4115: TRANSMISSION SYSTEM BLOCK	73
4116: TRANSMISSION SYSTEM ERROR	74
4117: BRAKE POWER ERROR	74
4118: FAN CIRCUIT PROTECTOR TRIPPED	75
4119: FAN ERROR(IN CONTROL BOX)	75
4121: COOLING FAN1 ERROR	75
4122: COOLING FAN2 ERROR	76
4123: COOLING FAN3 ERROR	76
4124: WRONG EXECUTION OF VISION INST	76
4126: CANNOT EXECUTE AUTO PMT	78
4128: ARC MONITOR ERROR	80
4129: TWIN DRIVE OUT OF RANGE(START)	81
4130: NETWORK APPLICATION PROCESS ERROR	81
4131: UDP PROCESS ERROR	87
4132: TCP PROCESS ERROR	89
4134: COOLING FAN SET ABNORMAL	90
4137: WRONG EXECUTION OF SETUALM INST	90
4138: WRONG EXECUTION OF SVON INST	91
4139: WRONG EXECUTION OF PRINT INST	91
4140: WRONG EXECUTION OF DIALOG INST	92
4141: SNTP ERROR	92
4145: RELAY NO. ERROR(LADDER PROGRAM)	95
4146: ENCDR PWR CIRCUIT PROTECTOR TRIP	96
4147: USER COORD EDIT ERROR	96
4148: TRACELV ERROR	96
4149: TRACE ERROR	97
4152: TIMING BELT BLOWN	97
4153: COOLING UNIT ERROR	98
4154: COOLING FAN ERROR (DOOR)	98
4155: COOLING FAN ERROR (BACKSIDE)	98
4156: COOLING FAN4 ERROR	99
4192: TRACE FILE ERROR	99
4193: DATABASE ACCESS ERROR(PAINT)	100
4194: 3D TRACE BUFFER OVERFLOW	100

4197: INCORRECT SAFETY LOGIC CIRCUIT	100
4200: SYSTEM ERROR(FILE DATA)	101
4201: SYSTEM ERROR(JOB)	101
4202: SYSTEM ERROR(JOB)	107
4203: SYSTEM ERROR(POSITION DATA)	113
4204: SYSTEM ERROR(POSITION DATA)	117
4206: SYSTEM ERROR(TRANSMISSION)	120
4207: SYSTEM ERROR(MOTION)	121
4208: SYSTEM ERROR(ARITH)	138
4209: OFFLINE SYSTEM ERROR(ARITH)	144
4210: SYSTEM ERROR(LOCAL VARIABLE)	145
4218: MOTOR POWERON STATUS NOT READY	147
4219: MOTOR STOP MODE ERROR	147
4220: SERVO POWER OFF FOR JOB	148
4221: SERVO POWER OFF FOR JOB	148
4224: MEMOPLAY FILE ERROR	148
4225: OVER SPEED(RC)	149
4226: COMMUNICATION SERVICE ERROR	150
4228: WRONG DATA	151
4229: ETHERNET PROCESS ERROR	152
4234: COMMUNICATION TIMEOUT(IO MODULE)	163
4294: CANNOT EXECUTE INST(HPMMV CTRL)	170
4295: HPMMV CTRL FAILED	170
4296: IMPOSSIBLE HPMMV CTRL	170
4300: VERIFY ERROR(SERVO PARAMETER)	171
4301: CONTACTOR ERROR	172
4307: SERVO ON DEFECTIVE SPEED	172
4308: VOLTAGE DROP(CONVERTER)	173
4310: ENCODER OVERHEAT	173
4311: ENCODER BACK-UP ERROR	174
4312: ENCODER BATTERY ERROR	175
4315: COLLISION DETECT	175
4320: OVERLOAD(CONTINUE)	176
4321: OVERLOAD(MOMENT)	177
4326: OVER SPEED	179
4327: WRONG MOTOR ROTATION	180
4328: SERVO TRACKING ERROR	180
4329: SAFETY SPEED ERROR(SERVO)	182
4331: SPEED MONITOR LEVEL ERROR	185
4334: OVERVOLTAGE(CONVERTER)	186
4336: OPEN PHASE(CONVERTER)	186
4344: LINEAR SERVOFLOAT TRACKING ERROR	187
4345: LNK SERVOFLOAT EXECUTE ERROR	187
4346: LNK SERVOFLOAT TRQ LIMIT ERROR	188
4347: LNR SERVOFLOAT TRQ LIMIT ERROR	188
4348: LNR SERVOFLOAT COORD TYPE ERROR	188
4349: LNR SERVOFLOAT TOOL POSE ERROR	188
4350: LNR SERVOFLOAT EXECUTE ERROR	189
4351: DRIVE BELT SNAP DETECT	189
4352: TWIN DRIVE OVER DEVIATION	189
4353: DEFECTIVE TAUGHT POINT(ENDLESS)	190
4354: FILE NO. ERROR(SHOCK LEVEL)	190
4355: EXTERNAL PRES DETECT(SERVOFLOAT)	190
4362: POWER SUPPLY READY ERROR(SERVO)	191
4363: BASE BLOCK SIGNAL ERROR(SERVO)	191
4364: GUN SOFTLIMIT	192
4365: TOUCH DETECT DATA OVER	192
4366: GUN BEND COMPENSATION SET ERROR	192
4367: ROBOT POSE ERROR	193
4371: SYSTEM ERROR(SERVO)	193

4379: SAFETY RELAY ERROR(SERVO)	193
4398: PULSE LIMIT(SERVO)	194
4399: SERVO TRACKING ERROR(LOW)	194
4400: NOT READY (ARITH)	196
4401: SEQUENCE TASK CONTR ERROR	196
4402: UNDEFINED COMMAND(ARITH)	199
4403: UNDEFINED IOSPDCTRL HOME POS	199
4404: ARITHMETIC ERROR	200
4406: GROUP AXIS CONTROL ERROR	201
4407: TWO STEPS SAME POSITION(CIRC)	202
4408: TWO STEPS SAME POSITION(SPLINE)	202
4409: TWO STEPS SAME POSITION(3 STEPS)	202
4410: TWO STEPS SAME POSITION(WEAV)	202
4411: TEACH ERROR(SPLINE)	203
4412: IMPOSSIBLE LINEAR MOTION(L/U)	203
4413: IMPOSSIBLE LINEAR MOTION(S/L)	203
4414: EXCESSIVE SEGMENT (LOW/HIGH)	204
4416: PULSE LIMIT(MIN./MAX.)	204
4418: CUBE LIMIT(MIN./MAX.)	204
4420: SPECIAL SOFTLIMIT(MIN./MAX.)	204
4422: MECHANICAL INTERFERENCE(MIN./MAX.)	205
4424: SPECIAL MECHANICAL INTRF(MIN./MAX.)	205
4426: PULSE MECHANICAL LIMIT(MIN./MAX.)	205
4428: SEGMENT CONTROL ERROR	205
4429: WRONG SPECIFIED CONTROL GROUP	206
4430: CPU COMMUNICATION ERROR	208
4431: JHM ERROR	210
4432: INSTRUCTION INTERPRETER ERROR	210
4433: UNDEFINED GLOBAL VARIABLE	214
4435: UNDEFINED LOCAL-VARIABLE	215
4436: LESS THAN 3 STEPS(CIRCULAR)	216
4437: LESS THAN 3 STEPS(SPLINE)	216
4438: UNDEFINED JOB	216
4439: UNDEFINED LABEL	216
4440: UNDEFINED RETURN JOB	217
4441: LACK OF LOCAL-VARIABLE AREA	217
4444: UNSUCCESSFUL FINE POSITIONING	217
4445: DATA PRESET ERROR	218
4446: OVER VARIABLE LIMIT	218
4447: DEFECTIVE TAUGHT POINT(CIRC)	221
4448: WEAVING CONTROL ERROR	222
4449: UNMATCHED POSN VAR DATA TYPE	224
4450: FILE NO. ERROR	225
4451: UNDEFINED REFERENCE POINT	226
4452: STACK MORE THAN 10 (JOB CALL)	226
4453: OVER VARIABLE NO.	226
4459: EXCESSIVE INSTRUCTION EQUATION	227
4460: ZERO DIVIDED OCCURRENCE	227
4463: PARITY ERROR	227
4464: OVER BCD RANGE	227
4465: OVER BINARY RANGE(PARITY CHECK)	228
4466: OFFLINE UNDEFINED COMMAND(ARITH)	228
4467: USER COORD STEP NOT ENOUGH	228
4468: ROBOT CALIBRATION DATA ERROR	228
4469: ROBOT CALIBRATION FRAME ERROR	229
4470: ROBOT CARIB STEP NOT ENOUGH	230
4471: ROBOT CALIBRATION DATA ERROR	230
4473: ARITHMETIC ALARM RESET ERROR	231
4474: WRONG CONTROL GROUP AXIS	231
4475: CANNOT EXECUTE JOB(NO ROBOT)	231

4476: CANNOT EDIT (EDIT LOCK JOB)	231
4477: SELECT ERROR(APPLICATION)	232
4478: MotoPlus MM TASK NO RESPONSE	232
4479: MotoPlus MM TASK WATCH DOG ERROR	233
4480: SELECT ERROR(SENSOR 1)	233
4484: WRONG PORT NO.(ANALOG OUTPUT)	233
4485: WRONG SELECTION (SENSOR)	234
4487: WRONG MECH PARAMETER FILE	234
4489: DEFECTIVE TAUGHT POINT(CUTTING)	234
4490: DEFECTIVE TAUGHT POINT(ENDLESS)	235
4491: CORRECTIONAL DIRECTION ERROR	235
4492: POSITION CORRECTION ERROR	236
4493: OVER TOOL FILE NO.	236
4494: DEFECTIVE TAUGHT POINT(WEAV)	237
4495: UNDEFINED ROBOT CALIBRATION	237
4496: PARAMETER ERROR	237
4497: DEFECTIVE TAUGHT POINT(CALIB)	246
4498: CANNOT EXECUTE JOB(NO GRP AXIS)	247
4499: UNDEFINED POSITION VARIABLE	247
4500: UNDEFINED USER FRAME.	247
4501: OUT OF RANGE(PARALLEL PROCESS)	247
4502: SL BOARD ON-LINE ERROR	248
4507: REFP POS ERROR(SEARCH MOTION)	248
4508: SPECIFIED ERROR(COORDINATE)	248
4509: MFRAME ERROR	251
4510: CANNOT EXECUTE INSTRUCTION(SQRT)	251
4511: OUT OF RANGE(DROP-VALUE)	251
4512: TWO STEPS SAME LINE(3 STEPS)	252
4513: EXCESSIVE SEGMENT(SAFETY 1): LOW/HIGH	252
4515: EXCESSIVE SEGMENT(SAFETY 2): LOW/HIGH	252
4517: SEARCH MONITOR SET ERROR(SERVO)	253
4518: SEARCH MON RELEASE ERR(SERVO)	253
4520: AXIS BLOCKING	253
4521: WRONG JOB TYPE	253
4522: TAG DATA CHANGE PROCESS ERROR	254
4523: SHARED AXES CONTROL ERROR	254
4524: CANNOT EXECUTE INST(CONCUR JOB)	255
4525: CANNOT EXECUTE SPECIFIED JOB	256
4527: UNDEFINED PORT NO.(AOUT)	256
4528: SYNTAX ERROR.	256
4529: TWIN COORDINATED ERROR	257
4530: CONVEYOR TRACKING ERROR	258
4531: UNDEFINED CONVEYOR COND FILE	259
4532: CONVEYOR SPEED DOWN	259
4533: ARITHMETIC ERROR(CV TRACKING)	259
4534: TORQUE INTERFERENCE	260
4535: TARGET VARIABLE TYPE UNMATCHED	260
4538: ROBOT AXIS TRACKING INVALID	261
4539: CORNER R CONTROL ERROR	261
4540: JOB QUE EMPTY ERROR	262
4541: INVALID INPUT STRING(VAL)	263
4542: MRESET ERROR	263
4543: STACK LESS THAN 0(JOB CALL)	263
4544: MID\$ INST ERROR	263
4546: CANNOT EXECUTE SYSTEM JOB	264
4547: PRIMITIVE ERROR.	264
4548: CANNOT OPERATE SPECIFIED EVENT	264
4549: NOT EXECUTION OF INIEVNT	264
4550: CANNOT EXECUTE INST(USER JOB)	265
4565: SOFTWARE UNMATCH	265

4566: USER FRAME MAKING ERROR	267
4567: CANNOT MONITOR DISTANCE	267
4571: SERVO FLOAT MODE RELEASE ERR.....	267
4579: ANTICIPATION CONTROL ERROR	268
4580: ANTICIPATION DISTANCE NOT ENOUGH	268
4581: DEFECTIVE ANTICIPATION OT FILE	268
4584: STRWAIT TIME LIMIT	269
4585: SERVO PG ON ERROR	269
4590: NO SERVO HAND CONTROL GROUP.....	269
4591: SPEED CTRL MODE SET ERR(SERVO)	269
4592: SPEED CTRL MODE CANCEL ERR(SV)	270
4593: SVHAND CTRL MODE SET ERR(SERVO)	270
4594: SVHND CTRL MODE CANCEL ERR(SV).....	270
4595: CAN'T DO FIXED FORM CUT MOTION	270
4596: FORMCUT ERROR.....	273
4597: OFFLINE POSITION DATA CONVERT ERR	274
4599: SERVO COMMAND ERROR	276
4604: SPECIFIED ERR(ABSO RECOVER AXIS).....	276
4605: SETTOOL ERROR	276
4606: LACK OF GLOBAL VARIABLE AREA	277
4607: WRONG EXECUTION OF MACRO INST	277
4608: WRONG EXECUTION OF GETARG INST	278
4609: MEMOPLAY ERROR.....	278
4610: MEMOPLAY SAMPLING ERROR	279
4611: OVER OPTON INST EXECUTION LIMIT	281
4612: TSYNC ERROR.....	281
4614: UNDEFINED SEALERGUN COND FILE.....	281
4615: I/O AXIS OPERATING.....	281
4616: AXIS SHIFT ERROR	282
4618: SHIFT INST EXECUTE ERROR	282
4619: UNDEFINED JOB ENTRY TABLE	282
4620: ARM (TOOL) INTERFERENCE	283
4622: SELF-INTERFERENCE	283
4623: WRONG EXECUTION OF GETPOS INST	283
4625: WRONG EXECUTION OF LOADDB INST	284
4626: IMPOSSIBLE S-AXIS MOV(IN SPHERE)	287
4628: WRITE VARIABLE NO. MULTI SETTING	287
4629: GROUP CHANGE ERROR.....	288
4631: DEFECTIVE OPERATION VELOCITY	289
4635: CANNOT EXECUTE COMMON JOB.....	289
4637: TRACK CHG WORK IN/NOT NOT FOUND	289
4638: TRACKING CHG WORK ID NOT FOUND.....	289
4639: SYMOVJ INST EXECUTE ERROR	290
4640: WRONG EXECUTION OF PSTART INST	290
4641: CANNOT EXECUTE JOB(SEPARATE GRP)	291
4645: NOT PERMIT FIXED-WEAV ON SWVON	291
4648: FILE TRANSFER ERROR(ARITH)	291
4649: PARTIAL MOTION RANGE INTRF.....	291
4650: TRQ CLEAR ERROR	292
4651: PALLETIZING EXECUTE ERROR.....	292
4652: TRQ MEASURE MODE SET ERR(SV)	293
4653: TRQ MEASURE MODE CANCEL ERR(SV)	293
4654: WRONG EXECUTION OF SETREG INST	293
4655: WRONG EXECUTION OF GETREG INST	293
4656: WRONG EXECUTION OF SETPRM INST	294
4657: WVADJ ERROR.....	294
4658: OVER SPEED LIMIT	294
4661: MEMORY ERROR(PRESS COND FILE)	295
4668: MEMORY ERROR(PREVENTION FILE).....	295
4669: DETECT BRAKE SLIP	296

4670: INSUFFICIENT NUM OF SAMPLE DATA	296
4671: SAMPLE BUFFER OVER FLOW	296
4672: BASIC SPEED UNREACHED	296
4673: MAX TRQ UNDETECTED	297
4674: SETE ERROR	297
4676: BROKEN FAN FUSE	297
4677: IMPOSSIBLE LINEAR MOTION	298
4678: SPOT MONITOR DATA ERROR	298
4680: F-SAFE COMMAND ERROR (RC)	298
4681: OVER SPEED(MainCPU)	299
4684: INTERPOLATION INVALID	299
4685: F-SAFE WRITE ERROR	299
4692: F-SAFE ENCODER BACKUP ERROR	300
4693: F-SAFE READBACK PROC. ERROR	300
4696: TURN TABLE CALIBRATION ERROR	302
4697: OFFLINE ARM BEND POS CONVERT ERR	302
4698: SHIFT VALUE MAKING ERROR	304
4699: SYSTEM ERROR 1(RSC1)	304
4700: SYSTEM ERROR 2(RSC1)	305
4701: MEMORY ALLOCATION ERROR	305
4703: F-SAFE OPERATION MODE ERROR	305
4707: TIMING CONTROL ERROR	305
4715: CIP MESSAGE SERVER FUNC ERROR	307
4716: BINARY ETHERNET SERVER FUNC ERR	309
4718: BINARY ETHERNET CLIENT FUNC ERR	312
4719: VIB SUPPRESSION FLT TIME OUT	316
4721: IMPROPER TOOL FILE SETTING	316
4725: SETTM ERROR	317
4727: GETCVSFT ERROR	317
4728: CONVEYOR SYNCHRONIZATION (SHIFT FUNCTION) ERROR	318
4729: ASCII IF CONTROL ERROR	318
4730: CANNOT EXECUTE BRAKE SLIP DETECT	320
4733: WRIST MOTION ERROR (SINGULAR POINT)	321
4734: FIGURE CONVERSION IMPOSSIBLE	321
4735: SENSOR-LESS LEARNING CTRL ERROR	321
4736: USER GROUP IO ERROR	322
4737: MOTION RANGE LIMIT OVER	323
4738: DEST MOTION RANGE LIMIT OVER	323
4739: USER ANALOG IO ERROR	323
4740: M-SAF OVERRUN DETECT	324
4741: M-SAF PPESP SIG. ERROR	325
4742: M-SAF PBESP SIG. ERROR	325
4743: M-SAF EXESP SIG. ERROR	326
4744: M-SAF PP ENABLE SW SIG. ERROR	326
4746: M-SAF SAFETY FENCE SIG. ERROR	327
4747: M-SAF OVERRUN SIG. ERROR	327
4748: M-SAF ON_ENABLE SIG. ERROR	328
4750: M-SAF GENERAL INPUT SIG. ERROR	328
4751: M-SAF GENERAL INPUT SIG. ERROR2	329
4752: M-SAF PPESP DIAG. ERROR	329
4753: M-SAF PBESP DIAG. ERROR	330
4754: M-SAF EXESP DIAG. ERROR	330
4755: M-SAF PP ENABLE SW DIAG. ERROR	330
4757: M-SAF SAFETY GUARD DIAG. ERROR	331
4758: M-SAF OVERRUN DIAG. ERROR	331
4759: M-SAF ON_ENABLE DIAG. ERROR	331
4760: M-SAF FULL SPEED DIAG. ERROR	332
4761: M-SAF GENERAL INPUT DIAG. ERROR	332
4762: M-SAF GENERAL INPUT DIAG. ERROR2	333
4764: M-SAF STO FB DIAG. ERROR	333

4765: M-SAF BRAKE FB DIAG. ERROR	334
4767: M-SAF GENERAL OUT FB DIAG. ERROR	335
4768: M-SAF GENERAL OUT FB DIAG. ERROR2	336
4769: M-SAF BRAKE DIAG. ERROR	337
4770: M-SAF STO DIAG. ERROR	337
4771: M-SAF GENERAL OUTPUT DIAG. ERROR	338
4772: M-SAF GENERAL OUTPUT DIAG. ERROR2	338
4776: M-SAF YSF LOGIC FILE SIGNAL ERR	339
4779: PointPLC CONTROL ERROR	339
4780: F-SAFE AXIS RANGE LIMIT INTF	340
4781: AXIS RANGE LIMIT INTF	340
4782: F-SAFE AXIS SPEED MONITOR ERROR	341
4783: F-SAFE ROBOT RANGE LIMIT INTF	341
4784: ROBOT RANGE LIMIT INTF	341
4785: F-SAFE SPEED LIMIT ERROR	341
4786: F-SAFE TEACH SAFETY SPEED ERROR	342
4787: F-SAFE ROBOT STOP MONITOR ERROR	342
4788: F-SAFE STATION STOP MONITOR ERR	342
4789: F-SAFE TOOL CHANGE MONITOR ERR	343
4790: F-SAFE TOOL ANGL MONITOR ERR	343
4791: F-SAFE AXIS STOP MONITOR ERROR	343
4792: TOOL ANGL MONITOR ERR	344
4793: F-SAFE SIGNAL SET ERR(GENERAL)	344
4794: F-SAFE MONITOR EXECUTE TIME OVER	345
4795: F-SAFE CANNOT OPERATE TEMP DSBL	345
4796: F-SAFE DATA CRC UNMATCH	345
4797: F-SAFE RANGE COMBINATION ERR	346
4798: F-SAFE SIGNAL SET ERR(SFB)	346
4799: F-SAFE SIGNAL SET ERR(LOGIC)	347
4810: LINEAE SERVOFLOAT CONCURRENT EXECUTION ERROR	347
4811: LINEAE SERVOFLOAT PASSING A SINGULARITY POINT	347
4822: HARD WIRE BASE BLOCK ERROR	348
4823: HARD WIRE BASE ENABLE ERROR	349
4828: M-SAF READBACK PROC. ERROR	349
4849: SERVO ON EXECUTION INCOMPLETE	350
4878: SPEED CONTROL EXECUTE ERROR(SERVO)	351
4880: EXCESSIVE FORCE DETECTION	351
4881: EXCESSIVE VELOCITY CORRECTION	351
4882: SINGULAR POINT ERROR	352
4883: SENSOR OVER RANGE	352
4884: FORCE CONTROL NOT PERMITTED	352
4885: SENSOR OUTPUT ERROR	352
4886: FORCE CONTROL FILE ERROR	353
4887: FORCE CONTROL CONDITION ERROR	353
4888: FORCE SENSOR OUTPUT ERROR	353
4889: FORCE COMMAND VALUE SET ERROR	353
4890: SCALE SETTING ERROR	354
4897: FORCE CONTROL INTERNAL ERROR	354
4898: EXCESSIVE SEGMENT (SV)	354
4899: EXCESSIVE SEGMENT(SAFETY 1) (SV)	355
4900: EXCESSIVE SEGMENT(SAFETY 2) (SV)	355
4901: CUBE/AXIS INTERFERENCE	355
4902: CUBE INTERFERENCE(TCP)	355
4903: CUBE INTERFERENCE(ENTIRE)	356
4904: CUBE INTERFERENCE AREA SET ERR	356
4905: INSTRUCTION ERROR 1	357
4908: SPEED CONTROL ERROR	357
4909: TEST RUN(HIGH ACCURACY) ERROR	357
4910: SAFETY FIELDBUS DATA ERROR	358
4911: SAFETY FIELDBUS NOT ESTABLISHED	358

4912: SAFETY FIELDBUS COMM ERROR.....	362
4913: SUB SEQUENCE TASK CONTR ERROR.....	366
4914: SUB SEQUENCE(H) TASK CONTR ERROR.....	369
4915: PathSwitch CONTROL ERROR.....	372
4916: WRONG JOB EXEC OF DETACHED AXIS.....	373
4917: WRONG JOB EXEC OF DETACHED AXIS.....	374
4918: PROFINET SETTING ERROR.....	374
4919: SYSTEM JOB(CYCLIC) EXEC. ERROR.....	375
4920: M-SAF CONTACTOR SELF CHECK ERR.....	377
4921: M-SAF STO SELF CHECK ERR.....	377
4922: M-SAF GENERAL OUT SELF CHECK ERR.....	378
4923: M-SAF GENERAL OUT SELF CHECK ERR2.....	378
4924: M-SAF BRAKE UNMATCH.....	379
4925: M-SAF STO UNMATCH.....	380
4926: M-SAF GENERAL OUTPUT UNMATCH.....	380
4927: M-SAF GENERAL OUTPUT UNMATCH2.....	381
4932: REFERENCE USER FRAME ERROR.....	381
4933: TIMING DELAY CONTROL IMPOSSIBLE.....	382
4934: MotoPlus APP. RESPONSE ERROR.....	382
4935: PointPLC EXECUTE ERROR.....	383
4936: LOCAL VARIABLE CONTROL ERROR.....	384
4937: TIMING ADJUSTMENT SETTING ERROR.....	384
4940: MOTION COMMAND CODE ERROR (SV).....	384
4941: CANNOT EXECUTE MOTION CMD (SV).....	384
4942: AVERAGING TIME CHANGE ERR (SV).....	385
4943: AVERAGING TIME ERROR (SERVO).....	385
4944: POSITION LOOP GAIN ERROR (SV).....	385
4945: MOTION COMMAND DATA ERROR (SV).....	385
4946: PG POWER ON INCOMPLETE (SV).....	385
4947: SERVO ON MULTIPLE REQUEST (SV).....	386
4953: ENCODER COUNTER DIFF. ERR(SV).....	386
4954: REALTIME STATUS S/R ERROR (SV).....	386
4955: AVERAGING DATA ERROR (SERVO).....	387
4956: AVERAGING SUM ERROR (SERVO).....	387
4957: AVERAGING STATUS ERR (SERVO).....	387
4958: HIGH RESOLUTION PRM UNDEFINED(SV).....	387
4959: WRONG GRP CHANGE AXIS (SERVO).....	387
4960: BELT SNAP DETECT PRM ERROR (SV).....	388
4962: BRAKE LOCK ERROR (SERVO).....	388
4963: BRAKE RELEASE ERROR (SERVO).....	388
4964: CONST.SPD MEASURE MULTI REQ (SV).....	388
4965: DIN SIGNAL SPECIFIC. ERROR (SV).....	388
4968: POSITIONING(DISTANCE) ERROR.....	389
4972: CONVTR REGENERATE OVERLOAD(SV).....	389
4973: POSITION ERROR(COLLISION DETECT).....	390
4974: POSITION ERROR(START LIFT).....	390
4975: WRONG START LIFT AXIS(SERVO).....	390
4979: ACCELERATION LIMIT OVER.....	391
4980: DESTINATION PULSE LIMIT.....	391
4981: DEST PULSE MECHANICAL LIMIT.....	391
4982: DEST MECHANICAL INTRF.....	391
4983: DEST MECHANICAL INTRF.....	392
4984: DESTINATION SELF-INTERFERENCE.....	392
4985: TEACH LINE CORD JOG MOVE DISABLE.....	392
4986: TEACH LINE CORD JOG MOV C DISABLE.....	392
4989: DEFECTIVE OPERATION VELOCITY.....	393
4990: MOTION ERROR (SINGULAR POSTURE).....	393
4991: IO MODULE PROC OVERTIME.....	393
4992: INTERNAL ROBOT POS.UNMATCH.....	395
4995: RUSH LIMIT RESISTOR OVERLOAD(CONVERTER).....	395

	4997: M-SAF DATA CRC UNMATCH	396
	4998: M-SAF SYSTEM ERROR2	396
	4999: ENCODER USER DATA SUM ERROR	396
1.2	Alarm Number (6000 to 6999)	398
	6000: SYSTEM ERROR2(PFL).....	398
	6001: MUTING ERROR(PFL).....	398
	6002: NEAR SINGULARITY(PFL)	398
	6003: UNDEFINED SPEED LIMIT(PFL)	398
	6004: ESCAPE FROM CLAMPING ERROR(PFL)	399
	6005: EXTERNAL FORCE ERROR(PFL)	399
	6008: TRQ SENSOR OVERLOAD	400
	6010: CONTROLLER SYNCHRONIZATION ERROR.....	400
	6011: AVOIDANCE FUNC. PARAMETER ERROR	400
	6012: HAND GUIDING PARAMETER ERROR	401
	6013: CANNOT START HAND GUIDING(JOINT).....	401
	6014: CANNOT START HAND GUIDING(XYZ-T).....	401
	6015: CANNOT START HAND GUIDING(RBT)	402
	6016: AVOIDANCE FUNC.RECOVER ERR(IMOV)	402
	6017: HAND GUIDING SUSPEND	402
	6018: ESCAPE FROM CLAMPING SUSPEND	403
	6019: DIRECT TEACHING FAILED	403
	6021: WORK CALIBRATION DATA ERROR	403
	6022: EXTERNAL FORCE ESTIMATION ERROR	404
	6023: AVOIDANCE FUNC. ERR(CONV. SYNC).....	405
	6024: PENDANT COMMUNICATION ERROR	405
	6025: SYNC TARGET CONTROLLER ERR	405
	6027: SERVO AMPLIFIER CMD VALIDITY ERROR	405
	6028: SERVO AMPLIFIER COMM STATUS ERROR	406
	6031: HIGH SPEED ROBOT DATA COMM ERROR.....	406
	6033: NAMED VARIABLE ACCESS ERRER	407
	6036: ROBOT I/F CONNECTION ERROR	408
	6037: MANUAL OPERATION FAILED	408
	6038: EXTERNAL FORCE CONTROL FAILED	409
	6039: GAS PRESS CHECK SETTING ERROR	410
	6044: 1-STEP BACK EXECUTION ERROR	410
	6045: CONTROLLER SYNC INTERFERENCE	410
	6046: PROFINET DISCONNECT FUNC ERROR.....	411
	6047: PROFINET ERROR.....	411
	6048: BACKWARD EXECUTION ERROR.....	412
	6049: AXIS INTERFERENCE	412
	6050: CUBE INTERFERENCE(TCP).....	412
	6051: CUBE INTERFERENCE(ENTIRE).....	413
	6053: PATH GENERATION ERROR(ARITH).....	413
	6054: PATH GENERATION ERROR	413
	6056: DESTINATION CUBE INTF	423
	6057: CC-Link COMMUNICATION ERROR.....	423
	6058: CC-Link IE Field COMM ERROR	424
	6059: DeviceNet COMMUNICATION ERROR.....	424
	6060: CANNOT START HAND GUIDING(ROTATE).....	425
	6061: RECONFIGURE TORQUE SENSOR FAILED	425
	6067: DEST ROUTE ARITHMETIC ERROR	426
	6069: ABSOLUTE ACCURACY ERROR	426
	6070: SYSTEM LIBRARY LOAD ERROR	427
	6071: EtherNet/IP COMMUNICATION ERROR.....	428
	6200: COMBINATION ERROR	428
	6201: INVALID SERVO ON COMMAND ALARM	429
	6202: VIBRATION ALARM	429
	6203: AUTOTUNING ALARM	429
	6204: DYNAMIC BRAKE OVERLOAD	430

6206: INTERNAL TEMPERATURE ERROR 1 (CONTROL BOARD TEMPERATURE ERROR)	430
6207: INTERNAL TEMPERATURE ERROR 2 (POWER BOARD TEMPERATURE ERROR)	431
6208: SERVOPACK BUILT-IN FAN STOPPED	431
6209: DRIVE SERIAL COMMUNICATIONS ERROR	432
6210: POSITION DEVIATION OVERFLOW	432
6211: POSITION DEVIATION OVERFLOW ALARM AT SERVO ON	433
6212: POSITION DEVIATION OVERFLOW ALARM FOR SPEED LIMIT AT SERVO ON	433
6213: MECHATROLINK INTERNAL SYNCHRONIZATION ERROR 1	433
6214: MECHATROLINK TRANSMISSION CYCLE SETTING ERROR	434
6215: MECHATROLINK SYNCHRONIZATION ERROR	434
6216: MECHATROLINK SYNCHRONIZATION FAILED	435
6217: RECEPTION ERROR IN MECHATROLINK COMMUNICATIONS	435
6218: SYNCHRONIZATION INTERVAL ERROR IN MECHATROLINK TRANSMISSION CYCLE	436
6219: MECHATROLINK SYNCHRONIZATION FRAME NOT RECEIVED	436
6220: COMMAND EXECUTION TIMEOUT	437
6221: MAIN CIRCUIT DETECTOR ERROR	437
6223: MAIN CIRCUIT POWER SUPPLY WIRING ERROR	437
6224: MECHATROLINK COMMUNICATIONS SETTING ERROR	438
6225: MECHATROLINK INTERNAL SYNCHRONIZATION ERROR 2	438
6226: CONVERTER INSTANTANEOUS OVERLOAD	439
6227: CONVERTER CONTINUOUS OVERLOAD	439
6228: CONVERTER TEMPERATURE ERROR 1	439
6229: CONVERTER TEMPERATURE ERROR 2	440
6240: DC 24V POWER SUPPLY FAILURE(SERVO)	440
6241: M-SAFETY COMMUNICATE ERROR	440
6242: M-SAF CPU BOARD COMM ERROR	442
6244: EXCEPTION CLAUSE UNDEFINED	442
6245: BRAKE ENABLE FEEDBACK ERROR -LOCK(SERVO)	443
6246: BRAKE ENABLE FEEDBACK ERROR -RELEASE(SERVO)	443
6247: BRAKE HOLDING VOLTAGE COMMAND ERROR	444
6248: MECHATROLINK CYCLIC COMMUNICATION ERROR	445
6249: MECHATROLINK COMMUNICATION ERROR	445
6250: SIMULTANEOUS EXECUTION ERROR	446
6251: SINGULAR POINT ERROR DURING FORCE CONTROL	446
6253: CALCULATED TORQUE SATURATION ERROR(SERVO)	447
6254: CALCULATED VELOCITY SATURATION ERROR(SERVO)	447
6255: BRAKE CONTROL BOARD RELAY ERROR(SERVO)	448
6256: INPUT POWER SUPPLY SETTING ERROR(SERVO)	448
6259: ACU CONNECTION ERROR	449
6260: ACTIVE FORCE CONTROL SET ERROR	449
6261: ACTIVE FORCE CONTROL CANCEL ERROR	450
6262: SIGMA LINK2 SAFETY ENCODER PROCESS ERROR	450
6263: M-SAF GP.INPUT SIG. ERROR	451
6264: M-SAF GP.INPUT DIAG. ERROR	451
6265: DEST INTERPOLATION INVALID	452
6273: TORQUE SENSOR OVER LOAD	452
6276: Excessive load at emergency stop	452
6277: OSCILATION DETECTION	452
6278: SEGMENT PULSE DETECTED DURING HAND GUIDING	453
6280: PASSIVE FORCE CONTROL SET ERROR	453
6281: PASSIVE FORCE CONTROL CANCEL ERROR	453
6282: HAND GUIDING SET ERROR	454
6283: HAND GUIDING CANCEL ERROR	454
6286: MotoPlus memory access error	454
6287: ENCODER SAFE ADDRESS SETTING ERROR	455
6290: ROBOT MODEL MISMATCH(SV)	455

6291: COMPENSATION CALC ERROR	455
6292: PFL CANNOT OPERATE TEMP DSBL	455
6297: SENSOR MODE SELECT ERROR	455

Before Using the Product

i.1	Introduction to This Manual.....	16
i.2	Notes for Safe Operation	18
i.3	Using This Manual.....	34

i.1 Introduction to This Manual

This manual describes the relevant functions of the robot controller given in the title.

The robot controller is composed of multiple devices that have a wide variety of functions. Read this manual together with the manuals for the options and peripheral devices that make up the robot system in the relevant equipment or facility.

[Important]

- Read and understand this manual to ensure the correct usage of the product.
- Keep this manual in a safe place so that it can be referred to whenever necessary.
- Assume that items not described in this manual are either prohibited or not possible. General items related to safety are described in "Notes for Safe Operation" in this manual. Carefully read and understand these instructions and use the product correctly.


◆ Applicable Products

This manual provides information on the following robot controllers.

Applicable Manipulators	Specification	Robot Controller Type
MOTOMAN NEXT-NEX4 MOTOMAN NEXT-NEX7 MOTOMAN NEXT-NEX10	Specification for Japan	ERXR-1000-06VX10-A00
	Specification for Europe and North America	ERXR-1000-06VX10-G00
MOTOMAN NEXT-NEX20	Specification for Japan	ERXR-1000-06VX35-A00
	Specification for Europe and North America	ERXR-1000-06VX35-G00
MOTOMAN NEXT-NEX35	Specification for Japan	ERXR-1000-06VX35-A00
	Specification for Europe and North America	ERXR-1000-06VX35-G00
MOTOMAN NEXT-NHC12	Specification for Japan	ERXR-1000-06VXC12-A00
	Specification for Europe and North America	ERXR-1000-06VXC12-G00

◆ Nameplate

The nameplate is attached to the robot controller in the following location. The nameplate lists basic information about the product.

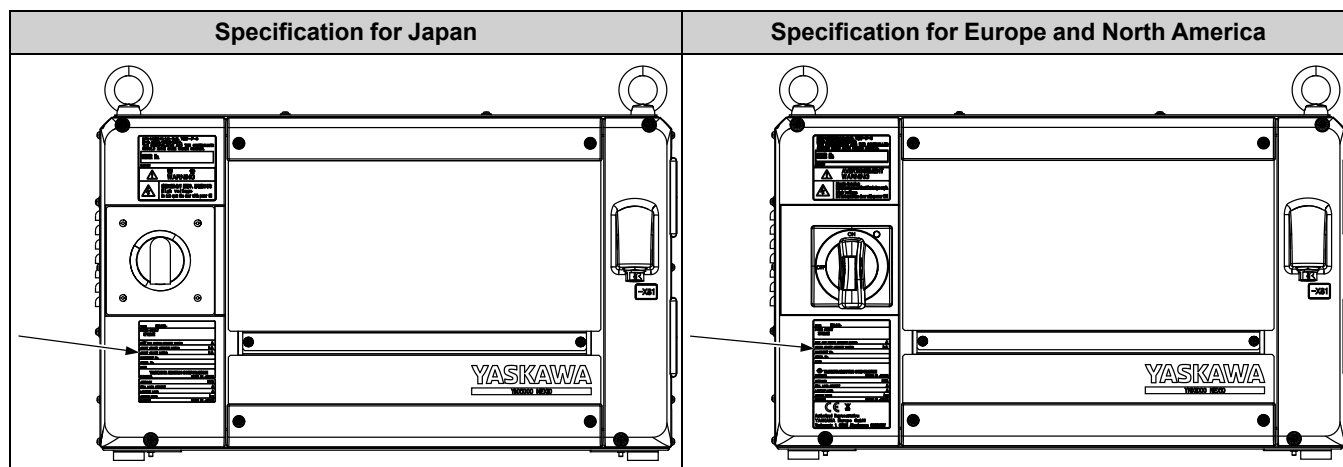

◆ Intended Audience

The following people are the intended audience for this manual.

- Managers and safety management supervisors
- Robot system designers
- Robot system programmers
- Robot system maintenance personnel
- Robot system users

◆ Related Manuals

Category	Manual Name	Manual No.
Manipulator	MOTOMAN NEXT-* Instructions ^{*1}	-
Robot controller	YNX1000 Instructions	RE-CTO-A226
	YNX1000 Quick Start Guide	HW2481225
	YNX1000 Instructions for Block Language	RE-CKI-A472
	YNX1000 Instructions for Concurrent I/O	RE-CKI-A473
	YNX1000 Maintenance Manual	RE-CHO-A118
	YNX1000 Alarm Codes	RE-CER-A603
	YNX1000 Instructions for Collaborative Operation	HW2403011
	YNX1000 Instructions for Functional Safety Function	HW2481604
	MOTOMAN NEXT Notes for Safe Operation	R-AN-A312
ACU application development environment	YNX1000 Instructions for Autonomous Control Unit	HW2481239
	YNX1000 Autonomous Control Unit Quick Start Guide for Application Development	HW2481227
	YNX1000 Autonomous Control Unit API Reference Manual for Robot Control Service	HW2481229
	YNX1000 Autonomous Control Unit Instructions for Machine Vision Service	HW2481231
	YNX1000 Autonomous Control Unit API Reference Manual for Machine Vision Service	HW2481233
	YNX1000 Autonomous Control Unit Instructions for Force Control Service	HW2481235
	YNX1000 Autonomous Control Unit API Reference Manual for Force Control Service	HW2481237
	YNX1000 Autonomous Control Unit API Reference Manual for AI Service	HW2481364
	YNX1000 Autonomous Control Unit API Reference Manual for Path Planning Service	HW2481368
	YNX Robot Simulator Operator's Manual	HW2481790
Options	YNX1000 Option Instructions for Conveyor Synchronization Function	HW2481333
	YNX1000 Option Instructions for EtherNet/IP Communications Function (For CM-EI01M)	HW2481642
	SLIO I/O Series Digital Input/Output Module Product Manual ^{*2}	-
	SLIO I/O Series Power Module / Power Distribution Module Product Manual ^{*2}	-

*1 Refer to the instructions for your manipulator.

*2 SLIO I/O series product manuals can be downloaded from the following website.

https://www.yaskawa.eu.com/products/plc-control-systems/seriesdetail/serie/slio_1447

i.2 Notes for Safe Operation

◆ Safety Information

Read this manual carefully before installation, operation, maintenance, or inspection of your product. In this manual, the Notes for Safe Operation are classified as “DANGER”, “WARNING”, “CAUTION”, or “NOTICE”.

DANGER

Indicates an imminently hazardous situation which, if not avoided, will result in death or serious injury. Safety Signs identified by the signal word DANGER should be used sparingly and only for those situations presenting the most serious hazards.

WARNING

Indicates a potentially hazardous situation which, if not avoided, will result in death or serious injury. Hazards identified by the signal word WARNING present less risk of injury or death than those identified by the signal word DANGER.

CAUTION

Indicates a hazardous situation, which if not avoided, could result in minor or moderate injury. It may also be used without the safety alert symbol as an alternative to “NOTICE”.

NOTICE

NOTICE is the preferred signal word to address practices not related to personal injury. The safety alert symbol should not be used with this signal word. As an alternative to “NOTICE”, the word “CAUTION” without the safety alert symbol may be used to indicate a message not related to personal injury.

◆ Visual Aids

The following aids are used to indicate certain types of information for easier reference.

- **[Important]**
Indicates precautions or restrictions that must be observed. Also indicates alarm displays and other precautions that will not result in machine damage.
- **[Term]**
Indicates definitions of difficult terms or terms that have not been previously explained in this manual.
- **[Information]**
Indicates supplemental information to deepen understanding or useful information.

◆ Important Safety Precautions

■ Overall Precautions

DANGER

This manual contains important information in order to use the product safely and correctly. A robot typically has characteristics that make it superior to other types of machinery: a wide range of motion when compared to its installation area, high-speed and high-output arm motion, and varied, autonomous operations. However, these characteristics also involve risks not found in typical machinery.

Before using the product (e.g., installation, operation, inspection, and maintenance), carefully read this manual, as well as all relevant instruction manuals and included documentation, and carefully study the information on devices, safety, and precautions. Afterward, make sure to use the product safely and correctly. Refer to "[Related Manuals on page 17](#)" for the relevant instruction manuals and confirm that they are readily accessible. If any manuals are missing, contact your YASKAWA representative.

Be sure to understand the residual risks shown on the warning labels before using this product. Do not remove any covers, cables, connectors, or optional devices while the product is powered.

There is a risk of electrical shock, termination of product operation, or burnout.

WARNING

An experienced engineer must install this product in an appropriate manner.

There is a risk of electrical shock or injury.

When starting operation with the product connected to the machine, make sure an emergency stop can be performed at all times.

There is a risk of injury.

If a momentary power interruption occurs during operation and then the power is restored, the product may restart operation suddenly. In this case, keep away from the machine. Implement measures that can ensure the safety of workers if the product restarts operation.

There is a risk of injury.

Do not touch the interior of the product under any circumstances.

There is a risk of electrical shock.

Do not damage cables, pull on cables with force, apply excessive force to cables, place heavy objects on cables, or crush cables.

There is a risk of electrical shock, termination of product operation, or burnout.

Use the product with the appropriate power supply specifications (AC, number of phases, voltage, and frequency).

There is a risk of burnout, electrical shock, or fire.

Do not disassemble, repair, or modify the product.

There is a risk of fire or failure. The warranty is not applicable to a product that has been disassembled, repaired, or modified.

■ For Ensuring Safety

Make sure to observe the national, municipal, and other laws and regulations related to safety and hygiene shown below.

DANGER

Robot teaching and maintenance should conform to the following laws and regulations: (Japan only)

- Industrial Safety and Health Act
- Order for Enforcement of Industrial Safety and Health Act
- Ordinance on Industrial Safety and Health
- Technical Standards for Electrical Facilities

The business operator (user) must create a manual of safe working procedures based on specific safety management guidelines according to all relevant laws and regulations and abide by these procedures.

Follow the requirements provided in "JIS B 8433-1: 2015 (ISO 10218-1:2011) Industrial robots: Safety requirements" to ensure robot safety. (Japan only)

Create a safety management system, such as by deciding on a designated worker and safety manager for the robot and ensuring that workers receive comprehensive safety training.

Robot teaching and maintenance correspond to dangerous work as specified in the Industrial Safety and Health Act (Japan only).

Workers employed to perform this dangerous work must attend special training for safety at YASKAWA.

■ Special Education

DANGER

Personnel who perform robot operation and administration must receive robot operation and maintenance training according to the following items (Japan only).

- Industrial Safety and Health Act, Chapter 6, Article 59, Section 3: Before assigning a worker to dangerous or hazardous operations, an employer must educate that worker in safety or health as it relates to the operations.
- A worker must attend and complete special education for industrial robot operation (e.g., teaching) and maintenance/repair (e.g., inspection) that corresponds to the following dangerous or harmful operation.

- Ordinance on Industrial Safety and Health, Chapter IV, Article 36 (Work Necessitating Special Education))

No. 31: Special Education Pertaining to the Work of Giving Instructions, Etc. to Industrial Robots

No. 32: Special Education Pertaining to the Work of Inspection, etc. of Industrial Robots ("Inspection, etc. of Industrial Robots" means the inspection, repair, and adjustment of industrial robots.)

MOTOMAN operation and maintenance training is provided at four locations in Japan. ("MOTOMAN operation and maintenance training" corresponds to "special education" as described in the Industrial Safety and Health Act (Japan only).)

- Kanto region (Saitama and Iruma, Saitama Prefecture)
- Chubu region (Miyoshi, Aichi Prefecture)
- Kansai region (Amagasaki, Hyogo Prefecture)
- Kyushu region (Kitakyushu, Fukuoka Prefecture)

Contact your YASKAWA representative for more information.

■ Safety Precautions for Workers

The manipulator moves through space, which means the space in its range of motion is considered a hazardous area in which there is a risk of an unforeseen accident. The safety manager and workers involved in the installation, operation, and maintenance of the manipulator must consider safety to be their first priority. This includes safety of related personnel and other people in addition to their own safety.

⚠ WARNING

Avoid hazardous actions in the area around the manipulator, such as entering the range of motion in a careless manner.

There is a risk of injury from contact with the manipulator and peripheral devices.

Always observe the instructions on safety signage in the factory, such as "NO OPEN FLAME," "HIGH VOLTAGE," "DANGER," and "AUTHORIZED PERSONNEL ONLY."

There is a risk of fire, electrical shock, or injury from contact with the product.

Make sure to observe the following items on clothing as a measure to prevent hazards.

- **Wear appropriate work clothes.**
- **Do not wear gloves when operating the manipulator because there is a risk of making mistakes in operation.**
- **Do not allow loose clothing (e.g. t-shirts, neckties, etc.) to stick out of work clothes.**
- **Do not wear jewelry or accessories, such as particularly large earrings or necklaces.**
- **Make sure to wear safety and protective equipment, such as safety shoes and a helmet.**


Inappropriate clothing is a cause of accidents.

Create a rule to keep workers other than the operator away from the installation site of the manipulator and have all workers follow that rule.

There is a risk of injury from contact with the manipulator, operation panel, workpiece, jig, or other equipment.

Do not force the manipulator to move, hang off the manipulator, or ride on the manipulator.

There is a risk of injury or equipment damage.

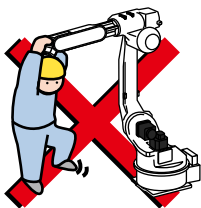

Do not stand, sit, or place heavy objects on the top side of the robot controller.

The top cover of the robot controller may be crushed and there is a risk of injury on protruding internal parts or product damage.

Do not accidentally press the switches and buttons on the robot controller, jig control panel, operation panel, and other equipment.

The manipulator may move in an unexpected manner, and there is a risk of injury or equipment damage.

⚠ WARNING

Only the predetermined worker in charge who has received special training may use the robot controller and pendant when the product is powered. Keep other workers from touching the robot controller and pendant.

The manipulator may move in an unexpected manner, and there is a risk of injury or equipment damage.

Ready the pendant or brake release unit in the work area so that the target axes of the manipulator can be moved without driving power to free it from a hazardous state in an emergency (e.g., a person is pinched, crushed, or trapped by the manipulator) or when there is an error.

Refer to "Brake Release" in "YNX1000 Instructions (RE-CTO-A226)" for the method to release the brakes using the pendant.

Refer to "How to manually release the brakes on the manipulator" in "YNX1000 Maintenance Manual (RE-CHO-A118)" for the method to release the brakes using the brake release unit.

■ Precautions during Storage and Transportation

⚠ DANGER

When the pendant is not being used, store it in an appropriate manner so it is clear the pendant is no longer connected to the robot controller.

(For example, store the pendant in a separate location away from the robot controller and manipulator.)

There is a risk of injury or equipment damage because the manipulator cannot be stopped during an emergency if the emergency stop button on the unconnected pendant is pressed by mistake.

⚠ WARNING

Transportation tasks that involve a sling, operating a crane or forklift, and other similar work must be performed by workers who have acquired the relevant national qualifications or workers approved by that company.

There is a risk of injury or equipment damage.

Transport the product in the correct manner according to its mass. Refer to the product instructions for the transportation methods.

There is a risk of injury or equipment damage.

As a basic rule, use a crane when transporting a heavy object (e.g., manipulator or robot controller).

- **Use the eye bolts or shipping brackets as specified in the product instructions, and hoist the product with a sling that has the specified number of legs.**
- **Check the mass of the product and select a sling suited to the mass before transport.**
- **Check that the eye bolts are fastened beforehand.**

There is a risk of injury or equipment damage from the product being dropped or falling over during transport.

Secure the manipulator with the shipping brackets and hoist it in the shipping posture listed in the instructions for each manipulator model.

There is a risk of injury or equipment damage from the manipulator falling over during transport.

If temporarily placing the manipulator in a location before installation, make sure it is done so in stable condition. Take measures so that unrelated personnel do not touch the manipulator, such as by posting an observer.

There is a risk of injury from the product falling over.

NOTICE

Transport the product so that it is not exposed to excessive vibration or shock.

Performance will be affected because this product is a precision machine.

Do not expose the connectors to shock.

There is a risk of a faulty connection or failure.

■ Precautions during Installation

Refer to the instructions for your manipulator together with this manual for information on installation and wiring. Perform all installation, wiring, and piping work by thinking about emergencies. Be careful not to allow cables and hoses to be crushed, and use caution so as not to trip over cables and hoses. In addition, install the manipulator, jig, and other equipment in a highly-visible and easy-to-operate location for safe operation.

[Important]

Article 150 of the Ordinance on Industrial Safety and Health mandates that the employer must take necessary measures, such as providing a railing or enclosure, to prevent workers from getting close to the manipulator and other equipment when there is a risk of contact during automatic operation of an industrial robot.

To prevent equipment damage and injury to workers and others during manipulator operation, make sure to install a safety fence that complies with (JIS B 9700 (ISO 12100) / JIS B 9716 (ISO 14120)).

When designing a robot system in which a worker and a robot perform collaborative work without installing a safety fence, a sufficient risk assessment must be conducted to prevent damage to equipment and to prevent accidents to the worker and other people in the surrounding area during manipulator operation (JIS B 8433-2 (ISO 10218-2)).

⚠ DANGER

Install a safety fence around the manipulator and ensure that workers cannot easily get close to the manipulator when it is powered. In addition, hang warning signage at the entrance/exit of the safety fence, such as "ENTRY PROHIBITED DURING OPERATION."

At the entrance/exit of the safety fence, install a safety plug that turns OFF the servo power when the door is opened, and make sure to check that the servo power turns OFF by pulling the safety plug before the start of operation.

For locations where a safety fence is not installed, have the manipulator stop when a worker enters the area of operation by using a device such as a phototube or light curtain.

There is a risk of a serious accident from contact with the manipulator.

⚠ WARNING

Select the following kind of location as the installation site for the manipulator.

- **A location where the tip of the tool or workpiece will not touch walls, the safety fence, the robot controller, or any other objects when the manipulator arm is fully extended while holding a workpiece.**

There is a risk of injury or equipment damage from contact with the manipulator.

Clearly identify the maximum range of motion of the manipulator, including the tip of the tool or workpiece, with a line or by changing the color of the floor.

Do not supply power and operate the manipulator unless it has been fixed to an object.

The manipulator may fall over and cause injury or damage.

For the ceiling-mounted and wall-mounted installation methods, secure the manipulator to a ceiling or wall with sufficient strength and rigidity. In addition, implement measures on the manipulator base part to prevent the manipulator from falling in case of an accident.

There is a risk of injury or damage.

⚠ WARNING

To install the manipulator, use the types and sizes of bolts described in the instructions for each manipulator model.

There is a risk of injury or equipment damage from the manipulator falling over.

Do not install or operate the manipulator when damaged or with missing parts.

There is a risk of injury or damage due to malfunction.

Make sure there is room to perform maintenance on the manipulator, robot controller, and other peripheral devices.

There is a risk of an unforeseen injury during maintenance.

Install the robot controller that operates the manipulator and the jig operation panel in a location where the movement of the manipulator can be easily seen and where the manipulator can be safely operated.

There is a risk of injury from mis-operation or other reasons.

Install the robot controller outside the safety fence for the manipulator.

There is a risk of injury from contact with the manipulator.

After the robot controller is installed, fix it to a secure object, such as the floor or a pedestal.


There is a risk of injury or equipment damage from the robot controller falling over.

Place cables and hoses for the robot controller, manipulator, peripheral devices, jig operation panel, and other devices in a pit so they are not directly exposed to workers, forklifts, or other equipment.

There is a risk of fall accidents from tripping over cables and hoses.

A cable break may also cause the manipulator to move in an unexpected manner, and there is a risk of injury or accident.

There is a risk of fire or electrical shock due to a cracked cable sheath or broken cable.

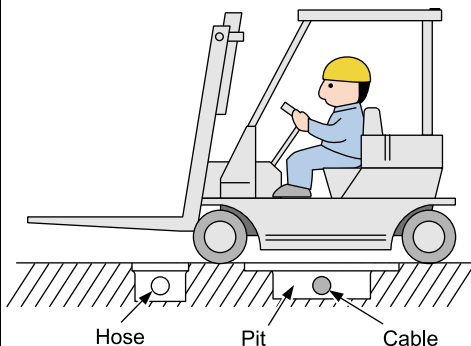

⚠ CAUTION

Do not block the air intake or exhaust ports. Do not allow foreign matter to get inside the product.

There is a risk of deterioration in the internal elements of the products, causing fire or failure.

NOTICE

Use the product in an environment that satisfies its specifications.

There is a risk of failure or damage if the product is used in an environment that exceeds its specifications.

After the manipulator is installed, make sure to remove the shipping brackets before turning ON the power supply for the first time.

There is a risk of damage to the main drive parts.

■ Precautions during Wiring

DANGER

Do not modify the wiring when the product is powered.

There is a risk of electrical shock or injury.

WARNING

Always ground the product. Additionally, protect the ground wire along its entire length to keep it safe from mechanical damage by placing it in a protective cover, duct, or other protective material.

There is a risk of fire or electrical shock.

Ground the product in accordance with all relevant local and national electrical codes.

There is a risk of electrical shock or fire.

Always turn OFF the power supply and tag out the system (e.g., using a "DO NOT POWER" sign) before maintenance, inspection, and wiring work.

There is a risk of electrical shock or injury.

When power is supplied, always attach the protective cover to the breaker, and attach the front panel of the robot controller back in its original location.

There is a risk of fire or electrical shock.

The user is responsible for wiring the emergency stop circuits. Always check the operation of the circuits after they are wired.

There is a risk of injury or failure.

Wiring and inspection must be performed by a specialized engineer.

There is a risk of electrical shock or product failure.

Connect the product to a power supply that satisfies the ratings.

There is a risk of fire or failure.

Ensure that the screws for the main circuit terminals and control circuit terminals are tightened in an appropriate manner.

There is a risk of fire or electrical shock.

Carefully study the connection diagrams before wiring the products, and connect the products according to those connection diagrams.

There is a risk of equipment damage from incorrect wiring or injury from the manipulator and machinery moving in an unexpected manner.

NOTICE

Do not directly touch the circuit boards with your fingers.

The ICs may fail due to static electricity.

■ Safety at the Work Site

Deficiencies at the work site may cause serious accidents.

To ensure safety, carefully manage and implement measures for the following items.

⚠ DANGER

When the manipulator and robot controller are first commissioned, confirm the following items: the correct operation of safety protection devices (e.g., emergency stop circuits and safety plug), the correct operation of each axis in teach mode, the correct operation of the manipulator at the speed limits (control point and flange speeds are 250 mm/s or less) in teach mode, and the correct operation of the teaching and playback functions.

The manipulator may stop because it is waiting for certain conditions to be satisfied, even during operation. In these cases, the manipulator moves immediately when those conditions are satisfied, so it is dangerous to get close to the manipulator in a careless manner just because it has stopped.

Implement measures to clearly indicate that the manipulator is in operation, such as with an indicator lamp and alarm, so that the operator can take action to stay away from the manipulator or to stop the manipulator if a worker gets too close.

Install a safety fence around the manipulator and ensure that workers cannot easily get close to the manipulator when it is powered. In addition, hang warning signage at the entrance/exit of the safety fence, such as "ENTRY PROHIBITED DURING OPERATION."

At the entrance/exit of the safety fence, install a safety plug that turns OFF the servo power when the door is opened, and make sure to check that the servo power turns OFF by pulling the safety plug before the start of operation.

For locations where a safety fence is not installed, have the manipulator stop when a worker enters the area of operation by using a device such as a phototube or light curtain.

There is a risk of a serious accident from contact with the manipulator.

⚠ CAUTION

Always store tools and other materials in a safe location outside the range of motion of the manipulator.

If tools or other materials are carelessly left in a location such as on the manipulator, jig, or floor, there is a risk of damage to the manipulator and jig from accidental contact.

When working in a dark environment, add appropriate lighting.

■ Precautions during Operation**⚠ DANGER**

When performing inspection, maintenance, wiring and connection work, when mounting the tool, and performing other work, first turn OFF the power supply to the robot controller and the tool, and lock the handles so that unauthorized personnel cannot inadvertently turn ON the power supply.

In addition, hang a "DO NOT POWER" sign.

If power is supplied accidentally during work, there is a risk of electrical shock or the manipulator moving in an unexpected manner and causing injury.

Do not use products outside the ranges listed in specifications in the instructions.

There is a risk of injury or equipment damage if products are used outside the ranges listed in the specifications.

Work in teach mode should be performed when personnel are outside the safety fence as much as possible.

As a general rule, work in teach mode should be performed outside the range of motion of the manipulator.

⚠ DANGER

Observe the following items if the manipulator must be taught inside its range of motion.

- Pull out and carry the safety plug when entering the inside of the safety fence. Or tag out the system by hanging a sign that indicates the programmer is operating the manipulator inside the safety fence and warn other people not to close the safety fence.
- Make sure to always view the manipulator from the front direction.
- Follow the predetermined operating procedures.
- Always think about how to respond to danger if the manipulator suddenly moves in your direction.
- Ensure there is a safe place to retreat in a worst case scenario. Limiting the motion of the manipulator by using the interference area function or another function is recommended to prevent the manipulator from entering the safe place to retreat.

There is a risk of injury from mis-operation and the manipulator moving in a manner the programmer does not intend.

Before manipulator operation, perform the following operations and confirm that the servo power turns OFF. If the servo power is turned OFF, [SERVO] is displayed in blue at the top of the screen on the pendant.

- Press the emergency stop button on the pendant and all other external operation devices. (Equipping the robot controller with an emergency stop button is available as an option.)
- Pull out the safety plug on the safety fence. (For play mode and remote mode)

There is a risk of injury or equipment damage if the manipulator cannot stop in an emergency.

Emergency Stop Button



Resetting the Emergency Stop State



Before starting a job in play mode, reset all safety protection devices to the active state.

When performing the following work, confirm that there are no people in the range of motion of the manipulator and perform the work from a safe area.

- When turning ON the power supply to the robot controller.
- When moving the manipulator with the pendant.
- When performing check mode operation.
- When performing automatic operation.

If a person carelessly enters the range of motion of the manipulator, there is a risk of injury from contact with the manipulator.

⚠ DANGER

Press the emergency stop button as quickly as possible when there is a problem.

The emergency stop button is equipped on the pendant adapter. (Equipping the robot controller with an emergency stop button is available as an option.)

If the pendant screen is not lit, the emergency stop button on the pendant adapter may be disabled.

If the emergency stop button on the pendant adapter is disabled, press the external emergency stop button.

- **Confirm the state of the pendant by tapping its screen.**
- **If the following error message is displayed on the pendant screen, the pendant cable is not connected, and there is a risk that the manipulator will not stop when the emergency stop button on the pendant adapter is pressed.**



Cannot Communicate with the Controller



SHOW ALL



Communication with the controller timed out. Please check the controller connection.

⚠ WARNING

Before performing teaching work for the manipulator, inspect the items listed below. If a problem is discovered, immediately correct the problem or take other necessary corrective actions.

- **Are there problems in the operation of the manipulator?**
- **Is there damage to the insulation and sheathing of external wires?**

Always return the pendant to its designated location after use.

If the pendant is carelessly placed in a location such as on the manipulator, jig, or floor, the uneven surface may activate the enable switch and turn ON the servo power. In addition, if the manipulator moves, there is a risk that the manipulator or the tool may crush the pendant, hurt a worker, or damage other devices.

After the following work, always perform initial operation at low speed and confirm there are no abnormal noises, vibrations, or abnormal movements.

- **Manipulator installation**
- **Change in part**
- **Change in teaching**
- **Change in the robot system, such as due to changing the tool or a peripheral device**

If a problem occurs, immediately turn OFF the power supply to the robot controller and contact the safety manager.

■ Precautions during Maintenance and Inspection

⚠ DANGER

Do not modify the wiring when the product is powered.

There is a risk of electrical shock or injury.

⚠ WARNING

Wiring and inspection must be performed by a specialized engineer.

There is a risk of electrical shock or product failure.

■ Precautions When Moving, Transferring, or Selling the Product

When moving, transferring, or selling the product, make sure to observe the following items for safety.

DANGER

When moving, transferring, or selling the product, always include the manuals and make sure they are delivered to the end user of the product.

Refer to "[Related Manuals on page 17](#)" for the manuals included with the product.

Contact your YASKAWA representative if any manuals are missing.

Clean warning labels affixed to the manipulator and other products when dirty. If a warning label has peeled off, replace it with a new one in the same spot. Warning labels are available from your YASKAWA representative.

When the robot system that includes this product is moved, inspection by your YASKAWA representative is recommended.

There is a risk of injury or equipment damage from incorrect installation or wiring of devices.

■ Precautions during Disposal

In Japan, dispose of this product in an appropriate manner according to the local or regional ordinances of the location where the manipulator is used. Outside of Japan, dispose of this product according to the relevant national laws and regulations. As necessary, label or provide notification regarding disposal on the final product.



⚠ DANGER

Do not modify the product.

There is a risk of fire, failure, or injury and equipment damage from malfunction.

⚠ WARNING

Take measures to keep the manipulator from falling over, even when it is placed in a temporary location as waste.

There is a risk of injury from the manipulator falling over.

NOTICE

Dispose of used batteries according to all relevant local rules.

■ Safety Functions in This Product

This product has the safety functions listed below.

Note:

Equipping the robot controller with an emergency stop button is available as an option.

- Emergency stop button input (robot controller/pendant)
- Enable switch input (pendant)
- Safety fence interlock signal input (safety plug)
- External emergency stop button input
- Safety logic circuits

These safety functions comply with the following safety standards:

- EN ISO 13849-1: 2015 Cat.3/PLc
- IEC 61508 SIL3

The following functions are available as functional safety functions: ^{*1}

- Robot range limit
- Axis range limit
- Speed limit
- Axis speed monitor
- Tool angle monitor
- Tool change monitor
- Tool number select

In addition, when using a Collaborative AI Robot, the following function is available as safety functions for collaborative operation: ^{*2}

- PFL (Power and Force Limiting) function

These functional safety functions comply with the following safety standards:

- EN ISO 13849-1: 2015 Cat.3/PLd
- IEC 61508 SIL 2

Note:

The functional safety function can continue to be used even when collaborative operation is disabled.

The user must conduct a risk assessment before using this product.

The following table lists the expected usage frequency for switches used in the safety functions.

Switch Type	Usage Frequency
Emergency stop button	500 times per year
Enable switch (pendant)	2000 times per year

*1 Refer to the following manual for details on functional safety function.

YNX1000 Instructions for Functional Safety Function (HW2481604)

*2 Refer to the following manual for details on collaborative operation.

YNX1000 Instructions for Collaborative Operation (HW2403011)


■ General Precautions


- Figures provided in this manual are typical examples or conceptual representations. There may be differences between them and actual wiring, circuits, and products.
- The products shown in illustrations in this manual are sometimes shown with their covers or protective guards removed to illustrate detail. Always install all covers and protective guards before the product is used.
- If a new copy of this manual is required because it has been lost or damaged, contact your nearest YASKAWA representative or one of the offices, and inform them of the manual number.
- This manual is subject to change without notice for product improvements, specifications changes, and improvements to the manual itself. The manual number of this manual will be updated and revisions issued when changes are made.
- Any and all quality guarantees provided by YASKAWA are null and void if the customer modifies the product in any way. YASKAWA disavows any responsibility for damages or losses that are caused by modified products.

◆ Warning Label Attachment Locations

This section describes the safety symbols on the warning labels that are attached to the product. Be careful of the residual risks shown on the warning labels.

■ Front Side of Robot Controller

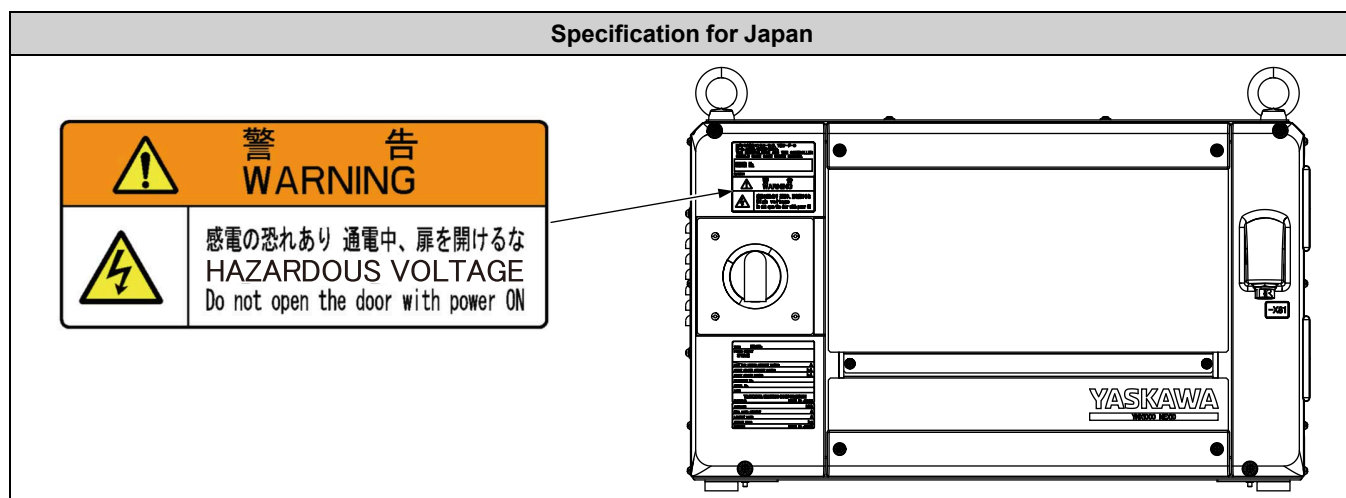


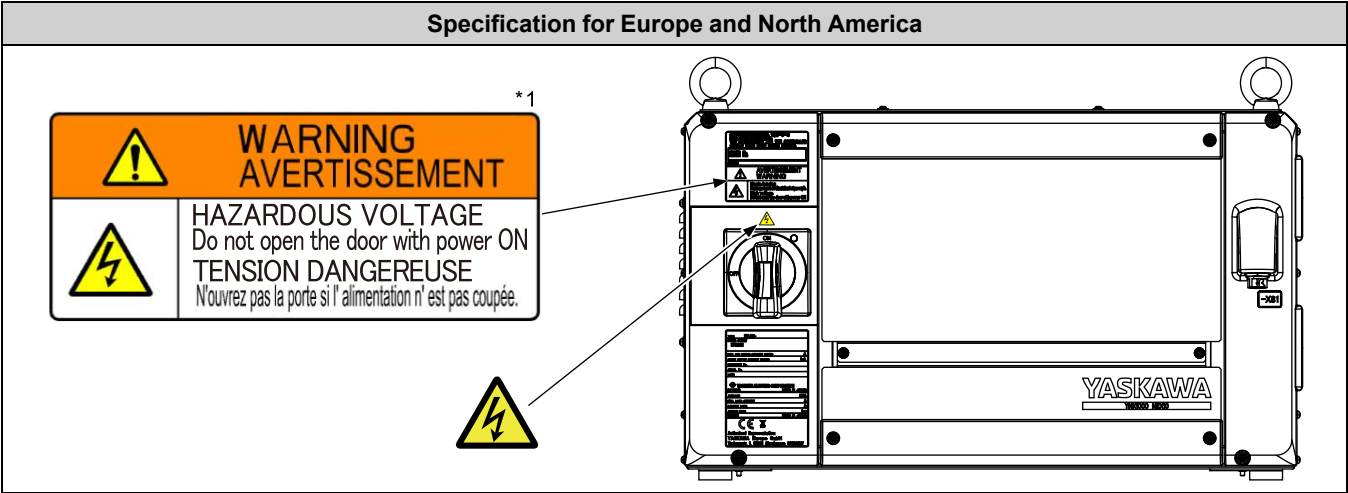

*1 Affixed to products shipped to North America.


■ Breaker and Protective Grounding Terminal inside Robot Controller

Specification for Japan

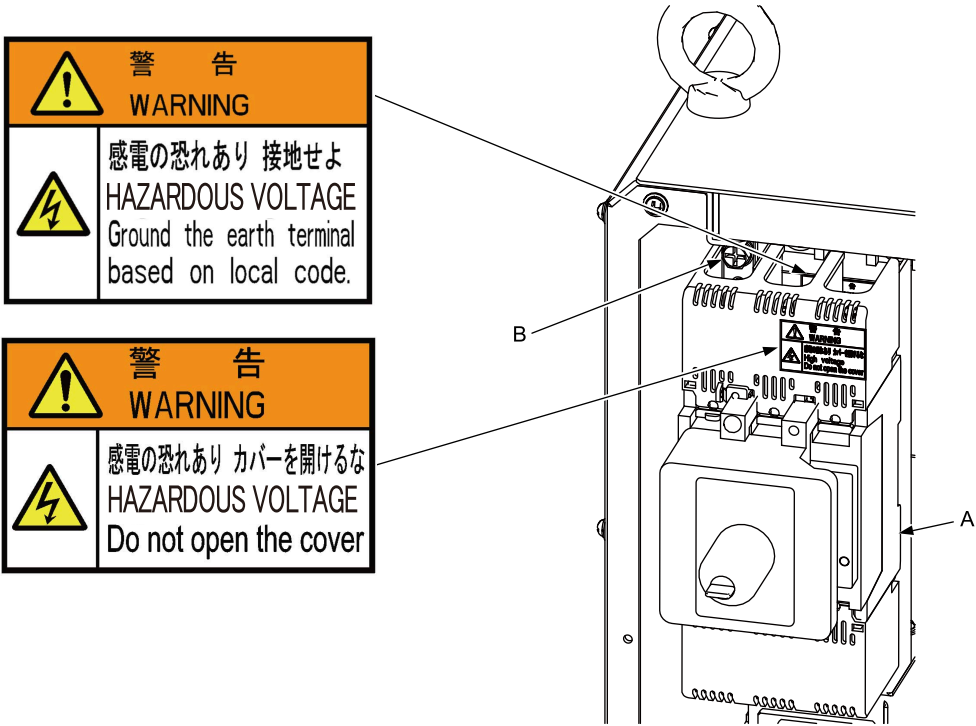

A	Breaker	B	Protective grounding terminal
---	---------	---	-------------------------------

Specification for Europe and North America

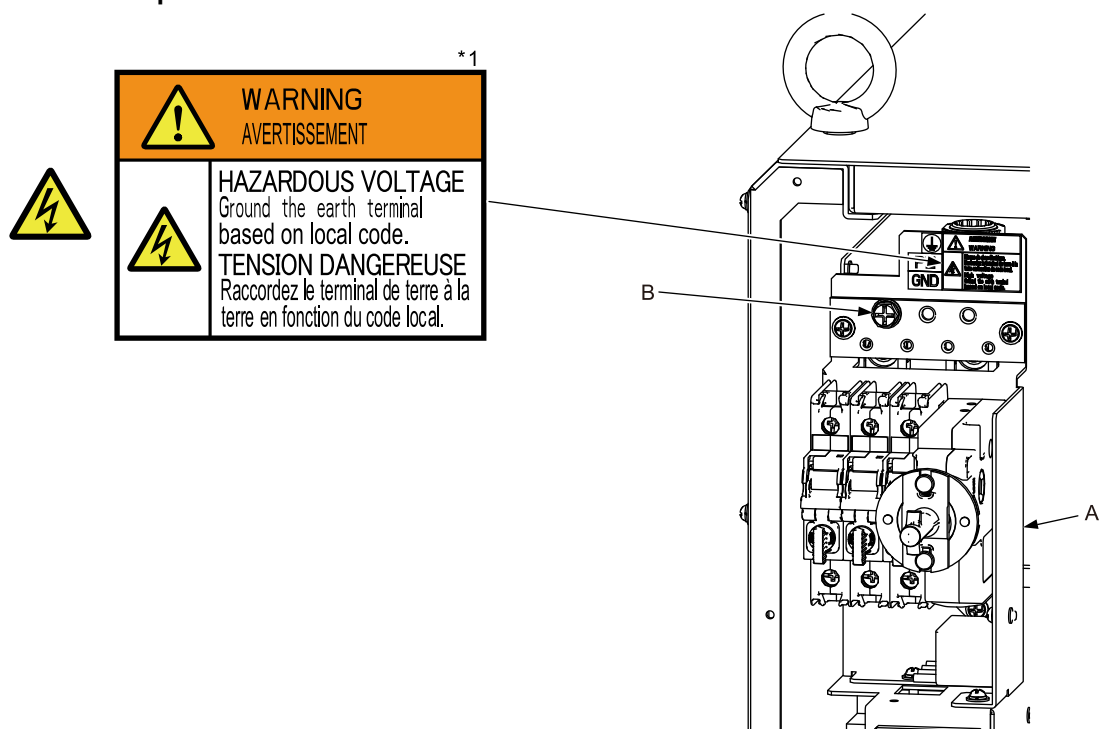

*1 Affixed to products shipped to North America.

A	Disconnect switch with fuse	B	Protective grounding terminal
---	-----------------------------	---	-------------------------------

i.3 Using This Manual

◆ Terms

"MOTOMAN NEXT" is the product name for industrial robots manufactured by YASKAWA.

MOTOMAN NEXT consists of a manipulator, a robot controller, a pendant, and a manipulator cable. Interpret the devices described in this manual as shown below.

Device	Name in This Manual
YNX1000 robot controller or control panel	Robot controller
Tablet-style pendant for the YNX1000	Pendant
Arm composed of multiple joints	Manipulator
Cable between the manipulator and the YNX1000	Manipulator cable

◆ Terms for Pendant Operation

This product uses a general-purpose tablet as the programming interface.

The following terms are used in the descriptions of operations in this manual.

Term	Description
Tap	Touching your finger lightly on a menu or icon displayed on the screen. This is equivalent to clicking the mouse on a personal computer.
Long press	Pressing and holding your finger on a menu or icon displayed on the screen for an extended length of time. Use this operation to display the sub menu of a detailed setting and to move an icon. Note: The pendant does not need to be pressed with force. Simply place your finger on the screen.
Drag	Sliding your finger around the screen while touching an icon displayed on the pendant. Release your finger at the desired position to complete the operation.

◆ Trademarks

The product names and company names used in this manual are the trademarks or product names of the respective company. TM and the ® mark do not appear with the trademarks of companies in this manual.

Alarm List

1.1	Alarm Number (4000 to 4999)	36
1.2	Alarm Number (6000 to 6999)	398

1.1 Alarm Number (4000 to 4999)

◆ 4000: MEMORY ERROR(TOOL FILE)

An error was detected at memory check.
The memory for the tool file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Tool number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the tool file in maintenance mode, and then load the tool file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4001: MEMORY ERROR(USER COORD FILE)

An error was detected at memory check.
The memory for the user coordinates file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: User coordinate number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the user coordinates file in maintenance mode, and then load the user coordinates file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4002: MEMORY ERROR(SV MON SIGNAL FILE)

An error was detected at memory check.

The memory for the servo monitor signal file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the servo monitor signal file in maintenance mode, and then load the servo monitor signal file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4003: MEMORY ERROR(WEAVING FILE)

An error was detected at memory check.

The memory for the weaving condition file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Page number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the weaving condition file in maintenance mode, and then load the weaving condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4004: MEMORY ERROR(HOME POS FILE)

An error was detected at memory check.

The memory for the home positioning file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the home positioning file in maintenance mode, and then load the home positioning file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4005: MEMORY ERROR(SECOND HOME POS)

An error was detected at memory check.

The memory for the second home position file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the second home positioning file in maintenance mode, and then load the second home positioning file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4011: MEMORY ERROR(FILE DATA)

An error was detected at memory check.

Sub Code	Meaning	Cause	Remedy
16	The memory for the tool file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the tool file in maintenance mode, and then load the tool file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	The memory for the user coordinate file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the user coordinate file in maintenance mode, and then load the user coordinate file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
39	The memory for the robot calibration file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the robot calibration file in maintenance mode, and then load the robot calibration file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
69	The memory for the conveyor calibration file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the conveyor calibration file in maintenance mode, and then load the conveyor calibration file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4011: MEMORY ERROR(FILE DATA) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
136	The memory for the liner up file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the liner up file in maintenance mode, and then load the liner up file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
261	The memory for the IOSPDCTRL setup file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the IOSPDCTRL setup file in maintenance mode, and then load the IOSPDCTRL setup file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
262	The memory for the SETTM SETUP file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the SETTM SETUP in maintenance mode, and then load the SETTM SETUP saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
263	The memory for the TIMER VARIABLE NAME file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the TIMER VARIABLE NAME file in maintenance mode, and then load the TIMER VARIABLE NAME file saved in the external memory device.

4011: MEMORY ERROR(FILE DATA) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
265	The memory for the USER GROUP INPUT file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the USER GROUP INPUT file in maintenance mode, and then load the USER GROUP INPUT file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
266	The memory for the USER GROUP OUTPUT file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the USER GROUP OUTPUT file in maintenance mode, and then load the USER GROUP OUTPUT file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
270	The memory for the F-SAFETY SIGNAL ALLOC file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the USER ANALOG OUTPUT file in maintenance mode, and then load the USER ANALOG OUTPUT file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4011: MEMORY ERROR(FILE DATA) (continued)

Sub Code	Meaning	Cause	Remedy
271	The memory for the SLC EXT. SIGNAL ALLOC file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
272	The memory for the safety logic comment file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
273	The memory for the timer set file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
277	The memory for the reducer remain time file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the reducer remain time file in maintenance mode, and then load the reducer remain time file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4011: MEMORY ERROR(FILE DATA) (continued)

Sub Code	Meaning	Cause	Remedy
278	The memory for the safety logic signal display setup file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
284	The memory for the F-SAFETY SIGNAL ALLOC file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
285	The memory for the SPECIFIC INPUT COMMENT SET file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
286	The memory for the operating time database is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the operating time database in maintenance mode, and then load the operating time database saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4011: MEMORY ERROR(FILE DATA) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
287	The memory for the operating time database is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the operating time database in maintenance mode, and then load the operating time database saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
288	The memory for the operating time database is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the operating time database in maintenance mode, and then load the operating time database saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
289	The memory for the Job Monitor is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the operating time database in maintenance mode, and then load the operating time database saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
290	The memory for the STEP DIAGNOSIS file is damaged.	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the STEP DIAGNOSIS file in maintenance mode, and then load the STEP DIAGNOSIS saved in the external memory device.

4011: MEMORY ERROR(FILE DATA) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
291	The memory for the ROBOT MONITOR file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the ROBOT MONITOR in maintenance mode, and then load the ROBOT MONITOR file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
292	The memory for the ROBOT ARRANGEMENT SETUP file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the ROBOT ARRANGEMENT SETUP in maintenance mode, and then load the ROBOT ARRANGEMENT SETUP file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
295	The memory for the ROBOT RANGE DISP DATA is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the ROBOT RANGE DISP DATA in maintenance mode, and then set the ROBOT RANGE DISP DATA.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4011: MEMORY ERROR(FILE DATA) (continued)

Sub Code	Meaning	Cause	Remedy
298	The memory for the servo power time is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the servo power time database in maintenance mode, and then load the servo power time database saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
300	The memory for the safety logic file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
301	The memory for the safety logic comment file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
372	The memory for the tool confirmation file is damaged.	Data error	- Reset the alarm. - If the alarm occurs again, initialize the tool file in maintenance mode, and then load the tool file saved in the external memory device.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4012: MEMORY ERROR(LINK SERVOFLOAT)

An error was detected at memory check.

The memory for the link servo float condition file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Condition file number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the link servo float condition file in maintenance mode, and then load the link servo float condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4013: MEMORY ERROR(LINEAR SERVOFLOAT)

An error was detected at memory check.

The memory for the linear servo float condition file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Condition file number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the linear servo float condition file in maintenance mode, and then load the linear servo float condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4014: MEMORY ERROR(ROBOT CALIB FILE)

An error was detected at memory check.

The memory for the file for calibration between manipulators is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Page number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the file for calibration between manipulators in maintenance mode, and then load the file for calibration between manipulators saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4018: MEMORY ERR(LADDER PRG FILE)

An error was detected at memory check.

The memory for the ladder program file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the ladder program file in maintenance mode, and then load the ladder program file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4019: MEMORY ERROR(CUTTING COND FILE)

An error was detected at memory check.
The memory for the user coordinates file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Page number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the cutting condition file in maintenance mode, and then load the cutting condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4020: MEMORY ERROR(OPERATION ORIGIN)

An error was detected at memory check.
The memory for the work home position file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the work home position file in maintenance mode, and then load the work home position file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4021: MEMORY ERROR(CONVEYOR COND FILE)

An error was detected at memory check.

The memory for the conveyor condition file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the conveyor condition file in maintenance mode, and then load the conveyor condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4024: MEMORY ERR(WRIST WEAV AMP FILE)

An error was detected at memory check.

The memory for the wrist weaving amplitude file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the wrist weaving amplitude file in maintenance mode, and then load the wrist weaving amplitude file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4025: MEMORY ERROR(INTERRUPT JOB FILE)

An error was detected at memory check.
The memory for the interrupt job file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the interrupt job file in maintenance mode, and then load the interrupt job file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4028: MEMORY ERR(SENSOR MON COND FILE)

An error was detected at memory check.
The memory for the sensor monitoring condition file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the sensor monitoring condition file in maintenance mode, and then load the sensor monitoring condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4034: MEMORY ERR(ANTICIPATION OT FILE)

An error was detected at memory check.

The memory for the anticipation outputs (OT) file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the anticipation output (OT) file in maintenance mode, and then load the anticipation output (OT) file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4035: MEMORY ERR(ANTICIPATION OG FILE)

An error was detected at memory check.

The memory for the anticipation outputs (OG) file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the anticipation output (OG) file in maintenance mode, and then load the anticipation output (OG) file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4039: MEMORY ERROR(FORM CUT FILE)

An error was detected at memory check.
The memory for the form cut file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the form cut file in maintenance mode, and then load the form cut file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4040: MEMORY ERROR(SHOCK LEVEL FILE)

An error was detected at memory check.
The memory for the shock level file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the shock level file in maintenance mode, and then load the shock level file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4042: MEMORY ERROR(VISION FILE)

An error was detected at memory check.

The memory for the vision condition file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Page number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the vision condition file in maintenance mode, and then load the vision condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4043: MEMORY ERROR(VISION CALIBRATION)

An error was detected at memory check.

The memory for the vision calibration file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Page number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the vision calibration file in maintenance mode, and then load the vision calibration file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4046: MEMORY ERR(CONVEYOR CALIB FILE)

An error was detected at memory check.

The memory for the conveyor calibration file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the conveyor calibration file in maintenance mode, and then load the conveyor calibration file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4047: MEMORY ERROR(MACRO DEFINITION FILE)

An error was detected at memory check.

The memory for the macro definition file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the macro definition file in maintenance mode, and then load the macro definition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4050: MEMORY ERR(Axis I/O ALLOC FILE)

An error was detected at memory check.

The memory for the axis motion I/O allocation file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the axis motion I/O allocation file in maintenance mode, and then load the axis motion I/O allocation file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4052: MEMORY ERROR(TOOL INTERFERENCE)

An error was detected at memory check.

The memory for the tool interference file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the tool interference file in maintenance mode, and then load the tool interference file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4061: MEMORY ERROR(GAUGE SENSOR FILE)

An error was detected at memory check.

The memory for the gauging sensor file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the gauging sensor condition file in maintenance mode, and then load the gauging sensor condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4062: MEMORY ERROR(LNR SCALE FILE)

An error was detected at memory check.

The memory for the linear scale condition file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the linear scale condition file in maintenance mode, and then load the linear scale condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4063: MEMORY ERR(CONVEYOR COND SUPP.)

An error was detected at memory check.

The memory for the conveyor condition auxiliary file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the conveyor condition auxiliary file in maintenance mode, and then load the conveyor condition auxiliary file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4065: MEMORY ERROR(I/F PANEL FILE)

An error was detected at memory check.

The memory for the I/F panel file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the I/F panel file in maintenance mode, and then load the I/F panel file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4069: MEMORY ERR(PALLETIZE COND FILE)

An error was detected at memory check.

The memory for the palletizing condition file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the palletize condition file in maintenance mode, and then load the palletize condition file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4080: MEMORY ERR(MUTUAL WAIT SET FILE)

An error was detected at memory check.

The memory for the mutual wait set file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the mutual wait set file in maintenance mode, and then load the mutual wait set file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4084: MUTUAL WAIT ERROR

An error was detected in the mutual wait function.

Sub Code	Meaning	Cause	Remedy
	SubCode 0000_0000_0000_0001:No response was returned from the mutual wait target. 0000_0000_0000_0010:An error occurred in the communication with the mutual wait target during the execution of RSYNC. 0000_0000_0000_0110:The setting of the mutual wait target was changed during the execution of RSYNC. 0000_0000_0001_0000:The mutual wait manipulator No. of the RSYNC is abnormal. 0000_0000_0010_0000:RSYNC was doubly executed. 0000_0000_0101_0000:An illegal notification was received from mutual wait target. 0000_0000_0111_0000:RSYNC was executed for the disconnected robot.	Setting error	SubCode 0000_0000_0000_0001 1. Reset the alarm. 2. Check the contents of the mutual wait setting file. 3. Check the network setting of the mutual wait target.
		Connection failure	SubCode 0000_0000_0000_0001 0000_0000_0000_0010 1. Reset the alarm. 2. Check the communication connection with the mutual wait target.
		HUB failure	SubCode 0000_0000_0000_0001 0000_0000_0000_0010 1. Reset the alarm. 2. Check the communication connection with the mutual wait target.
		Setting error	SubCode: 0000_0000_0000_0110 1. Reset the alarm. 2. During the execution of the RSYNC instruction, check whether mutual waiting function setting change and isolation (specific input signal # 40563 = ON) are not performed.
		Setting error	SubCode 0000_0000_0001_0000 1. Reset the alarm. 2. Check the mutual wait manipulator No. of the RSYNC.

4084: MUTUAL WAIT ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Setting error	SubCode 0000_0000_0010_0000 1. Reset the alarm. 2. Correct the job so that the RSYNC instruction will not be executed at the same time in multiple task job. 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Software operation error occurred	SubCode 0000_0000_0101_0000 1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Setting error	SubCode 0000_0000_0111_0000 1. Reset the alarm. 2. Make sure that the RSYNC instruction is not executed at the robot controller during isolation (dedicated input signal # 40563 = ON).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4085: MEMORY ERR(INTERF. HISTORY FILE)

An error was detected at memory check.

The memory for the interference history file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the mutual wait set file in maintenance mode, and then load the interference history file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	1. Reset the alarm. 2. If the alarm occurs again, replace the AIF01 board. Save the CMOS.BIN before replacing the board to be safe. Replace the AIF01 board, and then load the CMOS.BIN saved before alarm occurred.

◆ 4086: MEMORY ERROR(SAFETY SET FILE)

An error was detected at memory check.

The memory for the safety set file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4087: MEMORY ERROR(TMR FILE)

An error was detected at memory check.

The memory for the timer file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4088: MEMORY ERROR(SAFETY LOGIC FILE)

An error was detected at memory check.
The memory for the safety logic file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the safety logic file in maintenance mode, and then load the safety logic file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4091: 24V FUSE BLOWN(GENERAL I/O EXP.)

24V fuse blown is detected in the General I/O unit.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Station address of I/O module	Parts failure	Replace the fuse on the General I/O unit of the corresponding station.
		Unit failure(General I/O Unit)	Replace the General I/O unit of the corresponding station.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4092: 24V CIRCUIT ERR(GENERAL I/O EXP.)

An error was detected in 24V detection circuit of the General I/O unit.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Station address of I/O module	Unit failure	Replace the General I/O unit of the corresponding station.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4093: EXT. POWER ERR(GENERAL I/O EXP.)

External power (24V) for the General I/O unit is OFF

Sub Code	Meaning	Cause	Remedy
	Sub Code: Station address of I/O module	Connection failure	Check if the 24V line that is input for the General I/O unit of the corresponding station is correctly wired.
		Unit failure(External Unit)	Replace the unit that supplies the external 24V power supply of the corresponding station.
		Unit failure(General I/O Unit)	Replace the General I/O unit of the corresponding station.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Connection failure(MII cable)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4095: PULLBACK ERROR (PFL)

An error was detected in the PFL pullback function.

Sub Code	Meaning	Cause	Remedy
1	The pullback was executed when the shock detection function was invalid.	Setting error	Check the following settings. Shock Detection Function. Pullback signal
		Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 4099: DC 24V POWER SUPPLY FAILURE(CPS)

An error was detected in the voltage value of the CPS power,

Sub Code	Meaning	Cause	Remedy
		CPS01 unit failure	1. Reset the alarm. 2. If the alarm occurs again, turn the power OFF then back ON. 3. If the alarm occurs again, replace the following unit. • CPS01 unit
		Short circuit or ground fault	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. Check the insertion, connection, Short circuit or ground fault of the following. • AIO-CN306,CN307,CN308,CN309
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4102: SYSTEM DATA HAS BEEN CHANGED

The system parameters are modified.

An attempt was made to turn ON the servo power supply after having modified the system parameters.

Sub Code	Meaning	Cause	Remedy
		System data changed	1. Reset the alarm. 2. Turn the power OFF then back ON before turning ON the servo power supply.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4103: PARALLEL START INSTRUCTION ERROR

An error occurred in the independent control startup operation.

Sub Code	Meaning	Cause	Remedy
1	Sub task being executed: Although a job is being executed by instructed sub task, an attempt was made to execute another job by the sub task.	Setting error	- Reset the alarm. - Check if other JOB has been already executed in the same task which is used in the PSTART. If same task need to be executed in series, add PWAIT to confirm if the previous task end.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Group axis being used: The job operated by another sub task uses the same group axis.	Setting error	- Reset the alarm. - Check if the control group of the JOB which is used in the PSTART has been already executed in other task. If the same group need to be executed in series, add PWAIT to confirm if the other task end.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Multiple start of same job: The job that was tried to be started was executed by another sub task.	Setting error	- Reset the alarm. - Check if the JOB which is used in the PSTART has been already executed in other task. If the same job need to be executed in series, add PWAIT to confirm if the other task end.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Unregistered master job: Although the master job was not registered, an attempt was made to execute PSTART SUB (job name omitted).	Setting error	- Reset the alarm. - Check the following settings. - The master job of the subtask is registered
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Synchronization instruction error: When restarted by PSTART, synchronization instruction status of the sub task under interruption was different from the status to restart.	Setting error	- Reset the alarm. - Check the following settings. - The job to be started - The execution timing for start command
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Stopped by an alarm: An attempt was made to start the sub task which is stopped by an alarm.	Setting error	- Check the following settings. - Alarm occurrence status
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4103: PARALLEL START INSTRUCTION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
7	Synchronization task specification of SYNC instruction omit error	Setting error	- Reset the alarm. - Check the following setting. - Synchronization task specification of SYNC instruction
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The task is specified by synchronization task of SYNC instruction.	Setting error	- Reset the alarm. - Check the following setting. - Synchronization task specification of SYNC instruction It is not possible to set the same task to the SYNC as the sub task of PSTART instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	I/O jog being executed	Setting error	- Reset the alarm. - Check the following setting. - I/O jog executing status Complete the I/O jog execution, and then restart.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Separate group axis being used	Setting error	- Reset the alarm. - Check the following settings. - Usage status of separation use axis Complete the use of separation use axis, and then restart.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The servo power supply is OFF.	Setting error	- Reset the alarm. - Check the following setting. - Servo power Turn ON servo power.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	Twin synchronous task ID error	Setting error	- Reset the alarm. - Check the following setting. - Twin synchronous task specification of SYNC instruction
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	PSTART instruction is the old specification.	Setting error	- Reset the alarm. - Check the following settings. - The specifications of PSTART instruction Register the PSTART instruction as new specification.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4103: PARALLEL START INSTRUCTION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
17	PWAIT instruction is the old specification.	Setting error	- Reset the alarm. - Check the following settings. - The specifications of PWAIT instruction Register the PWAIT instruction as new specification.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	Sub task to be set PSTART has been already executed.	Setting error	- Reset the alarm. - Check the following settings. - The subtask is completed by the PWAIT instruction. - The execution timing for start command
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	An attempt was made to start up the control group where IO speed control is activated by a job.	Setting error	- Reset the alarm. - Check the status of IOSPDCTRL operation setting. The control group of which setting status is "VALID" cannot be started up by a job. - Modify the job so as not to start up the control group in which IO speed control is activated.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	MotoPlus is operating	Setting error	- Reset the alarm. - Check the following setting. - MotoPlus operating status Complete the MotoPlus operation, and then restart.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4104: WRONG EXECUTION OF LOAD INST

An error occurred when an instruction was executed by the data transmission DCI function.

Sub Code	Meaning	Cause	Remedy
	Sub Code1 to 245: Signifies the data transmission error.	Setting error	- Reset the alarm. - Refer to the instruction manual for Data Transmission Function for details.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4105: WRONG EXECUTION OF SAVE INST

An error occurred when an instruction was executed by the data transmission DCI function.

Sub Code	Meaning	Cause	Remedy
	Sub Code1 to 245: Signifies the data transmission error.	Setting error	1. Reset the alarm. 2. Refer to the instruction manual for Data Transmission Function for details.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4106: WRONG EXECUTION OF DELETE INST

An error occurred when an instruction was executed by the data transmission DCI function.

Sub Code	Meaning	Cause	Remedy
	Sub Code1 to 245: Signifies the data transmission error.	Setting error	1. Reset the alarm. 2. Refer to the instruction manual for Data Transmission Function for details.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4107: OUT OF RANGE(ABSO DATA)

The position difference between when the power was turned OFF and when the power was turned ON again exceeded the tolerance for the manipulator or a station.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	1. Reset the alarm. 2. Check the following settings. • Move the manipulator or station to the zero position by the axis operation and check the home position alignment marks (the arrow).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4109: DC 24V POWER SUPPLY FAILURE(I/O)

24V power for I/Os is not supplied.

Sub Code	Meaning	Cause	Remedy
	0000_0000_0000_0001: Detector circuit error. 0000_0000_0000_0010: Fuse blown (AIO board) 0000_0000_0000_0011: External 24V power supply error.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. Check the insertion and connection of the following. • CN303 of AIO board • Fuse (blown) of YIO board • The communications cable for the I/O module
		Voltage error	1. Reset the alarm. 2. If the alarm occurs again, Check the 24V external power supply. If abnormal, replace the 24V external power supply.
		YIO board failure	1. Reset the alarm. 2. If the alarm occurs again, replace the YIO board. Save the CMOS.BIN before replacing the board to be safe.
		Short circuit or ground fault	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. Check the insertion, connection, Short circuit or ground fault of the following. • AIO-CN306,CN307,CN308,CN309
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4110: SHOCK SENSOR ACTION

This alarm occurs if the shock sensor signal is detected.

Sub Code	Meaning	Cause	Remedy
		Shock sensor activated	Shock sensor is activated. Select "OVERRUN&SHOCK SENSOR" under sub menu "ROBOT" to reset the sensor. After that, perform avoidance movement by jog operation.
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Multi-axis servo amplifier -CN12
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.

4110: SHOCK SENSOR ACTION (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4112: DATA SENDING ERROR

A sending error occurred during data transmission.

Sub Code	Meaning	Cause	Remedy
1	Retry over of NAK	Communication error	- Reset the alarm. - If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Retry over for timeout in timer A	Communication error	- Reset the alarm. - If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Retry over for mutual response error	Communication error	- Reset the alarm. - If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4113: DATA RECEIVING ERROR

A receiving error occurred during data transmission.

Sub Code	Meaning	Cause	Remedy
1	Reception timeout (timer A)	Communication error	- Reset the alarm. - If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Reception timeout (timer B)	Communication error	- Reset the alarm. - If the alarm occurs again, check the communication setting and communication wiring is correct.

4113: DATA RECEIVING ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Heading length is too short.	Setting error	1. Reset the alarm. 2. If the alarm occurs again, send EOT code to release the data link and then check that the sending side data is correctly set. 3. Check that the communication setting is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Heading length is too long.	Setting error	1. Reset the alarm. 2. If the alarm occurs again, send EOT code to release the data link and then check that the sending side data is correctly set. 3. Check that the communication setting is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The header No. error	Setting error	1. Reset the alarm. 2. If the alarm occurs again, send EOT code to release the data link and then check that the sending side data is correctly set. 3. Check that the communication setting is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The text length exceeded 256 characters.	Setting error	1. Reset the alarm. 2. If the alarm occurs again, send EOT code to release the data link and then check that the sending side data is correctly set. 3. Check that the communication setting is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Illegal data received	Setting error	1. Reset the alarm. 2. If the alarm occurs again, send EOT code to release the data link and then check that the sending side data is correctly set. 3. Check that the communication setting is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4114: TRANSMISSION HARDWARE ERROR

An error occurred during data transmission.

Sub Code	Meaning	Cause	Remedy
1	Overrun error	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Parity error	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Framing error	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Transmission timeout (timer A)	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Transmission timeout (timer B)	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the communication setting and communication wiring is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4115: TRANSMISSION SYSTEM BLOCK

An error occurred during data transmission. (This alarm occurs when received data cause inconsistency on the system although the transmission protocol is correct. Mainly, this alarm occurs due to an illegal transmission or erroneous report at the data sending side.)

Sub Code	Meaning	Cause	Remedy
1	Received EOT while waiting ACK.	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the setting of communication or transmission side data is correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Received EOT while waiting ENQ.	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the setting of communication or transmission side data is correctly set.

4115: TRANSMISSION SYSTEM BLOCK (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Received EOT before last block reception.	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the setting of communication or transmission side data is correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Received codes other than EOT after last block reception.	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the setting of communication or transmission side data is correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4116: TRANSMISSION SYSTEM ERROR

An error occurred in data transmission.

Sub Code	Meaning	Cause	Remedy
1	Transmission data contents error	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the setting of communication or transmission side data is correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	Trans error or protocol error	Communication error	1. Reset the alarm. 2. If the alarm occurs again, check the setting of communication or transmission side data is correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4117: BRAKE POWER ERROR

Brake power supply unit has been blown.

Sub Code	Meaning	Cause	Remedy
1	The robot control module #1 generates an alarm.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the brake connection if there is a ground fault or short circuit.
		Fuse failure	1. Reset the alarm. 2. If the alarm occurs again, check the brake connection and then replace the fuse.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4118: FAN CIRCUIT PROTECTOR TRIPPED

The circuit protector of the in-panel cooling fan is tripped or turned OFF.
(This alarm will be displayed one minutes after detection.)

Sub Code	Meaning	Cause	Remedy
1	The robot control module #1 generates an alarm.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check fan power line if there is a ground fault or short circuit.
		Setting error	1. Reset the alarm. 2. Check the following settings. • (After cancellation of the short-circuit and ground fault) Turn ON the circuit protector.
		Cooling fan failure	1. Reset the alarm. 2. Replace the in-panel cooling fan. Check the connection between manipulator and servo board. * Move the manipulator to safety place in teach mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4119: FAN ERROR(IN CONTROL BOX)

The rotation speed of the cooling fan 1 with alarm sensor connected to the CPS01K* unit decreased.

Sub Code	Meaning	Cause	Remedy
	Sub Code 1 to 8: Signifies the robot safety module No. in which the alarm occurred	Cooling fan failure	Replace the CPS01K* unit.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4121: COOLING FAN1 ERROR

The rotation speed of the cooling fan 1 with alarm sensor connected to the contactor unit decreased.

Sub Code	Meaning	Cause	Remedy
	Sub Code 1 to 8: Signifies the robot control module No. in which the alarm occurred	Cooling fan failure	1. Reset the alarm. 2. Replace the cooling fan of manipulator. Check the wiring from a manipulator to a servo board. * Move the manipulator to the safe position in teach mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4122: COOLING FAN2 ERROR

The rotation speed of the cooling fan 2 with alarm sensor connected to the contactor unit decreased.

Sub Code	Meaning	Cause	Remedy
	Sub Code 1 to 8: Signifies the robot control module No. in which the alarm occurred	Cooling fan failure	1. Reset the alarm. 2. Replace the cooling fan of manipulator. Check the wiring from a manipulator to a servo board. * Move the manipulator to the safe position in teach mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4123: COOLING FAN3 ERROR

The rotation speed of the cooling fan 3 with alarm sensor connected to the contactor unit decreased.

Sub Code	Meaning	Cause	Remedy
	Sub Code 1 to 8: Signifies the robot control module No. in which the alarm occurred	Cooling fan failure	Replace the cooling fan of manipulator. Check the wiring from a manipulator to a servo board. * Move the manipulator to the safe position in teach mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4124: WRONG EXECUTION OF VISION INST

Sub Code	Meaning	Cause	Remedy
1	The specified file number is incorrect.	Setting error	1. Reset the alarm. 2. Check the following settings. • File No. Specify the correct file number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The specified file set value is incorrect.	Setting error	1. Reset the alarm. 2. Check the following settings. • File set value Specify the set value.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Calibration could not be executed.	Setting error	1. Reset the alarm. 2. Check the following settings. • The robot coordinate data or the pixel coordinate data used for the calibration • The user variable number in the calibration file Set the robot coordinate data and the pixel coordinate data used for the calibration to the user variable. Correctly set the user variable number in the calibration file.

4124: WRONG EXECUTION OF VISION INST (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The communication port for the vision system could not be initialized.	Setting error	- Reset the alarm. - Check the following settings. - The Parameter for vision communication port. - Set the correct parameters for the communication port.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Time-out occurred during data transmission.	Setting error	- Reset the alarm. - Check the following settings. - The communication setting of vision system
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection of the following cables. - Cable between vision system and YNX1000 system
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Time-out occurred during data reception.	Setting error	- Reset the alarm. - Check the following settings. - The communication setting of vision system
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection of the following cables. - Cable between vision system and YNX1000 system
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The data received from the vision system is incorrect.	Setting error	- Reset the alarm. - Check the following settings. - The communication setting of vision system - The detection setting of vision system
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection of the following cables. - Cable between vision system and YNX1000 system
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The pixel coordinates value was not able to be converted into the robot coordinates.	Setting error	- Reset the alarm. - Check the following settings. - The communication setting of vision system - Calibration file for use
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4124: WRONG EXECUTION OF VISION INST (continued)

Sub Code	Meaning	Cause	Remedy
9	Failed to read or write the position type variable (P variable).	Setting error	- Reset the alarm. - Check the following settings. - Usage status of the specified position type variable Don't use the specified positional type variable at the same time in other jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Use memory is lacking and the area could not be obtained.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The setting value of measurement item (FT) is incorrect.	Setting error	- Reset the alarm. - Correct the setting value of a measurement item.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The data for the vision execution command is incorrect.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
48	The number of waiting commands sent by Vision sensor exceeded the limit.	Software operation error occurred	- Reset the alarm, and then try again. - Check the command sent by Vision sensor. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4126: CANNOT EXECUTE AUTO PMT

An error occurred when execution of auto PMT.

Sub Code	Meaning	Cause	Remedy
1	System error	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4126: CANNOT EXECUTE AUTO PMT (continued)

Sub Code	Meaning	Cause	Remedy
2	PBOX cannot be edited.	Setting error	- Reset the alarm. - Check the following setting. - I/O status of the edit prohibit signal The edit prohibit signal cannot input.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The source job cannot be edited.	Setting error	- Reset the alarm. - Check the following setting. - The prohibit status of source job If the source job is protected from editing, it cannot be edited.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The converted job cannot be edited.	Setting error	- Reset the alarm. - Check the following settings. - The prohibit status of converted job If the converted job is protected from editing, it cannot be edited.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The memory area for job area is insufficient.	Software operation error occurred	- Reset the alarm. - If the error occurs again, delete unused jobs. - If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file. In that case, delete the unused jobs. - If the error occurs again though the previous measures were executed, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The source job is not exist.	Setting error	Check the following settings. Presence of the specified source job The job which does not exist cannot be set to the source job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4126: CANNOT EXECUTE AUTO PMT (continued)

Sub Code	Meaning	Cause	Remedy
7	The memory area for position data of the job is insufficient.	Software operation error occurred	1. Reset the alarm. 2. when the error occurs again, if there is an unnecessary teaching position, delete it. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file. In that case, delete the unused jobs. 4. If the error occurs again though the previous measures were executed, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The job under execution is specified as the conversion job.	Setting error	1. Reset the alarm. 2. Check the following settings. • Execution status of the source job • Execution status of the converted job The job under execution is specified for the source / converted job. Execute conversion operation after ending the job execution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4128: ARC MONITOR ERROR

An error occurred when arc monitor was in execution.

Sub Code	Meaning	Cause	Remedy
1	Monitor ON was executed in Monitor ON.	Setting error	1. Reset the alarm. 2. Check the following settings. • Arc monitor ON status Arc monitor ON cannot be executed during arc monitor ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Analog CH specification or register specification is not exist.	Setting error	1. Reset the alarm. 2. Check the following settings. • Analog CH specification • Register specification Analog CH specification or register specification is required.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4128: ARC MONITOR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
11	The number of samplings exceeds the set value.	Setting error	- Reset the alarm. - Check the following settings. - The number of samplings The number of sampling is too much. Confirm the monitor ON/OFF status.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4129: TWIN DRIVE OUT OF RANGE(START)

When the twin drive started, the error value of the pulse between the master-axes and the slave-axes exceeded the allowable range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Corresponding master-axes and slave-axes are displayed by the bit.	Setting error	- Reset the alarm. - Check the following settings. - Pulse error of the master-axes and the slave-axes Switch to independent movement mode so that the pulse error of the master-axes and the slave-axes is settled within allowable range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4130: NETWORK APPLICATION PROCESS ERROR

An error occurred when the Ethernet function was used.

Sub Code	Meaning	Cause	Remedy
1	An error occurred when the notification of the APP task re-initialization was processed in the Ethernet function.	Software operation error occurred	- Turn the power OFF then back ON. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
2	An error occurred when the re-initialization response was received in the Ethernet function.	Software operation error occurred	- Turn the power OFF then back ON. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4130: NETWORK APPLICATION PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
3	The incomplete task of re-initialization was unsuccessfully completed in the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
4	An error occurred when the semaphore for re-initialization was received in the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
5	An error occurred when the re-initialization mail was sent in the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
6	An error occurred in the exclusive process of the storage area control table of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
7	Time-out occurred in the re-initialization response receiving process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4130: NETWORK APPLICATION PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
8	An error occurred in the re-initialization response receiving process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
9	Receiving data size error occurred in the re-initialization response receiving process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
30	An error occurred in the Web server task mail receiving process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
31	An error occurred in the FTP server task mail receiving process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
32	An error occurred in the FTP client task mail receiving process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4130: NETWORK APPLICATION PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
40	Illegal e-mail data were received in the Web server task of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
41	Illegal e-mail data were received in the FTP server task of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
42	Illegal e-mail data were received in the FTP client task of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
50	An error occurred in the data size written to PCI of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
51	An error occurred when the request to write PCI data was received in the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4130: NETWORK APPLICATION PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
52	The request of the undefined transmission was received in the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
53	An error occurred in the transmission request of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
54	The transmission request without data was received in the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
55	The transmission request of illegal data length was received in the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
60	Illegal mail data were received in the DNS task of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4130: NETWORK APPLICATION PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
61	Illegal mail data was transmitted in the DNS task of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
100	An error occurred in storing process of memory which is used in the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
101	An error occurred in the buffer for request to write PCI getting process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
200	The socket of the Ethernet function was full and was not able to create a socket.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
201	An error occurred in the semaphore of socket control table of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

◆ 4131: UDP PROCESS ERROR

An error occurred in the UDP process of the Ethernet function.

Sub Code	Meaning	Cause	Remedy
1	An error occurred in the creation of receiving socket during the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
2	An error occurred in the creation of transmission socket during the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
3	Illegal data were received in the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
4	Transmission error occurred in the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
5	The SELECT operation was not successfully completed in the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4131: UDP PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
10	The communication error was occurred in the UDP process of the WAIT ROBOT function.	Setting error	1. Reset the alarm. 2. Check the network setting for the robot controller.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
100	The re-initialization notification of illegal data length was received in the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
101	The re-initialization notification of illegal data was received in the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
102	The PCI write process was not successfully completed in the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
103	The transmission request of illegal data length was received in the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4131: UDP PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
104	The transmission request of illegal data was received in the UDP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

◆ 4132: TCP PROCESS ERROR

An error occurred in the TCP process of the Ethernet function.

Sub Code	Meaning	Cause	Remedy
1	The socket table was not successfully created in the TCP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
2	An error occurred in the process of the TCP server initialization of the Ethernet function.	Setting error	1. Make sure that there is no communication device with the same IP address in the network. 2. If DHCP is enabled, make sure that the correct IP address is leased from the DHCP server.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
3	An error occurred in connection detecting process of TCP server of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4132: TCP PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
4	An error occurred in the connection detection checking process of TCP server of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

◆ 4134: COOLING FAN SET ABNORMAL

Cooling fan setting parameter disabled.

Sub Code	Meaning	Cause	Remedy
0		Setting error	1. Reset the alarm. 2. Check the following settings. • Confirm parameter SVS and S2C for the cooling fan. • Open the front panel to refer to the parameter list on the back.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4137: WRONG EXECUTION OF SETUALM INST

An error occurred at SETUALM instruction execution.

Sub Code	Meaning	Cause	Remedy
1	Alarm code specification error	Setting error	1. Reset the alarm. 2. Check the following settings. • Alarm code Specify the alarm in the range 8000 to 8999.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Task specification error	Setting error	1. Reset the alarm. 2. Check the following settings. • Task specification Specify the task in the range 0 to 15.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4137: WRONG EXECUTION OF SETUALM INST (continued)

Sub Code	Meaning	Cause	Remedy
3	Motion mode specification error	Setting error	1. Reset the alarm. 2. Check the following settings. • Motion mode specification Set the motion mode to 0 or 1.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Alarm num error	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4138: WRONG EXECUTION OF SVON INST

An error occurred at SVON instruction execution.

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Reset the alarm. 2. Check the following settings. • Short-circuit the external servo ON (EXSVON) of MXT terminal block.
		Setting error	1. Reset the alarm. 2. Check the following settings. • The concurrent I/O signal #80031 (servo ON condition1) ON • The concurrent I/O signal #80033 (servo ON condition2) ON
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4139: WRONG EXECUTION OF PRINT INST

An error occurred at PRINT instruction execution.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Reset the alarm. 2. Check the following settings. • The setting of the PRINT output conversion spec (character string specification) If there is no problem in the setting, delete the corresponding PRINT instruction and register again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4140: WRONG EXECUTION OF DIALOG INST

An error occurred at DIALOG instruction execution.

Sub Code	Meaning	Cause	Remedy
1	DIALOG instruction control error	Setting error	- Reset the alarm. - Check the following settings. - The tag setting of DIALOG instruction If no fault is found, delete corresponding DIALOG instruction, and then register again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Messages and buttons are not registered.	Setting error	- Reset the alarm. - Check the following settings. - The information of DIALOG instruction message and button
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Buttons are not registered.	Setting error	- Reset the alarm. - Check the following settings. - The information of DIALOG instruction button
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4141: SNTP ERROR

An error occurred in the SNTP process of the Ethernet function.

Sub Code	Meaning	Cause	Remedy
1	The error on setting of time difference value occurred in the SNTP process of the Ethernet function.	Software operation error occurred	- Turn the power OFF then back ON. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
2	The error on setting of time-out value occurred in the SNTP process of the Ethernet function.	Software operation error occurred	- Turn the power OFF then back ON. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4141: SNTP ERROR (continued)

Sub Code	Meaning	Cause	Remedy
3	The error on setting of reference interval value occurred in the SNTP process of the Ethernet function.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
4	The IP address error occurred in the SNTP process of the Ethernet function.	Setting error	Check the following settings. • The IP address of the SNTP server • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Time-out occurred in the SNTP process of the Ethernet function.	Setting error	Check the following settings. • The SNTP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The server time is not synchronized in the SNTP process of the Ethernet function.	Setting error	Check the following settings. • The SNTP server operation • The network status
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The SNTP process of the Ethernet function is not compliant with the version that the server sent.	Setting error	Use the server compliant with the SNTP version 3.

4141: SNTP ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Illegal parameters were found in the SNTP process of the Ethernet function.	Setting error	Check the following settings. • SNTP setting
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The SNTP process of the Ethernet function was not successfully completed.	Setting error	Check the following settings. • SNTP setting
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The name resolution error occurred in the SNTP process of the Ethernet function.	Setting error	Check the following settings. • The IP address of the SNTP server • The DHCP server operation *If the DHCP is used • The network status *If the DHCP is used
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The error on getting of server address occurred in the SNTP process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation • The network status

4141: SNTP ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The server setting is incorrect in the SNTP process of the Ethernet function (for future use).	Setting error	Check the following settings. • SNTP setting
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4145: RELAY NO. ERROR(LADDER PROGRAM)

The relay number which was detected in the ladder program was out of range.

Sub Code	Meaning	Cause	Remedy
0	There is invalid relay number in the SYSTEM LADDER.	Setting error	Save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	There is invalid relay number in the USER LADDER.	Setting error	Set the security to management mode and compile the ladder program. If any error occurs, modify the invalid relay number to complete the compiling. Valid range General Input:00010to05127 General Output:10010to15127 External Input:20010to25127 External Output:30010to35127 Specific Input:40010to41607 Specific Output:50010to53007 I/F Panel Input:60010to60647 Auxiliary Relay:70010to79997 Control Input:80010to85127 Pseudo Input:87010to87207 Network Input:27010to29567 Network output:37010to39567
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4146: ENCDR PWR CIRCUIT PROTECTOR TRIP

An error was detected in the encoder power circuit protector.

Sub Code	Meaning	Cause	Remedy
1	Sub Code 1 to 8: Signifies the robot control module No. in which the alarm occurred	Incorrect setting	Check the following settings. • Turn ON the circuit protector.
		Short circuit or ground fault	1. Turn the power OFF then back ON. 2. If the alarm occurs again even after turning ON the circuit protector, check encoder power line if there is a ground fault or short circuit.
		Unit failure	Replace the motor or encoder to which the power is supplied.
		Parts failure	Replace the circuit protector.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4147: USER COORD EDIT ERROR

An error occurred during the editing operation of the user coordinates file.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the user coordinates file in maintenance mode, and then load the user coordinates file saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4148: TRACELV ERROR

An error occurred during the execution of TRACELV instruction.

Sub Code	Meaning	Cause	Remedy
	Trace level value is abnormal.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4149: TRACE ERROR

An error occurred during the execution of TRACE instruction.

Sub Code	Meaning	Cause	Remedy
0	Trace data is abnormal.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	Time stamp value is abnormal.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Trace level value is abnormal.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Abnormal variable is specified.	Setting error	Check the following setting; • TRACE instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Exceeded the maximum trace number.	Trace error	Execute TRACESAVE or TRACERST.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4152: TIMING BELT BLOWN

The timing belt of manipulator is blown.

Sub Code	Meaning	Cause	Remedy
1	The robot control module # 1 generates an alarm.	Manipulator timing belt is blown.	Move the manipulator in teach mode to the position where there is no torque on the driving belt. 1. Check the timing belt tension. 2. Check the wiring between manipulator and the machine safety unit (robot safety module).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4153: COOLING UNIT ERROR

An error was detected in the cooling unit.

Sub Code	Meaning	Cause	Remedy
1	The robot control module # 1 generates an alarm.	Unit failure	Refer to the instruction manuals for the cooling unit in use.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4154: COOLING FAN ERROR (DOOR)

An error occurred in the cooling fan on the front door.

Sub Code	Meaning	Cause	Remedy
1	The robot control module # 1 generates an alarm.	Connection failure	1. Reset the alarm. 2. Check the connection and insertion of the cable and connector for the cooling fan.
		Power voltage drop	1. Reset the alarm. 2. Check if the primary power voltage is normal.
		Dirt	1. Reset the alarm. 2. Clean the cooling fan and the fan duct.
		Unit failure	1. Reset the alarm. 2. Replace the malfunctioning cooling fan with a new one.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4155: COOLING FAN ERROR (BACKSIDE)

An error occurred in the backside cooling fan.

Sub Code	Meaning	Cause	Remedy
1	The robot control module # 1 generates an alarm.	Connection failure	1. Reset the alarm. 2. Check the connection and insertion of the cable and connector for the cooling fan.
		Power voltage drop	1. Reset the alarm. 2. Check the connection and insertion of the cable and connector for the cooling fan.
		Dirt	1. Reset the alarm. 2. Clean the cooling fan and the fan duct.
		Unit failure	1. Reset the alarm. 2. Replace the malfunctioning cooling fan with a new one.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4156: COOLING FAN4 ERROR

The rotation speed of the cooling fan 4 with alarm sensor connected to the YIU unit decreased.

Sub Code	Meaning	Cause	Remedy
	Sub Code 1 to 8: Signifies the robot control module No. in which the alarm occurred	Cooling fan failure	1. Reset the alarm. 2. Replace the cooling fan of manipulator. Check the wiring from a manipulator to a servo board. * Move the manipulator to the safe position in teach mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4192: TRACE FILE ERROR

An error occurred during the access to a TRACE file data

Sub Code	Meaning	Cause	Remedy
0	TRACE file generation error	Connection failure	1. Reset the alarm. 2. Check the connection status of the USB in the YNX1000 controller and its available memory.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	TRACE file open error	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	TRACE file writing error	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	TRACE file close error	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	TRACE file number error	Trace error	Delete the trace files generated today from the USB on the YNX1000 controller.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4192: TRACE FILE ERROR (continued)

Sub Code	Meaning	Cause	Remedy
5	TRACE file index error	Trace error	Review the name of the trace files generated today in the USB on the YNX1000 controller.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4193: DATABASE ACCESS ERROR(PAINT)

An error occurred while accessing the database.

Sub Code	Meaning	Cause	Remedy
0	The specified database doesn't exist.	Setting error	Check the setting of the following item; • Database number
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	Cannot access the specified database.	Database error	Delete the database file in the USB installed to the YNX1000 controller.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4194: 3D TRACE BUFFER OVERFLOW

An error occurred in the tracing function of 3D graphic function.

Sub Code	Meaning	Cause	Remedy
	There is not enough space for 3D trace buffer.	Setting error	Adjust the parameter: 3D trace sampling cycle:S3C1325.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4197: INCORRECT SAFETY LOGIC CIRCUIT

An error occurred in the safety logic circuit function.

Sub Code	Meaning	Cause	Remedy
	Subcode means the number of incorrect circuit.	Setting error	1. Check the safety logic circuit setting. 2. Check the safety functions setting in maintenance mode
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4200: SYSTEM ERROR(FILE DATA)

An error occurred during the access to file data (during file edition or external memory device operation).

Sub Code	Meaning	Cause	Remedy
	Sub code 01 to 50: Signifies the internal software error	Data error	1. Reset the alarm. 2. If the alarm occurs again, turn the controller power OFF and then ON to check the operation. 3. If the alarm occurs again, initialize the appropriate data in maintenance mode, and then load the data saved in the external memory device.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4201: SYSTEM ERROR(JOB)

An error occurred when accessing the job data of MOTION section.

Sub Code	Meaning	Cause	Remedy
-1	An error occurred during the access a job in parameter specifications.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	Access time exceeded the limit during the access to a job.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-3	The access to a job could not be performed with the specified job name.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4201: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-4	A job was newly created with the same name of the job already specified in the memory.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-5	A job was newly created with the same name of the job already specified in the memory.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-6	The allowable job registration area (memory) was exceeded.	Setting error	Delete unused jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-7	A job that did not exist in the memory was specified.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-8	An attempt was made to change the contents for the job prohibited from being edited.	Setting error	Release the prohibition.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-9	An error occurred during the access to a job in handle value.	Software operation error occurred	Reset the alarm, and then try again.

4201: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-10	An error occurred in job data control system.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-11	An error occurred in sequence number of the accessed job.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-12	An error occurred in step number of the accessed job.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-13	A job specified at job search did not exist in the memory.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4201: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-14	There was an instruction that did not exist in a job because of inconsistency of the system software.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-16	Unused handles were lacking when an attempt was made to open a job.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-18	The number of instructions added to a job exceeded 9999.	Setting error	Delete unnecessary instructions and add new instructions again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-19	The number of steps added to a job exceeded 9999.	Setting error	Delete unnecessary steps and add new steps again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-22	Job information was not able to be expanded.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-23	Job information was not able to be acquired.	Software operation error occurred	Reset the alarm, and then try again.

4201: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-24	An error occurred in cluster control.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-25	Failed to read the cluster information.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-26	Heap area could not be obtained.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-27	The target for change is the line where editing is prohibited or the comment-out line.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, deactivate the prohibit setting for the target line or delete the comment-out line.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4201: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-28	The marker job was incorrectly changed.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-90	The configuration data is damaged.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-91	The FAT area is damaged.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-92	A job data in the memory was destroyed.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4202: SYSTEM ERROR(JOB)

This alarm occurs if abnormal internal data is detected during the access to the job data of operating/editing software.

Sub Code	Meaning	Cause	Remedy
1	An error occurred in parameter specifications for the access to a job .	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Access time exceeded the limit during the access to a job.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Unapproved characters are used for a job name.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	A job was newly created with the same name of the job already specified in the memory.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	A job was newly created with the same name of the job already specified in the memory.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4202: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
6	The allowable job registration area (memory) was exceeded.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete unused jobs. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file. In that case, delete the unused jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	A job that did not exist in the memory was specified.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	An attempt was made to change the contents for the job prohibited from being edited.	Setting error	Check the following settings. • Setting of EDIT LOCK in JOB header screen If the job is protected from editing, release the prohibition.
		Software operation error occurred	1. Reset the alarm. 2. If you edit this job, release the prohibition. 3. If the error occurs again, delete the job where the alarm occurred. 4. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	An attempt was made to change the contents for the job prohibited from being edited.	Setting error	Check the following settings. • Setting of EDIT LOCK in JOB header screen If the job is protected from editing, release the prohibition.
		Software operation error occurred	1. Reset the alarm. 2. If you edit this job, release the prohibition. 3. If the error occurs again, delete the job where the alarm occurred. 4. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	An error occurred in job data control system.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.

4202: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	An error occurred in sequence number of the accessed job.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	An error occurred in step number of the accessed job.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	A job specified at job search did not exist in the memory.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	There was an instruction that did not exist in a job because of inconsistency of the system software.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	Unused handles were lacking when an attempt was made to open a job.	Setting error	Check the following settings. • The number of call job stacks Set the job configuration that decreases the number of call job stacks.
		Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.

4202: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	The number of instructions added to a job exceeded 9999.	Setting error	Check the following settings. • The number of steps in job Delete unnecessary instructions in job and add new instructions.
		Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	The number of steps added to a job exceeded 9999.	Setting error	Check the following settings. • The number of steps in job Delete unnecessary steps in job and add new steps.
		Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	A job was newly created with the same name of the undefined job already specified in the memory.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	Failed to expand job information during the access to a job.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4202: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
23	The accessed job was not opened.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	An error occurred in the cluster control process of the accessed job.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	An error occurred when reading the cluster information of the accessed job.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	Failed to acquire the necessary memory area during the access to a job.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
27	An attempt was made to change the contents for the line prohibited from being edited or the commented-out line.	Setting error	1. Reset the alarm. 2. Cancel the LINE EDIT LOCK/COMMENT OUT settings of target lines in JOB CONTENTS screen.
		Software operation error occurred	1. Reset the alarm. 2. Cancel the LINE EDIT LOCK/COMMENT OUT settings of target lines in JOB CONTENTS screen. 3. If the error occurs again, delete the line where the alarm occurred. 4. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4202: SYSTEM ERROR(JOB) (continued)

Sub Code	Meaning	Cause	Remedy
28	The marker job was incorrectly changed.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
90	The configuration information for job data control is damaged.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
91	The FAT information for job data is damaged.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
92	A job data was destroyed.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
99	A job data in the memory was destroyed.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4203: SYSTEM ERROR(POSITION DATA)

An data error occurred during the access to position data of MOTION section.

Sub Code	Meaning	Cause	Remedy
-1	The memory area for position data is lacking at the initialization of the position data control process.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	The number of axes for all the control groups is zero at the initialization of the position data control process.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-3	The number of axes for position data is zero.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-4	The number of stored position data exceeded the maximum stored data at the initialization of the position data control process.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4203: SYSTEM ERROR(POSITION DATA) (continued)

Sub Code	Meaning	Cause	Remedy
-5	The memory size of the position data exceeded the maximum memory size at the initialization of the position data control process.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-6	Unused position data file is destroyed.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-7	Unused position data file does not exist.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-8	Position data file is destroyed.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-9	Position data control information is destroyed.	Software operation error occurred	Reset the alarm, and then try again.

4203: SYSTEM ERROR(POSITION DATA) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-10	An error occurred in specified position data number.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-11	Position data is not registered.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-12	An attempt was made to access the undefined position data.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-13	An attempt was made to access the position data for the undefined control group.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.

4203: SYSTEM ERROR(POSITION DATA) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-14	Position data control is not initialized.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-15	The number of axes for the control groups exceeded the limit.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-16	An error occurred in exclusive control during the position data control process.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-17	An error occurred in exceptional control during the position data control process.	Software operation error occurred	Reset the alarm, and then try again.
		Robot control module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-20	Inconsistency of data.	Software operation error occurred	Reset the alarm, and then try again.

4203: SYSTEM ERROR(POSITION DATA) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm, and then try again. - If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4204: SYSTEM ERROR(POSITION DATA)

This alarm occurs if abnormal internal data is detected during the access to position data.

Sub Code	Meaning	Cause	Remedy
1	The number of axes for all the control groups is zero at the initialization of the position data control process	Software operation error occurred	- Reset the alarm. - If the error occurs again, delete the job where the alarm occurred. - If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The number of axes for all the control groups is zero at the initialization of the position data control process	Software operation error occurred	- Reset the alarm. - If the error occurs again, delete the job where the alarm occurred. - If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The number of axes for position data is zero.	Software operation error occurred	- Reset the alarm. - If the error occurs again, delete the job where the alarm occurred. - If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The number of stored position data exceeded the maximum stored data at the initialization of the position data control process.	Software operation error occurred	- Reset the alarm. - If the error occurs again, delete the job where the alarm occurred. - If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4204: SYSTEM ERROR(POSITION DATA) (continued)

Sub Code	Meaning	Cause	Remedy
5	The memory size of the position data exceeded the maximum memory size at the initialization of the position data control process.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Unused position data file is destroyed.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Unused position data file does not exist.	Setting error	Check the following settings. • The number of steps in job (position data) Delete unnecessary position data in job and add new position data.
		Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Position data file is destroyed.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Position data control information is destroyed.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4204: SYSTEM ERROR(POSITION DATA) (continued)

Sub Code	Meaning	Cause	Remedy
10	An error occurred in specified position data number.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Position data is not registered.	Setting error	Check the following settings. • Teaching of alarm occurred point Teaching the point where alarm occurred.
		Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	An attempt was made to access the undefined position data.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	An attempt was made to access the position data for the undefined control group.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Position data control is not initialized.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4204: SYSTEM ERROR(POSITION DATA) (continued)

Sub Code	Meaning	Cause	Remedy
15	The number of axes for the control groups exceeded the limit.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	An error occurred in exclusive control during the position data control process.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	An error occurred in exceptional control during the position data control process.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	Undefined position exists.	Software operation error occurred	1. Reset the alarm. 2. If the error occurs again, delete the job where the alarm occurred. 3. If the error occurs again after the previous measures were executed, initialize the job file in maintenance mode, and then load the saved job file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4206: SYSTEM ERROR(TRANSMISSION)

An error occurred in data transmission.

Sub Code	Meaning	Cause	Remedy
	Sub Code 1 to 4: Signifies the internal software error during data transmission.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4207: SYSTEM ERROR(MOTION)

A system error occurred in MOTION section.

Sub Code	Meaning	Cause	Remedy
1	An interrupt undefined in the main command from the system control section occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An interrupt undefined in the sub command from the system control section occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The interrupt command that was sent previously from the system control section is being processed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error was detected in the interrupt command data from the system control section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	An undefined command was detected in the sub segment task of MOTION section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	An undefined command was detected in the servo-related processing of MOTION section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	An undefined command was detected in the offline processing task of MOTION section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	An undefined command was detected in the utility task of MOTION section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Task Token is not generated.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Mail-box Token is not generated.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	Semaphore Token is not generated.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	RMS receiving data error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
15	RMS sending data error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	RMS receiving unit error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	Task generation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	Mail-box generation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	Semaphore generation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	TCB area overflow	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	Stack area overflow	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	Mail-box area overflow	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	Semaphore area overflow	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	Interrupt main command error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
33	Incorrect control group designation	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
34	Offline bank semaphore reception error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
35	m_gen_area semaphore reception error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
36	Offline HA processing timeout	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
37	DM_BANK flag error (DM_BANK conversion processing)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
38	S -> M offline processing command type error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
39	Function specification error in the data transmission to the sensor board	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
40	Error in designation of application in the request of general-purpose data preset for each application.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
45	Mail-box of sequence task is not ready.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
46	Control-group usage undefined	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
47	Segment task polling command error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
48	Physical axis number error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
49	The control group impossible to release the brake	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
50	Sub-segment request FULL	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
51	Sub-segment process timeout	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
52	Data latch request FULL	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
53	Data latch process timeout	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
54	AXIS command request FULL	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
55	AXIS command process timeout	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
56	Positioning monitor request FULL	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
57	Positioning monitor process timeout	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
58	Failed AXIS servo OFF command request during category1 emergency stop	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
59	AXIS servo OFF command execution system not set during category1 emergency stop	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
62	Duplicated request error during master control-group tracking	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
63	GVM shared resource semaphore error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
64	Job queue DEQUE error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
66	Execution system decision table not set	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
67	Unknown mode data (Without TEACH/PLAY mode data)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
68	Shift-value output timeout of the general-purpose sensor	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
69	Interrupt main status set	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
71	System number error at the master side in twin synchronous system	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
72	No data link added to the command	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
73	Setting status error of the user coordinates file	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
75	Previous path data reference error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
76	Target position preparation error in arc-retry shift motion mode	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
79	Inner track zone status error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
80	Instruction queue and instruction system data area overflow	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
81	Offline answer bank flag error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
82	Path and trace queue ENQUE BANK error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
83	Pending and block end request FULL	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
84	Base axis file type error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
85	Output buffer SYSCON for automatic test data in use	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
86	Conversion completion status for AXIS section feedback latch data not established	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
88	File C1 through C3 for calibration between manipulators not set	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
89	File C1 through C3 for conveyor calibration not set	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
90	HA function error (conv_pos_data())	Setting error	1. Check the following settings. • Correct the job so that the target position data is within the motion range. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
91	HA function error (conv_shift_data())	Setting error	1. Check the following settings. • Correct the job so that the target position data is within the motion range. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
94	HA function error (conv_pulse_to_angle())	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
98	HA function error (make_conv_frm_data())	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
99	HA function error (calc_dist_pos ())	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	Control-group axis configuration information parameter error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
101	Error in the parameter for the table for physical axes	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
102	Error in the parameter for the table for physical TU	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	Excessive number of control group axes in use	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
104	JOG and PLAY maximum speed setting parameter error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	Reduction ratio setting parameter error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
106	feedback PPR setting parameter error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
121	Job argument stack overflow	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
122	Job argument stack underflow	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
123	Designation error of the fetched feedback pulse area at preparation of current value	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
128	Timeout for waiting permission to modify the number of averaging times	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
129	Object undefined for CLEAR instruction	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
130	No space in RT_BANK setting area for correction-amount data	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
131	Queue operation error for variable write-in history at prereading (at ENQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
132	Queue operation error for variable write-in history at prereading (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
133	Queue operation error for variable write-in history at prereading (undefined operation)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
134	Queue operation error for variable write-in history at prereading (data length too long)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
135	Queue operation error for score-board setting history (at ENQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
136	Queue operation error for score-board setting history (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
137	Queue operation error for score-board setting history (undefined operation)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
138	Queue operation error for score-board setting history (data length too long)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
139	Queue operation error for instruction execution (at ENQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
140	Queue operation error for instruction execution (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
141	Queue operation error for instruction execution (undefined operation)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
142	Queue operation error for instruction execution (data length too long)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
143	Queue operation error for WORK ID conveyor (at ENQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
144	Queue operation error for WORK ID conveyor (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
145	Queue operation error for WORK ID conveyor (undefined operation)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
146	Queue operation error for WORK ID conveyor (data length too long)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
147	Queue operation error for WORK IN/OUT checking conveyor (at ENQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
148	Queue operation error for WORK IN/OUT checking conveyor (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
149	Queue operation error for WORK IN/OUT checking conveyor (undefined operation)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
150	Queue operation error for WORK IN/OUT checking conveyor (data length too long)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
151	Queue operation error for waiting for semaphore for LOCK instruction (at ENQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
152	Queue operation error for waiting for semaphore for LOCK instruction (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
153	Queue operation error for waiting for semaphore for LOCK instruction (undefined operation)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
154	Queue operation error for waiting for semaphore for LOCK instruction (data length too long)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
161	Functional safety command request is full.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
162	Functional safety command request is latency over.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
163	Transfer data overflow in functional safety readback data.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
164	PFL command request is full.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
165	PFL command request is latency over.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
166	Transfer data overflow in PFL readback data.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
221	Transfer data overflow in offline data bank	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
222	Impossible to execute system exclusive for system job	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
223	Event queue number range exceeded	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
224	No motor-gun control group for ESRCH instruction	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
225	The number of WORK ID data and the MAX. WORK FIND COUNT unmatched (MOTION NOT EQUAL CV)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
226	The number of WORK IN/OUT data and the MAX. WORK FIND COUNT unmatched (MOTION NOT EQUAL CV)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
227	Excessive number of scheduling for execution of instructions	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
228	Instruction execution scheduling impossible	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
229	Illegal 1st-line move instruction at execution of +SMOV instruction	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
230	Impossible to execute the slave circular interpolation and the master circular interpolation at the same time	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
231	Impossible to execute the slave spline interpolation and the master spline interpolation at the same time	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
232	Illegal index value for a +MOVx instruction	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
233	No xth-line move instruction exists where the master control group belongs.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
234	Marking error for WORK ID conveyor queue (empty queue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
235	Marking error for WORK IN/OUT conveyor queue (empty queue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
236	Data error 1 at restarting after an emergency stop (actual status and the data status unmatched)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
237	Data error 2 at restarting after an emergency stop (actual status and the data status unmatched)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
238	Data error 3 at restarting after an emergency stop (actual status and the data status unmatched)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
239	Timeout for receiving segment data output request	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
240	The number which designates the setting area of correction amount in RT_BANK exceeded the limit value.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
241	Task error of the function calling source (cv_sync_intr ())	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
242	No control group for motor gun for clearance move instruction	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
243	Motor gun condition file number error (including gun pressure file)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
244	GETTOOLW manipulator designation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
245	Overflow of entry number for instruction execution	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
246	Data latch processing (function number overflow)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
247	Data latch processing (real-time status number overflow)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
248	Failed to set a timer unit. (No allocation space for timer unit setting)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
249	Segment data missing (seg_t_req was not received in time.)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
250	GETS instruction internal error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
251	SETFILE undefined file	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
252	GETFILE undefined file	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
253	The parameter was destroyed when a GETPRM instruction was executed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
254	Null pointer assignment detected	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
255	Function or other processing parameter error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
260	Arithmetic answer is not set at prereading (ADV_HA_ANS.flag == OFF)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
261	Heap area obtainment failure (A_BANK)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
262	Heap area obtainment failure (C_BANK)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
263	Heap area obtainment failure (Instruction queue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
264	Heap area obtainment failure (Path/trace queue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
265	Heap area obtainment failure (IF-Express descriptor)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
270	Error in setting impedance control mode.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
271	Error in releasing impedance control mode.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
279	Specified MSS system instance is not generated.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
280	API error(HDAS_get_alias_name())	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
284	GA generation number is over the limit.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
285	GA gene number is over the limit.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
286	GA initial generation number setting error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
287	GA control group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
288	Learning control analysis error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
294	Job completion time over	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
295	Servo simulator averaging time change error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
296	Precondition judgment target instruction search failure	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
298	Heap area obtainment failure (speed recode queue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
310	Synchronized queue operation error for WORK ID conveyor (at ENQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
311	Synchronized queue operation error for WORK ID conveyor (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
312	Synchronized queue operation error for WORK ID conveyor (undefined operation)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
313	Synchronized queue operation error for WORK ID conveyor (data length too long)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
314	Synchronized queue operation error for WORK IN/OUT checking conveyor (at ENQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
315	Synchronized queue operation error for WORK IN/OUT checking conveyor (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
316	Synchronized queue operation error for WORK IN/OUT checking conveyor (undefined operation)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
317	Synchronized queue operation error for WORK IN/OUT checking conveyor (data length too long)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
318	Synchronized queue operation error for WORK ID conveyor or WORK IN/OUT conveyor (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
319	Synchronized queue empty error for WORK ID conveyor (at execution of CVQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
320	Synchronized queue empty error for WORK IN/OUT conveyor (at execution of CVQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
330	P-PLC suspend err	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
331	P-PLC suspend err	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
332	P-PLC suspend seq err	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
333	P-PLC suspend seq no err	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
334	P-PLC suspend seq no err	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
340	PSTRIG suspend err	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
341	PSTRIG suspend err	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
342	PSTRIG suspend seq err	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
360	Timing Control queue operation (at DEQUE)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
371	ACK response error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
372	Polling command release error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
380	Heap area obtainment failure (M_SV Transfer delay area)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
381	Heap area obtainment failure (M_SU Transfer delay area)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
382	Heap area obtainment failure (M_PFL Transfer delay area)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
500	SL undefined interrupt command (main command)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
501	SL undefined interrupt command (sub command)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
502	Previous SL interrupt command processing	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
503	SL interrupt command data error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
999	Arithmetic section error (segment data all zero timeout)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1000	System clock (RTC) setting error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1001	System task priority arrangement error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1002	VxWorks primitive error (msgQCreate)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1003	VxWorks primitive error (msgQSend)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4207: SYSTEM ERROR(MOTION) (continued)

Sub Code	Meaning	Cause	Remedy
1005	VxWorks primitive error (semBCreate)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1007	VxWorks primitive error (semTake)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1008	VxWorks primitive error (msgQSend) Message queue is full.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1100	Failed system job environment configuration	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1106	System library load failure.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module.
2000	Failed system job environment configuration	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4208: SYSTEM ERROR(ARITH)

A system error occurred in ARITH.

Sub Code	Meaning	Cause	Remedy
1	Prereading task is not completed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The averaging buffer in the arithmetic section is destroyed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	No previous bank exists.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The answer bank flag is ON.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4208: SYSTEM ERROR(ARITH) (continued)

Sub Code	Meaning	Cause	Remedy
8	An error occurred in preparation of current position.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Mails could not correctly be received in the current task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Spline-curve path designation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The previous bank's prereading conversion could not correctly be completed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	A manipulator designation error occurred at JOG operation using the external reference point.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Designation error of cubic interference coordinates	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Path control position data error of prereading bank	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	Station/base axis motion command error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	User coordinates number error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	Processing error in re-preparation of segment control data	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	Prereading task not completed at master in twin synchronous system	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	Dynamic model arithmetic error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4208: SYSTEM ERROR(ARITH) (continued)

Sub Code	Meaning	Cause	Remedy
24	Speed limit control error (excessive moment of gravity)	Setting error	- Check the following settings. - The allowable breaking torque was exceeded only by the gravity moment. Set the gravity value of the tool within payload of the manipulator. - Teach the manipulator orientation that does not become the overload for each-axes of the manipulator. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	Square root of a negative number	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	The system number is not set at master in twin synchronous system.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
29	FORMCUT internal control error	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	Arm interference check error (radius data referencing mistake)	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	Arm interference check error (miscalculation using direct kinematics)	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32	Arm interference check error (L-axis expansion flag setting error)	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
33	Arm interference check error (check-point re-setting error)	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
34	Impossible to edit the averaging buffer (zero division)	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
35	No master-group is designated at preparation of master-tool user coordinates.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
41	Pulse linked JOG function error	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4208: SYSTEM ERROR(ARITH) (continued)

Sub Code	Meaning	Cause	Remedy
42	Special JOG operation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
44	Segment overless: Segment excessive error	Setting error	The teaching position cannot hold down the speed by the segment overless function. Reduce the teaching speed of the job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
45	Segment overless: Path calculation repeat error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
47	Play path control: initialization error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
48	Play path control: continue process error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
49	Play path control: Step continuous initialization error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
50	Play path control: step continuous motion execution process error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
54	Approximation model internal control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
55	Pair coordinate system position calculation function error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
56	OPT higher acceleration and deceleration control is not allowed when Function acceleration and deceleration control is enabled.	Setting error	Check the following settings. • OPT higher acceleration and deceleration control is used. • Don't use the OPT higher acceleration and deceleration control.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
57	Arithmetic error occurred when calculating the acceleration and deceleration time (Function acceleration and deceleration control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4208: SYSTEM ERROR(ARITH) (continued)

Sub Code	Meaning	Cause	Remedy
58	Arithmetic error occurred when recalculating the acceleration and deceleration time (Function acceleration and deceleration control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
59	Arithmetic error occurred when calculating PL control (Function acceleration and deceleration control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
60	Arithmetic error occurred when calculating Function acceleration and deceleration dry run.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
61	Arithmetic error occurred when calculating current path of continuous motion stop operation	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
62	Arithmetic error occurred when calculating next path of continuous motion stop operation	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
63	Arithmetic error occurred when calculating acceleration time when continuous motion in the prereading processing	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
64	Arithmetic error occurred when calculating deceleration time when continuous motion in the prereading processing	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
65	Arithmetic error occurred when calculating acceleration and deceleration time when teaching.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
66	Arithmetic error occurred when calculating acceleration and deceleration time for plucking in prereading processing 1	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
67	Arithmetic error occurred when calculating acceleration and deceleration time for plucking in prereading processing 2	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
68	Arithmetic error occurred when calculating acceleration and deceleration time for plucking in prereading processing 3	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
69	Arithmetic error occurred when calculating acceleration and deceleration time for plucking in prereading processing 4	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4208: SYSTEM ERROR(ARITH) (continued)

Sub Code	Meaning	Cause	Remedy
70	Arithmetic error occurred when calculating acceleration and deceleration for PL control plucking in prereading processing 1	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
71	Arithmetic error occurred when calculating acceleration and deceleration for PL control plucking in prereading processing 2	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
72	Arithmetic error occurred when calculating acceleration and deceleration for plucking	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
73	Arithmetic error occurred when calculating acceleration and deceleration for PL control in prereading processing 1	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
74	Arithmetic error occurred when calculating acceleration and deceleration for PL control in prereading processing 2	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
75	Arithmetic error occurred when calculating acceleration and deceleration for PL control in prereading processing 3	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
76	Arithmetic error occurred when calculating acceleration and deceleration for PL control in prereading processing 4	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
77	Arithmetic error occurred when calculating acceleration and deceleration for PL control in prereading processing 5	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
102	Posture control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	HA Servo Simulation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	Timing control function control group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
106	Feedback approximation model table queue control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4208: SYSTEM ERROR(ARITH) (continued)

Sub Code	Meaning	Cause	Remedy
107	Feedback approximation model data reference error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
109	Speed corresponding position correction section multi step detection error	Setting error	Do not register more than two move instructions within the section "SFTON CSPD" and "SFTOF CSPD".
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
110	Speed corresponding position correction control group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
111	Speed corresponding position correction start time ratio error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
112	Speed corresponding position correction speed override level error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
65535	For HA debug use	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4209: OFFLINE SYSTEM ERROR(ARITH)

A system error occurred in arithmetic section offline.

Sub Code	Meaning	Cause	Remedy
100	Data setting error in offline data bank	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
101	Data setting error in offline answer bank	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
102	OFF_USER_POS occupation control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	OFF_USER_POS valid control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4209: OFFLINE SYSTEM ERROR(ARITH) (continued)

Sub Code	Meaning	Cause	Remedy
104	Mail-receiving error of offline task	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	Offline occupation control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
107	OFF_USER_ROT_POS occupation control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
108	OFF_USER_ROT_POS valid control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
109	OFF_CV_CALIB_POS occupation control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
110	OFF_CV_CALIB_POS valid control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
111	Incorrect teaching for offline conveyor tracking turntable function	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
112	No manipulator is designated for offline conveyor tracking turntable function.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
117	Detour posture control setup process error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4210: SYSTEM ERROR(LOCAL VARIABLE)

A system error occurred in local variable processing section.

Sub Code	Meaning	Cause	Remedy
-1	Local variable is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	Memory area for local variable could not be obtained.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4210: SYSTEM ERROR(LOCAL VARIABLE) (continued)

Sub Code	Meaning	Cause	Remedy
-3	The local variable area could not be secured when calling the job.	Software operation error occurred	The number of reserved local variable areas has exceeded the upper limit. Review the job call location as follows and reduce the number of times the local variable area is secured. - For job calls that do not need to return to the caller, change them to JUMP instructions instead of CALL instructions. - When you no longer need to return to the caller, execute CLEAR STACK to reset the job call stack.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-4	An error occurred in exclusive control.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-5	Handle value is invalid for specified local variable.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-6	Handle value is incorrect for specified local variable.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-7	An error occurred when memory area for local variable was released.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-8	An error occurred when memory area for local variable was registered.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-9	Local variable control process is not initialized.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-10	Local variable area shared heap area.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-11	An error occurred in exclusive control.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-12	An error occurred in exclusive control when control of the local variable was processed.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4218: MOTOR POWERON STATUS NOT READY

The servo amplifier does not enter the "M_RDY" state during Servo ON processing.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Robot control module -CN3 - Multi-axis servo amplifier -CN6A,CN6B - Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4219: MOTOR STOP MODE ERROR

The motor stop mode status received from the servo amplifier is not an allowed mode.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Robot control module -CN3 - Multi-axis servo amplifier -CN6A,CN6B - Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4220: SERVO POWER OFF FOR JOB

The servo power is not supplied to the job control group axis to be operated.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Turn OFF the servo power supply, and then turn ON the servo power supply for the group axis to be operated.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4221: SERVO POWER OFF FOR JOB

The servo power is not supplied to the job control group axis to be operated.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	The servo power is not supplied.	Turn OFF the servo power supply, and then turn ON the servo power supply for the group axis to be operated.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4224: MEMOPLAY FILE ERROR

An error occurred in memory play file.

Sub Code	Meaning	Cause	Remedy
-1	An error occurred in control process for memory play file.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	The arrangement address information is destroyed for memory play file system.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-3	The fixed control information is destroyed for memory play file system.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-4	The fixed control information is destroyed for memory play file system.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-5	An attempt was made to newly register the memory play file under use.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-6	An error occurred in checking written sampling data when the data was written to CMOS.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4224: MEMOPLAY FILE ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-7	An attempt was made to access an unused memory play file data.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-8	The memory play file is destroyed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-9	The memory area for sampling data is full.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-10	The sampling data is destroyed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-11	Data in control process for memory play file is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-12	The sampling data is scanned only at top or end position.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-13	The memory play file system is not initialized.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-14	The offset value is out of range at sampling data scanning.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4225: OVER SPEED(RC)

The motor real speed (feedback) exceeded the speed limit.

The speed limit is safety speed at teach mode and maximum speed at play mode.

Sub Code	Meaning	Cause	Remedy
	Signifies the control axis number which detected an error	Setting error	Check the following settings. • The gun tip hits the welded target distance of motor gun • manipulator motion (external force, gravity)
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • The motor power line • The encoder line
		Module failure(motor)	1. Reset the alarm. 2. If the alarm occurs again, replace the following unit. • The motor

4225: OVER SPEED(RC) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4226: COMMUNICATION SERVICE ERROR

An error occurred at OPEN/CLOSE instruction execution.

The communication channel could not be opened/closed.

Sub Code	Meaning	Cause	Remedy
1	The communication channel could not be opened/closed at OPEN/CLOSE instruction execution.	Setting error	Check the following settings. • Setting of the RS (transmission) parameter
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	The communication port is already opened.	Setting error	Check the following settings. The serial port setting
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
101	The communication port is not opened.	Setting error	Check the following settings. The serial port setting
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
102	No space was found in data sent buffer.	Setting error	Check the following settings. The serial port setting
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	The setting value for the event queue designation parameter is incorrect.	Setting error	1. Reset the alarm. 2. Check the following settings. • RS157- - - Set to 1 to 4
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	The type of output data is incorrect.	Setting error	1. Reset the alarm. 2. Check the following settings. The serial port setting
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4228: WRONG DATA

The YNX1000 divides the job; instruction data and position data, into separate files to save.

This alarm occurs if it detects the inconsistency between the Job instruction and position file.

The following are the causes of the inconsistency.

Cause 1: Single position data is chained by the plural Job instruction data. (Overlapped chain)

Cause 2: Job instruction file chains the unregistered position data. (Unregistered position data chain)

Cause 3: Registered position data is not chained.(Unchained position data)

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	- Reset the alarm, and then execute following operation. - Select a sub menu [WRONG DATA LOG] under main menu [SETUP]. - Execute "RESTORE" by selecting "UTILITY" from the pull-down menu. *Occurrence date changes to restoration date after it is restored. - Turn the power OFF and then ON to check the factor of the inconsistency 1 and 2, on the data inconsistency screen in maintenance mode . The factor 1: Check the position of the corresponding file The factor 2: Register the position of the corresponding file again *The factor 3: Just turn the power OFF and then ON again. - If it would not restore, select "RE CHECK" from the pull-down menu. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Data error	- If different axes configuration data is loaded, the system data becomes incorrect status, which causes this alarm. In this case, execute the following operations. - Select a sub menu [WRONG DATA LOG] under main menu [SETUP]. - Select "UTILITY" from the pull-down menu to execute "RESTORE". - Load correct axes configuration data - If it would not restore, select "RE CHECK" from the pull-down menu, and then load correct axes configuration data.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4229: ETHERNET PROCESS ERROR

An error occurred when the Ethernet function was used.

Sub Code	Meaning	Cause	Remedy
1	An error occurred in the acquisition process of the IP address during the IP address monitoring process of the Ethernet function.(LAN interface 2)	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error occurred in the acquisition process of subnet mask during the network service data creation process of the Ethernet function.(LAN interface 2)	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An error occurred in the acquisition process of gateway during the network service data creation process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error occurred in the conversion process of gateway address during the network service data creation process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	An error occurred in the conversion process of DNS server address during the network service data creation process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	An error occurred in the acquisition process of domain during the network service data creation process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	An error occurred in the acquisition process of SNTP server during the network service data creation process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
8	An error occurred in the acquisition process of host name during the network service data creation process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	An error occurred in the newest DNS information getting process from DHCP server in the DNS process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	An error occurred in the setting process to update DNS information in the DNS process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	An error occurred in the setting clearing process to update DNS information in the DNS process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
20	The subnet mask was not able to be acquired in the DHCP information update process of the Ethernet function.(LAN interface 2)	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	Subnet mask update error occurred in the DHCP information update process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	Gateway update error occurred in the DHCP information update process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	Gateway clear error occurred in the DHCP information update process of the Ethernet function.	Setting error	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
35	IP address duplication was detected.(LAN interface 2)	Setting error	Check the following settings. - IP address setting of LAN interface in maintenance mode - IP addresses of other devices in the network.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
36	IP address duplication was detected.	Setting error	Check the following settings. - IP address setting of LAN interface in maintenance mode - IP addresses of other devices in the network.
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
40	IP address cannot be gotten or cannot be updated via DHCP. (LAN interface 2)	Setting error	Check the following settings and status. - The DHCP server operation (If the DHCP is used) - The network status (If the DHCP is used)
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
50	Gateway setting is faulted.	Software operation error occurred	Check the following settings. - Default gateway setting of LAN interface in maintenance mode - Leased IP address, when getting IP address from DHCP.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
51	Static route setting is faulted. (LAN interface 2, route 1)	Software operation error occurred	Check the following settings. • Static route setting of LAN interface in maintenance mode • Leased IP address, when getting IP address from DHCP.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
52	NAT setting is faulted.(LAN interface 2)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
53	The host address to be used in ethernet function is not configured correctly.	Software operation error occurred	Check the following settings. • The host address setting of LAN interface in maintenance mode
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
151	Static route setting is faulted. (LAN interface 2, route 2)	Software operation error occurred	Check the following settings. • Static route setting of LAN interface in maintenance mode • Leased IP address, when getting IP address from DHCP.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
1001	An error occurred in the acquisition process of the IP address during the IP address monitoring process of the Ethernet function.(LAN interface 3)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
1002	An error occurred in the acquisition process of subnet mask during the network service data creation process of the Ethernet function.(LAN interface 3)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
1020	The subnet mask was not able to be acquired in the DHCP information update process of the Ethernet function.(LAN interface 3)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
1035	IP address duplication was detected.(LAN interface 3)	Software operation error occurred	Check the following settings. • IP address setting of LAN interface in maintenance mode • IP addresses of other devices in the network.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
1040	IP address cannot be gotten or cannot be updated via DHCP. (LAN interface 3)	Software operation error occurred	Check the following settings and status. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
1051	Static route setting is faulted. (LAN interface 3, route 1)	Software operation error occurred	Check the following settings. • Static route setting of LAN interface in maintenance mode • Leased IP address, when getting IP address from DHCP.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
1052	NAT setting is faulted.(LAN interface 3)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
1151	Static route setting is faulted. (LAN interface 3, route 2)	Software operation error occurred	Check the following settings. • Static route setting of LAN interface in maintenance mode • Leased IP address, when getting IP address from DHCP.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD from the failed robot control module to insert it into the new robot control module.
2001	An error occurred in the acquisition process of the IP address during the IP address monitoring process of the Ethernet function.(LAN interface 4)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2002	An error occurred in the acquisition process of subnet mask during the network service data creation process of the Ethernet function.(LAN interface 4)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2020	The subnet mask was not able to be acquired in the DHCP information update process of the Ethernet function.(LAN interface 4)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2035	IP address duplication was detected.(LAN interface 4)	Software operation error occurred	Check the following settings. • IP address setting of LAN interface in maintenance mode • IP addresses of other devices in the network.
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2040	IP address cannot be gotten or cannot be updated via DHCP. (LAN interface 4)	Software operation error occurred	Check the following settings and status. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2051	Static route setting is faulted. (LAN interface 4, route 1)	Software operation error occurred	Check the following settings. • Static route setting of LAN interface in maintenance mode • Leased IP address, when getting IP address from DHCP.
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2052	NAT setting is faulted.(LAN interface 4)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2151	Static route setting is faulted. (LAN interface 4, route 2)	Software operation error occurred	Check the following settings. • Static route setting of LAN interface in maintenance mode • Leased IP address, when getting IP address from DHCP.
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3001	An error occurred in the acquisition process of the IP address during the IP address monitoring process of the Ethernet function.(LAN interface 5)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3002	An error occurred in the acquisition process of subnet mask during the network service data creation process of the Ethernet function.(LAN interface 5)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3020	The subnet mask was not able to be acquired in the DHCP information update process of the Ethernet function.(LAN interface 5)	Software operation error occurred	Check the following settings. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3035	IP address duplication was detected.(LAN interface 5)	Software operation error occurred	Check the following settings. • IP address setting of LAN interface in maintenance mode • IP addresses of other devices in the network.

4229: ETHERNET PROCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3040	IP address cannot be gotten or cannot be updated via DHCP. (LAN interface 5)	Software operation error occurred	Check the following settings and status. • The DHCP server operation (If the DHCP is used) • The network status (If the DHCP is used)
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3051	Static route setting is faulted. (LAN interface 5, route 1)	Software operation error occurred	Check the following settings. • Static route setting of LAN interface in maintenance mode • Leased IP address, when getting IP address from DHCP.
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3052	NAT setting is faulted. (LAN interface 5)	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then remove the SD CARD from the failed robot control module to insert it into the new robot control module.
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3151	Static route setting is faulted. (LAN interface 5, route 2)	Software operation error occurred	Check the following settings. • Static route setting of LAN interface in maintenance mode • Leased IP address, when getting IP address from DHCP.
		YFB01 board failure	1. Reset the alarm. 2. If the alarm occurs again, Turn the power OFF then back ON. 3. If the alarm occurs again, replace the YFB011 board 4. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4234: COMMUNICATION TIMEOUT(IO MODULE)

An error was detected in communications timeout with the I/O module board when the control power turned ON.

Sub Code	Meaning	Cause	Remedy
0	The IO module board connected with 0th serial bus exists.	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
1	An error was detected in communications timeout with the I/O module board connected with 1st serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error was detected in communications timeout with the I/O module board connected with 2nd serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An error was detected in communications timeout with the I/O module board connected with 3rd serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode

4234: COMMUNICATION TIMEOUT(IO MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error was detected in communications timeout with the I/O module board connected with 4th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	An error was detected in communications timeout with the I/O module board connected with 5th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4234: COMMUNICATION TIMEOUT(IO MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
6	An error was detected in communications timeout with the I/O module board connected with 6th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	An error was detected in communications timeout with the I/O module board connected with 7th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	An error was detected in communications timeout with the I/O module board connected with 8th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.

4234: COMMUNICATION TIMEOUT(IO MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	An error was detected in communications timeout with the I/O module board connected with 9th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	An error was detected in communications timeout with the I/O module board connected with 10th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	An error was detected in communications timeout with the I/O module board connected with 11th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module

4234: COMMUNICATION TIMEOUT(IO MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	An error was detected in communications timeout with the I/O module board connected with 12th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	An error was detected in communications timeout with the I/O module board connected with 13th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	An error was detected in communications timeout with the I/O module board connected with 14th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode

4234: COMMUNICATION TIMEOUT(IO MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • MII communications cable (CN114) of the AIF01 board • MII communications cable (CN300) of the YIU unit • (For MII communications last station) Terminator • 24V power of the YIU unit
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	An error was detected in communications timeout with the I/O module board connected with 15th serial bus when the control power turned ON.	Setting error	Check the following settings. • The rotary switch setting which specifies slot numbers of each I/O module • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • The MII communications cable which I/O module of the corresponding node number • (For MII communications last station) Terminator • 24V power of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	An error was detected in communications timeout with the I/O module board connected with 1st PCI connector when the control power turned ON.	Setting error	Check the following settings. • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4234: COMMUNICATION TIMEOUT(IO MODULE) (continued)

Sub Code	Meaning	Cause	Remedy
17	An error was detected in communications with the I/O module board connected with 2nd PCI when the control power turned ON.	Setting error	Check the following settings. • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	An error was detected in communications timeout with the I/O module board connected with 3rd PCI when the control power turned ON.	Setting error	Check the following settings. • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	An error was detected in communications timeout with the I/O module board connected with 4th PCI when the control power turned ON.	Setting error	Check the following settings. • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		I/O module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4294: CANNOT EXECUTE INST(HPMMV CTRL)

The instruction specified in the high speed multi-move interval could not be executed.

Sub Code	Meaning	Cause	Remedy
1	An instruction that does not support high speed multi-move has been executed.	Setting error	Correct the job so that instructions that do not support high speed multi-move are not executed in the high speed multi-move section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4295: HPMMV CTRL FAILED

Execution of high speed multi-move has failed.

Sub Code	Meaning	Cause	Remedy
1	Failed to restart the high speed multi-move job.	Software operation error occurred	1. Reset the alarm, and re-select the job from [select job] window before starting the job again . 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Motion control not compatible with high speed multi-move has been executed.	Setting error	Correct the job so that motion control not compatible with high speed multi-move is not executed in the high speed multi-move section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Speed control that does not support high speed multi-move has been executed.	Setting error	Correct the job so that high speed multi-move non-compliant speed control is not executed in the high speed multi-move section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4296: IMPOSSIBLE_HPMMV_CTRL

Operation of high speed multi-move has failed.

Sub Code	Meaning	Cause	Remedy
1	Control group that does not support high speed multi-move has been executed.	Setting error	Correct the job so that high speed multi-move non-compliant control group is not executed in the high speed multi-move section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Interpolation that does not support high speed multi-move has been executed.	Setting error	Correct the job so that high speed multi-move non-compliant interpolation is not executed in the high speed multi-move section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4296: IMPOSSIBLE_HPMMV_CTRL (continued)

Sub Code	Meaning	Cause	Remedy
3	Function that does not support high speed multi-move has been executed.	Setting error	Correct the job so that high speed multi-move non-compliant function is not executed in the high speed multi-move section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error occurred in a calculated speed by high speed multi-move	Setting error	1. Reset the alarm, and re-select the job from [select job] window before starting the job again . 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Tag that does not support high speed multi-move has been executed.	Setting error	Correct the job so that high speed multi-move non-compliant tag is not executed in the high speed multi-move section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1	An error occurred in a high speed multi-move data.	Other	1. Reset the alarm, and re-select the job from [select job] window before starting the job again . 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	Checking high speed multi-move has failed.	Other	1. Reset the alarm, and re-select the job from [select job] window before starting the job again . 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4300: VERIFY ERROR(SERVO PARAMETER)

The parameter input value is out of the allowable range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the parameter in which the alarm occurred.	Setting error	1. Reset the alarm. 2. If the alarm occurs again, check the settings of any parameters that were operated just before the alarm occurred.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4301: CONTACTOR ERROR

The YNX1000 system checks the status of the power supply contactor unit. This alarm occurs if there is an inconsistency between the control output and contactor status.

Ex.)

- The signal from the contactor turned OFF while the servo was ON.
- The contactor turned ON while the servo was OFF for emergency stop.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the physical No. of contactor in which the alarm occurred Before performing a connection check of the wiring, turn OFF the controller power. Make sure that all the LEDs of SERVOPACK and converter are OFF, then verify that no electricity is charged using equipment such as a tester. This process may take a few minutes after shutting off the power.	Power supply contactor unit failure	1. Reset the alarm. 2. Check the connection and inserting state of the following cables and connectors. • Multi-axis servo amplifier -CN12 • power supply contactor unit -CN604 3. If the alarm occurs again, replace the power supply contactor unit. Save the CMOS.BIN before replacing the unit to be safe.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4307: SERVO ON DEFECTIVE SPEED

This alarm occurs if any manipulator axis moves (or any motor operates) when the servo power turned ON.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Mechanical failure	Check that the manipulator is not moving when the servo turned ON.
		Brake failure	Check that the brake has not been released because the brake relay is broken.
		Servo motor failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo motor.

4307: SERVO ON DEFECTIVE SPEED (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4308: VOLTAGE DROP(CONVERTER)

This alarm occurs if there is any error in the charge status of converter when the Servo ON.

Servo amplifier alarm A.410

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Voltage failure	- Reset the alarm. - If the alarm occurs again, check if the primary power supply voltage is dropping.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Robot control module -CN03 - Multi-axis servo amplifier -CN6A,CN6B - Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4310: ENCODER OVERHEAT

The encoder monitors its own temperature; the internal temperature of the encoder is abnormal.

Note that if the encoder temperature has not dropped to the appropriate temperature even after alarm reset, the message "The temperature of motor is increasing" is displayed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo motor overheated	- Reset the alarm. - If the alarm occurs again, turn OFF the power supply to the robot controller for about 10 minutes to lower the motor temperature.
		Ambient temperature abnormal	- Reset the alarm. - If the alarm occurs again, check the following - Check the ambient temperature is compatible with the installation temperature of Robot controller.

4310: ENCODER OVERHEAT (continued)

Sub Code	Meaning	Cause	Remedy
		Encoder failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo motor.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4311: ENCODER BACK-UP ERROR

Encoder resetting (initialization) not completed.

The position data in the encoder was lost due to the voltage drop of encoder backup battery.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(encoder battery)	[AL-4314 occurred] Replace the battery of the axis in which the error occurred. [AL-1327 occurred] Replace the battery of the axis in which the alarm occurred. If the home position of the corresponding axis is displayed as "****", register the home position again. AL-1327 occurs due to the battery disconnection (weak battery), causing undefined alarm data. If the alarm doesn't occur after turning the power OFF and then ON, there is no problem.
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 • Cable between encoders
		Module failure(encoder)	1. Reset the alarm. 2. If the alarm occurs again, replace the encoder.
		Module failure(servo amplifier)	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifier.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4312: ENCODER BATTERY ERROR

Encoder backup battery voltage is too low.

The voltage of the encoder backup battery is below 2.8V.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Module failure(encoder battery)	Replace the battery.
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the Manipulator cables.
		Module failure(encoder)	1. Reset the alarm. 2. If the alarm occurs again, replace the encoder.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4315: COLLISION DETECT

A collision was detected because of the interference between the manipulator and a peripheral device.

The external force applied to the robot exceeded the threshold.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the following settings. • The tool information • The selection tap of the transfer • The collision detection level • JOB • Work • The speed of JOB • The acceleration/deceleration speed of ACC and DEC • Length of the power cables • Diameter of the power cables
		Interference error	Remove the following interferences. • The interferences to the jigs of Robot. • The interferences to the jigs of workpieces. • If there is no interference between robot and workpieces, set the shock detection level to more than maximum eternal value. Up to 500% can be set.
		Acceleration limit over	This alarm occurs when excessive load is applied to the motor upon the satisfactions of all the following conditions; • The acceleration/deceleration is automatically calculated by the manipulator's position at start/end point • The JOB is stopped by category 1 stop or HOLD stop • Compared to the start/end point, excessive load is applied to the motor according to the position <Remedy> Adjust the acceleration/deceleration by ACC and DEC for the teaching position. Also, make sure to run the machine enough before operation when this alarm occurs at low temperature environment (ambient temperature: 10 degrees)

4315: COLLISION DETECT (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Connection failure	- If the alarm occurs again, check the wiring of phase-U, -V, and -W isn't disconnected. - If disconnected, replace the motor power wire.
		Connection failure	- Check that the motor brake wire is not disconnected. - If disconnected, replace the motor brake wire.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Speed reducer maintenance failure	Measure the density of grease iron powder in the speed reducer and do the maintenance.
		Defective speed reducer	Replace the speed reducer or the grease of it.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4320: OVERLOAD(CONTINUE)

This alarm occurs to protect the servo motor from overloading when 110% to 150% of the rated torque is continuously loaded.

Servo amplifier alarm A.720

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the tools or the mass of the workpieces.
		Interference with peripheral devices	Check if the manipulator interferes with any objects such as workpieces or peripheral devices. If interferes, remove the object.
		Setting error	Review the JOB to check if the load factor doesn't exceed 100%.

4320: OVERLOAD(CONTINUE) (continued)

Sub Code	Meaning	Cause	Remedy
		Brake control board failure	- Check if the brake voltage has been applied to the following terminal. - Multi-axis servo amplifier (brake control board) -CN202 - Motor brake terminal - If any error is found, replace the Multi-axis servo amplifier (brake control board). Save the CMOS.BIN before replacing the board to be safe.
		Single-axis brake control unit failure	- Check if the brake voltage has been applied to the following terminal. - Single-axis brake control unit -CN25 - Motor brake terminal - If any error is found, replace the single-axis brake control unit.
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Connection failure	- Reset the alarm. - If the alarm occurs again, replace the internal wiring harness.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4321: OVERLOAD(MOMENT)

This alarm occurs instantly to protect the servo motor from overloading when 200% of the rated torque is loaded.
Servo amplifier alarm A.710

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the tools or the mass of the workpieces.
		Interference with peripheral devices	Check if the manipulator interferes with any objects such as workpieces or peripheral devices. If interferes, remove the object.
		Setting error	Review the JOB to check if the load factor doesn't exceed 100%.

4321: OVERLOAD(MOMENT) (continued)

Sub Code	Meaning	Cause	Remedy
		Brake control board failure	- Check if the brake voltage has been applied to the following terminal. - Multi-axis servo amplifier (brake control board) -CN202 - Motor brake terminal - If any error is found, replace the Multi-axis servo amplifier (brake control board). Save the CMOS.BIN before replacing the board to be safe.
		Single-axis brake control unit failure	- Check if the brake voltage has been applied to the following terminal. - Single-axis brake control unit -CN25 - Motor brake terminal - If any error is found, replace the single-axis brake control unit.
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Connection failure	- Reset the alarm. - If the alarm occurs again, replace the internal wiring harness.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4326: OVER SPEED

This alarm occurs if the motor speed indicated in the axis data exceeds the allowable maximum motor speed.
Servo amplifier alarm A.510

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs. If the alarm occurs for the motor gun, check the following settings. • Setting of the touch speed • Setting of the touch pressure
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F • Single-axis servo amplifier -U, V, W
		Servo motor failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo motor.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4327: WRONG MOTOR ROTATION

While the motor is accelerating, the direction of the torque and the speed was detected as being the opposite of what it was supposed to be.

Servo amplifier alarm A.C10

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. Motor power cable - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W Encoder cable - Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F - Single-axis servo amplifier -CN2
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4328: SERVO TRACKING ERROR

The axis deviated from the specified position and motion path beyond the allowable range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the following settings. The tools or the mass of the workpieces
		Interference error	Check if the manipulator interferes with any objects such as workpieces or peripheral devices. If interferes, remove the object.
		Acceleration limit over	This alarm occurs when excessive load is applied to the motor upon the satisfactions of all the following conditions; - The acceleration/deceleration is automatically calculated by the manipulator's position at start/end point - The JOB is stopped by category 1 stop or HOLD stop - Compared to the start/end point, excessive load is applied to the motor according to the position <Remedy> Adjust the acceleration/deceleration by ACC and DEC for the teaching position. Also, make sure to run the machine enough before operation when this alarm occurs at low temperature environment (ambient temperature: 10 degrees)

4328: SERVO TRACKING ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F, CN202 - Single-axis servo amplifier -U, V, W, CN1 - Single-axis brake control unit -CN22, CN23, CN24, CN25 - Manipulator cable
		Brake control board failure	- Check if the brake voltage has been applied to the following terminal. - Multi-axis servo amplifier (brake control board) -CN202 - Motor brake terminal - If any error is found, replace the Multi-axis servo amplifier (brake control board). Save the CMOS.BIN before replacing the board to be safe.
		Single-axis brake control unit failure	- Check if the brake voltage has been applied to the following terminal. - Single-axis brake control unit -CN25 - Motor brake terminal - If any error is found, replace the single-axis brake control unit.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4329: SAFETY SPEED ERROR(SERVO)

This alarm occurs if the motion speed at the center of the control point and the center of the flange exceeded the specified max. speed.

Sub Code	Meaning	Cause	Remedy
11	The motion speed at the center of the flange exceeded the specified max. speed. (R1)	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The motion speed at the center of the flange exceeded the specified max. speed. (R1)	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	The motion speed at the center of the control point exceeded the specified max. speed. (R1)	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs.

4329: SAFETY SPEED ERROR(SERVO) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	The motion speed at the center of the control point exceeded the specified max. speed. (R1)	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
211	The motion speed at the center of the flange exceeded the specified max. speed. (R2)	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.

4329: SAFETY SPEED ERROR(SERVO) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
212	The motion speed at the center of the flange exceeded the specified max. speed. (R2)	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
221	The motion speed at the center of the control point exceeded the specified max. speed. (R2)	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4329: SAFETY SPEED ERROR(SERVO) (continued)

Sub Code	Meaning	Cause	Remedy
222	The motion speed at the center of the control point exceeded the specified max. speed. (R2)	Setting error	If the alarm occurs at the same site, set the lower motion speed around the site where the alarm occurs.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4331: SPEED MONITOR LEVEL ERROR

The speed monitor level is incorrect.

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4334: OVERVOLTAGE(CONVERTER)

The DC voltage supplied from the converter to the servo amplifier has exceeded the specified voltage.

Servo amplifier alarm A.400

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the physical No. of converter in which the alarm occurred	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Robot control module -CN3 - Multi-axis servo amplifier -CN6A,CN6B - Single-axis servo amplifier -CN6A,CN6B
		Setting error	Check the load mounted on the manipulator.
		Voltage failure	Modify the primary breaker voltage to the voltage specified for the power supply on the rated label on the door of the controller.
		Regenerative resistor failure	- Reset the alarm. - If the alarm occurs again, check if there is no cable disconnection. - Multi-axis servo amplifier -CN116 - Single-axis servo amplifier -B1/+, B2 - If disconnected, replace the regenerative resistor.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4336: OPEN PHASE(CONVERTER)

This alarm occurs if there is an open phase in the converter input power.

Servo amplifier alarm A.F10

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the physical No. of converter in which the alarm occurred.	Setting error	If you use single-phase input power supply, set S2C2050=1 (single-phase input power specification).
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - power supply contactor unit -CN601, CN602 - Robot control module -CN3 - Multi-axis servo amplifier -CN101,CN6A,CN6B - Single-axis servo amplifier -L1, L2, L3, CN6A,CN6B

4336: OPEN PHASE(CONVERTER) (continued)

Sub Code	Meaning	Cause	Remedy
		Voltage failure	Modify the primary breaker voltage to the voltage specified for the power supply on the rated label on the door of the controller.
		GPU01 unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the GPU01 unit. Save the CMOS.BIN before replacing the board to be safe.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4344: LINEAR SERVOFLOAT TRACKING ERROR

The deviation of X, Y, and Z-axis exceeded the allowable limit while the linear servo float was in execution.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Check the settings for jobs. 2. Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4345: LNK SERVOFLOAT EXECUTE ERROR

Request of the link servo float execution was sent to an axis where the linear servo float is executing.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Check the settings for jobs. 2. Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4346: LNK SERVOFLOAT TRQ LIMIT ERROR

The limit torque of the link servo float condition file is outside the specified range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Check the limit torque of the link servo float condition file. 2. Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4347: LNR SERVOFLOAT TRQ LIMIT ERROR

The limit torque of the linear servo float condition file is outside the specified range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Check the limit torque of the link servo float condition file. 2. Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4348: LNR SERVOFLOAT COORD TYPE ERROR

While the linear servo float was in execution, another request of linear servo float execution was sent with a different coordinates specified.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies linear servo float condition file number in which the alarm occurred	Setting error	1. Check the setting file of the job and the linear servo float. 2. Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4349: LNR SERVOFLOAT TOOL POSE ERROR

Another request of the linear servo float execution with a different tool orientation control specified was sent to an axis where the linear servo float is executing.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Check the setting file of the job and the linear servo float. 2. Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4350: LNR SERVOFLOAT EXECUTE ERROR

Request of the linear servo float execution was sent to an axis where the link servo float is executing.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Check the settings for jobs. 2. Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4351: DRIVE BELT SNAP DETECT

The driving belt may be disconnected because the torque decreased below the normal value.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Driving belt failure	1. Check that the driving belt is not broken. 2. If the driving belt is broken, replace the driving belt.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4352: TWIN DRIVE OVER DEVIATION

The deviation of the position error pulse from the twin drive axis exceeded the allowable limit with twin drive function.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F - Single-axis servo amplifier -CN2 - Cable between encoders.
		Connection failure (motor power)	1. If the alarm occurs again, check the wiring of phase-U, -V, and -W isn't disconnected. 2. If disconnected, replace the motor power wire.
		Connection failure (motor brake)	1. Check that the motor brake wire is not disconnected. 2. If disconnected, replace the motor brake wire.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.

4352: TWIN DRIVE OVER DEVIATION (continued)

Sub Code	Meaning	Cause	Remedy
		Servo motor failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo motor.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4353: DEFECTIVE TAUGHT POINT(ENDLESS)

This alarm occurs if the feedback pulse count of endless operation axis exceeds the allowable maximum pulse count (+-536,870,912).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the following settings. • Setting of the command soft (JOB) • MRESET instruction to corresponding axis
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4354: FILE NO. ERROR(SHOCK LEVEL)

The collision detection file for exclusive use for the SVSPOT is used with the SHCKSET instruction.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number.	Setting error	Do not use the collision detection file for exclusive use for the SVSPOT with the SHCKSET instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4355: EXTERNAL PRES DETECT(SERVOFLOAT)

An external force above the threshold was detected on the servo-float executing axis.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the settings for jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4362: POWER SUPPLY READY ERROR(SERVO)

The servo amplifier is not ready to accept Servo ON in the Servo ON command process.

"M_RDY" or "PON" status of the servo amplifier is abnormal.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - power supply contactor unit -CN601, CN602 - Robot control module -CN3 - Multi-axis servo amplifier -CN101,CN6A,CN6B - Single-axis servo amplifier -L1, L2, L3, CN6A,CN6B
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4363: BASE BLOCK SIGNAL ERROR(SERVO)

The status of "SVON" feedback from the servo amplifier is inconsistent with the command status of the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Robot control module -CN03 - Multi-axis servo amplifier -CN6A,CN6B - Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4364: GUN SOFTLIMIT

The gun axis exceeded the software limit while pressuring operation is executed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	Check the following settings. Home position of gun axis [Released side] Reset the software limit of released side gun. (Parameter S1CxG800 or 810) [Closed side] Reset the software limit at the gun closed side. Add the moving amount of tip wear. (Parameter S1CxG800 or 810)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4365: TOUCH DETECT DATA OVER

In comparison to the position, where the gun tip hits the welded target, at the previous wear detection, the position during pressuring exceeded the allowable limit which had been set in "ALLOWABLE TOUCH RANGE" in the GUN DETAIL SETTING file.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. - Home position of gun axis "ALLOWABLE TOUCH RANGE" in the GUN DETAIL SETTING file "PULSE - STROKE" setting in the GUN CONDITION file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4366: GUN BEND COMPENSATION SET ERROR

The function of gun bending correction was performed to the model which was not supported for the function. No gun and robot axis exists in the same SV board.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the group in which the alarm occurred	Setting error	Check if this model is supported.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4367: ROBOT POSE ERROR

Because the manipulator position is the singular point, the robot cannot execute the gun arm bend compensation.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	1. Check the teaching position. 2. If the alarm occurs at SVSPOT or SVSPOTMOV instruction, if you disable the gun arm bend compensation by specifying the BCOFF tag to the instruction, the alarm won't occur.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4371: SYSTEM ERROR(SERVO)

An error occurred in the program operation check of the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Indicates alarm factors.	Software operation failure	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4379: SAFETY RELAY ERROR(SERVO)

An feedback error of the output of STO signal is detected by Robot control module (Servo processing) in diagnosis process.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the settings for CONNECTION(STO/CONTACTOR) in maintenance mode
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the robot safety module-CN205 connectors. 3. When using the servo OFF function by the DIRECTIN signal, check the following settings; • The DIRECTIN signals are not set to servo OFF when performing servo ON. • Check the connection and inserting state of the DIRECTIN signals.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.

4379: SAFETY RELAY ERROR(SERVO) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4398: PULSE LIMIT(SERVO)

The speed control axis exceeded its pulse limit.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Check the following settings. • Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is within the motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4399: SERVO TRACKING ERROR(LOW)

The axis deviated from the specified position and motion path beyond the allowable range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Check the following settings. • The tools or the mass of the workpieces
		Interference error	Check if the manipulator interferes with any objects such as workpieces or peripheral devices. If interferes, remove the object.
		Acceleration limit over	This alarm occurs when excessive load is applied to the motor upon the satisfactions of all the following conditions; • The acceleration/deceleration is automatically calculated by the manipulator's position at start/end point • The JOB is stopped by category 1 stop or HOLD stop • Compared to the start/end point, excessive load is applied to the motor according to the position <Remedy> Adjust the acceleration/deceleration by ACC and DEC for the teaching position. Also, make sure to run the machine enough before operation when this alarm occurs at low temperature environment (ambient temperature: 10 degrees)

4399: SERVO TRACKING ERROR(LOW) (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F, CN202 - Single-axis servo amplifier -U, V, W, CN1 - Single-axis brake control unit -CN22, CN23, CN24, CN25 - Manipulator cable
		Brake control board failure	- Check if the brake voltage has been applied to the following terminal. - Multi-axis servo amplifier (brake control board) -CN202 - Motor brake terminal - If any error is found, replace the Multi-axis servo amplifier (brake control board). Save the CMOS.BIN before replacing the board to be safe.
		Single-axis brake control unit failure	- Check if the brake voltage has been applied to the following terminal. - Single-axis brake control unit -CN25 - Motor brake terminal - If any error is found, replace the single-axis brake control unit.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4400: NOT READY (ARITH)

The arithmetic process section was not completed within the specified time.

Sub Code	Meaning	Cause	Remedy
1	The arithmetic process for motion control did not complete within regulated time. No motion command was prepared.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The arithmetic processing section is not ready for JOG operation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The arithmetic processing section is not ready for the playback operation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The prereading processing in the arithmetic processing section has not completed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The arithmetic processing section is not ready for the timer follow-up of the conveyor tracking function.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The prereading processing in the arithmetic processing section has not completed when specifying the target position.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The prereading processing in the arithmetic processing section has not completed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4401: SEQUENCE TASK CONTR ERROR

An error occurred in job execution process.

Sub Code	Meaning	Cause	Remedy
1	Unused A_BANK does not exist in the prereading processing of move instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Unused bank priority does not exist in the prereading processing of move instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	A_BANK pointer is not set.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4401: SEQUENCE TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
6	A_BANK conversion could not be performed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The specified A_BANK number does not exist.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	An error occurred when system number (MSS) was obtained.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	An error occurred in RMS960 system call.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	Undefined interrupt command was received.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	Job start condition is not defined.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	An error occurred in instruction prefetch queue operation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	Intermediate code is not defined.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
29	Instruction prereading processing has not been completed normally.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	An error occurred in job data change.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	The specified sequence number at job execution start is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32	The added area for interruption command is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4401: SEQUENCE TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
33	System number (MSS) for interruption command is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
38	An error occurred at start of twin synchronous operation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
39	An error occurred when SYNC specification was reset.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
41	An error occurred in occupation control group setting in MOTION section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
45	An error occurred in path/trace control.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
47	An error occurred when waiting for a completion of main system task (job) in SYNC specification.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
48	An attempt was made to execute an instruction that could not be executed at line sequence execution.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
49	An error occurred while obtaining the instruction information.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
50	The instruction to be executed in the backward direction was not found.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
80	An exceptional error occurred in job execution process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	Main processing command is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
101	Subprocessing command is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4401: SEQUENCE TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
102	Prereading processing has not been completed at job execution.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	A_BANK conversion has not been completed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
104	System number (MSS) is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	An error occurred in instruction prefetch queue operation in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
106	An error occurred at IES switching in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4402: UNDEFINED COMMAND(ARITH)

An undefined command or unused command was issued to the path control section.

Sub Code	Meaning	Cause	Remedy
		Software operation error Setting error	1. Reset the alarm, and then try again. 2. Check the following settings. • the base-axis position must be registered for the system with base-axis MOVL P00001 BP00001 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4403: UNDEFINED IOSPDCTRL HOME POS

The Home Position is not registered.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Register the home position for IOSPDCTRL axis.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4404: ARITHMETIC ERROR

An error occurred in the arithmetic process for coordinates.

Sub Code	Meaning	Cause	Remedy
8	Interpolation such as linear and circular interpolation cannot be performed with this manipulator.	Setting error	Change the step (move instruction), where the alarm occurred, to MOVJ.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The setting of the form data for Flip/No Flip is not "B-axis Angle. "	Setting error	Set "1" to "S2C658: Type data detail settings".
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	An attempt was made to pass the B-axis zero degree position (singular area).	Setting error	Check the teaching position of the job so that the manipulator does not pass the B-axis zero degree position (singular area).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	An attempt was made to pass the B-axis zero degree position (singular area) during interpolation.	Setting error	Check the teaching position of the job so that the manipulator does not pass the B-axis zero degree position (singular area).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Wrist axis tended to rotate to the inverse with the teaching direction.	Setting error	Check the teaching position of the job so that a wrist axis does not inverse rotation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Two robots are attempting to move to a position beyond the specified inter-robot distance.	Setting error	Check the following settings. • Change the posture so that the distance between the robots is specified. • Change the teaching position so that the distance between the robots is specified.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4406: GROUP AXIS CONTROL ERROR

An internal control error occurred in a coordinated motion.

Sub Code	Meaning	Cause	Remedy
1	Designation error for master and slave	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Slave designation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Slave interpolation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	No designation of master axis	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Master-axis designation error for JOG motion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Slave-axis designation error for JOG motion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Occupation control error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Designation error of occupation control for JOG motion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Designation error of occupation control for Bank position	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Designation error of occupation control group for tracking motion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	No master and slave designated for tracking motion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4407: TWO STEPS SAME POSITION(CIRC)

Among three taught points in a circular interpolation step, two or three points are on the same point.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for teaching position of circular interpolation steps so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4408: TWO STEPS SAME POSITION(SPLINE)

Among three taught points in a spline interpolation step, two or three points are on the same point.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for teaching position of spline interpolation step so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4409: TWO STEPS SAME POSITION(3 STEPS)

Among three taught points to create an user coordinate system, two or three points are on the same point.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for three taught points to create an user coordinate system so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4410: TWO STEPS SAME POSITION(WEAV)

Among three taught points (start, end, and reference points) to create a weaving coordinate system, two or three points are on the same point.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for taught points (start, end, and reference points) so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4411: TEACH ERROR(SPLINE)

The distance between the teaching points in the spline interpolation section is not equidistant.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for the teaching position of spline interpolation section so that the distance between the teaching points is even.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4412: IMPOSSIBLE LINEAR MOTION(L/U)

If the form (folded direction) of L- and U-axes at start point and end point are different except for MOVJ instructions, the manipulator cannot move.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Perform the teaching again to make the form of L- and U-axes same at start point and end point. • Use a MOVJ instruction again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4413: IMPOSSIBLE LINEAR MOTION(S/L)

If the form (folded direction) of S- and L-axes at start point and end point are different except for MOVJ instructions, the manipulator cannot move.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Perform the teaching position again to make the form of S- and L-axes same at start point and end point. Use a MOVJ instruction again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4414: EXCESSIVE SEGMENT (LOW/HIGH)

This alarm occurs if the operation command which exceeds the designated max. speed is output.

It may occur when the robot operates near the singular point or when the robot is going to change its orientation widely with single control point.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	1. Reduce the speed in the step where the alarm occurred. 2. Change the move instruction to joint interpolation (MOVJ). * Be careful to the peripheral interference since its movement changes.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4416: PULSE LIMIT(MIN./MAX.)

The manipulator exceeded its motion limit (pulse limit) in the negative (-) and the positive (+) direction.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is within the motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4418: CUBE LIMIT(MIN./MAX.)

The manipulator TCP exceeded its motion limit (cube limit) in the negative (-) direction.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and XYZ	Setting error	Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is within the motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4420: SPECIAL SOFTLIMIT(MIN./MAX.)

The manipulator exceeded its motion limit (special software limit) in the negative (-) and the positive (+) direction.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is within the motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4422: MECHANICAL INTERFERENCE(MIN./MAX.)

Links interfered between manipulators.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is within the motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4424: SPECIAL MECHANICAL INTRF(MIN./MAX.)

Links interfered between manipulators.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is within the motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4426: PULSE MECHANICAL LIMIT(MIN./MAX.)

The manipulator exceeded its motion limit (mechanical limit) in the negative (-) and the positive (+) direction.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is within the motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4428: SEGMENT CONTROL ERROR

An error occurred in the segment processing section that controls the arithmetic section.

Sub Code	Meaning	Cause	Remedy
1	RT-buffer control command error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Segment-receiving control command error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	No bank priority	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4428: SEGMENT CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
4	Answer error at MOVE simulating	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The value of bank_refresh_flag (x) exceeded its limit.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	RT-buffer tracking option error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The segment was received although the previous segment had not been sent.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4429: WRONG SPECIFIED CONTROL GROUP

An error occurred in the manipulator information at job execution.

Sub Code	Meaning	Cause	Remedy
1	Control group not designated	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Slave control-group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Master control-group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Master and Slave control-group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Control-group error for a job file	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Control-group error for a user coordinate file	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Control-group error for a calibration file between manipulators	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4429: WRONG SPECIFIED CONTROL GROUP (continued)

Sub Code	Meaning	Cause	Remedy
8	Control-group error for a tool calibration file	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Control-group error for prereading-calculation start point (for adv_st_pos)	Software operation error occurred	1. Reset the alarm, and re-select the job from [select job] window before starting the job again . 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Control-group error for the current-value preset position	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	Control-group error for the conveyor prereading-calculation start point	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Occupation control-group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	Control-group error for servo hand	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	Control-group error for the prereading-calculation start point (for dm_st_pos)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	Control-group error for prereading-calculation start point (for dm_st_pos)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	Control-group error for HPMMVON	Setting error	1. Reset the alarm. 2. Review the JOB to see if it is a control group that can be executed.
23	Control-group error for the controller synchronization prereading-calculation start point	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
27	Control-group error for SMOOTH	Setting error	1. Reset the alarm. 2. Review the JOB to see if it is a control group that can be executed.

4429: WRONG SPECIFIED CONTROL GROUP (continued)

Sub Code	Meaning	Cause	Remedy
28	Control-group error for CAPTURE	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
29	Control-group error for force control	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4430: CPU COMMUNICATION ERROR

An error occurred in interrupt process between CPUs.

Sub Code	Meaning	Cause	Remedy
1	Interrupt processing error between MOTION section and system control section	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Interrupt processing error between MOTION section and SL#1	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Interrupt processing error between MOTION section and SL#2	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Interrupt processing error between MOTION section and SL#3	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Interrupt processing error between MOTION section and SL#4	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Interrupt processing error between MOTION section and SL#5	Software operation error occurred	1. Reset the alarm and then try again. 2. Turn the power OFF then back ON, and try again.
		Setting error	If the alarm occurred after executing SKILLSND or MACRO instruction, it may cause by MotoPlus application not to run. Check the following items under maintenance mode. • there should be [MotoPlus APL.] on main menu. • Open screen [MotoPlus APL.] -> [FILE LIST]. Suitable MotoPlus application should be on the list. • Open screen [MotoPlus APL.] -> [MotoPlus FUNC. SETTING]. "APPLI. AUTOSTART AT POWER ON" should be "ENABLE".

4430: CPU COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Setting error	If the alarm occurred after executing SKILLSND or MACRO instruction, it may cause by MotoPlus application couldn't return the response for the SKILLSND or the MACRO. Check the MotoPlus application program to make sure of mpEndSkillCommandProcess() definitely execution after executing mpReceiveSkillCommand().
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Interrupt processing error between MOTION section and SL#6	Software operation error occurred	1. Reset the alarm and then try again. 2. Turn the power OFF then back ON, and try again.
		Setting error	If the alarm occurred after executing SKILLSND or MACRO instruction, it may cause by MotoPlus application not to run. Check the following items under maintenance mode. • there should be [MotoPlus APL.] on main menu. • Open screen [MotoPlus APL.] -> [FILE LIST]. Suitable MotoPlus application should be on the list. • Open screen [MotoPlus APL.] -> [MotoPlus FUNC. SETTING]. "APPLI. AUTOSTART AT POWER ON" should be "ENABLE".
		Setting error	If the alarm occurred after executing SKILLSND or MACRO instruction, it may cause by MotoPlus application couldn't return the response for the SKILLSND or the MACRO. Check the MotoPlus application program to make sure of mpEndSkillCommandProcess() definitely execution after executing mpReceiveSkillCommand().
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Interrupt processing error between MOTION section and SL#7	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Interrupt processing error between MOTION section and SL#8	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Interrupt processing error between MOTION section and CV#1	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Interrupt processing error between MOTION section and CV#2	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4431: JHM ERROR

Data error occurred in job control process.

Sub Code	Meaning	Cause	Remedy
1	An error occurred in JMS system call when an attempt was made to open a job.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	No space was found in job handle value storage area when an attempt was made to open a job.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	No job handle was found.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Job control proprietary is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Job control proprietary could not be changed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	An error occurred in exclusive control.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4432: INSTRUCTION INTERPRETER ERROR

An error occurred in instruction interpretation/execution process.

Sub Code	Meaning	Cause	Remedy
1	The intermediate code of the instruction that is to be executed is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Destination (variable) tag arrangement is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Tag data type is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Box number is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4432: INSTRUCTION INTERPRETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
6	An error occurred in block separation processing of intermediate code.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Box number definition is duplicated.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Undefined instruction was found at block separation of intermediate code.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	IPRM is not set.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	An error occurred in tag data search process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	An error occurred move instruction search process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Variable information does not exist.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	An error occurred at position file data reading.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	Variable data type is not defined.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	An instruction is included with incorrect intermediate code in expression instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	The syntax in expression instruction is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	The tag data length is zero when tag data is read.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4432: INSTRUCTION INTERPRETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
21	The necessary tag data is not set.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	The object to be processed was secret variable in position file control process, so it could not be processed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	The object to be processed was position type variable in position file control process, so it could not be processed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	Job argument settings do not match when a variable is given and/or taken between jobs.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	An attempt was made to perform undefined operation at four-rule operation instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	Arithmetic stack used for expression operation exceeded.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
27	Arithmetic stack used for expression operation is empty.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
28	Operation items are lacking in expression operation and operation processing cannot be performed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
29	The number of executing the sub-instruction with EXEC processing exceeded the maximum number.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	An error occurred by the setting of the character-string type variable in the ARGF instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	The intermediate code of IFEXPRESS instruction is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32	The syntax of IFEXPRESS instruction is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4432: INSTRUCTION INTERPRETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
33	The number of components of the IFEXPRESS instruction exceeded.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
34	The stack used for executing the IFEXPRESS instruction overflowed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
35	The stack used for executing the IFEXPRESS instruction did underflow.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
36	The reinterpretation of the instruction was ordered when executing the instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
37	Tag data (box number) of the instruction that is to be executed is not supported.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
38	VARGF is not set.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
40	CAPTURE is not set.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
41	Excessive intermediate code length.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
42	VNTBL not set (execution result I/F).	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
43	Instrument append tag - destination tag error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
44	Instrument additional tag - sub-instrument error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
45	The data length of the tag data read buffer has exceeded.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4432: INSTRUCTION INTERPRETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
254	Access mechanism for old parameters is used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
255	An exceptional error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4433: UNDEFINED GLOBAL VARIABLE

The global variable is not defined.

Sub Code	Meaning	Cause	Remedy
0	The set data for byte type variable area is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The set data for integer type variable area is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The set data for double-precision integer-type variable area is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The set data for real type variable area is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The set data for character-string type variable area is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The set data for robot-axis position-type variable area is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The set data for base-axis position-type variable (S1D parameter) area is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The set data for station-axis position-type variable (S1D parameter) area is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4435: UNDEFINED LOCAL-VARIABLE

The local variable is not defined.

Sub Code	Meaning	Cause	Remedy
0	The byte type variable is not defined.	Setting error	Set the number of local variables to be used in the job header.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The integer type variable is not defined.	Setting error	Set the number of local variables to be used in the job header.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The double-precision integer-type variable is not defined.	Setting error	Set the number of local variables to be used in the job header.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The real-number type variable is not defined.	Setting error	Set the number of local variables to be used in the job header.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The character-string type variable is not defined.	Setting error	Set the number of local variables to be used in the job header.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The robot-axis position-type variable is not defined.	Setting error	Set the number of local variables to be used in the job header.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The base-axis position-type variable is not defined.	Setting error	Set the number of local variables to be used in the job header.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The station-axis position-type variable is not defined.	Setting error	Set the number of local variables to be used in the job header.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4436: LESS THAN 3 STEPS(CIRCULAR)

An error occurred in circular interpolation instruction execution.

There is no continuous three points or more for circular interpolation step.

Sub Code	Meaning	Cause	Remedy
		Setting error	Perform teaching so that circulation interpolation steps are continuous three points or more.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4437: LESS THAN 3 STEPS(SPLINE)

An error occurred in spline interpolation instruction execution.

There is no continuous three points or more for spline interpolation step.

Sub Code	Meaning	Cause	Remedy
		Setting error	Perform teaching so that spline interpolation steps are continuous three points or more.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4438: UNDEFINED JOB

The job to be executed is not registered.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check if the CALL/JUMP destination job is registered. If the job is not registered, delete the JUMP instruction where an alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4439: UNDEFINED LABEL

An error occurred in label jump execution.

The label for jump destination does not exist in the job.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check if the JUMP destination label is registered. If the label is not registered, delete the JUMP instruction where alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4440: UNDEFINED RETURN JOB

Call source job does not exist in the job call stack.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • If there is an illegal RET instruction in the start job, delete the RET instruction. • Check if RET instruction is not executed under the condition that there is no job in the job call stack. In that case, execute it from master (start) job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4441: LACK OF LOCAL-VARIABLE AREA

An error occurred when memory area for local variable was obtained.

Memory area is lacking because too many local variables in the job are used.

Sub Code	Meaning	Cause	Remedy
		Setting error	Reduce the number of local variables to be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4444: UNSUCCESSFUL FINE POSITIONING

When PL = 0 or an external servo turned OFF, the number of the servo error pulses did not fall in the limit range that had been set in a parameter, within the specified time.

Sub Code	Meaning	Cause	Remedy
	Sub Code: The lowest eight bits -> Bit specification of axis where error occurred. The highest eight bits -> Bit specification of control group number(0-31) where error occurred.	Effect of external force	Move the manipulator by the axis operation, etc. to remove the external force of axis where alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4445: DATA PRESET ERROR

Data error occurred at job prereading reinterpretation.

Sub Code	Meaning	Cause	Remedy
1	The token for prereading processing could not be obtained.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The prereading processing has not been completed within the time, and the waiting time for completion exceeded the limit.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The prereading operation processing has not been completed within the time, and the waiting time for completion exceeded the limit.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error occurred in prereading operation process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	A_BANK conversion has not been completed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, turn the main power of controller off and then turn it on. Re-select the job from [select job] window before starting the job again. 3. If the alarm occurs again even though you do 2. above, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
255	An exceptional error occurred in job execution process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4446: OVER VARIABLE LIMIT

The variable value exceeded the limit.

Sub Code	Meaning	Cause	Remedy
0	The variable value exceeded the limit.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The value for the binary (0/1) data type variable exceeded the limit.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The value for the signed 1-byte data type variable is less than the minimum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.

4446: OVER VARIABLE LIMIT (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The value for the unsigned 1-byte data type variable is less than the minimum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The value for the signed 2-byte data type variable is less than the minimum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The value for the unsigned 2-byte data type variable is less than the minimum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The value for the signed 4-byte data type variable is less than the minimum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The value for the unsigned 4-byte data type variable is less than the minimum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The value for the real-number 4-byte data type variable is less than the minimum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	The value for the character-string type variable is less than the minimum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32770	The value for the signed 1-byte data type variable exceeded the maximum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4446: OVER VARIABLE LIMIT (continued)

Sub Code	Meaning	Cause	Remedy
32771	The value for the unsigned 1-byte data type variable exceeded the maximum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32772	The value for the signed 2-byte data type variable exceeded the maximum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32773	The value for the unsigned 2-byte data type variable exceeded the maximum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32774	The value for the signed 4-byte data type variable exceeded the maximum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32775	The value for the unsigned 4-byte data type variable exceeded the maximum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32776	The value for the real-number 4-byte data type variable exceeded the maximum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32782	The value for the character-string type variable exceeded the maximum value.	Setting error	Check the settings for variable, and then correct the job to fall within the input range of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4447: DEFECTIVE TAUGHT POINT(CIRC)

Incorrect teaching of circular interpolation steps.

The three points taught for the circular interpolation step lie in a straight line.

Sub Code	Meaning	Cause	Remedy
1	Starting point and destination point are the same position.	Setting error	Change the teaching points so that circular interpolation points do not to same.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Any points of the circular interpolation are the same position.	Setting error	Change the teaching points so that circular interpolation points do not to same.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Any points of the circular interpolation are the same position as the center position.	Setting error	Change the teaching points so that circular interpolation points do not to same as the center point of circular path.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The three points taught for the circular interpolation points line in a straight line.	Setting error	Change the teaching points so that circular interpolation points do not line in a straight line.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The starting point and destination point taught for the circular interpolation points line in a straight line.	Setting error	Change the teaching points so that circular interpolation points do not line in a straight line.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Rotation angle of circular interpolation is out of range.	Setting error	Change the rotation angle of circular interpolation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1	Failed to calculate the circular path.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	Circular interpolation different ways in multiple robots are specified.	Setting error	Specify the same circular interpolation method to all robots.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4448: WEAVING CONTROL ERROR

An error occurred in weaving control.

Sub Code	Meaning	Cause	Remedy
1	Weaving control-group designation error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	When the speed is specified by weaving time in the weaving file, zero or the negative value is set for the weaving time.	Setting error	Reset the value 0.1 seconds or more.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	When the speed is specified by frequency in the weaving file, zero or the negative value is set for the frequency.	Setting error	Reset the value 0.1 Hz or more.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	When the timer mode is specified in the weaving file, a negative value is set for the timer value.	Setting error	Set a positive value for the timer value.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	For triangle or L-type weaving, zero is set for the vertical or horizontal distance.	Setting error	Set a positive value for the vertical and horizontal distance.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The coordinate control axis designation for the reference point is different from actual control axis.	Setting error	Match the control group designation of the wall point and weaving execution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The distance between the point P and the TCP could not be calculated in wrist weaving.	Setting error	Set the correct dimensions in the tool data.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The distance between the point P and the TCP could not be calculated in circular wrist weaving.	Setting error	Set the correct dimensions in the tool data.

4448: WEAVING CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The Y-direction element of circular coordinate system for circular wrist weaving could not be calculated.	Setting error	Check the settings for wall and horizontal direction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The X-direction element of circular coordinate system for circular wrist weaving could not be calculated.	Setting error	Check the settings for wall and horizontal direction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Weaving basic-orientation calculation error	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	Calculation error of horizontal- and wall-direction vector for weaving	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	Weaving synchronization file number selection range error	Setting error	Check the number of the weaving synchronizing file for use.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	Weaving interpolation error	Setting error	The ELLIPSE weaving can move, when MOVL or MOVC is taught. Check the job contents.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	Weaving coordinated motion error	Setting error	The independent motion and coordinated motion are taught in the weaving section. In one weaving section teach the independent motion or coordinated motion only. Check the job contents.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	WVON instruction execution error while changing weaving conditions	Setting error	Do not execute the WVON instruction while changing the weaving condition by the WVCHG instruction. Check the job contents.

4448: WEAVING CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	Weaving condition change mode error	Setting error	The WVCHG instruction cannot be used in weaving mode other than the "ELLIPSE" or "ELLIPSE (TOOL)". Check the job contents.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	Weaving condition change speed specification error	Setting error	If the speed specification of the weaving condition is "time", the condition cannot be changed by the WVCHG. Check the weaving condition.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	Weaving condition change groove correction execution error	Setting error	The weaving groove correction function (WVADJ) and WVCHG cannot be used together. Check the job contents.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	Weaving condition change COMARC execution error	Setting error	The COMARC function and the WVCHG cannot be used together. Check the job contents.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	SLOPE control execution error when changing weaving conditions	Setting error	The slope control of the weaving condition and the WVCHG cannot be used together. Check the job contents or the weaving condition.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4449: UNMATCHED POSN VAR DATA TYPE

The position type variable data type is different.

Sub Code	Meaning	Cause	Remedy
		Setting error	Match the data type of position type variable.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4450: FILE NO. ERROR

An error occurred in file number check.

Sub Code	Meaning	Cause	Remedy
1	An error occurred in tool file number check.	Setting error	Confirm that the specified tool file number is 0 to 63.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error occurred in user coordinate file number check.	Setting error	Confirm that the specified user coordinate file number is 1 to 63.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An error occurred in calibration file number check between the manipulators.	Setting error	Confirm that the specified robot calibration file number is 1 to 32.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error occurred in tool calibration file number check.	Setting error	Confirm that the specified tool file number is 0 to 63.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	An error occurred in reference point number check.	Setting error	Confirm that the specified robot calibration file number is 1 to 8.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	An error occurred in conveyor characteristic file number check.	Setting error	Confirm that the specified conveyor condition file number is 1 to 6.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	An error occurred in conveyor calibration file number check.	Setting error	Confirm that the specified conveyor calibration file number is 1 to 6.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	An error occurred in argument number check.	Setting error	Confirm that the argument number is 1 to 16.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	An error occurred in servofloat condition files check.	Setting error	The servofloat condition file is "UNUSED". Specify the servofloat condition file of either "FL#()" or "LFL#()" in detail edit display.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	An error occurred in interference area setting file number check.	Setting error	Confirm that the specified interference area setting file number is 1 to 8.

4450: FILE NO. ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	An error occurred in force control setting file number check.	Setting error	Confirm that the specified force control setting file number is 1 to 16.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4451: UNDEFINED REFERENCE POINT

An error occurred in the reference point data.

The reference point is not registered or is insufficient.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Reference point number in binary	Setting error	Set the reference point.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4452: STACK MORE THAN 10 (JOB CALL)

The job call stack exceeded the limit.

An attempt was made to add more than twelve stacks in the job call stack.

Sub Code	Meaning	Cause	Remedy
		Setting error	Change the job configuration so that the number of nests for CALL instruction is twelve or less.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4453: OVER VARIABLE NO.

The variable number is out of range.

Sub Code	Meaning	Cause	Remedy
	The variable number is out of range. Sub Code: The variable number which an attempt was made to use	Setting error	Correct the job using the variable number within the range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4459: EXCESSIVE INSTRUCTION EQUATION

An error occurred in expression operation.

The operation is impossible because the expression is too long.

Sub Code	Meaning	Cause	Remedy
		Setting error	Separate the operation expression, shorten the expression, and then check the settings for the job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4460: ZERO DIVIDED OCCURRENCE

An error occurred in operation instruction.

Zero division occurred.

Sub Code	Meaning	Cause	Remedy
		Setting error	Do not divide by zero.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4463: PARITY ERROR

The parity check for user I/O group detected the data error.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for the parity data of the user I/O group.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4464: OVER BCD RANGE

The BCD value exceeded the limit.

An attempt was made to output a value above the maximum value that can be expressed in Binary Coded Decimal: 99 (decimal) when no parity check is specified, and 79 (decimal) when parity check is specified.

An attempt was made to read a data that cannot be expressed in Binary Coded Decimal (a data whose lower or upper 4 bits exceeded 9 in decimal) in the variable.

Sub Code	Meaning	Cause	Remedy
		Setting error	Correct the BCD data so that it is within the limit.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4465: OVER BINARY RANGE(PARITY CHECK)

The binary data exceeded the limit.

An attempt was made to output a value that exceeded 127 (decimal) to the user I/O when parity check was specified.

Sub Code	Meaning	Cause	Remedy
		Setting error	Correct the binary data so that it is within the limit.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4466: OFFLINE UNDEFINED COMMAND(ARITH)

An undefined command was issued to the offline position-data preparation section.

Sub Code	Meaning	Cause	Remedy
0	An undefined command was issued to the offline position-data preparation section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4467: USER COORD STEP NOT ENOUGH

An error occurred at user coordinate creation by a job.

The number of steps was lacking for a job for user coordinate creation.

Sub Code	Meaning	Cause	Remedy
		Setting error	Correct the JOB that the number of steps will be three or more.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4468: ROBOT CALIBRATION DATA ERROR

An error occurred in calibration between manipulators.

Sub Code	Meaning	Cause	Remedy
1	The calibration between manipulators cannot be executed for this model.	Setting error	Do not use a coordinated motion with this manipulator.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The master group and the slave group are set to the same group.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Incorrect designation of the control group for master group	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4468: ROBOT CALIBRATION DATA ERROR (continued)

Sub Code	Meaning	Cause	Remedy
4	Incorrect designation of the control group for slave group	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Incorrect designation of the occupation control group for calibration data	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Incorrect designation of the enabling control group for calibration data	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Among three points in the master-group's calibration data, two or three points are on the same point.	Setting error	Teach the data for calibration so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Among three points in the slave-group's calibration data, two or three points are on the same point.	Setting error	Teach the data for calibration so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The number of the teaching points for calibration data is insufficient.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4469: ROBOT CALIBRATION FRAME ERROR

An error occurred in calibration coordinate conversion between manipulators.

Sub Code	Meaning	Cause	Remedy
1	The calibration between manipulators cannot be executed for this model.	Setting error	The calibration function between manipulators cannot be used for this model.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The master group and the slave group are set to the same group.	Setting error	Set the different groups for the master group and the slave group.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Incorrect designation of the control group for master group	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4469: ROBOT CALIBRATION FRAME ERROR (continued)

Sub Code	Meaning	Cause	Remedy
4	Incorrect designation of the control group for slave group	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Calibration data setting error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4470: ROBOT CARIB STEP NOT ENOUGH

An error occurred at calibration data creation between manipulators.

The number of steps was lacking for a job for calibration data creation between manipulators.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for number of the job steps
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4471: ROBOT CALIBRATION DATA ERROR

The tool calibration data could not correctly be prepared.

Sub Code	Meaning	Cause	Remedy
1	Incorrect number of teaching points for tool calibration	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Incorrect designation of the occupation control group for calibration data	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Incorrect designation of the enabling control group for calibration data	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Incorrect designation of the control group for calibration data	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4473: ARITHMETIC ALARM RESET ERROR

The alarm occurred in the calculation section could not be reset.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4474: WRONG CONTROL GROUP AXIS

The CALL/JUMP/PSTART destination job could not be executed.

An attempt was made to call or jump to a job whose control group cannot be controlled.

An attempt was made to start the control group job that could not be operated.

Sub Code	Meaning	Cause	Remedy
	Sub Code:The related control-group	Setting error	Check the following settings. • Make the setting in advance so that the control group of the CALL/JUMP designation job is included in that of the CALL/JUMP source job. • Don't start the job which including control group under already operation by "PSTART" instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4475: CANNOT EXECUTE JOB(NO ROBOT)

The robot axis is not designated for the control-group of the job at execution of a work instruction that uses a manipulator.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Add the robot axis to the control-group of the job. • When MotoPlus function (optional) is used, a robot which executed SKILLSND is not defined as using MotoPlus sensor related API. Check the combination of the robot and MotoPlus application. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4476: CANNOT EDIT (EDIT LOCK JOB)

An attempt was made to change the data for the job prohibited from being edited.

Sub Code	Meaning	Cause	Remedy
0	An attempt was made to change the tag data.	Setting error	Release the prohibition.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4476: CANNOT EDIT (EDIT LOCK JOB) (continued)

Sub Code	Meaning	Cause	Remedy
1	An attempt was made to change the speed tag data.	Setting error	Release the prohibition.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An attempt was made to change the board thickness tag data.	Setting error	Release the prohibition.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An attempt was made to change the MARKER job.	Setting error	Release the prohibition.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4477: SELECT ERROR(APPLICATION)

Incorrect selection of application.

When executing a work instruction, the application selection parameter (parameter exclusive for manufacturer) is inconsistent with the application parameter (AP parameter).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Application number	Setting error	Check the following settings. - Set the application to a specified robot by the application selection of maintenance mode. - A robot which executed SKILLSND is not defined as using MotoPlus sensor related API. Check the combination of the robot and MotoPlus application. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4478: MotoPlus MM TASK NO RESPONSE

MotoPlus application doesn't response more than stipulated time because MM task has not recovered from unexpected condition.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot control module. save the CMOS.BIN before replacing the board to be safe. After replacement, insert the SD card that has been used for the old robot control module to the new one. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4479: MotoPlus MM TASK WATCH DOG ERROR

MM Task cannot run more than stipulated time because of MotoPlus application running. Executing high priority task of MotoPlus application may dominate CPU for a long time, which may be preventing the man machine interface task from running.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	Check if there is high priority task of MotoPlus application running long time. Especially, check if there may be the process which waits for a special condition without executing mpTaskDelay in loop process. If such process exists, suitable remedy should be done like putting mpTaskDelay in the loop process.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4480: SELECT ERROR(SENSOR 1)

Incorrect selection of sensor function.

When executing a work instruction, the sensor application selection parameter (parameter exclusive for manufacturer) is inconsistent with the sensor parameter (SE parameter).

Sub Code	Meaning	Cause	Remedy
	Sub Code:Sensor number	Setting error	Select the option function for the specified robot in the option function selection of maintenance mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4484: WRONG PORT NO.(ANALOG OUTPUT)

Incorrect analog output port selection parameter

The value of the parameter AxP010 indicating the leading number of analog output port used for arc welding or sealing application was incorrect.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Application number	Setting error	Check the following settings. Set following value to the AxP010 parameter. For arc: 1 Arc + arc: 3 Three arc: 5 Four arc: 7
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4485: WRONG SELECTION (SENSOR)

When executing a sensor instruction, the robot specified to use the sensor (system parameter) and the robot specified to use the application (system parameter) are unmatched.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4487: WRONG MECH PARAMETER FILE

An error occurred in mechanical parameter for the path control section.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4489: DEFECTIVE TAUGHT POINT(CUTTING)

An error occurred at CUT instruction execution.

Sub Code	Meaning	Cause	Remedy
1	The C- and W-axis position at the cutting start position is not zero pulse.	Setting error	Check the settings for the cutting start position (zero pulse).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Zero is set for the cutting radius.	Setting error	Check the settings for radius (a value bigger than zero).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The cutting machine axis is not mounted.	Setting error	The CUT instruction can be used for the manipulator with small-circle cutting axis only.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	This manipulator cannot perform a hexagonal cutting motion.	Setting error	Select an other cutting form.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4490: DEFECTIVE TAUGHT POINT(ENDLESS)

The Endless motion could not be performed.

Sub Code	Meaning	Cause	Remedy
1	After the Endless rotation completed, an attempt was made to execute an interpolation instruction such as MOVL and MOVC before executing an MRESET instruction.	Setting error	To perform an interpolation motion such as MOVL and MOVC after an Endless rotation, execute an MRESET instruction beforehand.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The base axis is set as an Endless rotation axis. The Endless function cannot be used with the base axis.	Setting error	Check the parameter setting that designates the Endless rotation axis.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An attempt was made to execute the Endless function although the endless axis was not designated.	Setting error	Check the parameter setting that designates the Endless rotation axis.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The Endless axis exceeded the maximum pulse value (plus or minus 536870911).	Setting error	Set the rotation amount so that the Endless axis does not exceed the maximum pulse value.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4491: CORRECTIONAL DIRECTION ERROR

An internal control error occurred when calculate the correcting direction.

Sub Code	Meaning	Cause	Remedy
1	Control-group designation error for correcting-direction preparation	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Designation error for the correcting-direction coordinates	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	When "any direction" is set for the correcting direction, the correction coordinates is not prepared.	Setting error	Check the settings for the correcting direction with the reference point (REFP).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4491: CORRECTIONAL DIRECTION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
4	When "any direction" is set for the correcting direction, the reference points (REFP) are taught on the same point.	Setting error	Check the settings for the reference points (REFP) so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Designation error for the coordinated motion control axis at the reference point	Setting error	Match the control group designation of the wall point and weaving execution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4492: POSITION CORRECTION ERROR

An error occurred in the calculation section for the correcting direction at path correcting motion.

Sub Code	Meaning	Cause	Remedy
1	Data unmatched between the correction amount data and the job data: The information about the control groups designated for the series of jobs, which is added to the correction amount data, does not include the valid control-group for the job.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Data unmatched between the correction amount data and the job data: The valid control-group information that is added to the correction amount data disagrees with the valid control-group for the job.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Tool change err for orientation correction of the tool coordinate	Setting error	It is not possible to change the tool when correct the orientation by the tool coordinate.

◆ 4493: OVER TOOL FILE NO.

The tool file number exceeded the limit value.

The tool number for internal control is 65 or more.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4494: DEFECTIVE TAUGHT POINT(WEAV)

The teaching position setting was incorrect and weaving could not be executed.

Sub Code	Meaning	Cause	Remedy
1	The weaving start point and end point are on the same point.	Setting error	Check the settings for the positions so that the weaving start point and end point are different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Among the weaving start point, end point, and reference point, two or three points are on the same point.	Setting error	Check the settings for the positions so that the weaving start point, end point, and reference point are different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4495: UNDEFINED ROBOT CALIBRATION

Calibration between manipulators has not executed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group which calibration is not completed	Setting error	Before using the coordinated motion, execute the calibration between manipulators.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4496: PARAMETER ERROR

An error occurred when the parameter setting was performed.

Sub Code	Meaning	Cause	Remedy
1	The setting of the manipulator number is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Zero is set for the resolution.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Zero is set in the feedback pulse parameter.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The setting of L-axis ball-screw data is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4496: PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
5	The setting of U-axis ball-screw data is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Zero or a negative value is set for MAXPPS.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Zero or a negative value is set for the maximum acceleration speed.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Zero or a negative value is set for the maximum deceleration speed.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Zero or a negative value is set for the play-mode servo averaging time.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The setting of the manipulator number is incorrect. An undefined type is designated.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The incorrect coordinate system is designated for the cubic interference. An undefined coordinate system is set.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The designation of the user coordinates number is incorrect. A number out of the setting range is set.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	The reduction ratio ≤ 0 is output.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Zero or a negative value is set for the spring constant.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	Zero or a negative value is set for the motor inertia.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	Zero or a negative value is set for the speed calculation constant.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4496: PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
17	Dividing number setting error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	The setting of allowable torque for the speed reducer is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	The setting of allowable torque for the motor is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	The manipulator type is not applicable for torque acceleration/deceleration.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	Zero or a negative value is set for the balancer.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	The angle of hexagon set for the CUT instruction is out of the range "0 degree < angle < 60 degrees."	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	Encoder type designation error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	Observer sampling time error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
25	Two-degree-of-freedom system Kp value error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	The setting of torque acceleration/deceleration designation parameter is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
27	Observer polarity setting error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
28	The inertia value error for the shift value calculation	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4496: PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
29	Observer attenuation constant error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	Torque estimation parameter error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	The segment clock error occurred when the PV loop is 1 ms.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32	Non-robot axis observer selection error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
33	Zero is set for the response time constant.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
34	Efficiency data error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
35	Zero is set for the averaging time constant.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
36	Torque limit ratio data error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
37	Coulomb friction data error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
38	Kinematic friction coefficient data error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
39	The setting in the optimized acceleration/deceleration designation parameter is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
40	An uninstalled function is designated.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4496: PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
41	The dynamics-model calculation at the optimized acceleration/ deceleration is invalid.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
42	Zero is set for the inertia of dynamics fixed model.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
43	Designation error for dynamics-model calculation type	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
44	The optimized acceleration/ deceleration control of speed limit function is disabled.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
45	The axis designation parameter for the speed limit function is not set.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
46	The setting in the mode designation parameter for the speed limit function is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
47	Zero or negative value is set in the allowable braking torque parameter for the speed limit function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
48	Zero or a negative value is set in the speed adjustment ratio parameter for the speed limit function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
49	Zero or a negative value is set in the torque limit adjustment ratio parameter for the acceleration/ deceleration tuning.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
50	Zero or a negative value is set in the parameter that sets the shortest acceleration/ deceleration time for when the excessive torque is applied at the optimized acceleration/ deceleration.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
56	Zero or a negative value is set in the FORMCUT maximum acceleration/deceleration time parameter.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
57	The setting of expanded check-point designating bits for the arm interference check is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4496: PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
60	Zero or a negative value is set for the sphere at the arm interference check point.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
61	Zero or a negative value is set for the cylinder at the arm interference check point.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
62	The number of designated check points for the arm interference check is insufficient.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
70	All of X, Y, and Z value of the expanded check-point 1 for the arm interference check are set to zero.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
71	All of X, Y, and Z value of the expanded check-point 2 for the arm interference check are set to zero.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
85	The setting of wrist axis angle for tube-incorporated wrist type manipulators or three-roll wrist type manipulators is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
86	The special link JOG operation cannot be used with this manipulator.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
87	The setting in the parameter for special angle limit check designation is incorrect.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
91	The setting of the deceleration speed for the path-priority control is less than zero.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
92	A negative value is set in the roundness parameter for the path-priority control.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
93	The link parameter for the cutting device is not set.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
95	The real-time bending correction function is enabled for a control-group other than robot axis.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4496: PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
118	Wrong value in set for backlash correction function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
121	Incorrect parameter setting to inertia speed control function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
122	Incorrect acceleration/deceleration time setting at tool mass acceleration/deceleration speed correction function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
123	Incorrect coefficient/item settings at tool mass acceleration/deceleration speed correction function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
124	No tool mass as the minimum acceleration/deceleration time at tool mass acceleration/deceleration speed correction function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
125	Incorrect speed setting at tool mass acceleration/deceleration speed correction function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
126	Incorrect coefficient/item settings at tool mass acceleration/deceleration speed control function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
127	No tool mass as the maximum acceleration/deceleration time at tool mass acceleration/deceleration speed control function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
129	An error in the standard arithmetical axis number setting for approximation model.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
130	An error in the standard expanding point number setting for approximation model.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
131	An error in the radius setting for approximation model.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
132	setting error of arithmetical axis number in D-H method.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4496: PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
133	setting error of choosing no / wrong connection base arithmetical axis number in D-H method.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
134	The higher-order acceleration/ deceleration is prohibited when using operation acceleration / deceleration	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
135	Base axis control point to Robot coordinate system offset setting prohibited	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
136	Pulse linked JOG function specification error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
137	Dual drive control specification error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
138	Notch filter supported acceleration and deceleration tuning: Notch filter function setting error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
139	Notch filter supported acceleration and deceleration tuning: Notch filter (z2) setting error	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
147	NON ACTIVATION of Servo Simulation function error	Setting error	Enable Servo Simulation Function.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
152	the setting error of the number for vibration suppression filter for SVSPOTMOV	Setting error	Confirm that the number of the tables activated for vibration filter is less than 5.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
154	The setting in the parameter for special mechanical interference is incorrect.	Setting error	Correct the setting value of the parameter for special mechanical interference.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
157	Endless function encoder err	Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4496: PARAMETER ERROR (continued)

Sub Code	Meaning	Cause	Remedy
158	Incorrect parameter setting at tool mass acceleration/ deceleration speed control function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
160	Incorrect parameter setting at tool mass acceleration/ deceleration speed limit function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
161	Incorrect parameter setting at gun speed limit function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
162	Timing delay control function was invalid	Setting error	Enable timing delay control function.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
165	Incorrect parameter setting at TCP speed acceleration/ deceleration speed limit function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
168	Incorrect parameter setting at short pitch interval SPF frequency change function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
170	Incorrect parameter setting at speed corresponding position correction amount condition.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
171	Incorrect parameter setting at inertia SPF frequency change function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
177		Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
180	Incorrect parameter setting at short pitch interval SNAP minimum acceleration/ deceleration time change function.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
183	Incorrect value is set for a model that does not support palletize mode.	Setting error	1. Reset the alarm. 2. Check the value of S1CxG526.

◆ 4497: DEFECTIVE TAUGHT POINT(CALIB)

An error occurred in calibration teaching between manipulators.

Sub Code	Meaning	Cause	Remedy
1	Some of the teaching points for master-group are on the same point.	Setting error	Perform the teaching again so that the teaching points are different from one another.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Some of the teaching points for slave-group are on the same point.	Setting error	Perform the teaching again so that the teaching points are different from one another.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The 2nd-axis positions of C3, C4, and C5 of station axes are not the same.	Setting error	Perform the teaching again so that the 2ndaxis positions of C3, C4, and C5 of the station axes are the same.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The 1st-axis positions of C1, C2, and C3 of station axes are not the same.	Setting error	Perform the teaching again so that the 1staxis positions of C1, C2, and C3 of station axes are the same.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The 2nd-axis positions of C1, C2, and C3 of station axes are the same.	Setting error	Perform the teaching again so that the teaching positions are different from one another.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The 1st-axis rotation direction of C3, C4, and C5 of station axes are not the same.	Setting error	Perform the teaching again so that the 1staxis rotation direction of C3, C4, and C5 of station axes are the same.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The 1st-axis (elevation axis) positions of C1, C2, and C3 of station axes are not the same.	Setting error	Perform the teaching again so that the 1staxis (elevation axis) positions of C1, C2, and C3 of station axes are the same.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The 1st-axis (elevation axis) positions of C3, C4, and C5 of station axes are not the same.	Setting error	Perform the teaching again so that the 1staxis (elevation axis) positions of C3, C4, and C5 of station axes are the same.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4498: CANNOT EXECUTE JOB(NO GRP AXIS)

The function which is not allowed in TEST RUN(HIGH ACCURACY) was performed.

Sub Code	Meaning	Cause	Remedy
	An attempt was made to execute an instruction that could not be executed in a job without control group.	Setting error	Check the settings for the job instruction with control group.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4499: UNDEFINED POSITION VARIABLE

An attempt was made to use the position type variable that was not set.

Sub Code	Meaning	Cause	Remedy
	Sub Code: The variable number	Setting error	Check the settings for the position type variable.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4500: UNDEFINED USER FRAME

An attempt was made to use the user coordinate that was not set.

Sub Code	Meaning	Cause	Remedy
	Sub Code: User coordinate number	Setting error	Check the settings for the user coordinate.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4501: OUT OF RANGE(PARALLEL PROCESS)

An error occurred in the multi-task control process for the independent control function.
The number of tasks exceeded the limit.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Task number	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4502: SL BOARD ON-LINE ERROR

An error occurred in option board at power ON.

Sub Code	Meaning	Cause	Remedy
	The option board was detected not to operate normally at power ON.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Option module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the option module. Save the CMOS.BIN before replacing the board to be safe.

◆ 4507: REFP POS ERROR(SEARCH MOTION)

Incorrect teaching point for search detection.

The search start point and the motion target point are the same, or the distance between the two points is too short.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Perform the teaching again so that the search start point and the motion target point are not the same. • Increase the distance between the search start point and the motion target point.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4508: SPECIFIED ERROR(COORDINATE)

An invalid coordinate system was specified.

Sub Code	Meaning	Cause	Remedy
0	The specified coordinate system does not exist.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	Designation error of the master tool coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Designation error of the tool coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4508: SPECIFIED ERROR(COORDINATE) (continued)

Sub Code	Meaning	Cause	Remedy
3	Designation error of the direction of travel coordinate system (for a shared function). This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Designation error of the any direction coordinate system (for a shared function). This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Designation error of the approximation tool coordinate system (for a shared function). This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Designation error of the conveyor coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Designation error of the power sensor coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Designation error of the cylindrical coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Designation error of the coordinate system for the external reference point. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4508: SPECIFIED ERROR(COORDINATE) (continued)

Sub Code	Meaning	Cause	Remedy
12	Designation error of the coordinate system for 3D shifting. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Designation error of the KOMATSU tool Z-direction operation coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Designation error of the KOMATSU tool JOG operation coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	Designation error of the coordinate system at IMOV for 3D shifting. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	Designation error of the H-LINK type cylindrical coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	Designation error of the FSER_FRAME type cylindrical coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	Designation error of the reference USER_FRAME type cylindrical coordinate system. This coordinate system cannot be used.	Setting error	Check the settings for the coordinate system which can be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4509: MFRAME ERROR

An error occurred at MFRAME execution.

Sub Code	Meaning	Cause	Remedy
1	The master-tool user coordinates could not be prepared.	Setting error	Execute the MFRAME instruction in coordinated job when you make the master tool user coordinate.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	reference user frame cannot be used.	Setting error	Check the following settings. • reference user frame
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	position type variable (P variable) cannot be used.	Setting error	Check the following settings. • position type variable (P variable).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4510: CANNOT EXECUTE INSTRUCTION(SQRT)

The SQRT instruction could not be executed.

An attempt was made to calculate the square root of negative value. (The second argument was negative.)

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the job settings so that the second argument of SQRT instruction does not become negative.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4511: OUT OF RANGE(DROP-VALUE)

The pulse difference of the robot position exceeded the allowable value between when the servo was OFF previously and when the servo was ON this time.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group exceeding the allowable value	Setting error	Confirm the load setting to the robot.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4512: TWO STEPS SAME LINE(3 STEPS)

In the user coordinates for calibration between manipulators, three or more teaching points are aligned in a straight line.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings so that the teaching points are not aligned in a straight line.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4513: EXCESSIVE SEGMENT(SAFETY 1): LOW/HIGH

This alarm occurs if the operation command which exceeds the designated max. speed is output.

It may occur when the robot operates near the singular point or when the robot is going to change its orientation widely with single control point.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Check the following settings. • Reduce the speed of the step where the alarm occurred. • Change the move instruction to joint interpolation (MOVJ). * Be careful to the peripheral interference since its movement changes.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4515: EXCESSIVE SEGMENT(SAFETY 2): LOW/HIGH

This alarm occurs if the operation command which exceeds the designated max. speed is output.

It may occur when the robot operates near the singular point or when the robot is going to change its orientation widely with single control point.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Check the following settings. • Reduce the speed of the step where the alarm occurred. • Change the move instruction to joint interpolation (MOVJ). * Be careful to the peripheral interference since its movement changes.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4517: SEARCH MONITOR SET ERROR(SERVO)

An error occurred in search/monitoring mode settings in servo section.

An error occurred in interface with servo section at search/monitoring mode.

Sub Code	Meaning	Cause	Remedy
	Sub Code: The related control-group	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4518: SEARCH MON RELEASE ERR(SERVO)

An error occurred in search/monitoring mode releasing in servo section.

An error occurred in interface with servo section at search/monitoring mode.

Sub Code	Meaning	Cause	Remedy
	Sub Code: The related control-group	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4520: AXIS BLOCKING

A motion was commanded for the group axis during axis block at play mode.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Check the settings for the general-purpose input signal set in the parameter.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4521: WRONG JOB TYPE

Job type is inconsistent.

Sub Code	Meaning	Cause	Remedy
	Sub Code 0000_0001: A robot job was started from the concurrent job at CALL/JUMP instruction execution. 0000_1001: A concurrent job was started from the robot job at CALL/JUMP instruction execution. 1000_0001: A system job was started from the robot job at CALL/JUMP instruction execution.	Setting error	Check the settings for the job to be started.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4522: TAG DATA CHANGE PROCESS ERROR

An error occurred at tag data change.

Sub Code	Meaning	Cause	Remedy
0	An attempt was made to change the contents of variable tag data.	Setting error	The variable tag cannot be changed. Correct the job so as not to use the variable tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	An attempt was made to change the tag data for the job prohibited from being edited.	Setting error	Release the prohibition.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An error occurred at instruction read-in.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The tag is not registered.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The tag data was variable specification.	Setting error	The variable tag cannot be changed. Correct the job so as not to use the variable tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The value which it was made to change exceeded the limit of tag data.	Setting error	Check the contents of changing data.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	An error occurred at tag data change.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4523: SHARED AXES CONTROL ERROR

An error occurred at shared base axes control.

Sub Code	Meaning	Cause	Remedy
1	The teaching points are incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Robot information for implementing the shared base axes control cannot be acquired.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4523: SHARED AXES CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
3	Robot axes, base axis specification error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Control number of the main side base axis is abnormal.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Independent control base axis group error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Shared base axes current value creation error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Independent control slave side speed calculation error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Independent control slave side speed check error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Independent control Prohibit command execution error.	Setting error	In shared base axes control, the robot of slave side MOVs, EIMOV, EIMOV cannot be used. Correct the job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Independent control slave side coordinated motion specification error.	Setting error	The independent control slave side, cannot be coordinated motion. Correct the job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4524: CANNOT EXECUTE INST(CONCUR JOB)

An error occurred at concurrent job execution.

There was an instruction that cannot be executed such as move instruction in the concurrent job.

Sub Code	Meaning	Cause	Remedy
		Setting error	Delete an instruction that cannot be executed such as move instruction in the concurrent job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4525: CANNOT EXECUTE SPECIFIED JOB

The specified JOB couldn't be executed.

Sub Code	Meaning	Cause	Remedy
1	An interrupt job (user setting) is started up during the back operation.	Setting error	Check the job so that the interrupt job will not start up during the back operation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An suspend macro job is started up during the back operation.	Setting error	Check the job so that the suspend macro job will not start up during the back operation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An interrupt job (inside the system) is started up during the back operation.	Setting error	Check the job so that the interrupt job will not start up during the back operation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	A FOLGE job is started up from a job except the registered master job.	Setting error	Check the job so that the FOLGE job will start up from the registered master job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4527: UNDEFINED PORT NO.(AOUT)

Incorrect analog output port number.

The specified analog output port number was not allowed.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for the specified analog output port number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4528: SYNTAX ERROR

An error occurred in the instruction syntax.

Sub Code	Meaning	Cause	Remedy
1	A syntax error was found in the IF sentence.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4529: TWIN COORDINATED ERROR

An error occurred at twin synchronization execution.

Sub Code	Meaning	Cause	Remedy
1	A job without control group was started by SYNC instruction.	Setting error	Check the control group setting of the job to be started by SYNC.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	A job only with robot axes was started by SYNC instruction.	Setting error	Check the control group setting of the job to be started by SYNC.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	A job only with master control group axes was started by SYNC instruction.	Setting error	Check the control group setting of the job to be started by SYNC.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	At full synchronization, the completion timings of move instructions for the master and the slave disagreed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	At full synchronization, no operation request from the master was sent.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	At full synchronization, the execution timings of move instructions for the master and the slave disagreed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The twin synchronous ID number is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	An attempt was made to execute triple synchronization when specified Sub-master for the master was different.	Setting error	Match the system number specification of the master between the job to be started by SYNC.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Combination of twin coordination, SYNC instruction and TRACK instruction are mixed.	Setting error	Unify the combination of twin coordination with SYNC instruction or TRACK instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4530: CONVEYOR TRACKING ERROR

An error occurred in conveyor synchronization execution.

Sub Code	Meaning	Cause	Remedy
1	The base axis specification is other than 1 or 2 for conveyor characteristic file.	Setting error	Set the base axis specification of conveyor characteristic file to either 0, 1, or 2.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	No robot axis in the job for robot axis tracking	Setting error	Correct the job setting so that the robot axis tracking is executed in the job where robot axis exists.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	No base axis in the job for base axis tracking	Setting error	Correct the job settings so that the base axis tracking is executed in the job where base axis exists.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The conveyor board number and conveyor characteristic file number used are incorrect.	Setting error	Check the specification of conveyor condition file number for use.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	There was no conveyor start position data at prereading processing.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	No base axis in the job for arc tracking	Setting error	Correct the job setting so that the arc tracking is executed in the job where robot axis exists.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The set value for the TRACKING CORRECTION in a Conveyor condition file is abnormal.	Setting error	Set a larger value for the TRACKING CORRECTION in the Conveyor condition file to be used.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4531: UNDEFINED CONVEYOR COND FILE

Conveyor characteristic file is not set.

"Use state" of the conveyor characteristic file set for the job is not set to "1: Use".

Sub Code	Meaning	Cause	Remedy
	Sub Code: Conveyor characteristic file number	Setting error	Set "Use state" of conveyor characteristic file to "1: Use."
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4532: CONVEYOR SPEED DOWN

The conveyor speed decreased below the "Conveyor Lowest Speed" set in the conveyor characteristic file.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Conveyor number	Setting error	Correct the "Conveyor Lowest Speed" set in the conveyor characteristic file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4533: ARITHMETIC ERROR(CV TRACKING)

An error occurred when conveyor tracking was being used.

Sub Code	Meaning	Cause	Remedy
1	Designation error of the conveyor tracking control-group	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Designation error of the user coordinates for the conveyor tracking	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An attempt was made to use the conveyor tracking function with the slave manipulator at coordinate motion.	Setting error	The conveyor tracking cannot be executed to the slave manipulator of the coordinate system. Correct the job so that the conveyor tracking perform by the robot unit or without coordinated motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Zero is set for the resolution for the turn-table synchronization.	Setting error	Check the settings for the resolution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The BASE-axis is set in the TRACKING method.	Setting error	Base-axis tracking is not supported. Use ROBOT-axis for the tracking method.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4534: TORQUE INTERFERENCE

The load torque of an axis motor exceeded the allowable value when the manipulator is operating at the specified speed.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Correctly set the weight information in the tool file. (Are the weight: W and the number set to the load value of either Xg, Yg or Zg?) • Reduce the speed in the step where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4535: TARGET VARIABLE TYPE UNMATCHED

An error occurred when the system variable was obtained .

Sub Code	Meaning	Cause	Remedy
0	An attempt was made to obtain the byte type system variable by the other type variable.	Setting error	Obtain as the byte type variable.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	An attempt was made to obtain the integer type system variable by the other type variable.	Setting error	Obtain as the integer type variable.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An attempt was made to obtain the double-precision integer-type system variable by the other type variable.	Setting error	Obtain as the double-precision integer-type variable.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An attempt was made to obtain the real-number type system variable by the other type variable.	Setting error	Obtain as the real-number type variable.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An attempt was made to obtain the character-string type system variable by the other type variable.	Setting error	Obtain as the character-string type variable.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4538: ROBOT AXIS TRACKING INVALID

An error occurred while performing robot axis tracking.

Sub Code	Meaning	Cause	Remedy
0	"SYMOVJ" instruction is executed at robot-axis tracking.	Setting error	Do not use "SYMOVJ" instruction in robot axis tracking.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4539: CORNER R CONTROL ERROR

An error occurred at corner-R execution.

Sub Code	Meaning	Cause	Remedy
1	The Corner-R motion cannot be used for coordinated motion.	Setting error	Do not use the Corner-R motion for coordinated motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An attempt was made to execute the Corner-R motion for the same point.	Setting error	Check the settings for the teaching so that the start step and end step are not on the same point.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The Corner-R zone is taught on a straight line.	Setting error	Check the settings for teaching so that the Corner-R zone is not on a strait line.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The start position or end position for the Corner-R motion could not be calculated inside the start zone or the end zone.	Setting error	Check the following settings. • Make the setting for the Corner-R radius small. • Make the moving amount of the Corner-R start step long. • Make the moving amount of the Corner-R start end long.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The Corner-R motion cannot be used for coordinated motion (with master manipulators).	Setting error	Do not use the Corner-R motion for master manipulators at coordinated motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The Corner-R motion cannot be used for MOVC, MOVs, and EIMOVc instructions.	Setting error	Use a MOVL instruction when using the Corner-R motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The Corner-R motion is disabled during weaving.	Setting error	Do not perform weaving when using the Corner-R motion.

4539: CORNER R CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Different tool numbers are set in a Corner-R zone (for the Corner-R middle step and end step).	Setting error	Use the same tool number in a Corner-R zone.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The Corner-R motion is disabled when the higher-order acceleration/deceleration is specified.	Setting error	Disable the higher-order acceleration/deceleration when using the Corner-R motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	The Corner-R motion is disabled during conveyor tracking.	Setting error	Do not perform the conveyor tracking when using the Corner-R motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	A value other than "MOVL" is specified for the corner R end step.	Setting error	Change the Corner-R end step interpolation to "MOVL".
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4540: JOB QUE EMPTY ERROR

No job queue data.

"QUE" is used in CALL or JUMP instruction under the condition that no job queue is used.

Sub Code	Meaning	Cause	Remedy
		Setting error	Use "CALL QUE" under the condition that the job data is set to the job queue .
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4541: INVALID INPUT STRING(VAL)

An error occurred at VAL instruction execution.

A character string could not be converted to a numerical value.

Sub Code	Meaning	Cause	Remedy
1	There was no character string representing a constant in character string to be extracted at VAL instruction execution.	Setting error	Check the settings for the data of the character string to be extracted.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4542: MRESET ERROR

An error occurred at MRESET instruction execution.

Sub Code	Meaning	Cause	Remedy
1	An MRESET instruction was executed while no endless axis was designated.	Setting error	Set the endless axis.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4543: STACK LESS THAN 0(JOB CALL)

An error occurred at job return.

An error occurred in control of job call stack.

Sub Code	Meaning	Cause	Remedy
	At job return, an attempt was made to fetch a data from an empty job call stack or to stack a data in the job call stack that is full.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4544: MID\$ INST ERROR

An error occurred at MID\$ instruction execution.

The character string could not be extracted.

Sub Code	Meaning	Cause	Remedy
1	The first character of character string to be extracted is null at MID\$ instruction execution.	Setting error	Check the settings for the data of the character string to be extracted.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4544: MID\$ INST ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2	The extraction start position exceeds the character string length at MID\$ instruction execution.	Setting error	Check the settings for the data of the character string to be extracted.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4546: CANNOT EXECUTE SYSTEM JOB

The system job could not be executed.

An error in the system start number of system job.

Sub Code	Meaning	Cause	Remedy
	Sub Code: System number	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4547: PRIMITIVE ERROR

An error occurred in OS.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Error code	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4548: CANNOT OPERATE SPECIFIED EVENT

The specified event could not be operated at INIEVNT instruction execution.

Sub Code	Meaning	Cause	Remedy
	Sub Code: System number	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4549: NOT EXECUTION OF INIEVNT

INIEVNT instruction was not executed before having executed the event related process.

Sub Code	Meaning	Cause	Remedy
	Sub Code: System number	Setting error	Execute an INIEVNT instruction before executing an event related instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4550: CANNOT EXECUTE INST(USER JOB)

The specified instruction in the user job could not be executed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: System number	Setting error	This instruction cannot be executed in the system job. Correct the job so that the instruction is executed in the user job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4565: SOFTWARE UNMATCH

The used function and the system are inconsistent.

Sub Code	Meaning	Cause	Remedy
2	The observer function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The TURBO function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The conveyor/press synchronization function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The shared motion function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The layer motion function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The general sensor function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The servo float function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The laser cutting function (with small circle cutter) is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The speed control function (VCON/VCOF) is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4565: SOFTWARE UNMATCH (continued)

Sub Code	Meaning	Cause	Remedy
13	The servo hand function (for handling application) is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	The laser cutting function (for form cutting operation) is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	The series communication function between the systems (PSEND/PRECV) is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	The motion extension function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	The ME-NET function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	The MEMO-PLAY function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	The 3D-SHIFT function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	The Equalization function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	The press synchronization function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	The roller hem function is not used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
255	An attempt was made to execute an undefined instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4566: USER FRAME MAKING ERROR

An internal control error occurred at preparation of a user coordinates.

Sub Code	Meaning	Cause	Remedy
1	The teaching points are incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The teaching points for user-coordinate turning are incorrect.	Setting error	Among three taught points in the teaching position. Teach the three points again so that they do not lie in the straight line.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The robot axis is not specified for the control group of the job to prepare the user coordinates.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Position data error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Setting error of the slave group for user coordinate conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4567: CANNOT MONITOR DISTANCE

The distance could not be monitored when executing a move instruction.

An attempt was made to execute MOVJ/MOVS instruction in arc retry or restart operation.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Change the interpolation instruction to MOVL/MOVC. • Change the setting so that the arc retry or restart operation does not perform.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4571: SERVO FLOAT MODE RELEASE ERR

The servo float mode could not be reset when executing a FLOATOF instruction.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4579: ANTICIPATION CONTROL ERROR

An error occurred in the anticipation control processing.

Sub Code	Meaning	Cause	Remedy
1	No availability in anticipation control	Setting error	Maximum simultaneous execution number of anticipation control is twenty. Correct the settings for the job so that it is within twenty.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The anticipation data exceeded the maximum length.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	anticipation control did not complete within the setting time.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4580: ANTICIPATION DISTANCE NOT ENOUGH

Anticipation could not be executed at re-painting.

No return step in re-painting function after emergency stop.

Sub Code	Meaning	Cause	Remedy
		Setting error	Operate the manipulator to the start position of the step where the alarm occurred, and then re-execute.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4581: DEFECTIVE ANTICIPATION OT FILE

An error occurred in the anticipation output file.

Sub Code	Meaning	Cause	Remedy
1	Incorrect setting of OT output number for anticipation output file	Setting error	Check the setting value of OT output number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Incorrect setting of OG output number for anticipation output file	Setting error	Check the setting value of OG output number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4584: STRWAIT TIME LIMIT

An error occurred when executing a STRWAIT instruction.

No confirmation signal specified in the stroke change confirmation instruction was input within the set time.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the cause such as defective limit switch.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4585: SERVO PG ON ERROR

The encoder (PG) power supply could not be turned ON.

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm, and then try again. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Each axes encoder cable
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4590: NO SERVO HAND CONTROL GROUP

The control group was not set for the servo hand control.

Sub Code	Meaning	Cause	Remedy
		Setting error	Set the "servo hand axis" in the control group setting of maintenance mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4591: SPEED CTRL MODE SET ERR(SERVO)

The speed control mode could not be set at VCON instruction execution.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4592: SPEED CTRL MODE CANCEL ERR(SV)

The speed control mode could not be released at VCON instruction execution.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4593: SVHAND CTRL MODE SET ERR(SERVO)

The servo hand control mode could not be set at SHPICK instruction execution.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4594: SVHND CTRL MODE CANCEL ERR(SV)

The servo hand control mode could not be set at SHPLACE instruction execution.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4595: CAN'T DO FIXED FORM CUT MOTION

An error occurred at form cutting operation.

Sub Code	Meaning	Cause	Remedy
1	The setting for radius is incorrect. 1. For a circle, it is incorrectly set as: radius ≤ 0, radius < minimum radius value, or radius > maximum radius value. 2. For an ellipse, it is incorrectly set as: radius ≤ 0, radius < minimum radius value/2, or radius > (maximum radius/2 - width/2).	Setting error	Check the following settings. • Setting of the radius data
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4595: CAN'T DO FIXED FORM CUT MOTION (continued)

Sub Code	Meaning	Cause	Remedy
2	The setting for width is incorrect. 1. For a rectangle, it is incorrectly set as: width < 1.0, width > sqrt (maximum diameter ² - height ²), or width > maximum diameter. 2. It is incorrectly set as: width < 0, width > maximum diameter -2 * radius.	Setting error	Check the following settings. • Setting of the width data
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The setting for height is incorrect. For a rectangle, it is incorrectly set as: height > maximum diameter, height < minimum diameter/2, or height > sqrt (maximum diameter ² - width ²).	Setting error	Check the following settings. • Setting of the height data
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The setting for the corner radius is incorrect. For a rectangle, it is incorrectly set as: corner radius > width/2 or corner radius > height/2.	Setting error	Check the following settings. • Setting of the corner radius
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The setting for overlap is incorrect. 1. For a rectangle, it is incorrectly set as overlap > width/2. 2. For a circle, it is incorrectly set as overlap > ABS (2Pi * radius). 3. For an ellipse, it is incorrectly set as overlap > Pi * radius +ABS (width/2).	Setting error	Check the following settings. • Setting of the overlap data
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The setting for the cutting speed is incorrect. It is set as the cutting speed > maximum linear speed.	Setting error	Check the following settings. • Setting of the cutting speed
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4595: CAN'T DO FIXED FORM CUT MOTION (continued)

Sub Code	Meaning	Cause	Remedy
7	Coordinated motion cannot be used with the Form Cutting motion.	Setting error	Do not use the coordinated motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Zero or a negative value is set in the minimum diameter parameter (S1CxG063) for the Form Cutting motion.	Setting error	Check the following settings. The setting of the minimum diameter parameter (S1CxG063) for the Form Cutting motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Zero or a negative value is set in the maximum diameter parameter (S1CxG064) for the Form Cutting motion.	Setting error	Check the following settings. The setting of the maximum diameter parameter (S1CxG063) for the Form Cutting motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Although "PLACEMENT" or "AUTO" is set for the start point designation on the FORM CUT SETTING window, the FORMAPR instruction was not executed.	Setting error	Execute the FORMAPR instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The Cut file setting of the FORMAPR instruction is different from that of the FORMCUT instruction.	Setting error	The Cut file settings of FORMAPR and FORMCUT instructions must be same.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	A FORMAPR instruction was used for the conventional FORMCUT instruction.	Setting error	Check the following settings. - The FORMAPR instruction cannot be used for the conventional FORMCUT instruction. - Validate the new FORMCUT instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	A form other than a circle, rectangle, and ellipse was designated for the conventional FORMCUT instruction.	Setting error	Check the following settings. - A form other than a circle, rectangle, and ellipse cannot be designated for the conventional FORMCUT instruction. - Validate the new FORMCUT instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4595: CAN'T DO FIXED FORM CUT MOTION (continued)

Sub Code	Meaning	Cause	Remedy
90	The radius data setting for special circular interpolation is incorrect. It is incorrectly set as the radius ≤ 0 .	Setting error	Check the following settings. Setting of the radius data
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
91	The arc center coordinates could not be calculated at special circular interpolation. Incorrect teaching may be the cause.	Setting error	Check the following settings. Setting of the teaching
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
93	The averaging time at special circular interpolation motion is too short.	Setting error	Check the following settings. - Moving distance - Motion speed
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
94	Because the designated plane included reference points at special circular interpolation motion, the arc center coordinates could not be calculated. Incorrect teaching of the reference point 2 may be the cause.	Setting error	Check the following settings. Setting of the reference point 2
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	The arc center position is not set for the special circular interpolation motion.	Setting error	Check the settings for the reference point 1 as the arc center position.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4596: FORMCUT ERROR

An error occurred at FORMCUT instruction execution.

Sub Code	Meaning	Cause	Remedy
1	An attempt was made to re-execute the FORMCUT instruction after interrupting it.	Execute condition failure	Re-execute the move instruction executed before the FORMCUT instruction, and then execute the FORMCUT instruction again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4597: OFFLINE POSITION DATA CONVERT ERR

An internal control error occurred at offline position data conversion.

Sub Code	Meaning	Cause	Remedy
1	Incorrect information of reference position data for offline position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Incorrect user-coordinate number designation in the standard position data for offline position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Incorrect reference-point data for offline position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The standard position data for offline position data conversion could not correctly be calculated.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Incorrect pulse incremental value for offline position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The position data could not correctly be added by the pulse incremental value at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Incorrect Cartesian incremental value for offline position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The position data could not correctly be added by the Cartesian incremental value at the offline position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The position conversion could not be done in the designated coordinate system at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Incorrect incremental value of angle for offline position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4597: OFFLINE POSITION DATA CONVERT ERR (continued)

Sub Code	Meaning	Cause	Remedy
11	The position data could not correctly be added by the incremental value of angle at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The reverse shift value for 3D shifting could not correctly be calculated at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	The reverse shift value for 3D shifting could not correctly be added at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	The reverse shift value could not correctly be calculated at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	The reverse shift value could not correctly be calculated at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	The 3D shifting value could not correctly be added at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	The shift value could not correctly be added at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	No reference point is specified for the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	The positions for the mirror shift function could not correctly be calculated at the offline position data conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	The positions could not correctly be converted for the mirror shift function at the offline position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	The expansion positions for the mirror shift function could not correctly be converted at the offline position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.

4597: OFFLINE POSITION DATA CONVERT ERR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	Incorrect designation of coordinates for a new mirror-shift conversion function at the offline position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4599: SERVO COMMAND ERROR

The command could not be sent to the servo section.

Sub Code	Meaning	Cause	Remedy
	An attempt was made to issue the command while the servo control processing has not completed. Sub Code: Servo CPU bit number	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4604: SPECIFIED ERR(ABSO RECOVER AXIS)

No home position correction data of specified axis.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Registration for the home position correction data.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4605: SETTOOL ERROR

An error occurred when executing a SETTOOL instruction.

The difference between the current tool constant and a new set value exceeded the allowable range (parameter set value).

Sub Code	Meaning	Cause	Remedy
1	The difference between the current tool constant and a new set value exceeded the allowable range (parameter set value).	Setting error	Check the following settings. • Correct the job so that the setting value of tag is allowable value. • Set the allowance amount of the tool data automatic setting function maximum deviation (S3C1192) to large value.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4605: SETTOOL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2	The difference between the monitoring condition of tool and a new set value exceeded the allowable range (parameter set value).	Setting error	Check the following settings. • Correct the job so that the setting value of tag is allowable value. • Set the allowance amount of the tool data automatic setting function maximum deviation (S3C1193) to large value. • Set the monitoring condition of the tool data properly.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4606: LACK OF GLOBAL VARIABLE AREA

The memory area of global variable exceeded the limit value.

An error occurred in the value of parameter that defines the number of global (user) variables.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4607: WRONG EXECUTION OF MACRO INST

An error occurred at macro instruction execution.

Sub Code	Meaning	Cause	Remedy
1	The execution macro job is not set.	Setting error	Check the settings for execution macro job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The suspend macro job is not set.	Setting error	Check the settings for suspend macro job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An attempt was made to start the job that could not be started by the macro instruction.	Setting error	Check the settings for macro job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	An error occurred in the operation process of job call stack when the execution of macro instruction was canceled.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Incorrect macro number	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4608: WRONG EXECUTION OF GETARG INST

An error occurred at GETARG instruction execution.

Sub Code	Meaning	Cause	Remedy
1	The job argument is not set.	Setting error	Check the settings for jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	No number of the specified job argument	Setting error	Check the settings for jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The data types of job argument disagreed.	Setting error	Check the settings for jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4609: MEMOPLAY ERROR

An error occurred at memory play execution.

Sub Code	Meaning	Cause	Remedy
2	The memory play file was being used in another system.	Setting error	Check the setting of the used memory play file number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The control group in the memory play file did not agree with the control group of execution job.	Setting error	Check the control group setting of the used memory play file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	An attempt was made to clear the memory play file by a CLEAR instruction before having executed a MEMOF instruction.	Setting error	Execute the MEMOF instruction, and then execute the CLEAR instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4610: MEMOPLAY SAMPLING ERROR

An error occurred at memory play execution.

Sub Code	Meaning	Cause	Remedy
1	Failed to read the memory play sampling data.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Failed to write the memory play sampling data.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Failed to seek the memory play sampling data.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Failed to read the memory play file.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Incorrect mode setting at memory play sampling	Setting error	Check the settings for the memory play mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Incorrect designation of the control group at memory play sampling	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Designation of the control group in the memory play file did not agree with the designation of the control group at MEMON instruction execution (when the start point was specified).	Setting error	Check the number of the memory play file for use.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Designation of the control group in the memory play file did not agree with the designation of the control group at MEMON instruction execution (at initialization).	Setting error	Check the number of the memory play file for use.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	designation of the control group in the memory play file did not agree with the designation of the control group at MEMON instruction execution (at continue).	Setting error	Check the number of the memory play file for use.

4610: MEMOPLAY SAMPLING ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	It started reproducing though it did not record.	Setting error	Record and then play.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Correction amount to record is out of the allowable range.	Setting error	Correct the position of object workpieces so that the correction amount fall within allowable range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The number of recorded correction-amount exceeded the limit.	Setting error	Correct the job so that the movement section of memory play object is shorter.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Memoplay file Create error (REC)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Memoplay debug error C_BANK.func_ctrl (initial)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	Memoplay debug error C_BANK.func_ctrl (continue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	Memoplay debug error C_BANK RT_BANK.func_ctrl (continue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	Memoplay debug error MOVL, MOVC (continue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	Memoplay debug error Same point, moving amount is zero (continue)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	Memoplay debug error Dividing number error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4611: OVER OPTON INST EXECUTION LIMIT

An error occurred when executing a OPTON instruction.

The number of times that the OPTON instruction was executed exceeded the limit value.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for the OPTON instruction. OPTON instruction can use only the function to five simultaneously.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4612: TSYNC ERROR

An error occurred at the execution of the TSYNC instruction.

The number of synchronizations (SNUM) specified by the TSYNC instruction disagreed.

Sub Code	Meaning	Cause	Remedy
	Sub code: the number of synchronizations of the first executed TSYNC	Setting error	Check the settings for the number of synchronizations of the TSYNC instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4614: UNDEFINED SEALERGUN COND FILE

The servo sealer gun condition file is not set.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for servo sealer gun condition file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4615: I/O AXIS OPERATING

I/O axis motion could not be performed.

Sub Code	Meaning	Cause	Remedy
	An attempt was made to command a job whose control group was in I/O axis motion.	Setting error	Check the following settings. - Does not the I/O axis motion executed for the control group that executing the job? - Does not the job executed for the control group that operating by the I/O axis motion? The control group where the I/O axis is operating cannot execute the job. Moreover, the I/O axis motion cannot perform for the control group where the job is executing.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4616: AXIS SHIFT ERROR

An internal control error occurred when shifting the axis.

Sub Code	Meaning	Cause	Remedy
1	The file could not be switched because of incorrect start point designation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The control group with which the axis shifting is performed disagrees with the control group set for the axis shifting function in the calibration file.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The calibration file number for axis shifting function is out of the applicable range.	Setting error	Correct the settings for the OPTON instruction tag so that value of the file number specification is 1 to 32.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4618: SHIFT INST EXECUTE ERROR

An internal control error occurred at execution of the SHIFT instruction.

Sub Code	Meaning	Cause	Remedy
1	For the tool shift with Euler angle plus or minus 90 degrees, the shift value for axes other than Y-axis is set.	Setting error	Check if the shift value is setting for Y-axis only.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4619: UNDEFINED JOB ENTRY TABLE

An error occurred in job registration table.

The job registration table is not set.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Designated registration number	Setting error	Check the settings for the job registration table.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4620: ARM (TOOL) INTERFERENCE

Parts and tool of manipulators were about to interfere with each other.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Group(Interfering) &Axis(Interfering)&Group (Interfered)&Axis(Interfered)	Setting error	Check the following settings. • Change the teaching so that the manipulators specified by sub code will not interfere with each other. • Check if the tool model (Tool interference file) of the manipulator specified by sub code is correctly set. • Check if calibration between the manipulators are correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4622: SELF-INTERFERENCE

Each part and tool of the manipulator was about to interfere with each other.

Sub Code	Meaning	Cause	Remedy
	Sub code: Group&Axis (Interfering)&Axis(Interfered)	Setting error	Check the following settings. • Change the teaching so that each part of the manipulator specified by sub code will not interfere. • Check if the tool model (Tool interference file) displayed by sub code is correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4623: WRONG EXECUTION OF GETPOS INST

An error occurred when executing a GETPOS instruction.

Sub Code	Meaning	Cause	Remedy
1	An attempt was made to obtain the step that used a local position type variable. (The step with local position type variable cannot be fetched. Example: MOVJ LP000 VJ=25.00)	Setting error	Check the settings for the GETPOS instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An attempt was made to obtain the step that used a local position type variable. (The step with local position type variable cannot be fetched. Example: MOVJ LP000 VJ=25.00)	Setting error	Check the settings for the GETPOS instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The specified step did not exist.	Setting error	Check the settings for the GETPOS instruction.

4623: WRONG EXECUTION OF GETPOS INST (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An attempt was made to obtain the step without CTP(CTPP) tag.	Setting error	Check the settings for the GETPOS instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	An attempt was made to obtain the step with CTP(CTPP) tag of variable specification. (The step with CPT(CTPP) tag of variable specification cannot be fetched.)	Setting error	Check the settings for the GETPOS instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4625: WRONG EXECUTION OF LOADDB INST

An error occurred when executing a LOADDB instruction.

Sub Code	Meaning	Cause	Remedy
1	No file	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	No directory	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	There was no directory entry after this point.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1	No file name	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	File presence error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-3	Incorrect file name	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-4	The disk is full.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4625: WRONG EXECUTION OF LOADDB INST (continued)

Sub Code	Meaning	Cause	Remedy
-5	The directory is full.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-6	I/O error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-7	Invalid handle	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-8	Handle overflow	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-9	File has already been opened.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-10	File attribute error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-11	Open mode error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-12	The hardware disk with large capacity is used.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-14	The door is open.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-15	The disk is write-protected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-30	Card controller access error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-31	No card	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4625: WRONG EXECUTION OF LOADDB INST (continued)

Sub Code	Meaning	Cause	Remedy
-32	Card drive information readout error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-33	Partition table error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-34	No drive number	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-35	No specified partition number	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-36	Cluster size error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-37	Incorrect number of sectors	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-38	Sector/byte error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-40	Card not applicable for I/O	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-41	Unsupported version	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-42	The setting register did not exist.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-43	Card not applicable for ATA	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-44	Double chain error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4625: WRONG EXECUTION OF LOADDB INST (continued)

Sub Code	Meaning	Cause	Remedy
-45	Media error (not fixed disk)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-50	ATA command incomplete	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-51	Sector read command error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-52	Sector write command error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4626: IMPOSSIBLE S-AXIS MOV(IN SPHERE)

An error occurred at S-axis high-speed rotation.
The S-axis rotation radius was below the lower limit.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for the limit distance for S-axis rotation center motion (S1CG067).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4628: WRITE VARIABLE NO. MULTI SETTING

An error in the variable number setting.
Duplicated usage of the written destination variable numbers.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Duplicated variable number	Setting error	Check the settings for the written destination variable numbers.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4629: GROUP CHANGE ERROR

An error occurred at group change execution.

Sub Code	Meaning	Cause	Remedy
1	The group change parameter was invalid.	Setting error	Validate the group change parameter.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The GRPCHG instruction was executed while the external axis motor was servo ON.	Setting error	Execute the GRPCHG instruction when the external axis motor was servo OFF.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The GRPCHG instruction was executed in unchuck status.	Setting error	Execute the GRPCHG instruction in chuck status.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The group identification signal was not received.	Setting error	Check the settings for group identification signal.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The specified control group number and the group identification number were unmatched.	Setting error	Check the settings for the specified control group number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The encoder PG power supply was OFF when the GRPCHG was ON.	Setting error	Turn ON the encoder PG power supply when GRPCHG is ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The encoder PG power supply was ON when the GRPCHG was OFF.	Setting error	Turn OFF the encoder PG power supply when GRPCHG is OFF.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The control group that corresponded to the received group identification signal did not exist.	Setting error	Check the settings for group identification signal.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4631: DEFECTIVE OPERATION VELOCITY

The manipulator motion speed failed to reach the specified work speed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Check if the speed is hold down by the speed override and special operations etc.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4635: CANNOT EXECUTE COMMON JOB

The called job could not be executed because the specified control group was shared with the called job.

Sub Code	Meaning	Cause	Remedy
	Sub Code: The related control-group	Setting error	Check the settings for control group specified by the CALL instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4637: TRACK CHG WORK IN/NOT NOT FOUND

No workpiece presence/absence data at switching the synchronization section.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Conveyor characteristic file number	Setting error	Check the workpiece presence/absence and data settings for the synchronization section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4638: TRACKING CHG WORK ID NOT FOUND

No workpiece type data at switching the synchronization section.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Conveyor characteristic file number	Setting error	Check the workpiece presence/absence and data settings for the synchronization section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4639: SYMOVJ INST EXECUTE ERROR

SYMOVJ motion could not be performed.

Sub Code	Meaning	Cause	Remedy
2	The conveyor moving amount is not specified for the SYMOVJ motion.	Setting error	Set the conveyor moving amount for the SYMOVJ motion.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An error occurred in the preparation process of the manipulator motion start position for the SYMOVJ motion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	An error occurred in the preparation process of the manipulator motion end position for the SYMOVJ motion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4640: WRONG EXECUTION OF PSTART INST

An error occurred at PSTART execution.

Sub Code	Meaning	Cause	Remedy
1	No axis data of control group to be disconnected	Setting error	Check the settings for PSTART instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An attempt was made to disconnect a control group other than the occupation control group during prereading processing.	Setting error	Check the settings for PSTART instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An attempt was made to disconnect a control group other than the occupation control group when executing a PSTART instruction.	Setting error	Check the settings for PSTART instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4641: CANNOT EXECUTE JOB(SEPARATE GRP)

The disconnected control group could not be moved.

The control group disconnected by itself was used for its own move instruction.

Sub Code	Meaning	Cause	Remedy
	Sub Code: The disconnected control group used by a move instruction	Setting error	Correct the teaching so that the control group disconnected by itself is not to operate for move instruction of own system.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4645: NOT PERMIT FIXED-WEAV ON SWVON

Hover weaving could not be executed.

The hover weaving is disabled in coordinated motion.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the settings for jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4648: FILE TRANSFER ERROR(ARITH)

An error occurred when transferring the file to the controller.

Sub Code	Meaning	Cause	Remedy
1	Motion range file transfer error	Setting error	Check if the motion range file is correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Part motion range file transfer error	Setting error	Check if the part motion range is correctly set.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4649: PARTIAL MOTION RANGE INTRF.

The manipulator was about to interfere with the partial motion range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Interference control group number & interference axis & interference area number.	Setting error	Check the setting of the teaching position of the manipulator.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4650: TRQ CLEAR ERROR

Couldn't clear the Max Torque when performing TRQCLS.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4651: PALLETIZING EXECUTE ERROR

An error occurred at palletizing instruction execution.

Sub Code	Meaning	Cause	Remedy
1	The setting of the palletizing condition configuration file is incomplete.	Setting error	Set the palletizing condition setting file to "Completed."
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Palletize completion universal output number range exceeds the limit.	Setting error	Change the palletize completion universal output signal number of the palletizing condition setting file in the user output signal point of contact number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	During the palletize start instruction execution, the palletize start instruction is executed again (double execution).	Setting error	Delete the palletize start instruction in the palletize section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The value of the palletizing number present value output register (or I variable) is more than the total number output register (or I variable).	Setting error	Check if the palletizing number of current position output register (or I variable) and total number of output register (or I variable) is not changed by another function.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Palletize completion universal output signal is turned ON at palletize start instruction execution.	Setting error	Reset the palletize completion universal output signal.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Palletize end instruction is not registered.	Setting error	Register the palletizing end instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4652: TRQ MEASURE MODE SET ERR(SV)

Couldn't set to Constant speed torque measure mode when performing MEASON TRQ.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4653: TRQ MEASURE MODE CANCEL ERR(SV)

Couldn't release the Constant speed torque measure mode when performing MEASOF TRQ.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4654: WRONG EXECUTION OF SETREG INST

An error occurred at SETREG instruction execution.

Sub Code	Meaning	Cause	Remedy
1	An attempt was made to change the value of the analog input register.	Setting error	The SETREGM instruction cannot change the analog input register values. Correct the setting of tag that specifies register number of SETREG instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	An attempt was made to change the value of the register currently used by TMR/CNT.	Setting error	The SETREGM instruction cannot change the register values used in TMR/CNT. Correct the setting of tag that specifies register number of SETREG instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
65535	An attempt was made to change the value of the register currently used by TMR/CNT.	Setting error	Correct the setting of tag that specifies register number of SETREG instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4655: WRONG EXECUTION OF GETREG INST

An error occurred at GETREG instruction execution.

Sub Code	Meaning	Cause	Remedy
65535	An attempt was made to acquire the value of the register not existing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4656: WRONG EXECUTION OF SETPRM INST

An error occurred at SETPRM instruction execution.

Sub Code	Meaning	Cause	Remedy
-1	An attempt was made to change a parameter other than the cube-related or the analog output corresponding to speed-related parameter.	Setting error	The SETPRM instruction cannot change the parameter values other than the parameter related to the cube or the analog output corresponding to speed. Correct the setting of tag that specifies parameter number of SETPRM instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	The SETPRM instruction was executed while another system was in execution.	Setting error	The SETPRM instruction cannot execute while another system is operating. Correct the job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4657: WVADJ ERROR

An error occurred in the function of weaving groove width correction.

Sub Code	Meaning	Cause	Remedy
1	The correction amplitude value did not fall in the limit range.	Setting error	Correct the settings for "groove width correction limit value" specified for S2C1259 and 1260.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4658: OVER SPEED LIMIT

The manipulator motion speed attempted to exceed the speed limit.

Sub Code	Meaning	Cause	Remedy
1	The taught speed was going to exceed the limit during the multi arm simultaneous operation.	Setting error	Reduce the teaching speed of the step where the alarm occurred to the speed limit or less.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4661: MEMORY ERROR(PRESS COND FILE)

An error was detected at memory check.
The memory for the press condition file is damaged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: File number	Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the press characteristic file in maintenance mode, and then load the press characteristic file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4668: MEMORY ERROR(PREVENTION FILE)

An error was detected at memory check.
The memory for the maintenance prevention file is damaged.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm. 2. If the alarm occurs again, initialize the maintenance prevention file in maintenance mode, and then load the maintenance prevention file saved in the external memory device.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot control module. Save the CMOS.BIN before replacing the board to be safe. Replace the robot control module, and then insert the SD card which inserted original robot control module into the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4669: DETECT BRAKE SLIP

Brake slip was detected

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(motor)	1. Reset the alarm. 2. If the alarm occurs again, replace the motor. 3. If the alarm of "external brake" is occurred. , replace the external brake.
		Setting error	1. Reset the alarm. 2. Check the check torque value settings.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4670: INSUFFICIENT NUM OF SAMPLE DATA

The measurement section is too short.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	1. Reset the alarm. 2. Lengthen the measurement section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4671: SAMPLE BUFFER OVER FLOW

The measurement section is too long.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	1. Reset the alarm. 2. Shorten the measurement section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4672: BASIC SPEED UNREACHED

The motion speed could not exceeded the speed specified by BASICV.

The motion speed might have shifted to the speed reduction motion before BASICT has passed because BASICT was too long.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	1. Reset the alarm. 2. Increase the speed specification value of a measurement job or set a small value for BASICV. Or set a small value for BASICT, or lengthen the measurement section.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4673: MAX TRQ UNDETECTED

The measurement data contain the acceleration torque.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Setting error	1. Reset the alarm. 2. Set a large value for the BASICT, and then check again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4674: SETE ERROR

An error occurred at SETE instruction execution.

Sub Code	Meaning	Cause	Remedy
1	An attempt was made to set tool for base/station-axis position-type variable.	Setting error	Check the settings for jobs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4676: BROKEN FAN FUSE

The fuse (1FU/2FU) is blown in the power supply contactor unit.

Sub Code	Meaning	Cause	Remedy
1	Sub Code 1 to 8: Signifies the robot control module No. in which the alarm occurred	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check if there is a ground fault or short circuit in the fan power line.
		Fuse failure	(After cancellation of the short-circuit and ground fault) Replace the fuse.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4677: IMPOSSIBLE LINEAR MOTION

Interpolation motion cannot perform from a current form (folded direction of arm) to the form at the target position. The move instruction other than MOVJ instruction, or the movement to the position variable by pressing FWD under the Cartesian jog operation cause error.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Check the following settings. • If the sub code display is L- and U-axes, perform the teaching again to make the form (arm folded direction) of L- and U-axes same at start point and end point. • If the sub code display is S- and L-axes, perform the teaching again to make the form (arm folded direction) of S- and L-axes same at start point and end point. • Change the teaching move instruction to MOVJ instruction. * Be careful to the peripheral interference since its movement changes.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4678: SPOT MONITOR DATA ERROR

Failed to read or write the database of spot weld history.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Internal control error in software	Software operation error occurred	1. Reset the alarm. 2. If the alarm occurs again, initialize the database of spot weld history. 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4680: F-SAFE COMMAND ERROR (RC)

It was not possible to send commands to the robot safety module.

Sub Code	Meaning	Cause	Remedy
	The previous command was not completed. Sub Code: Functional safety board station number.	Software operation error occurred	Reset the alarm, and then try again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4681: OVER SPEED(MainCPU)

The operation command which exceeds the designated max. speed was output.

It may occur when the robot operates near the singular point or when the robot is going to change its orientation widely with single control point.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group and axis	Setting error	Check the following settings. • Reduce the speed of the step where the alarm occurred. • Change the move instruction to joint interpolation (MOVJ). * Be careful to the peripheral interference since its movement changes.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4684: INTERPOLATION INVALID

Operation to the position and posture in which the interpolation is impossible was occurred.

It may occur when the interpolation motion to the position in which the operation area is exceeded is performed, when the arm expands, or when the interpolation motion to the target position that cannot keep the position and posture is performed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Check the following settings. • At the Cartesian jog operation, switch to each-axes jog operations, and then change the orientation of manipulator. • Change the teaching position and orientation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4685: F-SAFE WRITE ERROR

An error occurred when recording the data in the robot safety module.

Sub Code	Meaning	Cause	Remedy
0	An error occurred in the parameter write operation.	Data error	1. Reset the alarm. 2. Try the write operation again.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	An error occurred in the file write operation.	Data error	1. Reset the alarm. 2. Try the write operation again.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.

4685: F-SAFE WRITE ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Write request has timed out.	Software operation error occurred	1. Reset the alarm. 2. Try the write operation again.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4692: F-SAFE ENCODER BACKUP ERROR

The robot safety module has detected a decrease in encoder battery.

Sub Code	Meaning	Cause	Remedy
		Encoder battery failure	1. Reset the alarm. 2. If AL4311 occurred simultaneously with this alarm, execute the troubleshooting for the AL4311.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4693: F-SAFE READBACK PROC. ERROR

The robot safety module has detected a readback process.

Sub Code	Meaning	Cause	Remedy
0	Readback value of CPU1 and CPU2 mismatch.	Data error	1. Reset the alarm. 2. Try the write operation again.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	Another readback request was issued to the readback process. (Parameter)	Software operation error occurred	1. Reset the alarm. 2. Try the write operation again.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4693: F-SAFE READBACK PROC. ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2	Another readback request was issued to the readback process. (File)	Software operation error occurred	- Reset the alarm. - Try the write operation again.
		Robot safety module failure	- Reset the alarm, and then try again. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Incorrect file type.	Data error	- Reset the alarm. - Try the write operation again.
		Robot safety module failure	- Reset the alarm, and then try again. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Incorrect file number.	Data error	- Reset the alarm. - Try the write operation again.
		Robot safety module failure	- Reset the alarm, and then try again. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Incorrect write data.	Data error	- Reset the alarm. - Try the write operation again.
		Robot safety module failure	- Reset the alarm, and then try again. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Process order error.	Software operation error occurred	- Reset the alarm. - Try the write operation again.
		Robot safety module failure	- Reset the alarm, and then try again. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4696: TURN TABLE CALIBRATION ERROR

An error occurred at the conveyor coordinate creation for the turn-table.

Sub Code	Meaning	Cause	Remedy
1	There was the same point in three points where the calibration had been executed.	Setting error	Correct the calibration position so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The three points where the calibration had been executed lie in a straight line.	Setting error	Check the calibration position so that the three taught points are not aligned in a straight line.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The three points where the calibration had been executed lie in a straight line.	Setting error	Check the calibration position so that the three taught points are not aligned in a straight line.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4697: OFFLINE ARM BEND POS CONVERT ERR

An error occurred when executing of bending correction job conversion.

Sub Code	Meaning	Cause	Remedy
1	Incorrect information of standard position data for offline arm bend position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Incorrect user-coordinate number in the standard position data for offline arm bend position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Incorrect reference-point data offline arm bend position data conversion	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	The position data could not be converted correctly/conversely for the standard position data at the offline arm bend position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Incorrect pulse incremental value for offline arm bend position data conversion	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.

4697: OFFLINE ARM BEND POS CONVERT ERR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The position data could not be converted correctly for the pulse incremental value at the offline arm bend position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Incorrect Cartesian incremental value for offline arm bend position data conversion	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The position data could not be converted correctly for the Cartesian incremental value at the offline arm bend position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The position conversion could not be done in the conversion data for offline arm bend position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Incorrect incremental value of angle for offline arm bend position data conversion	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The position data could not be converted correctly for the incremental value of angle at the offline arm bend position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The gravity moment for offline arm bend position data conversion could not be calculated.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4697: OFFLINE ARM BEND POS CONVERT ERR (continued)

Sub Code	Meaning	Cause	Remedy
13	The position data could not be converted correctly for the revised conversion data at the offline arm bend position data conversion.	Setting error	The variable position may be out of the robot motion range. Check if the variable position is within the robot motion range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4698: SHIFT VALUE MAKING ERROR

The shift value could not be set.

Sub Code	Meaning	Cause	Remedy
1	Reference position and target position occupation control-group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Reference position and target position enabling control-group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The position data type is not applicable.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Coordinated control-group error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	User coordinates number on the specified tag side error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4699: SYSTEM ERROR 1(RSC1)

An error was detected into RSC1 control task.

Sub Code	Meaning	Cause	Remedy
	Sub Code Internal control error in software	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4700: SYSTEM ERROR 2(RSC1)

An error was detected into RSC1 control task.

Sub Code	Meaning	Cause	Remedy
	Sub Code Internal control error in software	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4701: MEMORY ALLOCATION ERROR

Use memory is lacking and the area could not be obtained.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4703: F-SAFE OPERATION MODE ERROR

Cannot change the mode to PLAY under ENCODER BACK-UP ERROR in robot safety module system.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Change to teach mode. 2. Reset the alarm, and then try again. 3. If the alarm occurs again, set to home position.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the unit to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4707: TIMING CONTROL ERROR

A error occurred in the timing control processing.

Sub Code	Meaning	Cause	Remedy
1	Control data error occurred at prereading. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Control data error occurred. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Index number of the target does not exist. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4707: TIMING CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
4	Bank number of the target does not exist. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Control data size over. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Control index overflow. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The control-group of surveillance does not exist. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Instruction index overflow. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	An error occurred when calculate a feedback position. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The control-group of the target which supervises a position does not exist. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Waiting time exceeded the limit. (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	watching information settings incomplete (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Delay control impossible (Function the timing control)	Setting error	Change the settings so as not to delay control.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	Execution control request settings incomplete (Function the timing control)	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4707: TIMING CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
15	Instruction that cannot coexist with FPL/+DOUT/+PULSE was used	Setting error	- Check the following settings. - FPL/DOUT/+PULSE and NWAIT cannot be used at the same time for SYMOVL instruction. Correct the job. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
16	Monitor error occurred. (Function the timing control)	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	Executed step designation error	Setting error	- Check the following settings. - Review a job so that prereading processing of timing control is completed before an operation start of the control object step. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4715: CIP MESSAGE SERVER FUNC ERROR

An error occurred during CIP message communication

Sub Code	Meaning	Cause	Remedy
1	Failed in the generation of the CIP server task.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Failed in the ID take of the CIP server task.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Failed in the generation of the class entry table.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Library initialize error.	Setting error	Check the following settings. - EtherNet/IP(CPU Board) setting in maintenance mode - LAN interface setting in maintenance mode (In particular, the IP address, subnet mask, default gateway are set correctly, and DHCP is not used) - IO module setting in maintenance mode - IP address setting of devices connected to the network (the same IP address does not exist).
		Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4715: CIP MESSAGE SERVER FUNC ERROR (continued)

Sub Code	Meaning	Cause	Remedy
5	Failed in the generation of the access process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Detects undefined error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	Detects sever function started processing.	Setting error	Check the following settings. • EtherNet/IP(CPU Board) setting in maintenance mode • LAN interface setting in maintenance mode (In particular, the IP address, subnet mask, default gateway are set correctly, and DHCP is not used) • IO module setting in maintenance mode • IP address setting of devices connected to the network (the same IP address does not exist).
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	Detects request error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	Detects memory error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32	Detects mail send error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
33	Detects CIP answer error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
40	Detects CIP server task mail receive error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
41	Detects CIP server task request data error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
50	Detects CIP server task send error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4716: BINARY ETHERNET SERVER FUNC ERR

An error occurred during high speed Ethernet sever communication

Sub Code	Meaning	Cause	Remedy
1	IP address duplicated.	IP address setting error	1. Reset the alarm, and then try again. 2. The IP address is duplicated with the YNX1000 controller. Confirm the IP address of the communication target. 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
	Detects message library initialize error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Failed in the generation of the RC connect management task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Failed in the generation of the RC server task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Failed in the generation of the file server task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Failed in the generation of the command relay function server task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1040	Failed in the request take of the RC connect management task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1041	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1042	Received data area overflow.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1043	Failed in the request error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1044	Failed in the request error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4716: BINARY ETHERNET SERVER FUNC ERR (continued)

Sub Code	Meaning	Cause	Remedy
1059	In a RC connect management task, undefine error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1060	Failed in the ID take of the RC server task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1061	Failed in the mail take of the RC server task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1062	In a RC server task, request mail data error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1063	Answer data area overflow.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1064	In a RC server task, receive data area overflow.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1079	In a RC server task, undefined error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1080	In a file server task, mail receive error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1081	In a file server task, request mail data error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1082	IP address duplicated.	IP address setting error	1. Reset the alarm, and then try again. 2. The IP address is duplicated with the YNX1000 controller. Confirm the IP address of the communication target. 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
	In a file server task, request error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1083	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4716: BINARY ETHERNET SERVER FUNC ERR (continued)

Sub Code	Meaning	Cause	Remedy
1084	In a file server task, receive data area overflow.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2045	In a RC connect management task, send error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2046	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2065	Detects RC server task send error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2066	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2085	Detects file server task send error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2086	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2087	In a file server task, answer data error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2088	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2089	In a file server task, answer data area overflow.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2098	Failed in the status error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4716: BINARY ETHERNET SERVER FUNC ERR (continued)

Sub Code	Meaning	Cause	Remedy
2099	In a file server task, undefined error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3090	In a file sever task, file close error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4718: BINARY ETHERNET CLIENT FUNC ERR

An error occurred during high speed Ethernet client communication

Sub Code	Meaning	Cause	Remedy
1	Detects message library initialize error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Failed in the generation of the file function task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Failed in the generation of the RC function task.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Detects I/F data error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Detects undefined error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
110	In a file task, undefined error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
510	In a RC task, undefined error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
511	In a RC task, request command error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
512	In RC task, there is not the class entry of the request command.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4718: BINARY ETHERNET CLIENT FUNC ERR (continued)

Sub Code	Meaning	Cause	Remedy
513	In RC task, there is not the service entry of the request command.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1130	In a high speed Ethernet task, request mail error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1131	In a high speed Ethernet task, request command error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1132	In a file task, mail receive error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2140	In a file task, file reading error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2141	In a file task, file writing error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3150	In a file task, request send error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3151	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3160	In a file task, reply packet clear error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3161	Failed in the take of the reply packet data error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3162	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3163	In a file task, time out occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4718: BINARY ETHERNET CLIENT FUNC ERR (continued)

Sub Code	Meaning	Cause	Remedy
3164	In a file task, receive data area overflow occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3165	In a file task, received data unmatched.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3166	In a file task, receive data size overflow occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3167	In a file task, received data size set to zero occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3168	In a file task, reply head error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3169	In a file task, reply status error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5530	In a RC task, interface request error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5531	In a RC task, interface answer error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5532	In a RC task, interface data area overflow occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5533	In a RC task, interface data writing error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6540	In a RC task, time out occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6541	Detects data error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4718: BINARY ETHERNET CLIENT FUNC ERR (continued)

Sub Code	Meaning	Cause	Remedy
6542	Detects exclusive process error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6543	Detects time out.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6544	Setting error	Setting error	Reset the alarm, and confirm whether the following parameter is set to zero. • S2C541 • S2C542
	Detects data error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6545	Detects exclusive process error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7550	In a RC task, request send error occurred.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7551	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7560	In a RC task, reply packet error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7561	In a RC task, reply take error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7562	Failed in the endian conversion.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7563	Detects time out.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7564	In a RC task, receive data area overflow detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4718: BINARY ETHERNET CLIENT FUNC ERR (continued)

Sub Code	Meaning	Cause	Remedy
7565	In a RC task, received data unmatched.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7566	In a RC task, received data size over.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7567	In a RC task, receive data size zero detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7568	In a RC task, reply head error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7569	In a RC task, reply status error detected.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4719: VIB SUPPRESSION FLT TIME OUT

vibration suppression filter did not complete within the specified time.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4721: IMPROPER TOOL FILE SETTING

The current tool file setting doesn't allow the manipulator to be operated.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group number & tool data & tool number.	Setting error	1. Reset the alarm. 2. Check the following settings. • Select a sub menu [TOOL] under main menu [ROBOT]. • Select the coordinate window of the number specified by sub code(tool number). • Set "0" to the coordinate data specified by sub code (tool data).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4725: SETTM ERROR

An error occurred at SETTM instruction execution.

Sub Code	Meaning	Cause	Remedy
1	TM variable number exceeded the limit.	Setting error	Check the TM variable number used in the job, and then correct the job to fall within the range of TM variable number (0-59).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Same TM variable set up as "LOCAL" was used in different tasks.	Setting error	Correct the job not to use the same TM variable set up as "LOCAL" in different tasks.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The I/O signal number set up in the "SETTM SETUP FILE" cannot be carried out.	Setting error	Check the I/O signal number set in the "SETTM SETUP FILE", and then correct it within the effective setting range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4727: GETCVSFT ERROR

An error occurred at GETCVSFT instruction execution.

Sub Code	Meaning	Cause	Remedy
1	Conveyor condition support file (WORK ID shift) is not set.	Setting error	Set "Use state" of conveyor condition support file(WORK ID shift) to "1: Use."
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Conveyor condition support file (WORK IN/OUT shift) is not set.	Setting error	Set "USED STATUS" of conveyor condition support file (WORK IN/OUT shift) to "1: Use."
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Conveyor condition file is not set.	Setting error	Set "USED STATUS" of conveyor condition file to "1: Use."
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Conveyor condition support file (Start shift) is not set.	Setting error	Set "USED STATUS" of conveyor condition support file(Start shift) to "1: Use."
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	"WORK ID signal" of the Conveyor condition support file (WORK ID shift) is not set	Setting error	Set "WORK ID signal" of Conveyor condition support file (WORK ID shift)

4727: GETCVSFT ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	"WORK IN/OUT signal" of the Conveyor condition support file (WORK IN/OUT shift) is not set	Setting error	Set "WORK IN/OUT signal" of Conveyor condition support file (WORK IN/OUT shift)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4728: CONVEYOR SYNCHRONIZATION (SHIFT FUNCTION) ERROR

An error occurred in conveyor synchronization (shift function) execution.

Sub Code	Meaning	Cause	Remedy
1	"WORK ID signal" of the Conveyor condition support file (WORK ID shift) is not set	Setting error	Set "WORK ID signal" of Conveyor condition support file (WORK ID shift)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	"WORK IN/OUT signal" of the Conveyor condition support file (WORK IN/OUT shift) is not set	Setting error	Set "WORK IN/OUT signal" of Conveyor condition support file (WORK IN/OUT shift)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4729: ASCII IF CONTROL ERROR

An error occurred in the ASCII-IF control processing.

Sub Code	Meaning	Cause	Remedy
1	The file number is wrong. An attempt was made to record again the file being recorded by IBGNSTART instruction.	Setting error	Set a number of the file in IBGNSTART instruction, so that the file being recorded does not repeat.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	The number of robot in the JOB is wrong. An attempt was made to record the file in the JOB including robots more than two.	Setting error	Correct the JOB, so that IBGNSTART instruction is used in the JOB of one robot.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4729: ASCII IF CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
3	The number of external axis (STATION or BASE) in the JOB is wrong. An attempt was made to record the file in the JOB including external axis(STATION or BASE) more than two.	Setting error	Correct the JOB, so that IBGNSTART instruction is used in the JOB of one external axis(STATION or BASE).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	IBGNEND instruction is not registered.	Setting error	Register IBGNEND instruction in the same job after the line where IBGNSTART instruction was registered.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	IBGNEND signal is not turned OFF before a specified time at the time of IBGNSTART instruction executed.	Setting error	Turn off IBGNEND signal by executing mpNoticeIBGNRecordRefEnd() in the MotoPlus application before IBGNSTART instruction is executed.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The setting of the playback file is not completed at the time of IBGNSTART PLAYBACK=ON instruction executed.	Setting error	Complete the setting of the playback file by executing mpNoticeIBGNPlaybackSetEnd() in the MotoPlus application before IBGNSTART PLAYBACK=ON instruction is executed.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Job name in the playback file is wrong at the time of IBGNSTART PLAYBACK=ON instruction executed.	Setting error	Set the job name in which IBGNSTART PLAYBACK=ON instruction is executed in the playback file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The setting of interpolation clock in the playback file is wrong at the time of IBGNSTART PLAYBACK=ON instruction executed.	Setting error	Set the interpolation clock acquired in the record file in the playback file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	The start/end step number in the playback file is wrong at the time of IBGNSTART PLAYBACK=ON instruction executed.	Setting error	Set the start/end step number of the job in which the record file was made in the playback file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4729: ASCII IF CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
10	IBGNSTART PLAYBACK=ON instruction was executed in a forward direction, before a robot arrives at the start step of the playback file in a backward direction.	Setting error	Execute IBGNSTART PLAYBACK=ON instruction in a forward direction, after a robot arrives at the start step of the playback file in a backward direction, when IBGNSTART PLAYBACK=ON instruction was executed in a backward direction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	An error occurred when IBGNSTART PLAYBACK=ON instruction was executed in a backward direction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4730: CANNOT EXECUTE BRAKE SLIP DETECT

Brake slip detection could not be executed.

Sub Code	Meaning	Cause	Remedy
1	Brake slip detection was commanded to be executed while another optional function was in execution.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If another optional function was commanded to be executed, cannot execute brake slip detection. Correct the job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Brake slip detection could not be executed in the specified axis.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Holding torque data which is calculated by the brake slip detection is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Detection torque data which is calculated by the brake slip detection is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	The torque value for the brake slip detection device is not set.	Software operation error occurred	1. Reset the alarm. 2. Check the check torque value settings.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Holding torque data which is calculated by the brake slip detection exceeds the limit.	Software operation error occurred	1. Reset the alarm. 2. Check the check torque value settings.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4730: CANNOT EXECUTE BRAKE SLIP DETECT (continued)

Sub Code	Meaning	Cause	Remedy
7	The parameter of the pulse operation exceeds the limit.	Software operation error occurred	1. Reset the alarm. 2. Check the following settings. • Pulse operation (S1CxG940 to 949)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	The parameter of the error detection value parameter is incorrect.	Software operation error occurred	1. Reset the alarm. 2. Check the following settings. • Error detection value (S1CxG950 to 959)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4733: WRIST MOTION ERROR (SINGULAR POINT)

The wrist axis was about to enter singular area.

Sub Code	Meaning	Cause	Remedy
	An attempt was made to pass the B-axis zero degree position (singular area).	Setting error	Check the teaching position of the job so that the manipulator does not pass the B-axis zero degree position (singular area).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4734: FIGURE CONVERSION IMPOSSIBLE

Cannot convert to the specified figure.

Sub Code	Meaning	Cause	Remedy
	The setting of the form data for Flip/No Flip is not "B-axis Angle.	Setting error	Set "1" to "S2C658: Type data detail settings".
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4735: SENSOR-LESS LEARNING CTRL ERROR

An error occurred in learning control.

Sub Code	Meaning	Cause	Remedy
1	Learning control table setting error.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If another optional function was commanded to be executed, cannot execute brake slip detection. Correct the job.
2	Learning control table ID is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4735: SENSOR-LESS LEARNING CTRL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
3	Multiple task execution error	Setting error	The Learning control cannot execute the same time by multiple tasks. Correct the job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4736: USER GROUP IO ERROR

An error occurred in the user group I/O control processing.

Sub Code	Meaning	Cause	Remedy
1	Setting of "START" in the user group I/O setting file is 0.	Setting error	Set a value of 1-4096 at "START" in the user group I/O setting file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Setting of "LENGTH" in the user group I/O setting file is abnormal.	Setting error	Set a value of 1-32 at "LENGTH" in the user group I/O setting file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The number of I/O signals in the definition of the user group I/O is out of a range.	Setting error	Set "START" or "LENGTH" in the user group I/O setting file, so that the number of I/O signals in the definition of the user group I/O is within a range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	A number of the user group I/O is abnormal.	Setting error	Set a number of the user group I/O to 1-64 used in the JOB.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4737: MOTION RANGE LIMIT OVER

The manipulator exceeded its motion range limit.

Cause 1: When the instruction point is outside the motion range limit, this alarm occurs.

Cause 2: The special range of motion is the function from which the movement area expands with weight information setting of a tool file.

For the robot with the special range of motion, when the weight information on a tool file was changed to the setting the movement area reduces, after teaching the area which expanded, this alarm occurs.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	- Check the following settings. - Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is within the motion range. - Check the following setting for the robot with the special range of motion. - Check the weight information in the tool file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4738: DEST MOTION RANGE LIMIT OVER

The manipulator exceeded its motion range limit in the motion target position.

Cause 1: When the instruction point is outside the motion range limit, this alarm occurs.

Cause 2: The special range of motion is the function from which the movement area expands with weight information setting of a tool file.

For the robot with the special range of motion, when the weight information on a tool file was changed to the setting the movement area reduces, after teaching the area which expanded, this alarm occurs.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	- Check the following settings. - Check the position setting for the step (move instruction) where the alarm occurred. - Check the following setting for the robot with the special range of motion. - Check the weight information in the tool file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4739: USER ANALOG IO ERROR

An error occurred in the user analog I/O control processing.

Sub Code	Meaning	Cause	Remedy
1	Setting of "START" in the user analog I/O setting file is 0.	Setting error	Set a value of 1-4096 at "START" in the user analog I/O setting file.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4739: USER ANALOG IO ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2	The number of I/O signals in the definition of the user analog I/O is out of a range.	Setting error	Set "START" or "LENGTH" in the user analog I/O setting file, so that the number of I/O signals in the definition of the user analog I/O is within a range.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The number of the user analog I/O setting file is abnormal.	Setting error	Set the number of the user analog I/O setting file to 1-16 used in the JOB.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4740: M-SAF OVERRUN DETECT

Overrun signal is detected in the robot safety module.

Sub Code	Meaning	Cause	Remedy
	Overrun limit switch control group that is displayed in the sub code has tripped.	Overrun limit switch released	1. Reset the alarm. 2. If the alarm occurs again, overrun limit switch is released. Select "OVERRUN&SHOCK SENSOR" under sub menu "ROBOT" to reset the limit switch.
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Robot safety module -CN3 • Extension safety I/O unit (rotary switch : 1, 3) -CN2 • Check the connection and inserting state of the following manipulator cables (Between Manipulator and YNX1000) and connectors.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the control group on which the alarm occurred.
		Overrun limit switch failure	1. Reset the alarm. 2. If the alarm occurs again, replace the limit switch or an equivalent switch.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4741: M-SAF PPESP SIG. ERROR

Emergency stop signal of PP is unmatched.

Sub Code	Meaning	Cause	Remedy
	Emergency stop signal of programming pendant was unmatched longer than a certain time.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Robot safety module -CN5 - Replace the cable of the Programming Pendant.
		Programming pendant failure	- Reset the alarm. - If the alarm occurs again, replace the programming pendant.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Fuse failure	[Controller for painting use (Explosion-proof programming pendant spec)] - Reset the alarm. - If the alarm occurs again, replace the fuse (FU10, FU11) in the painting module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4742: M-SAF PBESP SIG. ERROR

Emergency stop signal of the panel box is unmatched.

Sub Code	Meaning	Cause	Remedy
	Emergency stop signal of the panel box was unmatched for a certain time.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Emergency stop switch - robot safety module -CN5 connector cable
		Hardware failure	- Reset the alarm. - If the alarm occurs again, replace the emergency stop switch of the panel box.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4743: M-SAF EXESP SIG. ERROR

External emergency stop signal is unmatched.

Sub Code	Meaning	Cause	Remedy
	External emergency stop signal was unmatched for a certain time.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - EXTERNAL EMERGENCY STOP switch - robot safety module -CN3 connector cable - Check connectors of the connected outside devices of EXTERNAL EMERGENCY STOP signal line.
		Hardware failure	- Reset the alarm. - If the alarm occurs again, replace the external emergency stop switch.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4744: M-SAF PP ENABLE SW SIG. ERROR

The enable switch signal of Programming Pendant is unmatched.

Sub Code	Meaning	Cause	Remedy
	The enable switch signal of Programming Pendant was unmatched for a certain time.	Programming pendant illegal operation	- Reset the alarm. - There are two contact points for an enable switch, and only one point may be turned on by how to squeeze it or when putting it on the place where it is not a plane such as on the knee etc. Check how to squeeze or put the programming pendant on flat.
		Programming pendant failure	- Reset the alarm. - If the alarm occurs again, replace the programming pendant.
		Connection failure	- Reset the alarm. - If the alarm occurs again, replace the programming pendant.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Fuse failure	[Controller for painting use (Explosion-proof programming pendant spec)] - Reset the alarm. - If the alarm occurs again, replace the fuse (FU14, FU15) in the painting module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4746: M-SAF SAFETY FENCE SIG. ERROR

Safety fence signal is unmatched.

Sub Code	Meaning	Cause	Remedy
	Safety fence signal is unmatched for a certain time.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - SAFETY FENCE switch - robot safety module -CN3 connector cable - Check connectors of the connected outside devices of SAFETY FENCE signal line.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4747: M-SAF OVERRUN SIG. ERROR

Overrun signal mismatch is detected by the robot safety module.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: 1:OT1 2:OT2 3:OT3 4:OT4	Overrun limit switch released	- Reset the alarm. - If the alarm occurs again, overrun limit switch is released. Select "OVERRUN&SHOCK SENSOR" under sub menu "ROBOT" to reset the limit switch.
		Connection failure	- Reset the alarm. - If the alarm occurs again, insert, and conduction state of the cable and connector of the control group to which the overrun limit switch has tripped.
		Overrun limit switch failure	- Reset the alarm. - If the alarm occurs again, replace the limit switch or an equivalent switch.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the OT signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4748: M-SAF ON_ENABLE SIG. ERROR

ON_ENABLE signal unmatched is detected by the robot safety module.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: 1:ON_ENABLE1 2:ON_ENABLE2 3:ON_ENABLE3 4:ON_ENABLE4	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - ON_ENABLE switch - robot safety module -CN3 connector cable - ON_ENABLE switch - extension safety I/O unit -CN2 connector cable
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the ON_ENABLE signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4750: M-SAF GENERAL INPUT SIG. ERROR

General input signal unmatched is detected by the robot safety module.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: 1:GSIN1 2:GSIN2	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Connected outside devices of GSIN signal line and robot safety module -CN4. - Check connectors of the connected outside devices of GSIN signal line.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the GSIN signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4751: M-SAF GENERAL INPUT SIG. ERROR2

Unmatch of general safety input signal of function safety is detected by extension safety I/O unit.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: D01:XIN01 D02:XIN02 D03:XIN03 D04:XIN04 D05:XIN05 D06:XIN06 D07:XIN07 D08:XIN08 D09:XIN09 D10:XIN10 D11:XIN11 D12:XIN12 D13:XIN13 D14:XIN14 D15:XIN15 D16:XIN16	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Connected outside devices of XIN signal line and extension safety I/O unit -CN2. - Check connectors of the connected outside devices of XIN signal line.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module.
		Extension safety I/O unit failure	- Reset the alarm. - If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4752: M-SAF PPESP DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of ESP signal of Programming Pendant.

Sub Code	Meaning	Cause	Remedy
	Sub code indicates the process that the software of CPU1 or CPU2 detected an error.	Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4753: M-SAF PBESP DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of ESP signal of Panel Box.

Sub Code	Meaning	Cause	Remedy
	Sub code indicates the process that the software of CPU1 or CPU2 detected an error.	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4754: M-SAF EXESP DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of external ESP signal.

Sub Code	Meaning	Cause	Remedy
	Sub code indicates the process that the software of CPU1 or CPU2 detected an error.	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4755: M-SAF PP ENABLE SW DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of ENABLE signal of Programming Pendant.

Sub Code	Meaning	Cause	Remedy
	Sub code indicates the process that the software of CPU1 or CPU2 detected an error.	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4757: M-SAF SAFETY GUARD DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of safety guard signal.

Sub Code	Meaning	Cause	Remedy
	Sub code indicates the process that the software of CPU1 or CPU2 detected an error.	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the robot safety module which is connected to the first robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4758: M-SAF OVERRUN DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of overrun signal.

Sub Code	Meaning	Cause	Remedy
	An error is detected by the robot safety module. The error is occurred in the signal that is inverted representation. CPU1 1:OT1 CPU1 2:OT2 CPU1 3:OT3 CPU1 4:OT4 CPU2 1:OT1 CPU2 2:OT2 CPU2 3:OT3 CPU2 4:OT4	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the overrun signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4759: M-SAF ON_ENABLE DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of ON_ENABLE signal.

Sub Code	Meaning	Cause	Remedy
	An error is detected by the robot safety module. The meaning of each sub code is as follows: CPU1 1:ON_ENABLE1 CPU1 2:ON_ENABLE2 CPU1 3:ON_ENABLE3 CPU1 4:ON_ENABLE4 CPU2 1:ON_ENABLE1 CPU2 2:ON_ENABLE2 CPU2 3:ON_ENABLE3 CPU2 4:ON_ENABLE4	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the ON_ENABLE signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4760: M-SAF FULL SPEED DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of full speed signal.

Sub Code	Meaning	Cause	Remedy
	Sub code indicates the process that the software of CPU1 or CPU2 detected an error.	Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the ON_ENABLE signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4761: M-SAF GENERAL INPUT DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of general safety input signal.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:GSIN1 CPU1 2:GSIN2 CPU2 1:GSIN1 CPU2 2:GSIN2	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Connected outside devices of GSIN signal line and robot safety module -CN4. - Check connectors of the connected outside devices of GSIN signal line. - Check that the connection destination of the duplicated signal is correct.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4762: M-SAF GENERAL INPUT DIAG. ERROR2

An error is detected by the robot safety module in self diagnosis process of function safety general safety input signal of extension safety I/O unit.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: D01:XIN01 D02:XIN02 D03:XIN03 D04:XIN04 D05:XIN05 D06:XIN06 D07:XIN07 D08:XIN08 D09:XIN09 D10:XIN10 D11:XIN11 D12:XIN12 D13:XIN13 D14:XIN14 D15:XIN15 D16:XIN16	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Connected outside devices of XIN signal line and extension safety I/O unit -CN2. - Check connectors of the connected outside devices of XIN signal line. - Check that the connection destination of the duplicated signal is correct.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module.
		Extension safety I/O unit failure	- Reset the alarm. - If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4764: M-SAF STO FB DIAG. ERROR

An feedback error of the output of STO signal is detected by the robot safety module in diagnosis process.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:EDM1 CPU1 2:EDM2 CPU1 3:EDM3 CPU1 4:EDM4 CPU2 1:EDM1 CPU2 2:EDM2 CPU2 3:EDM3 CPU2 4:EDM4	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Robot safety module -CN3 - Multi-axis servo amplifier -CN8 - Extension safety I/O unit (rotary switch : 1, 3) -CN2 - Single-axis servo amplifier -CN8
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board on which the alarm occurred.

4764: M-SAF STO FB DIAG. ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Extension safety I/O unit failure	- Reset the alarm. - If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4765: M-SAF BRAKE FB DIAG. ERROR

An feedback error of the output of brake signal is detected by the robot safety module in diagnosis process.

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Robot safety module -CN3 - Multi-axis servo amplifier (brake control board) -CN203 - Extension safety I/O unit (rotary switch : 1, 3) -CN2 - Single-axis brake control unit -CN22
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board on which the alarm occurred.
		Extension safety I/O unit failure	- Reset the alarm. - If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit, which is connected to the signal on which the alarm occurred.
		Brake control board failure	- Reset the alarm. - If the alarm occurs again, replace the multi-axis servo amplifier (brake control board) on which the alarm occurred. Save the CMOS.BIN before replacing the module to be safe.
		Single-axis brake control unit failure	- Reset the alarm. - If the alarm occurs again, replace the single-axis brake control unit on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4767: M-SAF GENERAL OUT FB DIAG. ERROR

An feedback error of general safety output signal is detected by the robot safety module in diagnosis process.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:GSEDM1 CPU1 2:GSEDM2 CPU2 1:GSEDM1 CPU2 2:GSEDM2	Setting error	This alarm can occur after the software update. If feedback signals of GSOUTs are not necessary in the system, change settings about 'GSOUT Feedback SETTING' in SAFETY LOGICAL CIRCUIT SETTING on maintenance mode.
		Setting error	If feedback signals of GSOUTs are necessary in the system, check safety logic circuits and signal status about GSOUTs and S_GSEDMs. According to the system requirements, change the settings of safety logic circuits.
		Connection failure	If feedback signals of GSOUTs are necessary in the system, check safety logic circuits and signal status about GSOUTs and S_GSEDMs. If the S_GSEDMs signal status isn't changed by GSOUTs, check the connections, cables, and connectors between GSOUTs and S_GSEDMs.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4768: M-SAF GENERAL OUT FB DIAG. ERROR2

An feedback error of function safety general safety output signal is detected by the robot safety module in diagnosis process.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: D01:XOUT01 D02:XOUT02 D03:XOUT03 D04:XOUT04 D05:XOUT05 D06:XOUT06 D07:XOUT07 D08:XOUT08 D09:XOUT09 D10:XOUT10 D11:XOUT11 D12:XOUT12 D13:XOUT13 D14:XOUT14 D15:XOUT15 D16:XOUT16	Setting error	This alarm can occur after the software update. If feedback signals of XOUTs are not necessary in the system, change settings about 'XOUT Feedback SETTING' in SAFETY LOGICAL CIRCUIT SETTING on maintenance mode.
		Setting error	If feedback signals of XOUTs are necessary in the system, check safety logic circuits and signal status about XOUTs and S_XEDMs. According to the system requirements, change the settings of safety logic circuits.
		Connection failure	If feedback signals of XOUTs are necessary in the system, check safety logic circuits and signal status about XOUTs and S_XEDMs. If the S_XEDMs signal status isn't changed by FSBOUs, check the connections, cables, and connectors between XOUTs and S_XEDMs.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module.
		Extension safety I/O unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4769: M-SAF BRAKE DIAG. ERROR

An error is detected by CPU1 on robot safety module in self diagnosis process of brake signal.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:SFRON1 CPU1 2:SFRON2 CPU1 3:SFRON3 CPU1 4:SFRON4 CPU2 1:SFRON1 CPU2 2:SFRON2 CPU2 3:SFRON3 CPU2 4:SFRON4	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Cable continuity between ASU03 unit and power supply contactor unit.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module.
		ASU03 unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the ASU03 unit. In a system where a plurality of ASU03 units are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Power supply contactor unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the power supply contactor unit. In a system where a plurality of power supply contactor units are connected, replace the unit, which is connected to the unit on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4770: M-SAF STO DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of STO signal.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:STO1 CPU1 2:STO2 CPU1 3:STO3 CPU1 4:STO4 CPU2 1:STO1 CPU2 2:STO2 CPU2 3:STO3 CPU2 4:STO4	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4771: M-SAF GENERAL OUTPUT DIAG. ERROR

An error is detected by the robot safety module in self diagnosis process of general safety output signal.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:GSOUT1 CPU1 2:GSOUT2 CPU2 1:GSOUT1 CPU2 2:GSOUT2	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Robot safety module -CN4
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4772: M-SAF GENERAL OUTPUT DIAG. ERROR2

An error is detected by Extension safety I/O unit in self diagnosis process of function safety general safety output signal.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: D01:XOUT01 D02:XOUT02 D03:XOUT03 D04:XOUT04 D05:XOUT05 D06:XOUT06 D07:XOUT07 D08:XOUT08 D09:XOUT09 D10:XOUT10 D11:XOUT11 D12:XOUT12 D13:XOUT13 D14:XOUT14 D15:XOUT15 D16:XOUT16	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Extension safety I/O unit -CN1
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.

4772: M-SAF GENERAL OUTPUT DIAG. ERROR2 (continued)

Sub Code	Meaning	Cause	Remedy
		Extension safety I/O unit failure	- Reset the alarm. - If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4776: M-SAF YSF LOGIC FILE SIGNAL ERR

The undefined signal was detected in the safety logical circuit function.

Sub Code	Meaning	Cause	Remedy
	Sub-code indicates the circuit number that detected the error.	Setting error	Display the screen of the "safety function" - "safety logical circuit", and check the value of a "signal", "logic", and a "timer." When a value is inaccurate, set up the right value and perform "writing."
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4779: PointPLC CONTROL ERROR

An error occurred in PointPLC.

Sub Code	Meaning	Cause	Remedy
1	When P-PLC instruction was executed, there was not PLCSTPON instruction or PLCSTPOF instruction.	Setting error	- Reset the alarm. - Check whether PLCSTPON instruction and PLCSTPOF instruction is registered. When unregistered, register PLCSTPON instruction and PLCSTPOF instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	PLCSTPON instruction or PLCSTPOF instruction is duplicated in the PointPLC program.	Setting error	- Reset the alarm. - delete duplicate PLCSTPON instruction or PLCSTPOF instruction
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	An attempt was made to execute an instruction that could not be executed in the PointPLC program.	Setting error	- Reset the alarm. - delete the instruction which cannot be executed in the PointPLC program.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4779: PointPLC CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
4	PointPLC Program could not be executed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	PointPLC Program could not be executed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	PointPLC Program execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	PointPLC Program execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	PointPLC Program execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	PointPLC function is invalid.	Setting error	Enable PointPLC function.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4780: F-SAFE AXIS RANGE LIMIT INTF

Each axis is trying to move outside the limits.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group and axis in which the alarm occurred.	Setting error	Check the following settings. • Check the axis range limit condition file that is indicated in the sub code is set correctly. • Modify the teaching so as not to interfere limit range setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4781: AXIS RANGE LIMIT INTF

Each axis is trying to move outside the limits. (detected in robot control module)

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group and axis in which the alarm occurred.	Setting error	Check the following settings. • Check the axis range limit condition file that is indicated in the sub code is set correctly. • Modify the teaching so as not to interfere limit range setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4782: F-SAFE AXIS SPEED MONITOR ERROR

Each axis has moved beyond the limit speed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group, axis and error type in which the alarm occurred.	Setting error	Check the following settings. - Check the axis speed monitor condition file that is indicated in the sub code is set correctly. - Modify the teaching so as not to over with limit speed setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4783: F-SAFE ROBOT RANGE LIMIT INTF

Robot tried to interfere with the limited area.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group and axis in which the alarm occurred.	Setting error	Check the following settings. - Check robot range limit condition file that is indicated in the sub code is set correctly. - Modify the teaching so as not to interfere limit area setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4784: ROBOT RANGE LIMIT INTF

Robot tried to interfere with the limited area. (detected in robot control module)

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group and axis in which the alarm occurred.	Setting error	Check the following settings. - Check the robot range limit condition file that is indicated in the sub code is set correctly. - Modify the teaching so as not to interfere limit area setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4785: F-SAFE SPEED LIMIT ERROR

Robot has moved beyond the limit speed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group and error type in which the alarm occurred.	Setting error	Check the speed limit condition file that is indicated in the sub code is set correctly.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4786: F-SAFE TEACH SAFETY SPEED ERROR

Robot has moved beyond the teach mode safety speed (250mm/sec).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the control group and error type in which the alarm occurred.	Setting error	Check the speed limit condition file that is indicated in the sub code is set correctly.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4787: F-SAFE ROBOT STOP MONITOR ERROR

Robot has moved, when the robot stop monitor is enabled.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number and control group in which the alarm occurred.	Setting error	Check the speed limit condition file that is indicated in the sub code is set correctly.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4788: F-SAFE STATION STOP MONITOR ERR

Station axis has moved, when the station stop monitor is enabled.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group and axis in which the alarm occurred.	Setting error	Check the speed limit condition file that is indicated in the sub code is set correctly.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4789: F-SAFE TOOL CHANGE MONITOR ERR

Selection tool file number is anomaly.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group and error type in which the alarm occurred. Error type means: 1:All tool change monitoring condition files is invalid. 2:It detects a mismatch of monitoring tool number and the selection tool file number. 3:Multiple tool change monitoring condition files is enabled. 4:Monitoring tool model(tool interference file) is not set.	Setting error	Check the following settings. • Check the tool change monitor condition file that is indicated in the sub code is set correctly. • Check whether only one tool change monitor condition file enable. • Coincide the tool file number chosen as the robot of the control group displayed in subcode, and a tool change monitor condition file. • Check that the tool model(tool interference file) is set correctly.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4790: F-SAFE TOOL ANGL MONITOR ERR

Selection tool angle is anomaly.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number and control group in which the alarm occurred.	Setting error	Check the following settings. • Check the tool angle monitor condition file that is indicated in the sub code is set correctly. • Modify the teaching so as not to over limit angle setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4791: F-SAFE AXIS STOP MONITOR ERROR

Each axis has moved, when the axis stop monitor is enabled.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number, control group and axis in which the alarm occurred.	Setting error	Check the following settings. • Check the axis speed monitor condition file that is indicated in the sub code is set correctly. • Modify the teaching so as not to over with limit speed setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4792: TOOL ANGL MONITOR ERR

Selection tool angle is anomaly. (detected in robot control module)

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file number and control group in which the alarm occurred.	Setting error	Check the following settings. • Check the tool angle monitor condition file that is indicated in the sub code is set correctly. • Modify the teaching so as not to over limit angle setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4793: F-SAFE SIGNAL SET ERR(GENERAL)

There is a problem with the configuration data of the general safety signal of safety monitoring conditions file.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Code [X _ _ _] indicates the abnormal content. 1000:Input/output signal number in condition file is abnormal. 2000:General safety input signal that is not available is set in condition file. 3000:General safety output signal that is not available is set in condition file. 4000:Safety fieldbus input signal that is not available is set in condition file. 5000:Safety fieldbus output signal that is not available is set in condition file. 6000:File valid condition data is abnormal. Code [_ Y _ _] indicates the type of condition file abnormality occurs. 100:Axis range limit function 200:Axis speed monitor function 300:Speed limit function 400:Robot range limit function 500:Tool angle monitor function 600:Tool change monitor function Code [_ _ Z Z] indicates the number of condition file abnormality occurs.	Data error	1. Check the configuration of condition file abnormality occurs. 2. Reset the alarm, and then try again.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4794: F-SAFE MONITOR EXECUTE TIME OVER

Execution time of the safety monitoring process has exceeded the specified value.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Reset the alarm. 2. If the alarm occurs again, reduce the number of robot range limit condition files validated at the same time.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4795: F-SAFE CANNOT OPERATE TEMP DSBL

Cannot change to play mode, when function disable mode is ON temporarily.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Change to teach mode. 2. Reset the alarm, and then try again.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4796: F-SAFE DATA CRC UNMATCH

The communication data error occurred between the robot safety module and the robot safety module.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the file kind in which the alarm occurred.	Data error	1. Reset the alarm, and then try again. 2. Check whether the data which it is going to load is surely saved as data of functional safety.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4797: F-SAFE RANGE COMBINATION ERR

The robot safety module has detected a range combine function.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	Reset the alarm, and then try again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4798: F-SAFE SIGNAL SET ERR(SFB)

There is a problem with the configuration data of the safety fieldbus signal of safety monitoring conditions file.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Code [X _ _ _] indicates the abnormal content. 1000:Input/output signal number in condition file is abnormal. 4000:Safety fieldbus input signal that is not available is set in condition file. 5000:Safety fieldbus output signal that is not available is set in condition file. 6000:File valid condition data is abnormal. Code [_ Y _ _] indicates the type of condition file abnormality occurs. 100:Axis range limit function 200:Axis speed monitor function 300:Speed limit function 400:Robot range limit function 500:Tool angle monitor function 600:Tool change monitor function Code [_ _ Z Z] indicates the number of condition file abnormality occurs.	Data error	1. Check the configuration of condition file abnormality occurs. 2. Reset the alarm, and then try again.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4799: F-SAFE SIGNAL SET ERR(LOGIC)

There is a problem with the configuration data of the safety logical circuit signal of safety monitoring conditions file.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Code [X _ _ _] indicates the abnormal content. 1000:Input/output signal number in condition file is abnormal. 4000:Safety logical circuit input signal that is not available is set in condition file. 5000:Safety logical circuit output signal that is not available is set in condition file. 6000:File valid condition data is abnormal. Code [_ Y _ _] indicates the type of condition file abnormality occurs. 100:Axis range limit function 200:Axis speed monitor function 300:Speed limit function 400:Robot range limit function 500:Tool angle monitor function 600:Tool change monitor function Code [_ _ Z Z] indicates the number of condition file abnormality occurs.	Data error	1. Check the configuration of condition file abnormality occurs. 2. Reset the alarm, and then try again.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4810: LINEAE SERVOFLOAT CONCURRENT EXECUTION ERROR

Lineare servo float functions were executed in concurrent.

Sub Code	Meaning	Cause	Remedy
		Software setting failure	1. Reset the alarm. 2. Check settings of a job. The lineare servo float function cannot execute concurrently in multiple robots.

◆ 4811: LINEAE SERVOFLOAT PASSING A SINGULARITY POINT

A Robot passed a singularity point while lineare servo float was running concurrently.

Sub Code	Meaning	Cause	Remedy
		Software setting failure	1. Reset the alarm. 2. Check settings of a job. The lineare servo float function cannot pass in singularity points.

◆ 4822: HARD WIRE BASE BLOCK ERROR

An feedback error of the output of STO signal is detected by Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Robot safety module -CN3 - Multi-axis servo amplifier -CN8 - Extension safety I/O unit (rotary switch : 1, 3) -CN2 - Single-axis servo amplifier -CN8
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Extension safety I/O unit failure	- Reset the alarm. - If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit, which is connected to the signal on which the alarm occurred.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifier on which the alarm occurred. Save the CMOS.BIN before replacing the board to be safe.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4823: HARD WIRE BASE ENABLE ERROR

An feedback error of the output of STO signal is detected by Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Robot safety module -CN3 - Multi-axis servo amplifier -CN8 - Extension safety I/O unit (rotary switch : 1, 3) -CN2 - Single-axis servo amplifier -CN8
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifier on which the alarm occurred. Save the CMOS.BIN before replacing the board to be safe.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Extension safety I/O unit failure	- Reset the alarm. - If the alarm occurs again, replace the extension safety I/O unit. In a system where a plurality of extension safety I/O units are connected, replace the unit, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4828: M-SAF READBACK PROC. ERROR

A readback processing error was detected by the robot safety module.

Sub Code	Meaning	Cause	Remedy
1	Parameter readback request error	Data error	- Reset the alarm. - Try the write operation again.
		Robot safety module failure	- Reset the alarm, and then try again. - If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Configuration file verification error	Data error	- Reset the alarm. - Try the write operation again.

4828: M-SAF READBACK PROC. ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	File number error	Data error	1. Reset the alarm. 2. Try the write operation again.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	File type error	Data error	1. Reset the alarm. 2. Try the write operation again.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Key code error	Data error	1. Reset the alarm. 2. Try the write operation again.
		Robot safety module failure	1. Reset the alarm, and then try again. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4849: SERVO ON EXECUTION INCOMPLETE

In the Servo ON process, the servo amplifier does not enter the "SV_ON" state even after a certain period of time has elapsed since the SVON command was sent to the servo amplifier.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.

4849: SERVO ON EXECUTION INCOMPLETE (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4878: SPEED CONTROL EXECUTE ERROR(SERVO)

Speed control could not be executed in the specified axis.

Sub Code	Meaning	Cause	Remedy
		Setting error	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4880: EXCESSIVE FORCE DETECTION

Force control system detected the excessive external force.

Sub Code	Meaning	Cause	Remedy
		Setting error	- Reset the alarm, and then check the direction of the external force looking at subcode(the direction is based on the sensor coordinate system),and operate robot to move in the direction releasing external force. - If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 4881: EXCESSIVE VELOCITY CORRECTION

Force control system detected the excessive axis angular velocity correction.

Sub Code	Meaning	Cause	Remedy
		Setting error	- Reset the alarm, and then make the reference force smaller or operate robot to move in the direction releasing external force. - If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 4882: SINGULAR POINT ERROR

Force control system detected the singular posture.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Reset the alarm, and then modify the toughed robot posture avoiding singularity points. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 4883: SENSOR OVER RANGE

Sensor output exceeded the range.

Sub Code	Meaning	Cause	Remedy
	Sub Code: channel	Setting error	1. Reset the alarm and decrease the motion speed in JOB. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode and contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4884: FORCE CONTROL NOT PERMITTED

YASKAWA force control function is unavailable.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Reset the alarm, and purchase the YASKAWA force control function. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 4885: SENSOR OUTPUT ERROR

Sensor output remains unchanged.

Sub Code	Meaning	Cause	Remedy
	Sub Code: channel	Sensor error	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode and contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4886: FORCE CONTROL FILE ERROR

The robot of instruction does not match the robot of force control file.

Sub Code	Meaning	Cause	Remedy
1	The specified force control file is for other manipulator.	Setting error	Reset the alarm and check the force control file. The robot of instruction does not match the robot of force control file. Change the file number or the settings of force control file.
		Other	If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4887: FORCE CONTROL CONDITION ERROR

Setting error in executing force control occur.

Sub Code	Meaning	Cause	Remedy
	Sub Code: wrong condition D0:tool number error D1:coordinate type error D2:singularity area error D3:inertia coefficient error D4:viscosity coefficient error D5:stiffness coefficient error D6:position limit error D7:velocity limit error D8:angular velocity limit error D9:angular velocity alarm error D10:contact stabilizing parameter error	Setting error	1. Reset the alarm, and then modify the parameter in the referred motoplus application program. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 4888: FORCE SENSOR OUTPUT ERROR

Force sensor continually outputs maximum or minimum values.

Sub Code	Meaning	Cause	Remedy
	Force sensor output error	sensor(error)	1. Reset the alarm, and then release external forces applied to force sensor if the forces are excessive. 2. If the alarm occurs again, force sensor is faulty. Contact your Yaskawa representative.

◆ 4889: FORCE COMMAND VALUE SET ERROR

Force command value for invalid axis direction is set.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	software(setting error)	Reset the alarm, and then check the relationship between the set force command value and the valid axial direction.

◆ 4890: SCALE SETTING ERROR

Argument error in function mpFcsConvForceScale()

Sub Code	Meaning	Cause	Remedy
	Argument error occurs in mpFcsForceConvScale(). Sub Code:erroneous argument value	software(setting error)	Reset the alarm, and then check the argument value related to scale.

◆ 4897: FORCE CONTROL INTERNAL ERROR

An error has occurred in MotoFit function.

Sub Code	Meaning	Cause	Remedy
32	Force control parameter error	Setting error	Reset the alarm and check the tags of the instruction.
		Other	If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure).
64	Excessive force detected	Setting error	- Reset the alarm and check the force sensor. Too large force has detected in force sensor. - If the alarm occurs again, save the CMOS.BIN in maintenance mode and contact your YASKAWA representative about occurrence status (operating procedure).
128	Overspeed	Setting error	Reset the alarm and decrease the motion speed in JOB.
		Other	If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure).
256	Singular point error	Setting error	Reset the alarm and check the posture of the robot. Change the JOB to avoid the singular point.
		Other	If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure).
512	Board / cable error	Sensor / Cable error	- Check the force sensor, the sensor board, and the cable of force sensor. - If the alarm occurs again, check the connection of sensor board to the controller. - If the alarm occurs again, save the CMOS.BIN in maintenance mode and contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4898: EXCESSIVE SEGMENT (SV)

Force control system detected the overspeed.

Sub Code	Meaning	Cause	Remedy
		Setting error	- Reset the alarm, and then ease the velocity or check whether the posture is singular . - If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 4899: EXCESSIVE SEGMENT(SAFETY 1) (SV)

Force control system detected the overspeed.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Reset the alarm, and then ease the velocity or check whether the posture is singular . 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 4900: EXCESSIVE SEGMENT(SAFETY 2) (SV)

Force control system detected the overspeed.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Reset the alarm, and then ease the velocity or check whether the posture is singular . 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 4901: CUBE/AXIS INTERFERENCE

The manipulator moved in the specified cubic area, or exceeded the maximum value or minimum value of the axis interference.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Group, axis, and interference area number	Setting error	Check the following settings. • Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is out of interference area. • Change the settings for interference area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4902: CUBE INTERFERENCE(TCP)

The TCP of the manipulator has entered the cube interference area that was specified.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Group and interference area number	Setting error	Check the following settings. • Change the step position where the alarm occurred to the area outside the interference area. • Modify the interference area setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4903: CUBE INTERFERENCE(ENTIRE)

A part of the manipulator has entered the cube interference area that was specified.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Group, axis, and interference area number	Setting error	Check the following settings. • Perform the teaching again to correct positions for manipulators so that the step where the alarm occurred is out of interference area. • Change the settings for interference area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4904: CUBE INTERFERENCE AREA SET ERR

Cube interference area setting is abnormal.

Sub Code	Meaning	Cause	Remedy
0	Maximum number of the cube interference area exceeds the allowable range.	Setting error	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The number of cube interference area whose monitoring part is "whole" exceeds the limit.	Setting error	Reduce the number of cube interference area whose monitoring part is "whole" .
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Detects the cube whose interference area are extremely big or small.	Setting error	1. Among the cube interference areas already values are entered, modify as follows. • Change the extremely big values to smaller ones. • Change the extremely small values to bigger ones. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Detects the cube interference area whose monitoring part is set to "whole" despite the invalid status of cube arm interference check function.	Setting error	1. Reset the alarm. 2. If the alarm occurs just after loading the cube interference area setting function, execute the following measures. a. Among the cube interference areas to be loaded, change the monitoring part setting from "whole" to "control point". b. Load the modified cube interference area. c. Confirm the settings if the alarm occurs again after the loading operation. 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4905: INSTRUCTION ERROR 1

SKCHK mode is not released normally.

Sub Code	Meaning	Cause	Remedy
1	Sub code: SKCHK mode release error	Software operation error occurred	1. Reset the alarm and decrease the motion speed in JOB. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode and contact your YASKAWA representative about occurrence status (operating procedure).
2	Sub code: Robot number error	Setting error	1. Reset the alarm and change the robot number. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode and contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4908: SPEED CONTROL ERROR

An error occurred at speed control execution.

Sub Code	Meaning	Cause	Remedy
1	Control group designation error.	Setting error	1. Reset the alarm. 2. Check the settings for the specified control group number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Speed control axis designation error.	Setting error	1. Reset the alarm. 2. Check the settings for the specified speed control axis number.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Maximum rotation speed over.	Setting error	1. Reset the alarm. 2. Set the rotation speed that does not exceed the maximum rotation speed.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4909: TEST RUN(HIGH ACCURACY) ERROR

The function which is not allowed in TEST RUN(HIGH ACCURACY) was performed.

Sub Code	Meaning	Cause	Remedy
		Operation mistake	Select a sub menu [TEACHING CONDITION SETTING] under main menu [SETUP]. Set "TEST RUN CONTROL " to "NORMAL" . Set S2C896=0.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4910: SAFETY FIELDBUS DATA ERROR

Communication data with the safety PLC is abnormal.

Sub Code	Meaning	Cause	Remedy
1	The output signal to the safety PLC does not match between CPU1 and CPU2.	Software operation error occurred	1. Reset the alarm. 2. If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	In the output signal to the safety PLC, CPU1 could not confirm the update of CPU2 within the specified time.	Software operation error occurred	1. Reset the alarm. 2. If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	In the output signal to the safety PLC, CPU2 could not confirm the update of CPU1 within the specified time.	Software operation error occurred	1. Reset the alarm. 2. If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4911: SAFETY FIELDBUS NOT ESTABLISHED

Communication with the safety PLC was not established to the default time.

Sub Code	Meaning	Cause	Remedy
1	PROFIsafe communication was not established to the default time, or communication was disconnected after establishment.	Setting error	1. Reset the alarm. 2. If the alarm occurs again, check the following. - Check that the F_CRC_Length set on the CP1616 board in maintenance mode matches the F_CRC_Length value set on the application software (TIA Portal, etc.). - Check that the safety IO size set on the CP1616 board in maintenance mode matches the value of the safety IO size set in the application software (TIA Portal, etc.).
		Setting error	When using the virtual communication function, check the following on the CP1616 setting screen in maintenance mode. - The setting item of "CP1616" is "USED". - The setting item of "IO device" is "ENABLE". - The setting item of "PROFIsafe VIRTUAL COMM." is "VIRTUAL".

4911: SAFETY FIELDBUS NOT ESTABLISHED (continued)

Sub Code	Meaning	Cause	Remedy
		Setting error	- Reset the alarm. - If the alarm occurs again, check the following. - SF(Group Fault) LED, BF(Bus Fault) LED of CP1616 board is lit or blinking. - SF(Group Fault) LED, BF(Bus Fault) LED of safety PLC board is lit or blinking. - If the above problems, there is a possibility that the connection settings of the safety PLC or CP1616 is not successful. Reset according to the manual.
		Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection or insertion state of cables connected to the CP1616 board and safety PLC.
		CP1616 board failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the CP1616 board.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	CIP Safety communication was not established to the default time.(sub code is not defined)	Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the following. - For EtherNet/IP Safety, check the connection or insertion state of cables connected to the "CN5 connector of robot control module" and safety PLC. - For of DeviceNet Safety, check the connection or insertion state of cables connected to the SST-DN4-PCIE board and safety PLC.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	CIP Safety communication was not established to the default time.(CIP Safety stack is under the Self-diagnosis)	Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.

4911: SAFETY FIELDBUS NOT ESTABLISHED (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the following. - For EtherNet/IP Safety, check the connection or insertion state of cables connected to the "CN5 connector of robot control module" and safety PLC. - For DeviceNet Safety, check the connection or insertion state of cables connected to the SST-DN4-PCIE board and safety PLC.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	CIP Safety communication was not established to the default time.(Waiting for communication establish)	Software configuration error occurred	- Reset the alarm. - If the alarm occurs again, the connection setup of EtherNet/IP (CPU board) or safety PLC may not be performed normally. Reset according to a manual.
		Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the following. - For EtherNet/IP Safety, check the connection or insertion state of cables connected to the "CN5 connector of robot control module" and safety PLC. - For of DeviceNet Safety, check the connection or insertion state of cables connected to the SST-DN4-PCIE board and safety PLC.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	CIP Safety communication was not established to the default time.(Exception generating under CIP Safety stack self-diagnosis)	Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the following. - For EtherNet/IP Safety, check the connection or insertion state of cables connected to the "CN5 connector of robot control module" and safety PLC. - For DeviceNet Safety, check the connection or insertion state of cables connected to the SST-DN4-PCIE board and safety PLC.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.

4911: SAFETY FIELD BUS NOT ESTABLISHED (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	CIP Safety communication was not established to the default time.(Abort of CIP Safety stack processing)	Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the following. - For EtherNet/IP Safety, check the connection or insertion state of cables connected to the "CN5 connector of robot control module" and safety PLC. - For DeviceNet Safety, check the connection or insertion state of cables connected to the SST-DN4-PCIE board and safety PLC.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	CIP Safety communication was not established to the default time.(Waiting for TUNID configuration)	Software configuration error occurred	- Reset the alarm. - If the alarm occurs again, carry out the following according to a manual. - For EtherNet/IP Safety, set up TUNID (combination data of an IP address and Safety Network Number) using RSNetWorx for EtherNet/IP (setting tool by Rockwell). - For DeviceNet Safety, set up TUNID (combination data of a MAC ID and Safety Network Number) using RSLogix5000 (setting tool by Rockwell).
		Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the following. - For EtherNet/IP Safety, check the connection or insertion state of cables connected to the "CN5 connector of robot control module" and safety PLC. - For DeviceNet Safety, check the connection or insertion state of cables connected to the SST-DN4-PCIE board and safety PLC.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4912: SAFETY FIELDBUS COMM ERROR

An error occurred during communication with the safety PLC.

Sub Code	Meaning	Cause	Remedy
1	Value of F_Dest_Add do not match.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_Dest_Add that is set to the safety PLC and the CP1616 board are the same.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Value of F_Dest_Add is out of range.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_Dest_Add that is set to the safety PLC and the CP1616 board is in the range of 1-65534.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Value of F_Src_Add is out of range.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_Src_Add that is set to the safety PLC is in the range of 1-65534.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Value of F_WD_Time is 0.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_WD_Time that is set to the safety PLC is 1 or more.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Value of F_SIL is invalid.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_SIL that is set to the safety PLC is SIL3.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.

4912: SAFETY FIELD BUS COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Value of F_Par_Version is invalid.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_Par_Version that is set to the safety PLC is 1(V2-mode).
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Value of F_Par_CRC do not match.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_Par_CRC that is set to the safety PLC is within the range of 0 to 65535.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Setting the value of the F-Parameter is invalid.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_CRC_Seed that is set to the safety PLC is CRC-Seed24/32 (CRC-FP+/MNR) and the value of F_Passivation is Device/Module (no support). - The value of F_CRC_Length that is set to the safety PLC is 4-Byte-CRC and the value of F_Par_Version is 1 (V2-mode).
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Value of F_Src_Add do not match.	Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	Value of F_iPar_CRC is invalid.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_iPar_CRC that is set to the safety PLC is 1.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.

4912: SAFETY FIELD BUS COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	Value of F_CRC_Length is invalid.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_CRC_Length that is set to the safety PLC is 4-Byte-CRC, the value of F_Par_Version is 1 (V2-mode), and the value of F_CRC_Seed value is CRC-Seed24/32(CRC-FP+/MNR)
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	Value of F_Block_ID is invalid.	Setting error	- Reset the alarm. - If the alarm occurs again, check the following F-Parameter settings. - The value of F_Block_ID that is set to the safety PLC is 1(Can be set) and the value of F_Passivation is 1(V2-mode).
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	F-Parameter check processing was performed during the transfer of safety I/O signals to and from the safety PLC.	Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	PROFIsafe config processing was performed during the transfer of safety I/O signals with the safety PLC, or during initialization processing.	Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	Processing of safety field bus does not start.	Software operation error occurred	- Reset the alarm. - If the alarm occurs again, turn the power OFF then back ON.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4912: SAFETY FIELDBUS COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
30	Communication error of safety field bus occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection or insertion state of cables connected to the CP1616 board and safety PLC.
		Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	Watchdog time error of safety field bus occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection or insertion state of cables connected to the CP1616 board and safety PLC.
		Operation mistake	- Reset the alarm. - If the alarm occurs again, check the following. - Safety I/O signals are not used in the standard ladder program of the safety PLC. - The safety I/O signal ON/OFF status must not be changed from outside the safety PLC safety ladder program.
		Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32	Passivated state.	Software operation error occurred	- Reset the alarm. - If the alarm occurs again, it is necessary to release the passivated state. Operate the safety program with the setting tool (TIA Portal) made by SIEMENS and perform the reintegration operation. Alternatively, if the signal for forcibly performing passivation in the safety program is ON, turn it OFF.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4912: SAFETY FIELD BUS COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
20000	A communication error(CH1) occurred at connection with the CIP safety. A subcode shows the internal status of a CIP Safety stack.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the following. - For EtherNet/IP Safety, check the connection or insertion state of cables connected to the "CN5 connector of robot control module" and safety PLC. - For DeviceNet Safety, check the connection or insertion state of cables connected to the SST-DN4-PCIE board and safety PLC.
		Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30000	A communication error(CH2) occurred at connection with the CIP safety. A subcode shows the internal status of a CIP Safety stack.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the following. - For EtherNet/IP Safety, check the connection or insertion state of cables connected to the "CN5 connector of robot control module" and safety PLC. - For DeviceNet Safety, check the connection or insertion state of cables connected to the SST-DN4-PCIE board and safety PLC.
		Software operation error occurred	- Reset the alarm. - If the alarm occurs again, re-power on the safety PLC and the robot controller.
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4913: SUB SEQUENCE TASK CONTR ERROR

An error occurred in job execution process of P-PLC program.

Sub Code	Meaning	Cause	Remedy
1	Unused A_BANK does not exist in the prereading processing of move instruction.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Unused bank priority does not exist in the prereading processing of move instruction.	Software operation error occurred	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4913: SUB SEQUENCE TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
5	A_BANK pointer is not set.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	A_BANK conversion could not be performed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The specified A_BANK number does not exist.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	An error occurred when system number (MSS) was obtained.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	An error occurred in RMS960 system call.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	Undefined interrupt command was received.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	Job start condition is not defined.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	An error occurred in instruction prefetch queue operation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	Intermediate code is not defined.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
29	Instruction prereading processing has not been completed normally.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	An error occurred in job data change.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	The specified sequence number at job execution start is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4913: SUB SEQUENCE TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
32	The added area for interruption command is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
33	System number (MSS) for interruption command is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
38	An error occurred at start of twin synchronous operation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
39	An error occurred when SYNC specification was reset.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
41	An error occurred in occupation control group setting in MOTION section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
45	An error occurred in path/trace control.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
47	An error occurred when waiting for a completion of main system task (job) in SYNC specification.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
48	An attempt was made to execute an instruction that could not be executed at line sequence execution.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
49	An error occurred while obtaining the instruction information.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
80	An exceptional error occurred in job execution process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	Main processing command is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
101	Subprocessing command is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4913: SUB SEQUENCE TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
102	Prereading processing has not been completed at job execution.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
103	A_BANK conversion has not been completed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
104	System number (MSS) is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	An error occurred in instruction prefetch queue operation in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
106	An error occurred at IES switching in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
108	An error occurred in prereading operation process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
200	The specified sequence number is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
201	An attempt was made to execute an instruction that could not be executed in P-PLC program.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4914: SUB SEQUENCE(H) TASK CONTR ERROR

An error occurred in job execution process of PSTRIG instruction.

Sub Code	Meaning	Cause	Remedy
1	Unused A_BANK does not exist in the prereading processing of move instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Unused bank priority does not exist in the prereading processing of move instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	A_BANK pointer is not set.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4914: SUB SEQUENCE(H) TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
6	A_BANK conversion could not be performed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The specified A_BANK number does not exist.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
20	An error occurred when system number (MSS) was obtained.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
21	An error occurred in RMS960 system call.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
22	Undefined interrupt command was received.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
23	Job start condition is not defined.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
24	An error occurred in instruction prefetch queue operation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
26	Intermediate code is not defined.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
29	Instruction prereading processing has not been completed normally.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
30	An error occurred in job data change.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
31	The specified sequence number at job execution start is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
32	The added area for interruption command is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4914: SUB SEQUENCE(H) TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
33	System number (MSS) for interruption command is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
38	An error occurred at start of twin synchronous operation.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
39	An error occurred when SYNC specification was reset.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
41	An error occurred in occupation control group setting in MOTION section.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
45	An error occurred in path/trace control.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
47	An error occurred when waiting for a completion of main system task (job) in SYNC specification.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
48	An attempt was made to execute an instruction that could not be executed at line sequence execution.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
49	An error occurred while obtaining the instruction information.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
80	An exceptional error occurred in job execution process.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	Main processing command is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
101	Subprocessing command is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
102	Prereading processing has not been completed at job execution.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4914: SUB SEQUENCE(H) TASK CONTR ERROR (continued)

Sub Code	Meaning	Cause	Remedy
103	A_BANK conversion has not been completed.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
104	System number (MSS) is incorrect in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
105	An error occurred in instruction prefetch queue operation in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
106	An error occurred at IES switching in prereading processing.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
210	An attempt was made to execute an instruction that could not be executed in sub sequence(H) task	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4915: PathSwitch CONTROL ERROR

An error occurred at PSTRIG instruction execution.

Sub Code	Meaning	Cause	Remedy
1	When PSTRIG instruction was executed, there was not PLCSTPON instruction or PLCSTPOF instruction.	Setting error	1. Reset the alarm. 2. Check whether PLCSTPON instruction and PLCSTPOF instruction is registered. When unregistered, register PLCSTPON instruction and PLCSTPOF instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	When PSTRIG instruction was executed, P-PLC instruction had not been executed.	Setting error	1. Reset the alarm. 2. Check whether P-PLC instruction is registered. When unregistered, register P-PLC instruction. 3. When PSTRIG instruction is executed, check P-PLC instruction is whether it has been executed. If it is not running, run PSTRIG instruction after P-PLC instruction execution.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The number of PSTRIG instruction exceeds the limit in the PointPLC program.	Setting error	1. Reset the alarm. 2. Reduce the number that can be set PSTRIG instruction.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4915: PathSwitch CONTROL ERROR (continued)

Sub Code	Meaning	Cause	Remedy
4	Delay control was not completed.	Setting error	1. Reset the alarm. 2. Change the teaching to be able to delay control.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	PSTRIG instruction execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	PSTRIG instruction execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm is complicated, check the contents and take a measure.
7	PSTRIG instruction execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	PSTRIG instruction execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	PSTRIG instruction execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm is complicated, check the contents and take a measure.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	PSTRIG instruction execution result is err.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
15	The new PSTRIG was performed during PSTRIG execution.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4916: WRONG JOB EXEC OF DETACHED AXIS

The axes detachment has been set to the job control group axis to be operated.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Check the following settings. • [OPTION FUNCTION] - [AXES DETACHMENT] settings in maintenance mode, Cancel the detachment axis setting of the job control group.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4917: WRONG JOB EXEC OF DETACHED AXIS

The axes detachment has been set to the job control group axis to be operated.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Check the following settings. • [OPTION FUNCTION] - [AXES DETACHMENT] settings in maintenance mode, Cancel the detachment axis setting of the job control group.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4918: PROFINET SETTING ERROR

An error occurred in the start process of the CP1616 board.

Sub Code	Meaning	Cause	Remedy
16	Device name or IP address has not been set to CP1616 board connected with 1st PCI connector.	Setting error	1. Reset the alarm. 2. If the alarm occurs again, carry out the following according to a manual. • Set the device name and IP address to CP1616 board by using TIA Portal (setting tool by SIEMENS). • Download the project file.
		CP1616 board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the CP1616 board.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	Device name or IP address has not been set to CP1616 board connected with 2nd PCI connector.	Setting error	1. Reset the alarm. 2. If the alarm occurs again, carry out the following according to a manual. • Set the device name and IP address to CP1616 board by using TIA Portal (setting tool by SIEMENS). • Download the project file.
		CP1616 board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the CP1616 board.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
116	Firmware version of CP1616 board connected with 1st PCI connector and driver software version does not match.	CP1616 board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the CP1616 board.
		CP1616 board version failure	1. Reset the alarm. 2. If the alarm occurs again, request the update of CP1616 board firmware to your YASKAWA representative.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4918: PROFINET SETTING ERROR (continued)

Sub Code	Meaning	Cause	Remedy
117	Firmware version of CP1616 board connected with 2nd PCI connector and driver software version does not match.	CP1616 board failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the CP1616 board.
		CP1616 board version failure	1. Reset the alarm. 2. If the alarm occurs again, request the update of CP1616 board firmware to your YASKAWA representative.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4919: SYSTEM JOB(CYCLIC) EXEC. ERROR

An error occurred at the SYSTEM JOB(CYCLIC) execution.

Sub Code	Meaning	Cause	Remedy
1	Task ID error	Software operation error occurred	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	MSS ID error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	JOB handle error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	RMS error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Job type is not SYSTEM JOB (CYCLIC/HIGH).	Setting error	Change the job type to "SYSTEM JOB(CYCLIC/HIGH)".
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	The intermediate code of the instruction that is to be executed is incorrect.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	The instruction cannot be executed in the SYSTEM JOB (CYCLIC/HIGH).	Setting error	Delete the instruction in which alarm occurred, because the instruction cannot be executed in the SYSTEM JOB(CYCLIC/HIGH).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4919: SYSTEM JOB(CYCLIC) EXEC. ERROR (continued)

Sub Code	Meaning	Cause	Remedy
9	The reinterpretation of the instruction was ordered when executing the instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The SYSTEM JOB(CYCLIC/HIGH) was going to branch to the other job.	Setting error	Delete the instruction in which alarm occurred, because The SYSTEM JOB(CYCLIC/HIGH) cannot branch to the other job.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
11	The execution number of SYSTEM JOB(CYCLIC/HIGH) exceeded a limitation.	Setting error	Correct the job under the current limitation of execution number, because SYSTEM JOB(CYCLIC/HIGH) can no longer be executed.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
12	The execution of SYSTEM JOB (CYCLIC/HIGH) was not finished within a time limit.	Setting error	Reduce the number of items in the SYSTEM JOB(CYCLIC/HIGH).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
13	The SYSTEM JOB(CYCLIC/HIGH) was executed in the system being executed already.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
14	The execution number of items in the SYSTEM JOB(CYCLIC/HIGH) exceeded a limitation.	Setting error	Reduce the number of items in the SYSTEM JOB(CYCLIC/HIGH) within the limit number(Initial setting is 300).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4920: M-SAF CONTACTOR SELF CHECK ERR

An error is detected by the robot safety module in self diagnosis process of contactor output signal to perform on a periodical basis.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:SFRON1 CPU1 2:SFRON2 CPU1 3:SFRON3 CPU1 4:SFRON4 CPU2 1:SFRON1 CPU2 2:SFRON2 CPU2 3:SFRON3 CPU2 4:SFRON4	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the cables and connectors.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		ASU03 unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the ASU03 unit. In a system where a plurality of ASU03 units are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Power supply contactor unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the power supply contactor unit.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4921: M-SAF STO SELF CHECK ERR

An error is detected by the robot safety module in self diagnosis process of STO signal to perform on a periodical basis.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:STO1 CPU1 2:STO2 CPU1 3:STO3 CPU1 4:STO4 CPU2 1:STO1 CPU2 2:STO2 CPU2 3:STO3 CPU2 4:STO4	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4922: M-SAF GENERAL OUT SELF CHECK ERR

An error is detected by the robot safety module in self diagnosis process of general safety output signal to perform on a periodical basis.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:GSOUT1 CPU1 2:GSOUT2 CPU2 1:GSOUT1 CPU2 2:GSOUT2	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Cable continuity between the robot safety module and IM-YE250/5-80P terminal board.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4923: M-SAF GENERAL OUT SELF CHECK ERR2

An error is detected by the robot safety module in self diagnosis process of function safety general safety output signal to perform on a periodical basis.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: D01:XOUT01 D02:XOUT02 D03:XOUT03 D04:XOUT04 D05:XOUT05 D06:XOUT06 D07:XOUT07 D08:XOUT08 D09:XOUT09 D10:XOUT10 D11:XOUT11 D12:XOUT12 D13:XOUT13 D14:XOUT14 D15:XOUT15 D16:XOUT16	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Cable continuity between ASF02 board and ASU03 unit, ASF02 board.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		ASF02 board failure	1. Reset the alarm. 2. If the alarm occurs again, replace the ASF02 board. In a system where a plurality of ASF02 boards are connected, replace the board, which is connected to the signal on which the alarm occurred.

4923: M-SAF GENERAL OUT SELF CHECK ERR2 (continued)

Sub Code	Meaning	Cause	Remedy
		ASU03 unit failure	- Reset the alarm. - If the alarm occurs again, replace the ASU03 unit. In a system where a plurality of ASU03 units are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4924: M-SAF BRAKE UNMATCH

Detected error by the robot safety module in self diagnosis process of brake signal.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:SFRON1 CPU1 2:SFRON2 CPU1 3:SFRON3 CPU1 4:SFRON4 CPU2 1:SFRON1 CPU2 2:SFRON2 CPU2 3:SFRON3 CPU2 4:SFRON4	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the cables and connectors.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		ASU03 unit failure	- Reset the alarm. - If the alarm occurs again, replace the ASU03 unit. In a system where a plurality of ASF03 boards are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Power supply contactor unit failure	- Reset the alarm. - If the alarm occurs again, replace the power supply contactor unit.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4925: M-SAF STO UNMATCH

Detected error by the robot safety module in self diagnosis process of STO signal.

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:STO1 CPU1 2:STO2 CPU1 3:STO3 CPU1 4:STO4 CPU2 1:STO1 CPU2 2:STO2 CPU2 3:STO3 CPU2 4:STO4	Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4926: M-SAF GENERAL OUTPUT UNMATCH

Detected error by the robot safety module in self diagnosis process of general safety output signal. (Machine safety signal)

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: CPU1 1:GSOUT1 CPU1 2:GSOUT2 CPU2 1:GSOUT1 CPU2 2:GSOUT2	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Cable continuity between the robot safety module and IM-YE250/5-80P terminal board.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4927: M-SAF GENERAL OUTPUT UNMATCH2

Detected error by ASF02 board and ASU03 unit in self diagnosis process of general safety output signal.
(Functional safety signal)

Sub Code	Meaning	Cause	Remedy
	The meaning of each sub code is as follows: D01:XOUT01 D02:XOUT02 D03:XOUT03 D04:XOUT04 D05:XOUT05 D06:XOUT06 D07:XOUT07 D08:XOUT08 D09:XOUT09 D10:XOUT10 D11:XOUT11 D12:XOUT12 D13:XOUT13 D14:XOUT14 D15:XOUT15 D16:XOUT16	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and inserting state of the following cables and connectors. • Cable continuity between the robot safety module and ASF02 board, ASU03 unit.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the signal on which the alarm occurred.
		ASF02 board failure	1. Reset the alarm. 2. If the alarm occurs again, replace the ASF02 board. In a system where a plurality of ASF02 boards are connected, replace the board, which is connected to the signal on which the alarm occurred.
		ASU03 unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the ASU03 unit. In a system where a plurality of ASU03 units are connected, replace the board, which is connected to the signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4932: REFERENCE USER FRAME ERROR

An error occurred in reference user frame.

Sub Code	Meaning	Cause	Remedy
1	reference user frame not set	Setting error	1. Reset the alarm. 2. Check the following settings. • reference user frame
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4932: REFERENCE USER FRAME ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2	multiple reference user frame	Setting error	- Reset the alarm. - Check the following settings. - reference user frame
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Incorrect control group designation	Setting error	- Reset the alarm. - Check the following settings. - reference user frame
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4933: TIMING DELAY CONTROL IMPOSSIBLE

Failed in timing delay control.

Sub Code	Meaning	Cause	Remedy
1	Timing delay control was impossible	Setting error	Check the following settings. correct the job and be able to timing delay control.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Timing exchange control was impossible	Setting error	Review a job so that an prohibited instruction does not enter between control object steps.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4934: MotoPlus APP. RESPONSE ERROR

MotoPlus application did not respond to the messages which were sent from the system software.

Sub Code	Meaning	Cause	Remedy
0	The message which was sent the last time has not been received.	Setting error	Turn the power OFF then back ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	The message which was sent when the NEXT/BACK/TEST operation was executed.	Setting error	- Turn the power OFF then back ON. - If the alarm occurs again, check the following settings. - The MotoPlus application has been running. - The MotoPlus API mpSendEventAck() that responds to system software is called in the MotoPlus application.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

4934: MotoPlus APP. RESPONSE ERROR (continued)

Sub Code	Meaning	Cause	Remedy
2	The message that was sent when the job was started.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the following settings. • The MotoPlus application has been running. • The MotoPlus API mpSendEventAck() that responds to system software is called in the MotoPlus application.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	The message which was sent from the pendant application.	Setting error	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the following settings. • The MotoPlus application has been running. • The MotoPlus API mpSendEventAck() that responds to system software is called in the MotoPlus application.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4935: PointPLC EXECUTE ERROR

An error occurred at execution of the PointPLC program.

Sub Code	Meaning	Cause	Remedy
1	TAG could not be executed on JUMP instruction in the PointPLC program.	Setting error	1. Reset the alarm. 2. Delete the TAG of the JUMP instruction which cannot be executed in the PointPLC program.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	JUMP instruction or LABEL is wrong in the PointPLC program.	Setting error	1. Reset the alarm. 2. Modify the JUMP instruction or LABEL in the PointPLC program. JUMP destination in the PointPLC program will need to be set in the PointPLC program. JUMP destination outside of PointPLC program will need to be set outside PointPLC program.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	TAG could not be executed on CLEAR instruction in the PointPLC program.	Setting error	1. Reset the alarm. 2. Delete the TAG of the CLEAR instruction which cannot be executed in the PointPLC program.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	TAG could not be executed on CALL instruction in the PointPLC program.	Setting error	1. Reset the alarm. 2. Delete the TAG of the CALL instruction which cannot be executed in the PointPLC program.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4936: LOCAL VARIABLE CONTROL ERROR

An error occurred in Local variable control.

Sub Code	Meaning	Cause	Remedy
1	Local variable is used in the PointPLC program.	Setting error	1. Reset the alarm. 2. Modify the instruction that uses Local variable in the PointPLC program.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4937: TIMING ADJUSTMENT SETTING ERROR

Failed in control of the setting timing adjustment.

Sub Code	Meaning	Cause	Remedy
1	Adjustment setting is exceeds the control area of the advance or delay control.	Setting error	Correct the job so that adjustment setting is within the control area.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Timing advance control was impossible.	Setting error	Correct the job so that it does not across the instructions that cannot be advance control.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Timing delay control was impossible.	Setting error	Correct the job so that it does not across the instructions that cannot be delay control.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4940: MOTION COMMAND CODE ERROR (SV)

Illegal command data (parameter) is received from MOTION section.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4941: CANNOT EXECUTE MOTION CMD (SV)

An optional function was commanded to be executed while another optional function was in execution.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4942: AVERAGING TIME CHANGE ERR (SV)

The request to change standardization time was sent without permission.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4943: AVERAGING TIME ERROR (SERVO)

The motor instruction standardization time is out of the allowable range.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4944: POSITION LOOP GAIN ERROR (SV)

The KP parameter input value is out of the allowable range.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4945: MOTION COMMAND DATA ERROR (SV)

No processing corresponds to the command code sent from MOTION section.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4946: PG POWER ON INCOMPLETE (SV)

An attempt was made to turn ON the servo while the encoder was not ready.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4947: SERVO ON MULTIPLE REQUEST (SV)

The request to turn ON the servo power supply again was sent to an axis where the servo's power was already ON.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4953: ENCODER COUNTER DIFF. ERR(SV)

The difference value of the encoder exceeded the threshold value.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4954: REALTIME STATUS S/R ERROR (SV)

An error occurred in real-time data transmission of SVSPOT Executing bit sent from MOTION.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4955: AVERAGING DATA ERROR (SERVO)

The illegal data are stored in the averaging buffer. (The lowest digit shows the axis No.)

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4956: AVERAGING SUM ERROR (SERVO)

The sum value in the averaging buffer is incorrect. (The lowest digit shows the axis No.)

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4957: AVERAGING STATUS ERR (SERVO)

The "empty" status of averaging buffer is incorrect. (The lowest digit shows the axis No.)

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4958: HIGH RESOLUTION PRM UNDEFINED(SV)

Overload detected parameter(a high resolution) was set to "0", though overload-related parameter flag is ON.

Sub Code	Meaning	Cause	Remedy
		Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4959: WRONG GRP CHANGE AXIS (SERVO)

An uncontrolled axis was specified at group change instruction execution.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4960: BELT SNAP DETECT PRM ERROR (SV)

The observer and collision detection function are set disabled although the broken belt detection function is set enabled.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	- Reset the alarm. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4962: BRAKE LOCK ERROR (SERVO)

The mechanical brake remains locked although the base block is released. (The lowest digit shows the axis No.)

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	- Reset the alarm. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4963: BRAKE RELEASE ERROR (SERVO)

The mechanical brake is not locked although the base block turns ON. (The lowest digit shows the axis No.)

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	- Reset the alarm. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4964: CONST.SPD MEASURE MULTI REQ (SV)

While the velocity torque sampling was in execution, another request of sampling was sent.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	- Reset the alarm. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4965: DIN SIGNAL SPECIFIC. ERROR (SV)

DIN signals are used for plural function.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software setting failure	- Reset the alarm. - If the alarm occurs again, check the DIN signal settings.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4968: POSITIONING(DISTANCE) ERROR

An error occurred at Positioning(distance specification) execution.

Sub Code	Meaning	Cause	Remedy
1	Step end stopping timeout of Positioning(distance specification) was detected.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	PL control is not allowed when Positioning(distance specification) is enabled.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Arithmetic error occurred when calculating consideration of servo delay for the Positioning (distance specification).	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 4972: CONVTR REGENERATE OVERLOAD(SV)

The converter regenerative resistor is overloaded.

Servo amplifier alarm A.320

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Primary power supply failure	Check the primary voltage for the converter.
		Setting error	Check the following settings; • Tool data • JOB • Workpiece • JOB speed • Acceleration and deceleration (ACC, DEC)
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Regenerative resistor failure	1. Reset the alarm. 2. If the alarm occurs again, check if there is no cable disconnection. • Multi-axis servo amplifier -CN116 • Single-axis servo amplifier -B1/+, B2 3. If disconnected, replace the regenerative resistor.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.

4972: CONVTR REGENERATE OVERLOAD(SV) (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4973: POSITION ERROR(COLLISION DETECT)

The position deviation reached the limit value after the manipulator stopped by the collision detection.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software setting failure	Confirm the following settings; - Tool information - Workpiece
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4974: POSITION ERROR(START LIFT)

The moving volume when executing start lift reached the limit.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	- Reset the alarm. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4975: WRONG START LIFT AXIS(SERVO)

Incorrect axis is specified when executing start lift.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	- Reset the alarm. - If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4979: ACCELERATION LIMIT OVER

This alarm is occurred when the acceleration of robot exceeds the maximum acceleration limit.
During conveyor tracking motion, the acceleration of robot might reach the limit when there is a big different between the actual target position and the teaching position.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	1. Adjust the CTP position to close the teaching position and the actual target position when this alarm occurred. 2. Adjust the OL to limit the operating range of the robot or add TRAP instruction to the JOB to operate without the alarm when this alarm occurred, 3. Make the teaching speed slow in the step where the alarm occurs. Check if the robot crashes against the obstacle or the products since the trajectory of the robot might change.

◆ 4980: DESTINATION PULSE LIMIT

The manipulator exceeded its motion limit (pulse limit) in the negative (-) direction and the positive (+) direction in the motion target position.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the position setting for the step (move instruction) where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4981: DEST PULSE MECHANICAL LIMIT

The manipulator exceeded its motion limit (mechanical limit) in the negative (-) and the positive (+) direction at the motion target point.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the position setting for the step (move instruction) where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4982: DEST MECHANICAL INTRF

The manipulator link was interfered with the motion target position.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the position setting for the step (move instruction) where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4983: DEST MECHANICAL INTRF

The manipulator link was interfered with the motion target position.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the position setting for the step (move instruction) where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4984: DESTINATION SELF-INTERFERENCE

The manipulator link was interfered with the motion target position.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the position setting for the step (move instruction) where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4985: TEACH LINE CORD JOG MOVE DISABLE

An error occurred when teach line cord jog move was in execution.

Sub Code	Meaning	Cause	Remedy
		Setting error	Correct the attitude of the tool and the ground are out of vertical, and execute teach line cord jog move.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4986: TEACH LINE CORD JOG MOV C DISABLE

An error occurred when teach line cord jog move was in execution.

Sub Code	Meaning	Cause	Remedy
		Setting error	Execute FWD/BWD/TEST RUN operation, and execute teach line cord jog move.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4989: DEFECTIVE OPERATION VELOCITY

Robot cannot move in the working speed that is specified in the speed limit by the functional safety.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Do not take effect safety of the speed limit by the functional safety during the interval of ARCON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4990: MOTION ERROR (SINGULAR POSTURE)

Cannot perform interpolation to the specified posture.

It may occur when the interpolation to the target position where the manipulator cannot keep posture is performed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Check the following settings. • Change the teaching orientation. [Tube built-in wrist type models] When a flange is parallel to a XY plane of the robot coordinated system, teach the flange so that it is inclined more than 0.01 degrees.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4991: IO MODULE PROC OVERTIME

The procedure of the accessing to I/O module did not finish in the defined period.

Sub Code	Meaning	Cause	Remedy
16	The procedure of the accessing to I/O module which is connected with 1st PCI connector did not finish in the defined period.	Setting error	Check the following settings. • When SST-DN4 is used; maximum waiting time for accessible to PCI board • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		Board failure(I/O module)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
17	The procedure of the accessing to I/O module which is connected with 2nd PCI connector did not finish in the defined period.	Setting error	Check the following settings. • When SST-DN4 is used; maximum waiting time for accessible to PCI board • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode

4991: IO MODULE PROC OVERTIME (continued)

Sub Code	Meaning	Cause	Remedy
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		Board failure(I/O module)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
18	The procedure of the accessing to I/O module which is connected with 3rd PCI connector did not finish in the defined period.	Setting error	Check the following settings. • When SST-DN4 is used; maximum waiting time for accessible to PCI board • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		Board failure(I/O module)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
19	The procedure of the accessing to I/O module which is connected with 4th PCI connector did not finish in the defined period.	Setting error	Check the following settings. • When SST-DN4 is used; maximum waiting time for accessible to PCI board • PCI slot number in which each PCI board is mounted • I/O module settings in maintenance mode
		Connection failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, check the connection and insertion of the following connector. • The PCI connector of the corresponding I/O module
		Board failure(I/O module)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the following board. Save the CMOS.BIN before replacing the board to be safe. • The corresponding I/O module (PCI board)
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4992: INTERNAL ROBOT POS.UNMATCH

Position data in the manipulator does not match home position data.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	Try 1 below if using the functional safety function. Try 2 below if you are not using the functional safety function, and the alarm occurs after replacing the robot, the controller or loading CMOS.BIN. Try 3 below if you are not using the functional safety function, and this alarm occurs after replacing the motor. - In SAFETY MODE, calibrate the home position on the "HOME POSITION" window. Then, perform "READBACK" and "WRITE". - In MANAGEMENT MODE, select "CLEAR ROBOT DATA" under menu "DATA" on the "HOME POSITION" window, then clear home position data. Turn the power OFF then back ON. - In MANAGEMENT MODE, select "HOME POSITION" window and press the function menu "DATA" to select "RECORD TO ROBOT" which appears only when an alarm occurs.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4995: RUSH LIMIT RESISTOR OVERLOAD(CONVERTER)

Rush limit resistor in converter is overloading.

Servo amplifier alarm A.740

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Main circuit power on frequency is high	- Reset the alarm. - If the alarm occurs again, check the following settings; - The number of Servo ON in a certain time
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4997: M-SAF DATA CRC UNMATCH

An error was detected while loading machine safety-related data.

Sub Code	Meaning	Cause	Remedy
		Data error	1. Reset the alarm, and then try again. 2. Check whether the data which it is going to load is surely saved as data of machine safety.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 4998: M-SAF SYSTEM ERROR2

An error occurred in a process of Machine-Safety system.

Sub Code	Meaning	Cause	Remedy
	If the sub-code is 1nxx, the following is shown: A feedback diagnosis error in robot safety module number n, target signal xx(following) 00:BON 01:MCON 02-05:HWBB1-HWBB4 06-07:GSOUT1-GSOUT2 08-11:SFRON1-SFRON4 12-27:XOUT01-XOUT16	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the following: • Target signal and its feedback signal.

◆ 4999: ENCODER USER DATA SUM ERROR

This alarm occurs if there is an error of user data in the encoder memory.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Encoder failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo motor.
		Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Multi-axis servo amplifier -CN2A, CN2B, CN2C, CN2D, CN2E, CN2F • Single-axis servo amplifier -CN2 • Cable between encoders.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.

4999: ENCODER USER DATA SUM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

1.2 Alarm Number (6000 to 6999)

◆ 6000: SYSTEM ERROR2(PFL)

Process is not performed properly on the robot safety module.

Sub Code	Meaning	Cause	Remedy
0	Force Monitor Condition Disabled	Setting error	1. Reset alarm. 2. Confirm that at least 1 External Force Monitor condition setting is enabled.
1	Tool changing distance parameter setting error	Setting error	1. Reset alarm. 2. Confirm that tool changing distance parameter is set correctly.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 6001: MUTING ERROR(PFL)

PFL Speed limitation is invalid during PFL muting operation.

Sub Code	Meaning	Cause	Remedy
		Operation mistake	1. Reset alarm. 2. Confirm the robot is crashed. 3. If PFL function is muted, confirm the safety and resume the robot.

◆ 6002: NEAR SINGULARITY(PFL)

On the singularity, 2 or more axes movement is restricted. If 2 or more axes movement is detected on the singularity, this alarm is occurred.

Sub Code	Meaning	Cause	Remedy
		Operation mistake	1. Reset alarm. 2. If the alarm occurs again, confirm if 2 or more axes are moved near singularity in collaborative operation. 3. Confirm the robot is crashed. 4. Confirm the safety and resume the robot.

◆ 6003: UNDEFINED SPEED LIMIT(PFL)

Speed limitation is required for collaborative operation. If speed limitation is not set, this alarm is occurred.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Confirm the setting of speed limit condition file no.30, 31, and 32 in accordance with the manual. 2. Reset alarm. 3. Confirm if collision occurs. 4. Confirm the safety and resume the robot.

◆ 6004: ESCAPE FROM CLAMPING ERROR(PFL)

When clamping is happened, robot moves the any direction which direction decrease the power automatically. If power is increased greatly during escaping, this alarm is occurred.

Sub Code	Meaning	Cause	Remedy
		Operation mistake	1. Reset alarm. 2. If collision occurred, confirm the safety and escape from collision. 3. Confirm if setting of Tool files is correct. 4. Confirm if torque sensor home position is deviated. If it is deviated, set home position again following Collaborative Operation Instructions. 5. If the alarm occurs again, Turn the power OFF then back ON. 6. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
		Near Singularity	If the robot's posture when the alarm occurred is near singularity, take the following measures. 1. Reset alarm. 2. Confirm if external force of TCP exceeds external force limits in posture when the alarm occurred. If it exceeds, it may be improved by changing to a movement that does not pass the posture. 3. Confirm if external force of TCP exceeds external force limits during operation. 4. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 6005: EXTERNAL FORCE ERROR(PFL)

Large external force is detected continuously.

Sub Code	Meaning	Cause	Remedy
	Sub Code:alarm occurred axis or direction 1-8: Axis number 9-12: TCP(Resultant,X,Y,Z)	Setting error	1. Reset alarm. 2. If collision occurred, confirm the safety and escape from crash. 3. Confirm if setting of Tool files is correct. 4. Confirm the torque sensor home position. And, if home position is diverged, set correct position again following Collaborative Operation Instructions. 5. After home position setting, confirm the movement before operation start.
		Other	1. Turn the power OFF then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 6008: TRQ SENSOR OVERLOAD

This alarm occurs if a torque that is higher than the rated torque is applied to the torque sensor due to a collision of the manipulator or in other situations, or failure is detected in the torque sensor.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Indicates the axis in which the alarm occurred.	Torque sensor failure	1. If an external force is applied to the manipulator due to a collision with the surroundings or other causes, move the manipulator according to the manual. 2. Turn the power OFF then back ON. 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 6010: CONTROLLER SYNCHRONIZATION ERROR

An error occurred in inter-controller synchronization execution.

Sub Code	Meaning	Cause	Remedy
1	Master group designation error	Setting error	1. Reset the alarm. 2. Confirm that the specified control group is master group.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6011: AVOIDANCE FUNC. PARAMETER ERROR

Parameter for avoidance function is wrong.

Sub Code	Meaning	Cause	Remedy
	Subcode: Signifies the error type and the targeted D variable. last 3 digit: D variable's number first digit: error types Meaning of error type is as follows. None:Parameter range error 1:Setting of two D variables is wrong. When setting of two D variable is wrong, the younger one is signified as the targeted D variable.	Software operation error occurred	1. Reset the alarm after turn off Servo Power. 2. Check the and correct the D variable settings.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6012: HAND GUIDING PARAMETER ERROR

Parameter for hand guiding is wrong.

Sub Code	Meaning	Cause	Remedy
	Subcode: Signifies the error type and the targeted D variable. last 3 digit: D variable's number first digit: error types Meaning of error type is as follows. None:Parameter range error 1:Setting of two D variables is wrong. When setting of two D variable is wrong, the younger one is signified as the targeted D variable.	Software operation error occurred	1. Reset the alarm. 2. Check the and correct the D variable settings.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6013: CANNOT START HAND GUIDING(JOINT)

External force is exceeding the allowable value when starting hand guiding.

Sub Code	Meaning	Cause	Remedy
	subcode:The axis that exceeds the allowable value is indicated by a bit. D01:S D02:L D03:U D04:R D05:B D06:T	Operation mistake	1. Reset the alarm. 2. Reduce the force for the hand guiding when starting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6014: CANNOT START HAND GUIDING(XYZ-T)

External force is exceeding the allowable value when starting hand guiding.

Sub Code	Meaning	Cause	Remedy
	subcode:The direction or the axis that exceeds the allowable value is indicated by a bit. D01:X D02:Y D03:Z D04:T	Operation mistake	1. Reset the alarm. 2. Reduce the force for the hand guiding when starting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6015: CANNOT START HAND GUIDING(RBT)

External force is exceeding the allowable value when starting hand guiding.

Sub Code	Meaning	Cause	Remedy
	subcode:The axis that exceeds the allowable value is indicated by a bit. D01:S D02:L D03:U D04:R D05:B D06:T	Operation mistake	1. Reset the alarm. 2. Reduce the force for the hand guiding when starting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6016: AVOIDANCE FUNC.RECOVER ERR(IMOV)

Avoidance function has executed during IMOV.

Sub Code	Meaning	Cause	Remedy
		Operation mistake	1. Reset the alarm. 2. Do not execute avoidance function during IMOV.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6017: HAND GUIDING SUSPEND

Hand guiding function has force-quit.

Sub Code	Meaning	Cause	Remedy
16	Servo power has been turn OFF during hand guiding.	Operation mistake	Reset the alarm.
17	Hold has requested during hand guiding.	Operation mistake	Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6018: ESCAPE FROM CLAMPING SUSPEND

Escape from clamping function has force-quit.

Sub Code	Meaning	Cause	Remedy
16	Servo power has been turn OFF during escape from clamping.	Operation mistake	Reset the alarm.
17	Hold has requested during escape from clamping.	Operation mistake	Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6019: DIRECT TEACHING FAILED

Cannot edit the JOB.

Sub Code	Meaning	Cause	Remedy
16	Cannot edit the prohibited JOB.	Operation mistake	Reset the alarm.
64	Cannot edit JOB because edit screen is not active.	Operation mistake	Reset the alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6021: WORK CALIBRATION DATA ERROR

An error occurred in work calibration.

Sub Code	Meaning	Cause	Remedy
1	Incorrect number of teaching points for work calibration	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
2	Incorrect designation of the occupation control group for PC program work calibration data	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
3	Incorrect designation of the enabling control group for PC program work calibration data	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
4	Incorrect designation of the control group for PC program work calibration data	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
5	Incorrect designation of the occupation control group for controller program calibration data	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).

6021: WORK CALIBRATION DATA ERROR (continued)

Sub Code	Meaning	Cause	Remedy
6	Incorrect designation of the enabling control group for controller program calibration data	Setting error	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
7	Incorrect designation of the control group for controller program calibration data	Setting error	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
8	Among taught points in the PC work calibration program, two or three points are on the same point.	Setting error	Teach the data for work calibration so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Among taught points in the controller work calibration program, two or three points are on the same point.	Setting error	Teach the data for work calibration so that each point is different.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	The number of robots in the PC work calibration program is two or more.	Setting error	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
11	The number of robots in the controller work calibration program is two or more.	Setting error	- Reset the alarm, and then try again. - If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).

◆ 6022: EXTERNAL FORCE ESTIMATION ERROR

External force is exceeding the allowable value when starting controller.

Sub Code	Meaning	Cause	Remedy
	subcode:The axis that exceeds the allowable value is indicated by a bit. D01:S D02:L D03:U D04:R D05:B D06:T	Sensor error	- Check if any external force has been applied to the manipulator, such as colliding with the surroundings. - Reset the alarm, and confirm the tool file settings(Weight, Unit of centroid position, +-). - Confirm the torque sensor home position. And, if home position is diverged, set correct position.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6023: AVOIDANCE FUNC. ERR(CONV. SYNC)

Avoidance function has used during conveyor synchronized operation.

Sub Code	Meaning	Cause	Remedy
		Operation mistake	1. Reset the alarm. 2. Do not use the avoidance function during conveyor synchronized operation.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6024: PENDANT COMMUNICATION ERROR

A communication error occurred between the controller and the programming pendant.

Sub Code	Meaning	Cause	Remedy
		-	For the cause and remedy, refer to "Troubleshooting" of the YNX1000 MAINTENANCE MANUAL.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6025: SYNC TARGET CONTROLLER ERR

An error has occurred on the synchronization target controller.

Sub Code	Meaning	Cause	Remedy
		Software operation error occurred	Resolve the error of the synchronization target controller.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6027: SERVO AMPLIFIER CMD VALIDITY ERROR

The servo amplifier detected an error in the received data.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6028: SERVO AMPLIFIER COMM STATUS ERROR

The servo amplifier detected a communication status error.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6031: HIGH SPEED ROBOT DATA COMM ERROR

Communication processing error with Trumpf laser welding machine.

Sub Code	Meaning	Cause	Remedy
0	IP address for Trumpf i-PFO is not set correctly.	Setting error	Check the setting of the IP address for Trumpf i-PFO.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
1	Port number for Trumpf i-PFO is not set correctly.	Setting error	Check the setting of the Port number for Trumpf i-PFO.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	SENTYPE for Trumpf i-PFO is not set correctly.	Setting error	Check the setting of the SENTRYTYPE for Trumpf i-PFO.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Communication direction for Trumpf i-PFO is not set correctly.	Setting error	Check the setting of the Communication direction for Trumpf i-PFO.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Error counter output M register for Trumpf i-PFO is not set correctly.	Setting error	Check the setting of the Error counter output M register for Trumpf i-PFO.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6031: HIGH SPEED ROBOT DATA COMM ERROR (continued)

Sub Code	Meaning	Cause	Remedy
5	Communication error threshold for Trumpf i-PFO is not set correctly.	Setting error	Check the setting of the Communication error threshold for Trumpf i-PFO.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Continuous writing check for Trumpf i-PFO is not set correctly.	Setting error	Check the setting of the Continuous writing check for Trumpf i-PFO.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	No transmission request counter output M register for Trumpf i-PFO is not set correctly.	Setting error	Check the setting of the No transmission request counter output M register for Trumpf i-PFO.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
100	LAN Interface Setting is not set correctly.	Setting error	Check the setting of the LAN interface.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2000	Trumpf i-PFO communication error over the threshold has detected.	Setting error	Check the communication settings for Trumpf i-PFO is correct. Check the MotoPlus application for Trumpf i-PFO is correct.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6033: NAMED VARIABLE ACCESS ERROR

An error was detected at the named variable management function.

Sub Code	Meaning	Cause	Remedy
-1	Named variable setting error.	Setting error	Check that the variable name is set correctly.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Array index type error.	Setting error	Array types cannot be specified for R, S, and P variables. Check the variable type.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Reference argument: data type mismatch	Setting error	Check the data type of the set argument.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6033: NAMED VARIABLE ACCESS ERROR (continued)

Sub Code	Meaning	Cause	Remedy
9	Tag data cannot be converted.	Setting error	Check the data type of the tag.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6036: ROBOT I/F CONNECTION ERROR

An error of communication with the host device using the YERCPProfile has occurred.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Check the settings of Ethernet for the robot controller. 2. Check whether the host device's power is ON. 3. Check the settings of IP address for the host device.
		Connection failure	1. Reset the alarm. 2. After above operation implementation, If the alarm occurs again, check the connection and inserting state of between the host device and the LAN connector on the robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6037: MANUAL OPERATION FAILED

An error occurred in manual operation.

Sub Code	Meaning	Cause	Remedy
3	Do not tried to manually operate multiple robots in a coordinated control job.	Operation mistake	1. Reset the alarm. 2. Set R1 and R2 to jobs in different control groups.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
	System error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 6038: EXTERNAL FORCE CONTROL FAILED

An error occurred in external force control operation.

Sub Code	Meaning	Cause	Remedy
1	Failed to read the command of SKILLSND.	Setting error	1. Confirm and fix the command of SKILLSND. 2. Confirm and fix the delimiter character between command name and argument.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
2	Failed to read the argument of SKILL command.	Setting error	1. This command requires the argument. Set the argument into SKILL command. 2. Confirm and fix the command name of SKILLSND. 3. Confirm and fix the delimiter character between command name and argument.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
3	Too many arguments of SKILL command.	Setting error	Decrease the number of arguments of SKILL command.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
4	Out of range of argument value.	Setting error	Confirm and fix the value of arguments of SKILL command.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
5	Wrong combination about arguments.	Setting error	Confirm and fix the pair of arguments of SKILL command.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
	System error	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 6039: GAS PRESS CHECK SETTING ERROR

An error occurred when registering criteria of gas pressure check.

Sub Code	Meaning	Cause	Remedy
		Setting error	Do not execute any job when registering criteria of gas pressure check.
		Software operation error occurred	Reset the alarm, and then try again.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6044: 1-STEP BACK EXECUTION ERROR

Cannot execute BWD operation from the current position.

Sub Code	Meaning	Cause	Remedy
	Sub Code: System number	Operation mistake	Cannot execute BWD operation from the current position. Reset the alarm, and then move the manipulator to safety place in teach mode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6045: CONTROLLER SYNC INTERFERENCE

The distance between the interference monitoring axes has exceeded the threshold value.

Sub Code	Meaning	Cause	Remedy
	Sub Code; Group and file number	Setting error	Check the following settings. • Change the step position at which the alarm occurs so that it does not exceed the threshold value. • Modify the csync interference setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6046: PROFINET DISCONNECT FUNC ERROR

There is a wrong setting for the PROFINET disconnect function.

Sub Code	Meaning	Cause	Remedy
	Sub code: Indicates a communication target station that has been improperly configured in 6-digit decimal [XX Y ZZZ] format. XX : IO module number Y : Channel number 0: 1 channel 1: 2 channels (SST-DN4-PCU only) ZZZ: Communication station number (station number)	Setting error	Check that the PROFINET disconnection function settings are correct for the communication target station indicated by the subcode.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6047: PROFINET ERROR

A communication error or a module error has been detected on the PROFINET module, CM-PN02M

Sub Code	Meaning	Cause	Remedy
	Subcode: A 6-digit decimal number [XX Y ZZZ] indicating the PROFINET module that detected the error. XX: IO module number Y: For future use (Always 0) ZZZ: For future use (Always 0)	Communication partner error	Check the communication partner (IO-Controller) is working normally.
		Connection error	Check that the cable and the communication devices between CM-PN02M and the communication partner (IO-Controller), such as a hub, are properly connected and functioning normally.
		Configuration error	Check that the IP address and Device name are correctly configured on the CM-PN02M. Also, check that the CM-PN02M is properly configured in YNX maintenance mode.
		CM-PN02M module fault	Check that the CM-PN02M is working normally.
		Other	If the alarm occurs again, save the CMOS.BIN file, and then contact your YASKAWA representative with the occurrence details (including the operating procedure).

◆ 6048: BACKWARD EXECUTION ERROR

Failed to execute the BWD operation.

Sub Code	Meaning	Cause	Remedy
1	Backward operation is not possible for the current job.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
2	Could not find information about the job called by the instruction.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).
3	The information of the job called by the instruction was abnormal.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure, ladder editor line index).

◆ 6049: AXIS INTERFERENCE

The manipulator has entered the axis interference area that was specified.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Group, interference area number and set number	Setting error	Check the following settings. • Change the step position where the alarm occurred to the area outside the interference area. • Modify the interference area setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6050: CUBE INTERFERENCE(TCP)

The TCP of the manipulator has entered the cube interference area that was specified.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Group, interference area number and set number	Setting error	Check the following settings. • Change the step position where the alarm occurred to the area outside the interference area. • Modify the interference area setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6051: CUBE INTERFERENCE(ENTIRE)

A part of the manipulator has entered the cube interference area that was specified.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Group, axis, interference area number and set number	Setting error	Check the following settings. • Change the step position where the alarm occurred to the area outside the interference area. • Modify the interference area setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6053: PATH GENERATION ERROR(ARITH)

An error occurred when generating the path.

Sub Code	Meaning	Cause	Remedy
	An error occurred in the arithmetic process.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6054: PATH GENERATION ERROR

An error occurred when generating the path.

Sub Code	Meaning	Cause	Remedy
1	The number of passing positions generated exceeds the maximum value.	Setting error	Check the following: • Check the path planning start and end points. • Place the robot model or tool model and the obstacle model apart. • If you are using the MOVAUTO instruction, separate it into multiple MOVAUTO instructions. • If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	A back operation is executed in the MOVAUTO step.	Setting error	A back operation cannot be performed in the MOVAUTO step.
-1	Initialization process was not properly completed.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2	Initialization process was not properly completed.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-3	Initialization process was not properly completed.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-10	Path planning was executed while initialization processing was not completed.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. Execute path planning again after a certain period of time has passed. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-20	An error occurred while generating a path in ACU.	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-21	Failed to execute command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-22	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-23	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-24	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-25	An error occurred while executing the command to ACU.	Software operation error occurred	1. Check the robot controller is starting up without error. Execute path planning again after a certain period of time has passed. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-26	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-100	An error occurred during initialization processing.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-101	An error occurred during initialization processing.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-102	An error occurred during initialization processing.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-200	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-201	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-300	Failed to pathplanning.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-301	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-302	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-303	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-304	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-305	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-306	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-307	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-308	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-309	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-310	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-311	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-312	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-313	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-314	Robot model or tool model and obstacle model interfered at the path planning starting point.	Setting error	Check the following: • Teach the path planning start point in the direction in which the robot moves away from the obstacle. • Check that the tool model is not in constant interference with the robot model. • Check that the robot model is not in constant interference with the obstacle model. • If you are using a polygon model, check the interference check pair. • If you are using a polygon model, check margin levels.
-315	Robot model or tool model and obstacle model interfered at the path planning end point.	Setting error	Check the following: • Teach the path planning end point in the direction in which the robot moves away from the obstacle. • If you are using a polygon model, check the interference check pair. • If you are using a polygon model, check margin levels.
-316	The number of passing positions generated exceeds the maximum value.	Setting error	Check the following: • Check the path planning start and end points. • Place the robot model or tool model and the obstacle model apart. • If you are using the MOVAUTO instruction, separate it into multiple MOVAUTO instructions. • If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-317	The number of retries when path planning fails has exceeded the maximum value.	Setting error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, change the retry count (S3C [3006]).
-319	The path planning start and end points of the base axes do not match.	Setting error	Check the following: • Check that the path planning start and end points match.
-400	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-401	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-402	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-500	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-600	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-601	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-700	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-701	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-800	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-900	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1000	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1100	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1200	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1201	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1300	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-1400	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1500	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1600	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1700	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1701	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1800	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1801	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1802	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-1803	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1804	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1805	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1806	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1807	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1808	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1900	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1901	An error occurred while executing the command to ACU.	Setting error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

6054: PATH GENERATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
-1902	An error occurred while executing the command to ACU.	Setting error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1903	An error occurred while executing the command to ACU.	Setting error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1904	An error occurred while executing the command to ACU.	Setting error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-1905	An error occurred while executing the command to ACU.	Setting error	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2000	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2001	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2002	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
-2003	An error occurred while executing the command to ACU.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save ACU system log, Path Planning project file and CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6056: DESTINATION CUBE INTF

A part of the manipulator has entered the cube interference area that was specified in the motion target position.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Group, axis, and interference area number	Setting error	Check the following settings. • Change the step position where the alarm occurred to the area outside the interference area. • Modify the interference area setting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6057: CC-Link COMMUNICATION ERROR

A CC-Link communication error has been detected.

Sub Code	Meaning	Cause	Remedy
	Sub code: Indicates a communication target station that has detected a communication error in 6-digit decimal [XX Y ZZZ] format. XX : IO module number Y : Channel number (always "0") ZZZ: Communication station number (always "000")	Setting error	Check the following. 1. Check that the CC-Link communication settings are correct. 2. Check that the communication settings of the communication master (PLC) and the communication settings of the YNX1000 match.
		Communication target failure	Check that the communication master (PLC) is working normally.
		Connection failure	Check that the communication equipment such as the cable and branch unit to the communication master (PLC) are properly connected and working normally.
		CC-Link board failure	Check the communication status and the LED status on the board to confirm that the CC-Link board (SST-CCS-PCIE) is working normally.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6058: CC-Link IE Field COMM ERROR

A CC-Link IE Field communication error has been detected.

Sub Code	Meaning	Cause	Remedy
	Sub code: Indicates a communication target station that has detected a communication error in 6-digit decimal [XX Y ZZZ] format. XX : IO module number Y : Channel number (always "0") ZZZ: Communication station number (always "000")	Setting error	Check the following. 1. Check that the CC-Link IE Filed communication settings are correct. 2. Check that the communication settings of the communication master (PLC) and the communication settings of the YNX1000 match.
		Communication target failure	Check that the communication master (PLC) is working normally.
		Connection failure	Check that the communication equipment such as the cable and HUB to the communication master (PLC) are properly connected and working normally.
		CC-Link IE Field board failure	Check the communication status and the LED status on the board to confirm that the CC-Link IE Field board (Q81BDJ71GF11-T2) is working normally.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6059: DeviceNet COMMUNICATION ERROR

A DeviceNet communication error has been detected.

Sub Code	Meaning	Cause	Remedy
	Sub code: Indicates a communication target station that has detected a communication error in 6-digit decimal [XX Y ZZZ] format. XX : IO module number Y : Channel number 0: channel 1 1: chaneel 2 (Only for SST-DN4-PCU-2) ZZZ: Communication station number (MAC ID) (Only for master)	Setting error	Check the following. 1. Check that the CC-Link communication settings are correct. 2. Check that the communication settings of the communication master (PLC) and the communication settings of the YNX1000 match.
		Communication target failure	Check that the communication master (PLC) is working normally.
		Connection failure	Check that the communication equipment such as the cable and branch unit to the communication master (PLC) are properly connected and working normally.
		DeviceNet board failure	Check the communication status and the LED status on the board to confirm that the DeviceNet board (SST-DN4-PCIE or SST-DN4-PCU-2) is working normally.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6060: CANNOT START HAND GUIDING(ROTATE)

External force is exceeding the allowable value when starting hand guiding.

Sub Code	Meaning	Cause	Remedy
	subcode:The direction that exceeds the allowable value is indicated by a bit. D01: Rx D02: Ry D03: Rz	Operation mistake	1. Reset the alarm. 2. Reduce the force for the hand guiding when starting.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6061: RECONFIGURE TORQUE SENSOR FAILED

An error occurred during reconfigure the torque sensor home position operation.

Sub Code	Meaning	Cause	Remedy
10	Failed to get the current home position.	Operation error	If any incomplete readback files exist, write or discard the files, and then try again.
		Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
11	Failed to send the reconfigure data.	Operation error	If any incomplete readback files exist, write or discard the files, and then try again.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
12	Failed to get the readback data.	Operation error	1. If opened TORQUE SENSOR ORG POS window, change to other window, and then try again. 2. If any incomplete readback files exist, write or discard the files, and then try again.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
13	Failed to write the readback data.	Operation error	1. If opened TORQUE SENSOR ORG POS window, change to other window, and then try again. 2. If any incomplete readback files exist, write or discard the files, and then try again.
		Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
23	Failed to cancel procedure.	Other	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

6061: RECONFIGURE TORQUE SENSOR FAILED (continued)

Sub Code	Meaning	Cause	Remedy
101	Timeout(Confirmation the current data).	Operation error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
102	Timeout(Confirmation the reconfigure data).	Operation error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
103	Timeout(Confirmation and write the readback data).	Operation error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
104	Timeout(Confirmation the complete signal).	Operation error	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).
255	Software operation failure	Software operation error occurred	1. After reset the alarm, turn the power OFF then back ON, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6067: DEST ROUTE ARITHMETIC ERROR

An error was detected during motion path calculation.

Sub Code	Meaning	Cause	Remedy
		Setting error	Check the following settings. • Execute the troubleshooting for the alarms which simultaneously occurred with this alarm.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6069: ABSOLUTE ACCURACY ERROR

Failed to execute the absolute accuracy.

Sub Code	Meaning	Cause	Remedy
1	Motion control that does not support the ABSAOFF was executed.	Setting error	Change the job so that ABSAOFF is not executed in motion control that does not supportt ABSAOFF.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6070: SYSTEM LIBRARY LOAD ERROR

Setup process was not properly completed when the power turned ON.

Sub Code	Meaning	Cause	Remedy
1	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
5	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
6	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
7	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
8	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
9	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
10	Setup process was not properly completed when the power turned ON.	Software operation error occurred	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6071: EtherNet/IP COMMUNICATION ERROR

A EtherNet/IP communication error has been detected.

Sub Code	Meaning	Cause	Remedy
	Sub code: Indicates a communication target station that has detected a communication error in 6-digit decimal [XX Y ZZZ] format. XX : IO module number Y : Channel number (always "0") ZZZ: Communication station number ("000":Scanner/always "001"-:Registered adapter number)	Setting error	Check the following. 1. Check that the EtherNet/IP communication settings are correct. 2. When using as an Adapter, check that the communication settings of the Scanner (communication master) match the communication settings of the YNX1000. 3. When using as a Scanner, check that the communication settings of the Adapter (communication slave) match the communication settings of the YNX1000.
		Communication target failure	1. When using as an Adapter, check that the Scanner (communication master) is working normally. 2. When using as a Scanner, make sure that all Adapters (communication slaves) are working normally.
		Connection failure	Check that the cables and communication devices such as HUBs between the Scanner (communication master) and Adapter (communication slave) are properly connected and working properly.
		EtherNet/IP module failure	Check that the EtherNet/IP module (CM-EI01M) is working normally by the communication status and the LED on the EtherNet/IP module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6200: COMBINATION ERROR

The capacities of the Servo amplifier and servo motor do not match.

Servo amplifier alarm A.050

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Out of combinable motor capacity range	1. Reset the alarm. 2. If the alarm occurs again, check that the capacity of the servo amplifier and the servo motor satisfy the following formula $1/4 \leq (\text{Servomotor capacity} / \text{Servo amplifier capacity}) \leq 4$
		Encoder failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo motor.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6201: INVALID SERVO ON COMMAND ALARM

Servo ON command was sent from the host device while the servo amplifier was executing the auxiliary function to Servo ON the motor.

Servo amplifier alarm A.0b0

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6202: VIBRATION ALARM

Abnormal vibration was detected in the motor speed.

Servo amplifier alarm A.520

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software setting failure	1. Reset the alarm. 2. If the alarm occurs again, check the job and consider reducing the motor speed.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6203: AUTOTUNING ALARM

Vibration detected during auto tuning.

Servo amplifier alarm A.521

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, turn OFF the power supply to the robot controller, then back ON.
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.

6203: AUTOTUNING ALARM (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6204: DYNAMIC BRAKE OVERLOAD

Rotational or kinetic energy has exceeded the capacity of the Dynamic Brake(DB) resistance during dynamic braking (DB) operation.

Servo amplifier alarm A.730, A.731

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software setting failure	- Reset the alarm. - If the alarm occurs again, check the following - Reduce the command speed of the servo motor. - Reduce the moment of inertia ratio or mass ratio. - Reduce the frequency of Dynamic brake stops.
		Motor is being driven by external forces.	- Reset the alarm. - If the alarm occurs again, check the following - Check the operating condition to see if the motor is being driven by external forces.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6206: INTERNAL TEMPERATURE ERROR 1 (CONTROL BOARD TEMPERATURE ERROR)

The ambient temperature of the servo amplifier control board is abnormal.

Servo amplifier alarm A.7A1

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Ambient temperature abnormal	- Reset the alarm. - If the alarm occurs again, check the following - Check the ambient temperature is compatible with the installation temperature of the servo amplifier.
		Excessive load or operation beyond regenerative processing capacity	- Reset the alarm. - If the alarm occurs again, check the following - Check load conditions and operating conditions.

6206: INTERNAL TEMPERATURE ERROR 1 (CONTROL BOARD TEMPERATURE ERROR) (continued)

Sub Code	Meaning	Cause	Remedy
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6207: INTERNAL TEMPERATURE ERROR 2 (POWER BOARD TEMPERATURE ERROR)

The ambient temperature of the servo amplifier power board is abnormal.

Servo amplifier alarm A.7A2

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Ambient temperature abnormal	- Reset the alarm. - If the alarm occurs again, check the following - Check the ambient temperature is compatible with the installation temperature of the servo amplifier.
		Excessive load or operation beyond regenerative processing capacity	- Reset the alarm. - If the alarm occurs again, check the following - Check load conditions and operating conditions.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6208: SERVOPACK BUILT-IN FAN STOPPED

The built-in FAN inside the servo amplifier is stopped.

Servo amplifier alarm A.7Ab

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Built-in FAN failure	- Reset the alarm. - If the alarm occurs again, check the following - Check to see if any foreign objects have entered the FAN.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6209: DRIVE SERIAL COMMUNICATIONS ERROR

Drive serial communication inside the servo amplifier is abnormal.

Servo amplifier alarm A.b00

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6210: POSITION DEVIATION OVERFLOW

Position deviation exceeds the specified level.

Servo amplifier alarm A.d00

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	System setting failure	- Reset the alarm. - If the alarm occurs again, check the following - Check load conditions and external forces conditions.
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Multi-axis servo amplifier -CN102A, CN102B, CN102C, CN102D, CN102E, CN102F - Single-axis servo amplifier -U, V, W
		Ground fault or short circuit	- Reset the alarm. - If the alarm occurs again, check if a ground fault has not occurred in the U-, V-, and W-phase of motor power line, or short circuit has not occurred between these phases.
		Servo motor failure	- Reset the alarm. - If the alarm occurs again, replace the servo motor.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	- Reset the alarm. - If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6211: POSITION DEVIATION OVERFLOW ALARM AT SERVO ON

Servo was turned ON while the position deviation exceeded the specified value during Servo OFF.

Servo amplifier alarm A.d01

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Motor is being driven by external force while Servo OFF	1. Reset the alarm. 2. If the alarm occurs again, check the following • Check the condition of the motor when the Servo OFF.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6212: POSITION DEVIATION OVERFLOW ALARM FOR SPEED LIMIT AT SERVO ON

Excessive position deviation alarm level setting was exceeded during Servo ON.

Servo amplifier alarm A.d02

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation failure	1. Reset the alarm. 2. If the alarm occurs again, turn OFF the power supply to the robot controller, then back ON.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6213: MECHATROLINK INTERNAL SYNCHRONIZATION ERROR 1

A synchronization error occurred during MECHATROLINK communications with the servo amplifier.

Servo amplifier alarm A.E02

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6214: MECHATROLINK TRANSMISSION CYCLE SETTING ERROR

The setting of the MECHATROLINK communications transmission cycle is not correct.

Servo amplifier alarm A.E40

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6215: MECHATROLINK SYNCHRONIZATION ERROR

A synchronization error occurred during MECHATROLINK communications.

Servo amplifier alarm A.E50

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6216: MECHATROLINK SYNCHRONIZATION FAILED

Synchronization failed during MECHATROLINK communications.

Servo amplifier alarm A.E51

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6217: RECEPTION ERROR IN MECHATROLINK COMMUNICATIONS

Communications errors occurred continuously during MECHATROLINK communications.

Servo amplifier alarm A.E60

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6218: SYNCHRONIZATION INTERVAL ERROR IN MECHATROLINK TRANSMISSION CYCLE

An error occurred in the transmission cycle during MECHATROLINK communications.

Servo amplifier alarm A.E61

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6219: MECHATROLINK SYNCHRONIZATION FRAME NOT RECEIVED

Synchronization frames were continuously not received during MECHATROLINK communications.

Servo amplifier alarm A.E63

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6220: COMMAND EXECUTION TIMEOUT

A timeout error occurred for a MECHATROLINK command.

Servo amplifier alarm A.Ed1

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6221: MAIN CIRCUIT DETECTOR ERROR

There is an error in the detection data for the main circuit.

Servo amplifier alarm A.030

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6223: MAIN CIRCUIT POWER SUPPLY WIRING ERROR

AC power input/DC power input setting is incorrect or power supply wiring is incorrect.

Servo amplifier alarm A.330

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6224: MECHATROLINK COMMUNICATIONS SETTING ERROR

There is an error in the MECHATROLINK communications settings.

Servo amplifier alarm A.E43

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6225: MECHATROLINK INTERNAL SYNCHRONIZATION ERROR 2

A synchronization error occurred during MECHATROLINK communications with the servo amplifier.

Servo amplifier alarm A.EA2

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6226: CONVERTER INSTANTANEOUS OVERLOAD

The converter operated for several seconds to several tens of seconds with the rated output of the converter greatly exceeded.

Servo amplifier alarm A.719

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software setting failure	- Reset the alarm. - If the alarm occurs again, check the following - Check tools or workpieces exceed the allowable load. - Adjust the operating speed of the robot and external axes.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6227: CONVERTER CONTINUOUS OVERLOAD

The converter continuous operated with the rated output of the converter exceeded.

Servo amplifier alarm A.729

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software setting failure	- Reset the alarm. - If the alarm occurs again, check the following - Check tools or workpieces exceed the allowable load. - Adjust the operating speed of the robot and external axes.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6228: CONVERTER TEMPERATURE ERROR 1

The ambient temperature of the servo amplifier converter control board is abnormal.

Servo amplifier alarm A.7b9

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Exhaust or intake vents failure	- Reset the alarm. - If the alarm occurs again, check the following - Check that the exhaust or intake vents are not blocked.
		Ambient temperature abnormal	- Reset the alarm. - If the alarm occurs again, check the following - Check the ambient temperature is compatible with the installation temperature of the servo amplifier.

6228: CONVERTER TEMPERATURE ERROR 1 (continued)

Sub Code	Meaning	Cause	Remedy
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6229: CONVERTER TEMPERATURE ERROR 2

The ambient temperature of the servo amplifier converter power control board is abnormal.

Servo amplifier alarm A.7bA

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Exhaust or intake vents failure	- Reset the alarm. - If the alarm occurs again, check the following - Check that the exhaust or intake vents are not blocked.
		Ambient temperature abnormal	- Reset the alarm. - If the alarm occurs again, check the following - Check the ambient temperature is compatible with the installation temperature of the servo amplifier.
		Servo Amplifier failure	- Reset the alarm. - If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6240: DC 24V POWER SUPPLY FAILURE(SERVO)

The power supply of a shock sensor is abnormal.

Sub Code	Meaning	Cause	Remedy
		A Power supply failure	- Reset the alarm. - If the alarm occurs again, check the power supply system.

◆ 6241: M-SAFETY COMMUNICATE ERROR

The communication error occurred between the Machine-Safety and the robot safety module.

Sub Code	Meaning	Cause	Remedy
1	There was no response from robot safety module within the time limit.	Connection failure	Check the connection and insertion of the following boards. - Robot control module - AIF01 board - Robot safety module
		Robot safety module failure	- Turn the power OFF then back ON. - If the alarm occurs again, replace the robot safety module.

6241: M-SAFETY COMMUNICATE ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD CARD that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Calculation results do not match the receive data.	Connection failure	Check the connection and insertion of the following boards. • Robot control module • AIF01 board • Robot safety module
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD CARD that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3	Calculation results do not match the receive data on a logical circuit.	Connection failure	Check the connection and insertion of the following boards. • Robot control module • AIF01 board • Robot safety module
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD CARD that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4	Here was no response from robot control module within the time limit.	Connection failure	Check the connection and insertion of the following boards. • Robot control module • AIF01 board • Robot safety module
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.

6241: M-SAFETY COMMUNICATE ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot control module. After replacing the board, remove the SD CARD that has been inserted into the robot control module to be removed, insert it the new robot control module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6242: M-SAF CPU BOARD COMM ERROR

The communication error was detected at Machine Safety Software.

Sub Code	Meaning	Cause	Remedy
1	Incorrect data was detected on communication between robot safety modules.	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2	Communication error was detected (RSF - RSF).	Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6244: EXCEPTION CLAUSE UNDEFINED

The exception clause is unregistered.

Sub Code	Meaning	Cause	Remedy
	No exception clause was registered in the job that executed the RAISE instruction.	Software operation error occurred	Teach the EXCEPT instruction within the job that taught the RAISE instruction.

◆ 6245: BRAKE ENABLE FEEDBACK ERROR -LOCK(SERVO)

Attempted to lock the brake, but it does not work.

The status of feedback from the brake control board is inconsistent with the brake command status of the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Robot safety module -CN3 - Multi-axis servo amplifier (brake control board) -CN203 - Single-axis brake control unit -CN22 - Extension safety I/O unit (rotary switch : 1, 3) -CN2
		Brake control board failure	- Reset the alarm. - If the alarm occurs again, replace the multi-axis servo amplifier (brake control board) where the alarm occurred. Save the CMOS.BIN before replacing the board to be safe.
		Single-axis brake control unit failure	- Reset the alarm. - If the alarm occurs again, replace the single-axis brake control unit where the alarm occurred.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module where the alarm occurred. Save the CMOS.BIN before replacing the module to be safe.
		Extension safety I/O unit failure	- Reset the alarm. - If the alarm occurs again, replace the extension safety I/O unit where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6246: BRAKE ENABLE FEEDBACK ERROR -RELEASE(SERVO)

Attempted to release the brake, but it does not work.

The status of feedback from the brake control board is inconsistent with the brake command status of the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and insertion of the following cables and connectors. - Robot safety module -CN3 - Multi-axis servo amplifier (brake control board) -CN203 - Single-axis brake control unit -CN22 - Extension safety I/O unit (rotary switch : 1, 3) -CN2
		Brake control board failure	- Reset the alarm. - If the alarm occurs again, replace the multi-axis servo amplifier (brake control board) where the alarm occurred. Save the CMOS.BIN before replacing the board to be safe.

6246: BRAKE ENABLE FEEDBACK ERROR -RELEASE(SERVO) (continued)

Sub Code	Meaning	Cause	Remedy
		Single-axis brake control unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the single-axis brake control unit where the alarm occurred.
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module where the alarm occurred. Save the CMOS.BIN before replacing the module to be safe.
		Extension safety I/O unit failure	1. Reset the alarm. 2. If the alarm occurs again, replace the extension safety I/O unit where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6247: BRAKE HOLDING VOLTAGE COMMAND ERROR

The state of feedback from the servo amplifier is inconsistent with the state of brake holding voltage assumed by the Robot control module (Servo processing).

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Servo Amplifier failure	1. Reset the alarm. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers to be safe.
		Robot control module failure	1. Reset the alarm. 2. If the alarm occurs again, save CMOS.BIN before replacing the robot control module. Replace the robot control module, and then remove the SD card from the failed robot control module to insert it into the new robot control module. After replacing the robot control module, load CMOS.BIN.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6248: MECHATROLINK CYCLIC COMMUNICATION ERROR

MECHATROLINK cyclic communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6249: MECHATROLINK COMMUNICATION ERROR

MECHATROLINK communication error was detected.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Connection failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot control module -CN3 • Multi-axis servo amplifier -CN6A,CN6B • Single-axis servo amplifier -CN6A,CN6B
		Servo amplifier failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, replace the servo amplifiers where the alarm occurred. Save the CMOS.BIN before replacing the servo amplifiers.

6249: MECHATROLINK COMMUNICATION ERROR (continued)

Sub Code	Meaning	Cause	Remedy
		Robot control module failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save CMOS.BIN, and then replace the robot control module. After replacing the robot control module, load CMOS.BIN.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6250: SIMULTANEOUS EXECUTION ERROR

Linear servo float has been enabled in multiple control groups.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	1. Reset the alarm and modify the job so that only one control group has linear servo float enabled. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 6251: SINGULAR POINT ERROR DURING FORCE CONTROL

Force control system detected the singular posture.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Reset the alarm, and then modify the toughed robot posture avoiding singularity points. 2. If the alarm occurs again, save the CMOS.BIN in maintenance mode, and then contact your YASKAWA representative about occurrence status (operating procedure)

◆ 6253: CALCULATED TORQUE SATURATION ERROR(SERVO)

Calculated torque saturation was detected in the servo process of the robot control module.

Sub Code	Meaning	Cause	Remedy
	The data [X____] indicates the generation process. 10000: Observer control 20000: High-precision path control 30000: Dynamics 40000: Disturbance observer control 50000: New observer control The data [____Z] indicates the physical axis number.	Tool file setting error	Check the tool file setting. (Check the values or units, signs about mass or center of gravity, inertia.)
		Motor load error	Overload is applied to the manipulator. Correct the tools, the work pieces, and the drive condition.
		Setting error	1. Reduce the speed in the step where the alarm occurred. 2. Change the move instruction to joint interpolation (MOVJ). * Be careful to the peripheral interference since its movement changes.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6254: CALCULATED VELOCITY SATURATION ERROR(SERVO)

Calculated velocity saturation was detected in the servo process of the robot control module.

Sub Code	Meaning	Cause	Remedy
	The data [X____] indicates the generation process. 10000: Observer control 20000: High-precision path control 30000: Dynamics 40000: Disturbance observer control 50000: New observer control The data [____Z] indicates the physical axis number.	Tool file setting error	Check the tool file setting. (Check the values or units, signs about mass or center of gravity, inertia.)
		Motor load error	Overload is applied to the manipulator. Correct the tools, the work pieces, and the drive condition.

6254: CALCULATED VELOCITY SATURATION ERROR(SERVO) (continued)

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Reduce the speed in the step where the alarm occurred. 2. Change the move instruction to joint interpolation (MOVJ). * Be careful to the peripheral interference since its movement changes.
		Software operation failure	1. Turn OFF the power supply to the robot controller, then back ON. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6255: BRAKE CONTROL BOARD RELAY ERROR(SERVO)

Status unmatched was detected between relays on brake control board.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Connection failure	1. Reset the alarm. 2. If the alarm occurs again, check the connection and insertion of the following cables and connectors. • Robot safety module -CN3 • Multi-axis servo amplifier (brake control board) -CN203
		Robot safety module failure	1. Reset the alarm. 2. If the alarm occurs again, replace the robot safety module where the alarm occurred. Save the CMOS.BIN before replacing the module to be safe.
		Brake control board failure	1. Reset the alarm. 2. If the alarm occurs again, replace the Multi-axis servo amplifier (brake control board) where the alarm occurred. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6256: INPUT POWER SUPPLY SETTING ERROR(SERVO)

The input power supply specification is not available in the system.

Sub Code	Meaning	Cause	Remedy
0	A single-phase power supply specification is set for a system only available three-phase power supply.	Setting error	Change the input power supply to three-phase and set S2C2050=0 (three-phase input power specification).
1	A three-phase power supply specification is set for a system only available single-phase power supply.	Setting error	Change the input power supply to single-phase and set S2C2050=1 (single-phase input power specification).

◆ 6259: ACU CONNECTION ERROR

Connection error of ACU occurred.

Sub Code	Meaning	Cause	Remedy
0	Communication connection with ACU failed.	Connection retry timeout	1. Check connector of the cable is inserted correctly. 2. Turn the control power OFF then back ON. 3. If the alarm occurs again, save the CMOS.BIN and system log of acu, and then contact your YASKAWA representative about occurrence status (operating procedure). If the connection with ACU fails, the alarm will occur again even if you reset the alarm. If you need to operate the robot in an emergency, change the parameter to disable the alarm(RS [477] = 1).
1	Communication connection with ACU has been disconnected.	Communication timeout	1. Check connector of the cable is inserted correctly. 2. Turn the control power OFF then back ON. 3. If the alarm occurs again, save the CMOS.BIN and system log of acu, and then contact your YASKAWA representative about occurrence status (operating procedure). If the connection with ACU fails, the alarm will occur again even if you reset the alarm. If you need to operate the robot in an emergency, change the parameter to disable the alarm(RS [477] = 1).

◆ 6260: ACTIVE FORCE CONTROL SET ERROR

Failed to set active force control.

Sub Code	Meaning	Cause	Remedy
1	Failed to set active force control.	Active force control could not be started normally.	1. Reset the alarm and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2		Active force control could not be started normally.	1. Reset the alarm and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3		No valid axis for active force control was specified.	1. Reset the alarm, specify a valid axis for active force control, and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4		Unsupported robot.	This robot does not support this function.
5		Mode specification error	The mode is incorrect. Ensure that the active force control mode ("Start" / "Set") is correctly configured.
6		Force sensor offset adjustment failed.	1. Reset the alarm and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6261: ACTIVE FORCE CONTROL CANCEL ERROR

Failed to cancel active force control.

Sub Code	Meaning	Cause	Remedy
1	Failed to cancel active force control.	Active force control could not be completed normally.	1. Reset the alarm and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6262: SIGMA LINK2 SAFETY ENCODER PROCESS ERROR

An error is detected in the communication between Robot safety module and encoder.

Sub Code	Meaning	Cause	Remedy
	Sub Code: error code	Setting error	Sub Code: 0 The setting of safety address is not completed for safety monitoring. 1. Check the safety address setting. 2. Check your configuration in maintenance mode.
		Setting error	Sub Code: 1 Servo on request is detected, but encoder communication is not ready. 1. Reset the alarm. 2. Check the safety address setting. 3. Check your configuration in maintenance mode.
		Setting error	Sub Code: error code The last two digits (10th digit and 1st digit) indicate the address where the error is detected. 1. Check the safety address setting. 2. Check your configuration in maintenance mode.
		Connection failure	Sub Code: error code The last two digits (10th digit and 1st digit) indicate the address where the error is detected. If there are alarms occurring simultaneously, see troubleshooting for the alarms.
		Other	Sub Code: error code The last two digits (10th digit and 1st digit) indicate the address where the error is detected. 1. If there are alarms occurring simultaneously, see troubleshooting for the alarms. 2. Turn OFF the power supply to the robot controller, then back ON. 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6263: M-SAF GP.INPUT SIG. ERROR

A mismatch in the general purpose safety input signal was detected by the robot safety module.

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - Connected outside devices of GSIN signal line and IM-YE250/5-80P terminal board. - robot safety module - IM-YE250/5-80P terminal board cable. - Check connectors of the connected outside devices of GSIN signal line.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board, which is connected to the GSIN signal on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6264: M-SAF GP.INPUT DIAG. ERROR

An error was detected in the self-diagnostic function of the general purpose safety input signal.

Sub Code	Meaning	Cause	Remedy
		Connection failure	- Reset the alarm. - If the alarm occurs again, check the connection and inserting state of the following cables and connectors. - IM-YE250/5-80P terminal board - robot safety module - IM-YE250/5-80P terminal board cable - Check connectors of the connected outside devices of GSIN signal line. - Check that the connection destination of the duplicated signal is correct.
		Robot safety module failure	- Reset the alarm. - If the alarm occurs again, replace the robot safety module. In a system where a plurality of robot safety modules are connected, replace the board on which the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6265: DEST INTERPOLATION INVALID

Operation to the position and posture in which the interpolation is impossible was occurred in the motion target position.

It may occur when the interpolation motion to the position in which the operation area is exceeded is performed, when the arm expands, or when the interpolation motion to the target position that cannot keep the position and posture is performed.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Check the position setting for the step (move instruction) where the alarm occurred.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6273: TORQUE SENSOR OVER LOAD

A error occurred in the lotus.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Module failure(LOTUS)	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the LOTUS.
		Overloading	Check that the load does not exceed the allowable limit.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your Yaskawa representative about occurrence status (operating procedure).

◆ 6276: Excessive load at emergency stop

Excessive load occurred during the emergency stop. There may be a misalignment.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred	Macha	1. Reset the alarm. 2. Check the position.

◆ 6277: OSCILATION DETECTION

Robot vibration is detected during force control.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Setting error	1. Reset the alarm. If the inertia setting value for active/passive force control is not 100%, set it to 100%. 2. For active force control, reset the alarm and increase the viscosity setting of the active force control by 5 rad/s incrementally. 3. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6278: SEGMENT PULSE DETECTED DURING HAND GUIDING

A motion command is detected during hand guiding.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	Software operation error occurred	1. Reset the alarm and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6280: PASSIVE FORCE CONTROL SET ERROR

Failed to set passive force control.

Sub Code	Meaning	Cause	Remedy
1	Failed to set passive force control.	Passive force control could not be started normally.	1. Reset the alarm and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2		Passive force control could not be started normally.	1. Reset the alarm and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3		No valid axis for passive force control was specified.	1. Reset the alarm, specify a valid axis for passive force control, and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4		Unsupported robot.	This robot does not support this function.
5		Mode specification error	The mode is incorrect. Ensure that the passive force control mode ("Start" / "Set") is correctly configured.

◆ 6281: PASSIVE FORCE CONTROL CANCEL ERROR

Failed to cancel passive force control.

Sub Code	Meaning	Cause	Remedy
1	Failed to cancel passive force control.	Passive force control could not be completed normally.	1. Reset the alarm and execute the job again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6282: HAND GUIDING SET ERROR

Failed to set hand guiding.

Sub Code	Meaning	Cause	Remedy
1	Failed to set hand guiding.	Hand guiding could not be started normally.	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
2		Hand guiding could not be started normally.	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
3		No valid axis for hand guiding was specified.	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).
4		Unsupported robot.	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6283: HAND GUIDING CANCEL ERROR

Failed to cancel hand guiding.

Sub Code	Meaning	Cause	Remedy
1	Failed to cancel hand guiding.	Hand guiding could not be completed normally.	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6286: MotoPlus memory access error

An Illegal Memory Access occurred in the MotoPlus application executing

Sub Code	Meaning	Cause	Remedy
1	An Illegal Memory Access occurred in the MotoPlus application executing	Setting error	Review the application software on the following points. 1. Check out if any pointer used places not to be set illegal data like as NULL 2. Check out if set illegal value to argument of MotoPlus API
2	Stack overflow was occurred in the MotoPlus application executing	Setting error	MotoPlus application's stack size for each task is 40Kbyte. So check out if not to be defined local variable size exceeding the above mentioned size.

◆ 6287: ENCODER SAFE ADDRESS SETTING ERROR

Encoder safe address setting error is detected in start up process.

Sub Code	Meaning	Cause	Remedy
1		Setting error	Check the encoder safe address setting value.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6290: ROBOT MODEL MISMATCH(SV)

The connected robot is different from a robot set to this controller.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Signifies the axis in which the alarm occurred.	The robot of the different model was connected to a robot set to a controller.	Confirm a robot model set to a controller, and reconnect.
		A motor used in the robot of the different model was connected.	When replacing the motor, perform home positioning after resetting the alarm.

◆ 6291: COMPENSATION CALC ERROR

An error occurred in the calculation of the compensation function.

Sub Code	Meaning	Cause	Remedy
1	COMPENSATION LIMIT OVER	Software operation error occurred	1. Reset the alarm, and then try again. 2. If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6292: PFL CANNOT OPERATE TEMP DSBL

Cannot change to play mode, when PFL disable mode is ON temporarily.

Sub Code	Meaning	Cause	Remedy
		Setting error	1. Change to teach mode. 2. Reset the alarm, and then try again.
		Robot safety module failure	1. Turn the power OFF then back ON. 2. If the alarm occurs again, replace the robot safety module. Save the CMOS.BIN before replacing the board to be safe.
		Other	If the alarm occurs again, save the CMOS.BIN, and then contact your YASKAWA representative about occurrence status (operating procedure).

◆ 6297: SENSOR MODE SELECT ERROR

A sensor that is not supported in force control has been specified.

Sub Code	Meaning	Cause	Remedy
	Sub Code: Control group	Setting error	Check the sensor mode setting of force control.

YNX1000

Alarm Codes

(Minor Alarms)

For inquiries or after-sales service on this product, contact your local YASKAWA representative as shown below.

YASKAWA ELECTRIC CORPORATION

2-1 Kurosakishiroishi, Yahatanishi-ku, Kitakyushu, 806-0004, Japan
Phone: +81-93-645-7703 Fax: +81-93-645-7802
www.yaskawa.jp

YASKAWA AMERICA, INC. (MOTOMAN ROBOTICS DIVISION)

100 Automation Way, Miamisburg, OH 45342, U.S.A.
Phone: +1-937-847-6200 Fax: +1-937-847-6277
www.motoman.com

YASKAWA EUROPE GmbH (ROBOTICS DIVISION)

Yaskawastrasse 1, 85391, Allerhausen, Germany
Phone: +49-8166-90-0 Fax: +49-8166-90-103
www.yaskawa.eu.com

YASKAWA NORIDC AB

Verkstadsgratan 2, Box 504, SE-385 25 Torsås, Sweden
Phone: +46-480-417-800 Fax: +46-486-414-10
www.yaskawa.com.cn

YASKAWA ELECTRIC (CHINA) CO., LTD.

22F, One Corporate Avenue, No.222 Hubin Road, Huangpu District, Shanghai 200021, China
Phone: +86-21-5385-2200 Fax: +86-21-5385-3299
www.yaskawa.com.cn

YASKAWA SHOUGANG ROBOT CO., LTD.

No.2 Building, No.6 Rongchang East Street, Beijing E&T Development Area, Beijing 100176, China
Phone: +86-10-6788-0545
www.ysr-motoman.cn

YASKAWA ELECTRIC KOREA CORPORATION

6F, 11, LS-ro, Dongang-gu, Anyang-si, Gyeonggi-do, 14118, Korea
Phone: +82-31-8015-4224 Fax: +82-31-8015-5034
www.yaskawa.co.kr

YASKAWA ELECTRIC TAIWAN CORPORATION

12F, No.207, Sec. 3, Beishin Rd., Shindian District, New Taipei City 23143, Taiwan
Phone: +886-2-8913 Fax: +886-2-8913-1513
www.yaskawa.com.tw

YASKAWA ASIA PACIFIC PTE. LTD.

30A Kallang Place, #06-01, 339213, Singapore
Phone: +65-6282-3003 Fax: +65-6289-3003
www.yaskawa.com.sg

YASKAWA ELECTRIC (THAILAND) CO., LTD.

59, 1st-5th Floor, Flourish Building, Soi Ratchadapisek 18, Ratchadapisek Road, Huaykwang, Bangkok 10310, Thailand
Phone: +66-2-017-099 Fax: +66-2-017-0199
www.yaskawa.co.th

PT. YASKAWA ELECTRIC INDONESIA

Secure Building-Gedung B Lantai Dasar & Lantai 1 Jl. Raya Protokol Halim Perdanakusuma, Jakarta 12610, Indonesia
Phone: +62-21-2982-6470 Fax: +62-21-2982-6471
www.yaskawa.co.id

YASKAWA INDIA PRIVATE LIMITED (ROBOTICS DIVISION)

No. 136, Sector-8, Industrial Estate, IMT Manesar, Gurugram, Haryana 122050, India
Phone: +91-124-475-8500
www.yaskawaindia.in

©2024 YASKAWA ELECTRIC CORPORATION
Published by YASKAWA

YASKAWA

YASKAWA ELECTRIC CORPORATION