


Problems feeding thin paper on the Muller Spine Creaser

Customer have informed us of a bubbling or fish tailing effect which can occur while creasing approximately the last 75mm of the cover on the Muller gather, stitch and trim cover feeder machines.

After several prototypes I am now pleased to inform you we have now developed a simple and effective solution to overcome the problem.

By placing a special tape under the feed belts, it builds up the level of the drum so it feeds thin cover stock completely level with the creasing unit and therefore completely eliminates the bubbling effect.


(The simple procedure is shown in the photos below)

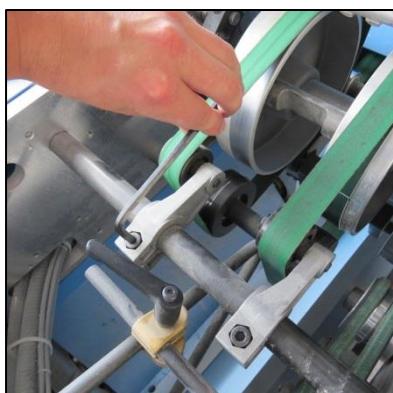

Loosen the drum tape tensioning arm



Position the special tape on to the cleaned drum making sure it is placed directly under the belt.

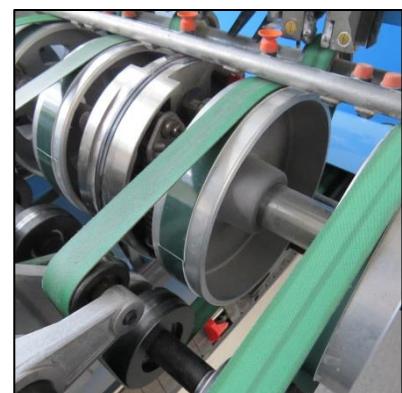

Cut the tape so there is no overlap and then retention the belt.

The tape incorporates a self adhesive backing, with a hard wearing outer surface and incorporating a foam centre.

The tape can be purchased in 6 x metre rolls which is enough to apply 2 complete recoveries at a cost of £10.00 per roll.