
Claw Rev B: the off-board wiring, every wire (pairs with breadboard_layout_claw.png)

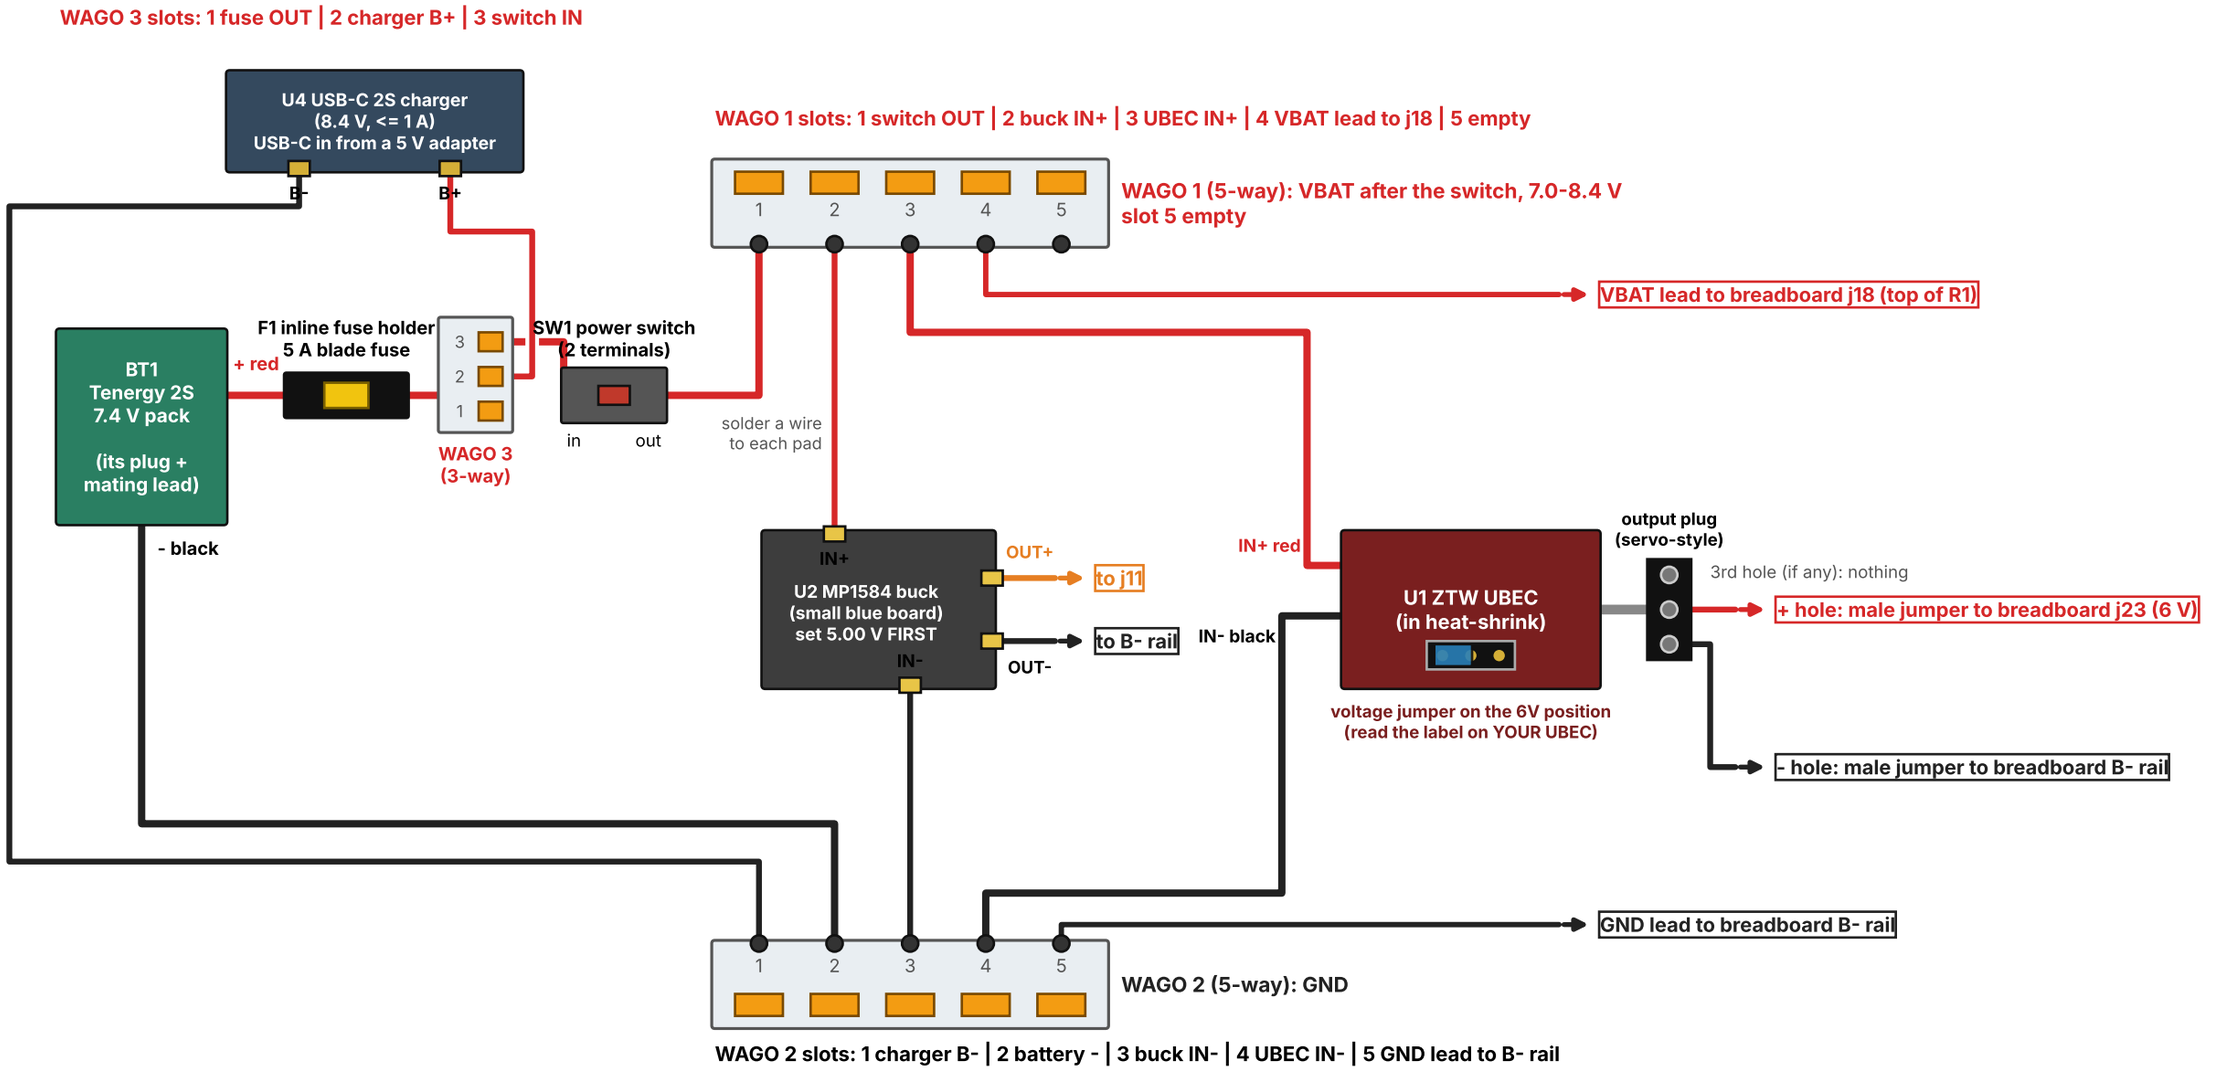

Order, with the battery UNPLUGGED and SW1 OFF:
1. Solder wire leads to the MP1584 pads (IN+, IN-, OUT+, OUT-). Red for +, black for -.
2. Battery side, 18-20 AWG: BT1 + -> fuse holder -> WAGO 3; WAGO 3 -> SW1 'in'; SW1 'out' -> WAGO 1 slot 1.
3. Charger: B+ -> WAGO 3 slot 2, B- -> WAGO 2 slot 1. Battery - -> WAGO 2 slot 2.
4. Modules: buck IN+ and UBEC IN+ -> WAGO 1 (slots 2, 3); buck IN- and UBEC IN- -> WAGO 2 (slots 3, 4).
5. Leave the module OUTPUTS loose. Plug in the battery, SW1 ON, meter the outputs: buck 5.00 V (trim the screw), UBEC 6.0 V (move its jumper). SW1 OFF.
6. Only now: buck OUT+ -> j11, OUT- -> B-; UBEC plug + -> j23, - -> B-; WAGO 1 slot 4 -> j18; WAGO 2 slot 5 -> B-.

Strip 11 mm for a WAGO 221, push the wire in fully, close the lever, tug it. Charge only with SW1 OFF.