g	GE Energy		Functional Testing Specification					
	Inspection & Repair Services Louisville, KY				LOU-GED-DS200PCCAG2			
	Test Procedure for a DS200PCCAG2 power connect card							
REV.	DOCUMENT REVISION STATUS: Determined by the last entry in the "REV" and "DATE" column REV. DESCRIPTION SIGNATURE REV. DATE							
A	Initial Release	DESCRIPTION			reenwell	2/27/2009		
						2,2,,2000		
© COPYRIGHT GENERAL ELECTRIC COMPANY Hard copies are uncontrolled and are for reference only PROPRIETARY INFORMATION – THIS DOCUMENT CONTAINS PROPRIETARY INFORMATION OF GENERAL ELECTRIC COMPANY AND MAY NOT BE USED OR DISCLOSED TO OTHERS, EXCEPT WITH THE WRITTEN PERMISSION OF GENERAL ELECTRIC COMPANY.								
	ARED BY y Greenwell	REVIEWED BY	REVIEWE	D BY	Charlie U			
DATE 2/27/2	2009	DATE	DATE		DATE 3/2/2009			

g

LOU-GED-DS200PCCAG2 REV. A

GE Energy Inspection & Repair Services Louisville, KY Page 2 of 6

Functional test procedure for a DS2000 Power Connect Card.

1. SCOPE

1.1 This is a functional testing procedure for a DS200PCCAG2 power connect card.

2. STANDARDS OF QUALITY

2.1 Refer to the current revision of the IPC-A-610 standard for workmanship standards.

3. APPLICABLE DOCUMENTS

- 3.1 The following document(s) shall form part of this specification to the extent specified herein. Unless otherwise indicated, the latest issue shall apply.
 - 3.1.1 GEK85769A or GEJ7301

4. ENGINEERING REQUIREMENTS

- 4.1 Equipment Cleaning
 - **4.1.1** Equipment should be clean and free of debris prior to applying power unless performing an initial check. Refer to the local documented procedures for cleaning guidelines.
- 4.2 Equipment Inspection
 - **4.2.1** Equipment should be visually inspected for any defects prior to applying power. This inspection should include the following as a minimum:
 - 4.2.1.1 Wires broken or cracked
 - 4.2.1.2 Terminal strips / connectors broken or cracked
 - **4.2.1.3** Loose wires
 - 4.2.1.4 Components visually damaged
 - 4.2.1.5 Capacitors leaking
 - 4.2.1.6 Solder joints damaged or cold
 - 4.2.1.7 Circuit board burned or de-laminated
 - 4.2.1.8 Printed wire runs burned or damaged

5. EQUIPMENT REQUIRED

5.1 The following equipment is required to perform the process requirements. Equipment may be substituted provided that all accuracy's and test ratios are equivalent or better:

Qty	Reference #	Description
1		Fluke 85 DMM (or Equivalent)
1		100 Ohm Resistor
1		SCR firing box
1		O-Scope
1		BNC to Banana jack adapter
1		24Vdc power supply
1		120 VAC Variac
1		Resistor Box (22.1K)

LOU-GED-DS200PCCAG2
REV. A

GE Energy
Inspection & Repair Services
Louisville, KY

Page 3 of 6

6. TESTING PROCESS

6.1 Resistance Tests

6.1.1 Verify the proper resistance between each pair of points listed below:

STEP	FROM	TO	LOW LIMIT	HIGH LIMIT
4.1	1ACS	P1	1.314 Meg	1.342 Meg
4.2	2ACS	P1	1.314 Meg	1.342 Meg
4.3	3ACS	P1	1.314 Meg	1.342 Meg
4.4	DCS	P1	1.314 Meg	1.342 Meg
4.5	4ACS	P2	1.314 Meg	1.342 Meg
4.6	5ACS	P2	1.314 Meg	1.342 Meg
4.7	6ACS	P2	1.314 Meg	1.342 Meg
4.8	P1	P6	1.269 Meg	1.295 Meg
4.9	P6	P10	814.7 K	831.2 K
4.10	P10	P5	1.072 Meg	1.094 Meg
4.11	P5	P9	568.3 K	579.7 K
4.12	P2	P3	1.269 Meg	1.295 Meg
4.13	P3	P7	814.7 K	831.2 K
4.14	P7	P4	1.072 Meg	1.094 Meg
4.15	P4	P8	568.3 K	579.7 K

6.2 Visual Test

- **6.2.1** Verify that T1F through T6F are part number 323A2335P2.
- **6.2.1** Verify that R1, R3, R5, R7, R9 and R11 are 15-OHM 2W resistors.

g

LOU-GED-DS200PCCAG2 REV. A

GE Energy Inspection & Repair Services Louisville, KY

Page 4 of 6

6.3 Snubber Test


6.3.1 For the points listed below, apply 100 +/-1 VAC through a 22.1K resistor to point A with respect to point B. Then verify a voltage drop of 68 +/- 4 VAC across the 22.1K resistor. See figure 1 & 2 for more information.

Point A	Point B		
4ACS	P2		
5ACS	P2		
6ACS	P2		
DCS	P1		

Figure 1

Point A	Point B
1ACS	P1
2ACS	P1
3ACS	P1

Figure 2



6.3.2 Disconnect and remove 100VAC source.

6.4 Pulse Circuit Test

- **6.4.1** Connect 5PLto positive output of 24V dc power supply.
- **6.4.2** Connect 5PL1 to NEGATIVE non-isolated connection on SCR firing box.
- **6.4.3** Connect negative output of 24V dc power supply to COM on non-isolated side of SCR firing box.
- **6.4.4** Connect Scope to 6FPL (Common to pin 1 and Signal to pin 2).
- **6.4.5** Set scope Vertical to 5 V/div and Horizontal to .2 mSec/div.
- **6.4.6** Verify SCR firing box is set to NORMAL and apply power.
- **6.4.7** Turn output to max and verify loaded output signal is above 10Vpp and remains steady throughout adjustment range of SCR firing box. See Figure 2 next page. Removing 100-ohm load on scope leads should allow output to increase to above 15Vpp.


LOU-GED-DS200PCCAG2 REV. A **GE Energy** Inspection & Repair Services Louisville, KY

Page 5 of 6

6.4.8 Repeat this test for the remaining circuits using the information in table 1.

g

Circuit	+ 24 VDC	SCR Box -	Scope +	Scope -
Under test		Firing pulse		
6FPL	5PL22	5PL1	6FPL2	6FPL1
5FPL	5PL22	5PL3	5FPL2	5FPL1
4FPL	5PL22	5PL5	4FPL2	4FPL1
3FPL	5PL22	5PL7	3FPL2	3FPL1
2FPL	5PL22	5PL9	2FPL2	2FPL1
1FPL	5PL22	5PL11	1FPL2	1FPL1

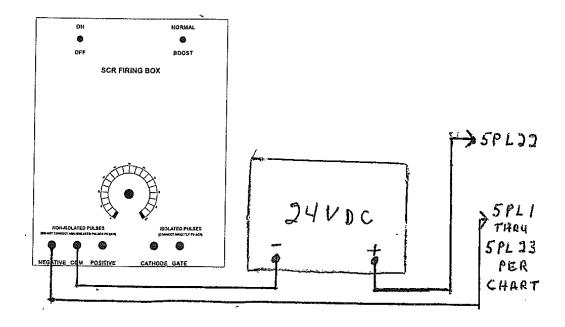

6.5 ***TEST COMPLETE ***

LOU-GED-DS200PCCAG2
REV. A

GE Energy
Inspection & Repair Services
Louisville, KY

Page 6 of 6

7. NOTES

Figure 2

