



NANOSPECT AI — RESIDENTIAL HOUSING INSPECTION REPORT

100 E University
04/20/2026



Placeholder Name
Building Inspector
placeholder@nanospect.com



Placeholder Name
Building Inspector
placeholder@gmail.com



Placeholder Name
Building Inspector
placeholder@nanospect.com

Table of Contents

Finding 1: INTERIOR BASEBOARD SEPARATION2

Finding 2: EXPOSED ELECTRICAL WIRING2

Finding 3: INOPERABLE CEILING LIGHT2

Finding 4: DAMAGED HVAC REGISTER3

Finding 5: WARPED AND SEPARATED BASEBOARD3

Finding 6: EVIDENCE OF MOISTURE STAIN4

Finding 7: EXPOSED ELECTRICAL WIRING4

Finding 8: DAMAGED INTERIOR DRYWALL5

Finding 9: NON-STANDARD ELECTRICAL RECEPTACLE5

Finding 10: DISPLACED CEILING TILE6

INSPECTION FINDINGS

Finding 1: INTERIOR BASEBOARD SEPARATION

Minor Defect / FYI

A continuous gap is observed between the top edge of the baseboard trim and the adjacent wall surface. This separation appears to be a result of material shrinkage over time, minor structural settling, or the failure of the original adhesive or fasteners. The condition is currently cosmetic but presents a potential entry point for insects and allows for the accumulation of dust and debris. If left unaddressed, the gap may widen due to normal temperature and humidity fluctuations. Furthermore, this condition compromises the finished aesthetic of the interior space and can make cleaning more difficult.



Finding 2: EXPOSED ELECTRICAL WIRING

Significant Defect

Hallway Wall

An open electrical junction box was observed in the wall, leaving energized wires and connection points exposed. This condition typically occurs when a light fixture or cover plate has been removed and not properly replaced. The absence of a protective cover presents a significant electrical shock hazard to occupants, especially if the wires are inadvertently touched. Additionally, the open box is susceptible to accumulating dust and combustible materials, which increases the risk of an electrical fire. This is a serious safety violation that requires immediate attention to prevent potential injury or property damage.



Finding 3: INOPERABLE CEILING LIGHT

Marginal Defect

Hallway Ceiling

The central recessed troffer light fixture located in the hallway ceiling was found to be non-functional at the time of the inspection. The probable cause for this condition could range from a simple burnt-out bulb or a failed ballast to a more complex issue with the electrical wiring or the controlling switch. This lack of illumination results in a significant reduction in ambient light within a primary thoroughfare of the property. The resulting dim conditions create a potential safety hazard by increasing the risk of trips and falls over unseen obstacles. Continued use of the hallway in this state compromises the safety and functionality of the space.




Finding 4: DAMAGED HVAC REGISTER

Minor Defect / FYI

Hallway Ceiling

The ceiling air return vent cover exhibits physical damage and a significant buildup of dust and particulate matter on its grille. The breakage could be the result of accidental impact or simple degradation of the material over time, while the dust is an accumulation from normal HVAC system operation without periodic cleaning. This condition can negatively impact indoor air quality by circulating dust, allergens, and other contaminants. Furthermore, the damaged components of the grille could potentially detach and fall into the space below. The overall efficiency of the HVAC system may also be marginally reduced due to restricted airflow.

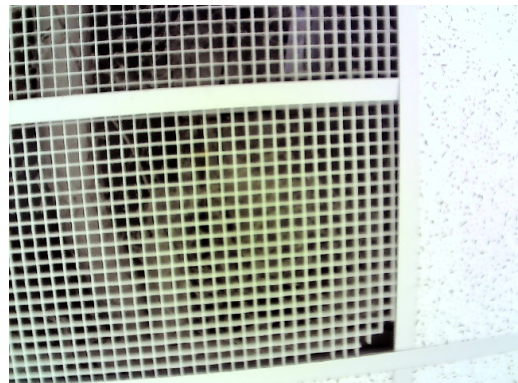

Finding 5: WARPED AND SEPARATED BASEBOARD

Minor Defect / FYI

Hallway

A noticeable gap and signs of warping were observed along the top edge of the baseboard where it meets the wall. This condition is prevalent in multiple areas and is likely caused by a combination of factors, including the natural expansion and contraction of building materials and failure of the original caulk and adhesive. The separation creates an unfinished appearance and provides a space where dust, moisture, and pests can accumulate. If moisture intrusion were to occur in this area, it could be concealed behind the baseboard, leading to potential hidden damage. This is a recurring maintenance item noted in the property.

**Finding 6: EVIDENCE OF MOISTURE STAIN**

Significant Defect

Hallway Ceiling

A distinct, circular water stain is present on an acoustic ceiling tile. This type of staining is clear evidence of moisture intrusion from an area above the ceiling, such as a roof leak, plumbing failure, or a malfunctioning HVAC condensation line. While the stain may be from a past and repaired leak, its presence warrants further investigation to determine if an active moisture source exists. If the leak is ongoing, it can lead to significant secondary damage, including decay of structural components, ceiling collapse, and the development of microbial growth. The integrity of the ceiling tile itself has also been compromised by the moisture saturation.



Finding 7: EXPOSED ELECTRICAL WIRING

Significant Defect

Hallway Wall

A second instance of an uncovered electrical junction box was identified in the hallway wall, exposing internal wiring and connectors. The cover plate for this box is missing, which is a direct violation of standard safety codes for electrical installations. This condition presents an immediate and serious risk of accidental electric shock to anyone who might come into contact with the energized components. Furthermore, the absence of a cover allows for the potential intrusion of foreign objects or dust, creating a notable fire hazard. This unsafe condition requires prompt remediation to ensure the safety of the building's occupants.



Finding 8: DAMAGED INTERIOR DRYWALL

Marginal Defect

Hallway Wall by Door

A vertical crack was observed in the drywall surface adjacent to a door frame, accompanied by additional superficial damage. This type of cracking is commonly associated with stress points in the structure, often resulting from normal building settlement or repeated vibrations from door usage. Although the immediate issue appears cosmetic, such cracks can propagate over time and may indicate underlying movement of the wall framing. The breach in the finished surface also creates a potential pathway for moisture ingress and can flake or chip further. This compromises the integrity of the wall's finished surface.



Finding 9: NON-STANDARD ELECTRICAL RECEPTACLE**Marginal Defect**

Hallway Wall

An electrical outlet with a non-standard configuration was observed installed near the floor. The receptacle appears to be a high-voltage or specific-use type, such as a twist-lock connector, rather than a standard 120-volt duplex outlet. This type of installation is typically intended for dedicated commercial or industrial equipment and is incompatible with common residential or office appliances. As a result, this outlet is non-functional for general purpose use within the space. Its presence does not contribute to the utility of the room for standard equipment and may have been left over from a previous building configuration.

**Finding 10: DISPLACED CEILING TILE****Minor Defect / FYI**

Hallway Ceiling

An acoustic ceiling tile was observed to be out of alignment and not properly seated within its suspended grid frame. This misalignment is often the result of recent maintenance or inspection activities within the ceiling plenum, but can also be caused by vibrations or air pressure changes. The condition is primarily cosmetic, detracting from the uniform appearance of the ceiling. However, the resulting gap can permit unconditioned air, dust, and debris from the plenum space to enter the occupied area below. In certain commercial ceiling systems, proper seating of all tiles is necessary to maintain the assembly's intended fire-resistance rating.

