

LAPORAN REPAIR KOMATSU INDONESIA

Tanggal Repair	30-Jan-24
Jam Berangkat	09.00 WIB
Jam Repair	11.20 s/d 15.55
Jam Kembali	19.40 WIB
Qty Unit Repair	1 pcs
Type Unit	PC 135 HARVESTER
Jumlah Man Power	1 Orang
Driver	1 Orang
Methode Repair	Potong wire ganti terminal dan pasang conector

Maker of Harness ☐ BEI ☒ NON BEI



Cause of Defect ☐ BEI ☒ NON BEI

MATERIAL UNTUK REPAIR :



PART NAME	PART NO	QTY
Terminal	1062-16-0122	12 Pcs
Terminal	1060-16-0122	12 Pcs
Terminal	+MT080-0123	2 Pcs
Terminal	+R1.25-5	1 Pcs
Terminal	+R1.25-8	1 Pcs
Wire	AVSS 0.5 B	1200 mm
Wire	AVSS 0.5 W	600 mm
Conector	DT06-6S-EP06	1 Pcs
Conector	DT04-6P-E005	1 Pcs
Conector	DT04-2P-E005	3 Pcs
Conector	W2P	3 Pcs
Retainer	W6P	1 Pcs
Retainer	W6S-P012	1 Pcs
Terminal	+B-1.25	2 Pcs
Sumitube	+ES2000-1	150 mm
Connector	+7124-9681	1 Pcs
Tape	WHVTA 19*20 B	100 mm
Fuse 10 A	+7123+3011	1 Pcs

1. Modif PC 135 HARVESTER sebanyak 1 unit

BEFORE

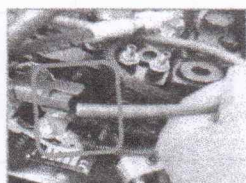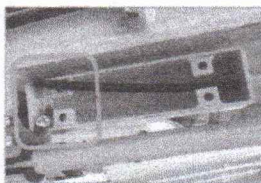

AFTER

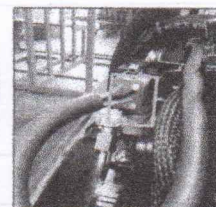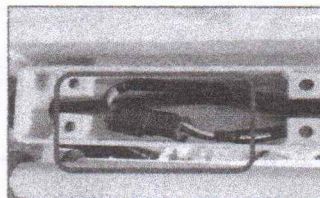


2. Sambung wire

Before




After

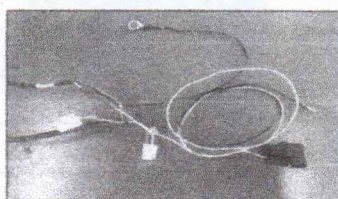


3. Modif connector pada Oil Cooler sebanyak 3 pcs


Before

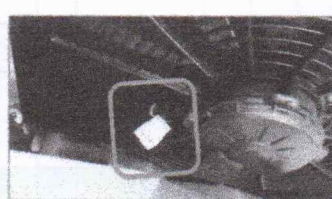

After

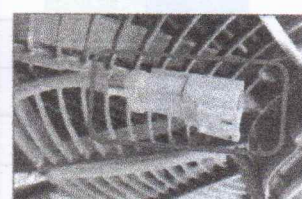

5. Type Unit

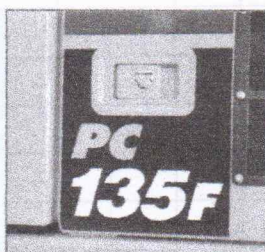

CONFIRM "OK"

Disetujui	Diperiksa	Dibuat
Ass Manager QA	Leader QA	Repairman