

LAPORAN MODIF KOMATSU INDONESIA

Tanggal Repair	09-Aug-24
Jam Berangkat	07.40 WIB
Jam Repair	10.30 s/d 15.15 WIB
Jam Kembali	19.30 WIB
Qty Unit Repair	2 pcs
Type Unit	PC 135 HARVESTER
Jumlah Man Power	1 Orang
Driver	-
Methode Repair	Potong wire ganti terminal dan pasang conector

Maker of Harness ☐ BEI ☒ NON BEI


Cause of Defect ☐ BEI ☒ NON BEI

MATERIAL UNTUK REPAIR :


PART NAME	PART NO	QTY
Terminal	1062-16-0122	24 Pcs
Terminal	1060-16-0122	24 Pcs
Terminal	+MT080-0123	4 Pcs
Terminal	+R1.25-5	2 Pcs
Terminal	+R1.25-8	2 Pcs
Wire	AVSS 0.5 B	2400 mm
Wire	AVSS 0.5 W	1200 mm
Connector	DT06-6S-EP06	2 Pcs
Connector	DT04-6P-E005	2 Pcs
Connector	DT04-2P-E005	6 Pcs
Retainer	W2P	6 Pcs
Retainer	W6P	2 Pcs
Retainer	W6S-P012	2 Pcs
Connector	+7124-9681	2 Pcs
Tape	WHVTA 19*20 B	400 mm
Fuse 10 A	+7123+3011	2 Pcs
Connector	DT06-8SA-CE05	2 Pcs
Retainer	W8S-P012	2 Pcs

1. Modif PC 135 HARVESTER sebanyak 2 unit

BEFORE

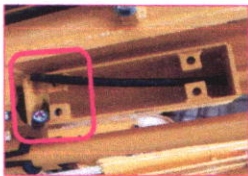

AFTER

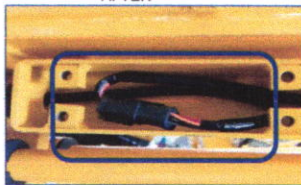


2. Sambung wire

Before



After

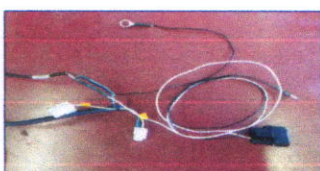


3. Modif connector pada Oil Cooler sebanyak 6 pcs

Before



After

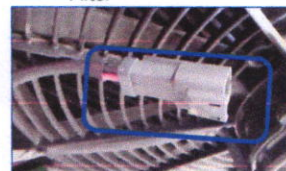

4. Type Unit



CONFIRM "OK"

Disetujui	Diperiksa	Dibuat
Ass Manager QA	Leader QA	Repairman