



Home Inspection Experts Report

LOCATED AT:
1634 Benedict Canyon Drive
Beverly Hills, California 90210

PREPARED EXCLUSIVELY FOR:
Mrs. Melony Mahaarachchi & Mr. Senaka Mahaarachchi & Mrs. Maria Rodriguez

INSPECTED ON:
Friday, February 6, 2026



Inspector, Kraig O Gloster
NATCHI# 14498436
Home Inspection Experts
(714) 594-3004



Executive Summary

This is a summary review of the inspectors' findings during this inspection. However, it does not contain every detailed observation. This is provided as an additional service to our client, and is presented in the form of a listing of the items which, in the opinion of your inspector, merit further attention, investigation, or improvement. Some of these conditions are of such a nature as to require repair or modification by a skilled craftsman, technician, or specialist. Others can be easily handled by a homeowner such as yourself.

Often, following the inspector's advice will result in improved performance and/or extended life of the component(s) in question. In listing these items, your inspector is not offering any opinion as to who, among the parties to this transaction, should take responsibility for addressing any of these concerns. Client understands that recommendations for further evaluation to help reduce the risk of costly repairs. This responsibility always falls on the client as part of their due diligence to seek additional advice from specialty trades when recommended to do so by the home inspector. As with most of the facets of your transaction, we recommend consultation with your Real Estate Professional for further advice with regards to the following items:

- SAF** = Items that could be unsafe, harmful or cause bodily injury
- REP** = Items requiring repair.
- WARN** = Potentially serious issue that should be addressed.
- MANT** = Maintenance needed.

GROUND'S BACK YARD RECEPTACLE CONDITIONS

SAF s-43: All exterior receptacles must be GFCI protected for occupant safety. While the receptacles were tested and found to be functional, GFCI protection is recommended. Consult with a licensed electrician for repairs.

EXTERIOR/BALCONY/CHIMNEY CHIMNEY CONDITIONS

SAF s-57: Foliage trimming is needed as leaf debris and branches are growing too close to the chimney exhaust. Consult with a licensed specialist regarding safety.

POOL & SPA CONDITION POOL FENCING AND GATES GENERAL CONDITION

SAF s-59: All gates that access the pool area must be self closing and self latching to prevent accidental access to the pool area. Adjustment and or repairs are needed. All gates should close in the direction of the pool as accessed from the outside area. Safety hazard.

GARAGE LIGHTING

SAF s-91: Signs of substandard wiring was noted in the garage. Client should consult with a licensed electrician prior to the close of escrow repairs.

GARAGE ELECTRICAL

SAF s-98: All garage receptacles must be GFCI protected for occupant safety. Consult with an electrician for complete evaluation and repairs.

HEATING - AIR HEATING HEAT SHIELD

SAF s-113: A heat shield is recommended below all horizontal gas furnaces. This will help prevent fires at wood platforms.

MAIN HOUSE PLUMBING WATER HEATER(S) VENT PIPE

SAF s-156: All singlewall vent pipe should have three screws per joint. This will help prevent misalignment during seismic activity. Carbon monoxide hazard.

SAF s-157: Foil tape was noted on the vent pipe. Foil tape is not recommended for use on hot gas type B vents. Or as a mechanical means of connection. Recommend removal. Potential fire hazard.

MAIN HOUSE PLUMBING WATER HEATER(S) SEISMIC STRAPS

SAF s-159: According to most manufacturers guidelines and seismic regulations. Three water straps are recommended for hot water heaters over 75 gallons. Consult with a licensed plumbing contractor for installation.

ADU PLUMBING WATER HEATER(S) VENT PIPE

SAF s-170: The draft hood was misaligned. Secure the draft hood with one sheet-metal screw to the top of the hot water tank to prevent misalignment.

BEDROOM #3 BED ROOMS BEDROOMS SMOKE DETECTOR

SAF s-192: The bedroom was missing installed smoke detectors. Smoke detectors are recommended in each bedroom for occupant safety.

BATH #2 BATHROOM TUB AND SHOWERS

SAF s-240: The shower/tub did not have the required temperature control valve install. This is a safety device. Consult with a plumbing contractor for cost of installation.

INTERIORS/FIREPLACE/STAIRS FOYER/HALLWAY CONDITION

SAF s-277: Functional smoke/carbon monoxide detectors needed in the hallways for occupant safety. Consult local building authority for location and manufacturers guidelines for installation.

INTERIORS/FIREPLACE/STAIRS FIREPLACE DETECTORS

SAF s-284: Combination/smoke and carbon monoxide detectors are recommended in rooms that have installed fireplaces. Detectors will function as an early warning device in the event of a fireplace with drafting issues.

INTERIORS/FIREPLACE/STAIRS FIREPLACE #1 GENERAL CONCERNS

SAF s-286: The damper door stopper was missing. Damper door stoppers are required to help prevent accidental closing of the damper door while the gas log lighter is in use.

SAF s-287: Cracks were noted in the firebox. This is an early sign of deterioration likely caused by age, seismic activity or overheating of the firebox. Consult with a brickmason for jointing and pointing as needed.

GUEST HOUSE FOYER/HALLWAY CONDITION

SAF s-312: Smoke detector installation is needed.

UTILITIES SEWER CONNECTION

REP s-16: The sewer line is nearing the end of its life expectancy. Significant corrosion and hairline cracks were observed. The sewer line is in need of repair, replacement or relining. Client is encouraged to get cost estimates for repairs prior to the close of escrow.

GROUNDS FRONT YARD FRONT YARD DRAINAGE

REP s-19: Cracks and damaged planters were noted at the front of the home. General repair should be performed.

GROUNDS FRONT YARD DRIVEWAY OBSERVATIONS

REP s-20: Major cracks were found in the driveway. Cracks of this nature can be caused by poor drainage, and or poor site conditions. Further investigation would be needed to determine the cause. The client is encouraged to speak with a licensed contractor for repairs. Client should also consult with sellers regarding any and all known issues.

REP s-21: Rain gutter, downspout extension should be performed as the water discharges next to the home foundation. This may have led to moisture intrusion in the past as water stains were detected at the interior yoga room.

GROUPS BACK YARD BACK YARD DRAINAGE

REP s-40: Depression noted at the rear yard turf. Consult with the licensed professional to perform all necessary repairs.

GROUPS BACK YARD SIDEWALK OBSERVATIONS

REP s-41: Common cracks were observed. These cracks did not appear to affect the overall performance of the sidewalk and or tile. Repairs should be performed to prevent further damage.

GROUPS BACK YARD HOSE BIBS

REP s-42: Backflow preventers should be installed at all hose bibs to prevent contamination and backflowing of water.

GROUPS BACK YARD PATIO CONDITIONS

REP s-46: Medium to large cracks were noted. These cracks may pose a trip hazard. Repairs are recommended.

GROUPS BACK YARD PATIO COVER CONDITIONS

REP s-48: Cracked and or damaged tiles were noted at the patio area. General repair should be performed to prevent further damage in the future.

EXTERIOR/BALCONY/CHIMNEY EXTERIOR WALLS EXTERIOR WALL CONDITIONS

REP s-53: A number of medium to large cracks were noted in the stucco. Cracks of this nature can be caused by seismic activity, poor drainage, differential settlement and or poor site conditions. Further investigation would be needed in order to determine the cause. The client is encouraged to speak with a qualified individual prior to the close of escrow to satisfy any concerns. Client should also consult with sellers regarding any and all known issues. Cracks in the stucco can lead to water intrusion. Water intrusion is the number one cause for mold within wall cavities. These conditions should be taken seriously for anyone who is hypersensitive to mold conditions.

EXTERIOR/BALCONY/CHIMNEY CHIMNEY STORM CAP & SPARK ARRESTOR

REP s-58: Storm cap and spark arrestors are recommended to help prevent deterioration of the flue liner and damper door. Consult a chimney expert for installation.

POOL & SPA CONDITION POOL GENERAL CONDITION

REP s-61: The pool is in need of replastering. Client should consult with a pool contractor prior to the close of escrow for cost estimates.

REP s-62: Evidence of plaster damaged/cracking was observed. It is advisable to consult with a licensed pool contractor to make all necessary repairs. In many cases, leak detection should also be performed.

POOL & SPA CONDITION ANCILLARY COMPONENTS POOL LIGHTING

REP s-67: Underwater lights were nonresponsive on the day of inspection. Further testing and troubleshooting is needed.

POOL & SPA CONDITION POOL EQUIPMENT FILTER

REP s-70: Filter was leaking, repairs needed.

POOL & SPA CONDITION POOL EQUIPMENT LEAKS NOTED

REP s-71: Leaks were noted at pool equipment. Consult with a licensed pool contractor for complete evaluation of pool plumbing system for repairs.

POOL & SPA CONDITION POOL EQUIPMENT HEATER

REP s-72: The pool heater was nonresponsive on the day of inspection. Consult with a pool heater technician for troubleshooting and repair.

ROOFING ROOF GENERAL CONDITION

REP s-76: Debris was noted on top of the roof system. Recommend clear debris.

REP s-77: Tree branches and limbs were observed to make contact with the roof. Trimming is recommended as damage and deterioration is a consent through regular contact. Moreover, this is in access point for rodents and other animals to access the attic space.

FOUNDATION/CRAWL SPACE FOUNDATION RAISED FOUNDATION GENERAL CONDITIONS

REP s-82: The effects of ongoing moisture have affected the performance of the steel reinforced Rebar in the concrete foundation. Exposed Rebar was noted. This can affect the foundation's overall performance.

MAIN HOUSE PLUMBING & DRAIN SYSTEM COPPER PIPING CONDITION

REP s-150: All plumbing located in unconditioned areas of the home and at the exterior must be properly insulated. Insulating plumbing pipes will help with energy efficiency. Consult with a plumber for repairs.

MAIN HOUSE PLUMBING WATER HEATER(S) GENERAL CONDITION

REP s-154: It is recommended that a bonding jumper be installed at the hot water heater lines as seen in the diagram. This will help ensure grounding continuity through the plumbing system.

MAIN HOUSE PLUMBING WATER HEATER(S) TPR VALVE

REP s-160: The TPR valve was leaking. Consult with a licensed plumber for replacement.

MAIN HOUSE PLUMBING WATER HEATER(S) DRIP PAN

REP s-161: Drip pans are recommended below all hot water heaters. This will help contain leaks and prevent water damage.

ADU PLUMBING WATER HEATER(S) GENERAL CONDITION

REP s-167: The hot water heater is functioning beyond its life expectancy. Client should consider the cost of upgrades. Consult with a licensed plumber for cost of installation.

REP s-168: It is recommended that a bonding jumper be installed at the hot water heater lines as seen in the diagram. This will help ensure grounding continuity through the plumbing system.

ADU PLUMBING WATER HEATER(S) SHUT OFF VALVE

REP s-169: Calcium and corrosion was noted at the hot water heater shut off valve. This is an early indication of valve failure. Subject to future leaks. Replacement needed.

ADU PLUMBING WATER HEATER(S) SEISMIC STRAPS

REP s-172: Hot water heater seismic straps were loosely installed. The tank moves about freely. Repair needed.

ADU PLUMBING WATER HEATER(S) TPR VALVE

REP s-173: Calcium and corrosion was noted at the temperature and pressure relief valve (TPR). Calcium and corrosion have been noted with valve failure. It is for that reason we recommend replacement of the TPR valve.

ADU PLUMBING WATER HEATER(S) DRIP PAN

REP s-174: Drip pans are recommended below all hot water heaters. This will help contain leaks and prevent water damage.

BEDROOM #5 BED ROOMS BEDROOMS PRIVACY DOOR

REP s-202: The privacy door needs adjustment to function normally.

BEDROOM #5 BED ROOMS BEDROOMS WARDROBE DOORS

REP s-205: The wardrobe doors were miss aligned. Repairs and or adjustments recommended.

BEDROOM #5 BED ROOMS BEDROOMS WINDOW CONDITIONS

REP s-206: Damaged hand-crank mechanism and components we're noted at the window. Consult with a licensed professional to perform all necessary repairs for a normal operation.

BATH #1 BATHROOM SINK AND PLUMBING

REP s-221: Calcium deposits were noted. Repairs / replacement is recommended.

REP s-222: The sink was clogged or slow to drain. Consult with a qualified contractor or handyman to clear the drain and retest for functionality.

BATH #1 BATHROOM TUB AND SHOWERS

REP s-226: Showerhead leaks while in use. Repair needed. Consult with a licensed plumber to perform evaluation and make all necessary repairs.

REP s-227: Seized shower valve noted. Consult with a licensed plumber to make all necessary repairs.

BATH #2 BATHROOM PRIVACY DOOR

REP s-234: The privacy door needs adjustment and or repairs to function normally.

BATH #3 BATHROOM SINK AND PLUMBING

REP s-247: The sink was clogged or slow to drain. Consult with a qualified contractor or handyman to clear the drain and retest for functionality.

BATH #3 BATHROOM TOILET

REP s-250: Corrosion was noted at the angle stop valve. This may be an indicator of early failure and can lead to future leaks. It is for that reason we recommend upgrades.

BATH #3 BATHROOM VENTILATOR CONDITIONS

REP s-251: The bathroom ventilator was nonresponsive. Troubleshooting needed.

BATH #4 BATHROOM TUB AND SHOWERS

REP s-259: Showerhead leaks while in use. Repair needed.

REP s-260: Damage and or missing tiles were observed on the day of inspection. Damaged or missing tiles can lead to water infiltration and concealed mold. Repairs needed.

KITCHEN SINK - COUNTER TOPS - CABINETS SINK PLUMBING CONDITIONS

REP s-291: Calcium deposits at supply lines and shutoff valves. Upgrades recommended. Subject to leaks.

GUEST HOUSE BATHROOM SINK AND PLUMBING

REP s-322: No hot water provided on the day of inspection. This is likely due to aged and failing hot water heater.

GUEST HOUSE BATHROOM TUB AND SHOWERS

REP s-325: No hot water provided on the day of inspection. This is likely due to aged and failing hot water heater.

UTILITIES GAS GAS UTILITY

WARN s-10: Seismic shut off valve is a recommended safety device. The seismic shut off valve functions during an earthquake to help prevent gas leaks that could result in serious safety hazards.

UTILITIES SEWER CONNECTION

WARN s-15: Consult with a licensed plumber for further evaluation and resolution prior to close of escrow.

GROUND FRONT YARD FRONT YARD DRAINAGE

WARN s-18: Caution should be exercised not to over water planters at the front of the home. There was no evidence of water proofing against the foundation at the planters. Excessive watering can lead to deterioration of the foundation walls and future damage.

GROUND SIDE YARDS SIDE YARD DRAINAGE

WARN s-27: The drainage at the side of the home was flat or mostly flat in areas. A 2-5% grade away from the home is recommended.

WARN s-28: It is vital to maintain clear storm drains. This will help prevent flooding during long sustained rains. Clogged storm drains can lead to significant water related issues.

GROUND SIDE YARDS SIDEWALK OBSERVATIONS

WARN s-32: Common cracks were observed. These cracks did not appear to affect the overall performance of the sidewalk.

GROUND BACK YARD BACK YARD DRAINAGE

WARN s-37: The drainage at the back of the home was flat or mostly flat in some areas. A 2-5% grade away from the home is recommended.

WARN s-38: Caution should be exercised not to over water planters at the front of the home. There was no evidence of water proofing against the foundation at the planters. Excessive watering can lead to deterioration of the foundation walls and future damage.

WARN s-39: It is vital to maintain clear storm drains. This will help prevent flooding during long sustained rains. Clogged storm drains can lead to significant water related issues.

ROOFING ROOF GENERAL CONDITION

WARN s-75: The roof was in satisfactory condition showing signs of normal wear and tear. The home inspector can in no way offer an opinion as to whether the roof leaks today unless it is moderately raining at the time of inspection. Client should request disclosure information for any and all known issues regarding the roof system.

FOUNDATION/CRAWL SPACE FOUNDATION RAISED FOUNDATION GENERAL CONDITIONS

WARN s-81: Efflorescence also referred to as salt and calcium deposits were noted on the foundation walls. This can lead to concrete deterioration. Efflorescence is caused by poor drainage around the exterior of the home. Address drainage concerns as needed.

GARAGE PERSONAL ITEMS

WARN s-88: Personal items and storage obstructed a complete visual inspection of the garage area. Thus potentially concealing serious defects. It is highly advisable that Personal items be removed and that garage be completely evaluated prior to the close of escrow.

GARAGE SLAB

WARN s-93: The slab could not be inspected as it was covered by floor coverings and or personal items. Significant issues can be concealed in the said areas. It is highly advisable that said items be removed and area be completely evaluated prior to the close of escrow.

GARAGE DOOR CONDITION

WARN s-97: Sectional rollup doors have a unique set of safety concerns. Pinch points and operable cables can cause severe injury. The door should not be operated while individuals or objects are in close proximity to moving components.

LAUNDRY WATER CONNECTION

WARN s-101: The water connections could not be inspected as they were obstructed buy appliances and or personal items. It is recommended that said items be removed and area be completely evaluated.

LAUNDRY GAS CONNECTION

WARN s-102: The gas line connection could not be evaluated as the gas line was obstructed by installed appliances.

LAUNDRY DRYER VENT

WARN s-103: The dryer vent could not be inspected as the connections were obstructed by appliance equipment. Dryer vents should be evaluated every 6 to 12 months as part of regular maintenance.

HEATING - AIR HEATING SYSTEM CONDITION

WARN s-115: The furnace system is outdated and poorly efficient. Client should consider the cost of upgrades. Consult with a licensed HVAC contractor for cost of upgrades prior to the close of escrow.

WARN s-116: The heating system is nearing the end of its life expectancy. Client should consider the cost of upgrades.

HEATING - AIR HEATING GAS LINE

WARN s-117: We recommended that a sediment leg be installed at the gas heater. The sediment leg will help contain sediment and debris from clogging gas valves and orifices.

HEATING - AIR CONDITION AIR-CONDITIONING CONDITION

WARN s-124: By the year 2020 The EPA has mandated that all refrigerant manufactures cease in the distribution of R-22 refrigerant. This refrigerant has been connected with O-Zone deterioration and will no longer be manufactured. While stockpiles of R-22 refrigerant may still be available for a few years following its discontinuation. It should be noted that repairing and servicing R-22 equipment will skyrocket. And may become cost prohibitive making said equipment obsolete. If the inspector has marked your equipment as a potential unit for R-22 refrigerant. It is vital that you speak with an HVAC contractor prior to the close of escrow to determine if your equipment is suitable for upgrade or replacement. Any air conditioner manufactured up until 2015 may have been charged or supplied with R-22 refrigerant.

HEATING - AIR CONDITION CONDENSER

WARN s-125: Air-conditioning system is nearing the end of its life expectancy. Client should consult with a licensed HVAC contractor for cost of upgrades.

HEATING - AIR CONDITION OUTPUT TEMPERATURE

WARN s-129: Output temperatures as tested on the day of inspection were satisfactory.

ELECTRICAL PANEL MAIN ELECTRICAL PANEL AFCI CIRCUIT BREAKERS


WARN s-133: In 2008 the National Electrical Code (NEC) required that all 15 and 20 amp branch circuits feeding convenience receptacles be protected by an AFCI circuit breaker. The National Fire Protection Authority (NFPA) recognizes that AFCI circuit breaker's can greatly reduce the risk of fire at receptacles throughout the dwelling caused by arc fault conditions. It is for that reason we recommend the client consult with a licensed electrical contractor for installation of such safety devices. Installation of such breakers may not be practical in all situations.

MAIN HOUSE PLUMBING WATER HEATER(S) SUPPLY LINES

WARN s-158: Insulation is recommended at supply lines. This will help prevent condensation calcium and corrosion.

MAIN HOUSE PLUMBING WATER HEATER(S) GAS LINE

WARN s-162: We recommend that a sediment leg be installed. This will help prevent sediment from clogging the gas valve or orifices.

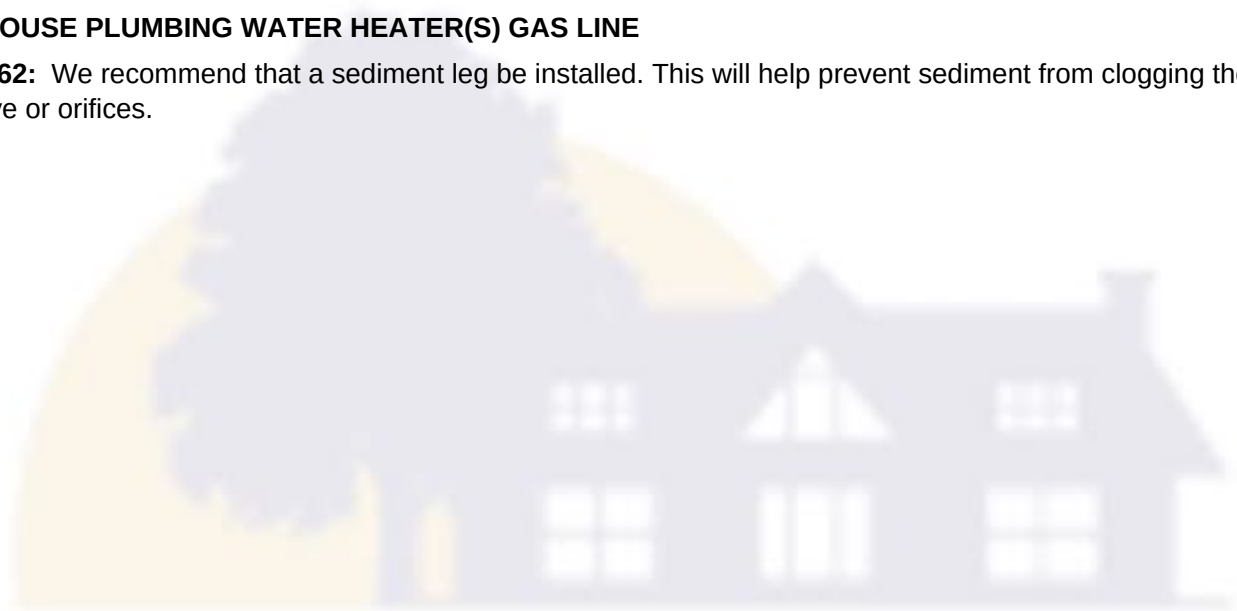

MAIN HOUSE PLUMBING SPECIAL NOTES CALIFORNIA SENATE BILL 407

WARN s-163: Updated January 2017: According to California Senate Bill 407 Chapter 587 and California Civil Code 1101.4, all residential properties built before January 1, 1994 require the property owner to replace plumbing fixtures that are not water conserving as defined by the following:

A toilet using more than 1.6 gallons per flush
A urinal using more than one gallon per flush
A showerhead using more than 2.5 gallons per minute
An interior faucet using more than 2.2 gallons per minute

A seller in a real estate transaction is required to disclose in writing to the prospective purchaser or transferee these requirements and whether the real property includes any noncompliant plumbing fixtures.

This article shall not apply to any of the following:

- (a) Registered historical sites.
- (b) Real property for which a "Licensed Plumber" certifies that, due to the age or configuration of the property or its plumbing, installation of water-conserving plumbing fixtures is not technically feasible.
- (c) A building for which water service is permanently disconnected.

This will be required in multi-family residential and commercial real property on January 1, 2019 under certain circumstances.

Technically, every homeowner living in a house built before January 1, 1994 is required to upgrade to the new low flow water requirements, regardless of them selling their house.

There does not seem to be a direct requirement from a Realtor regarding this issue, besides having the seller disclose if their house meets the requirement.

There is no penalty, as of now, if the house does not meet the requirements. This is subject to change at any time.

The home inspector is not in any way required to confirm if the faucets, shower heads and toilets meet this requirement.

There is the possibility that local cities and jurisdictions will create additional requirements and penalties regarding this issue. The buyer should always do their own due diligence as it pertains to local codes and ordinances.

ADU PLUMBING WATER HEATER(S) SUPPLY LINES

WARN s-171: Insulation is recommended at supply lines. This will help prevent condensation calcium and corrosion.

ADU PLUMBING WATER HEATER(S) GAS LINE

WARN s-175: We recommend that a sediment leg be installed. This will help prevent sediment from clogging the gas valve or orifices.

BEDROOM #3 BED ROOMS BEDROOMS WARDROBE DOORS

WARN s-193: No wardrobe/closet installed at the time of the inspection. This may not be a permitted bedroom. Buyer is urged to verify permits of this construction.

FITNESS ROOM BED ROOMS BEDROOMS GENERAL CONDITION

WARN s-210: Water stains were noted in the ceiling. Area was scanned with a flir and a moisture meter and appeared to be dry. Monitor water stains for leaks and repair as needed. Additionally damage and or mold like substances may be concealed out side of site, in wall spaces and cavities. These conditions can not be inspected by the home inspector. Client should preform further evolution prior to the close of escrow to satisfy any concerns. Further evaluation is recommended.

UTILITIES GAS GAS UTILITY

MANT s-11: Evidence of rust was noted at the gas meter service piping. Recommend these components be primed and painted to prolong the serviceable life and prevent future gas leaks at fittings.

GROUND'S FRONT YARD FRONT ENTRANCE

MANT s-23: While the doors in the home are tested for functionality, by their sheer nature and wear and tear. Door assembly's may result in loose hardware at hinges and door knobs. Requiring periodic maintenance.

GROUND'S SIDE YARDS LIGHT FIXTURE CONDITIONS

MANT s-30: All light fixtures should be properly caulked and sealed to the structure to help prevent water intrusion.

GROUND'S SIDE YARDS SIDEWALK OBSERVATIONS

MANT s-33: The stairs are in satisfactory condition overall. Handrails were tight

EXTERIOR/BALCONY/CHIMNEY EXTERIOR WALLS EXTERIOR WALL CONDITIONS

MANT s-54: Allergy/mold like substance was observed on the stucco. Expert cleaning needed.

MANT s-55: It is recommended where larger gaps are found through stucco wall openings that these areas to be properly sealed to help prevent water intrusion.

POOL & SPA CONDITION POOL DECKING

MANT s-60: Medium to large cracks were noted around the concrete decking surrounding the swimming pool. This poses a safety concern. Medium to large cracks can cause cuts in tender feet. Recommend repair.

FOUNDATION/CRAWL SPACE CRAWLSPACE/STRUCTURE POST AND PEIR CONDITION

MANT s-85: Seismic bracing is recommended for all raised foundations built prior to 1950. Seismic bracing will provide additional support during seismic activity and reduce overall damages.

GARAGE FIRE DOOR

MANT s-92: Adjustments are needed to the self-closing fire rated door to ensure proper functionality and latching of door.

LAUNDRY LAUNDRY SINK

MANT s-106: General caulking as needed, and the countertop to prevent moisture intrusion into the cabinetry below. Consult with a handy person for maintenance.

HEATING - AIR CONDITION SERVICE DISCONNECT

MANT s-126: The service disconnect should be properly sealed to the structure.

ELECTRICAL PANEL MAIN ELECTRICAL PANEL GENERAL CONDITION

MANT s-134: Corrosion was noted at the main electrical panel. Sand, prime and paint as needed.

BATH #1 BATHROOM TUB AND SHOWERS

MANT s-225: General caulking and cleaning is recommended throughout.

BATH #2 BATHROOM TUB AND SHOWERS

MANT s-239: General caulking and cleaning is recommended throughout.

BATH #4 BATHROOM TUB AND SHOWERS

MANT s-258: General caulking and cleaning is recommended throughout.

BATH #5 BATHROOM SINK AND PLUMBING

MANT s-268: General caulking is recommended throughout.

BATH #5 BATHROOM TUB AND SHOWERS

MANT s-271: General caulking and cleaning is recommended throughout.

KITCHEN SINK - COUNTER TOPS - CABINETS SINK PLUMBING CONDITIONS

MANT s-290: General caulking is needed. Caulking should be maintained to help prevent water intrusion into the lower cabinet area.

KITCHEN SINK - COUNTER TOPS - CABINETS GARBAGE DISPOSAL

MANT s-292: Debris noted in garbage disposal general cleaning should be performed.

KITCHEN APPLIANCES VENT HOOD

MANT s-299: Replace and or install lightbulb for the vent hood.

GUEST HOUSE FIREPLACE #1 GENERAL CONCERNS

MANT s-317: Cracks were noted in the firebox. This is an early sign of deterioration likely caused by age, seismic activity or overheating of the firebox. Consult with a brickmason for jointing and pointing as needed.

