



PROPERTY INSPECTION REPORT

Date: 1/19/2026

Time/Inspector Hours: 10:40 AM - 12:50 PM/2

Weather: 37 F SUNNY



Inspector: Ryan Foley

3380001506 NRS 04/30/2027

Agent: Bobbi Wood - BHHS RW Towne Realty - Beach Office

Prepared For

Diane Nwaonicha

4232 Maplehurst Rd, Virginia Beach

757-418-0944


SafeHousePropertyInspections.com

Reading the report

USE OF PHOTOS AND VIDEO AND GLOSSARY

Your report includes many photographs which help to clarify where the inspector went, what was looked at, and the condition of a system or component at the time of the inspection. Some of the pictures may be of deficiencies or problem areas, these are to help you better understand what is documented in this report and may allow you see areas or items that you normally would not see. A pictured issue does not necessarily mean that the issue was limited to that area only, but may be a representation of a condition that is in multiple places. Not all areas of deficiencies or conditions will be supported with photos.

To view videos and review highlighted glossary terms in the report the PDF should to be downloaded and viewed with a full PDF reader such as Adobe. If videos are in report the caption will state "**CLICK to VIEW VIDEO**" and there will a narrative to discuss content of video.

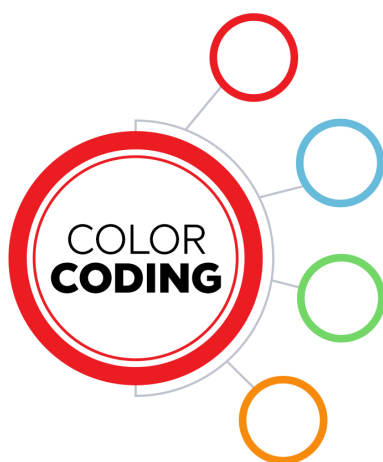

TEXT COLOR SIGNIFICANCE

RED text are comments of significant deficient components, safety issues or conditions which need attention, repair, or replacement. System with multiple observed issues will be directed to a list of observed conditions in the report, a complete evaluation by a professional contractor is recommended to determine if any hidden conditions exist. These comments are also duplicated in the Report Summary page(s)

BLUE text are observations and information regarding deficiencies which are less significant or discretionary, but correction is still advised. Limitations that may have restricted the inspection associated with an area will also be listed.

GREEN text will provide a link to additional information regarding a variety of different subjects important to your home and will also provide additional understanding of topics discussed in the report.

ORANGE highlighted text allows you to place your cursor over the word for definitions or additional information regarding the term in the report. .

UNDERSTANDING REPORT NARRATIVES

"IMPROVE": Denotes improvements which are recommended to help prevent issues from occurring. These may be items identified to be upgraded to meet modern construction and/or safety standards.

"FYI": For Your Information: Denotes additional general information and/or explanation of conditions, safety information, cosmetic issues, and useful tips or suggestions for home ownership.

"LOCATION": All reported locations are areas where the issue is mainly present but may not limited to that area. All necessary corrections should be made where condition exists.

When there are **"multiple issues"** found with a system we report that **"multiple issues"** were present and list the issues identified in the report. We recommend that systems with **"multiple issues"** be evaluated by a qualified contractor to determine if there are any latent or hidden issues present that can only be found with a more invasive inspection.

Recommendation to have **"repaired as needed"**. A qualified contractor should evaluate the system to ensure that all necessary repairs are made including items that may have caused the damage.

***FOR THE PURPOSE OF THIS REPORT ALL DIRECTIONAL REFERENCES TO THE HOUSE WILL BE MADE AS IF ONE WERE FACING THE FRONT OF THE HOUSE**

SafeHousePropertyInspections.com

Terms of Report

This report is the exclusive property of Safe House Property Inspections and the client whose name appears herewith, and its use by any unauthorized persons is strictly prohibited.

The observations and opinions expressed within this report are those of Safe House Property Inspections and supersede any alleged verbal comments. We inspect all of the systems, components, and conditions described in accordance with the standards of the International Association of Certified Home Inspectors (InterNACHI), and those that we do not inspect are clearly disclaimed in the contract and/or in the aforementioned standards. However, some components that are inspected and found to be functional may not necessarily appear in the report, simply because we do not wish to waste our client's time by having them read an unnecessarily lengthy report about components that do not need to be serviced.

A home inspection is intended to assist in evaluation of the overall condition of the dwelling. The report is not intended to be a "check list" of items that need repair or general maintenance, it is designed to identify material defects or deficiencies that would have an adverse impact on the value of the real-property, or that involve an unreasonable risk to people on the property. This home inspection report will not reveal every condition that exists or ever could exist, but only those material defects that were observed on the day of the inspection.

In accordance with the terms of the contract, the investigation and service recommendations that we make in this report should be completed DURING YOUR INSPECTION CONTINGENCY PERIOD by qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

By relying on this inspection report you have agreed to be bound by the terms, conditions and limitations as set forth in the CONTRACT AGREEMENT, which was presented to you at the time of the inspection or in an electronic mail attachment prior to the inspection. If you do not have a copy of the CONTRACT AGREEMENT please contact Safe House Property Inspections and a copy will be provided to you electronically.

If you do not agree to be bound by this CONTRACT AGREEMENT in its entirety, you must contact Safe House Property Inspections immediately upon receipt of this completed report. In addition, all electronic and paper copies of the inspection report must be deleted and destroyed, and may not be used in whole or in part for consideration in a real estate transaction.

PLEASE TAKE THE OPPORTUNITY TO READ THE COMPLETE REPORT

SafeHousePropertyInspections.com

Roof

1. Inspection Method and Roof Material

The roof age estimate is based on the visual appearance of the roofing material. Various factors can influence the material's visual condition, making it difficult to determine the exact age. We recommend inquiring with the seller to find out when the roof was installed.

Architectural shingles appeared to be in the first third of their life cycle.

Roof was inspected by walking where it could be done safely.

Important roof information: <http://bit.ly/3rNqW7A>




2. Shingled Roof

2.1. FYI: Minor damage was observed which appeared to be typical wear and tear and should be repaired as needed to prevent moisture intrusion.

2.2. There were shingles that were not installed in a manner consistent with standard building practices. We recommend consulting with a qualified roofing contractor to determine the potential performance and warranty implications with this manner of installation. Our locations are just an example, we did not inspect every row of shingle, a qualified roofer should determine the extent of improper installation. Location: rear right



Improper installation

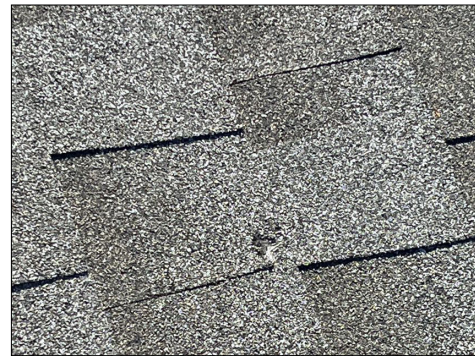

Shingle damage

3. Roof Drainage

The **roof drainage system** channels water away from the foundation. Water from the roof can raise the moisture content in soil near the foundation which can affect its ability to support the structure and may cause foundation damage. It is recommended that any downspouts discharging onto a lower roof be extended to prevent premature shingle damage. We cannot see inside downspouts we recommend making sure they are clear to prevent moisture issues caused by overflow.

3.1. FYI: There was no roof drainage system installed, but is highly recommended.

4. Flashings and Penetrations

4.1. Loose **flashing**(s) should be secured and sealed to prevent moisture intrusion. Location: power ventilator



Secure and seal loose flashing

5. Recommendations for Roof Inspection

We recommend that all repairs or replacements be conducted by a qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

Exterior

1. Vinyl Siding

The house was clad with vinyl siding.

Sealant maintenance is important to prevent water penetration of the exterior into the structure. All penetrations should be sealed. We do not note all penetrations. Pictures of penetrations in the report are used as an example.

Moisture Intrusion Information: <http://bit.ly/3jH38iV>

1.1. FYI: Minor damage was observed which appeared to be typical wear and tear and should be repaired as needed to prevent moisture intrusion.

1.2. Sealant maintenance was needed at penetrations and lights of the exterior cladding.

1.3. All loose vinyl siding trim should be secured. Location:by shed


1.4. Damage to the vinyl siding which can allow moisture intrusion and should be repaired. Location:front middle



Siding damage



Minor siding damage

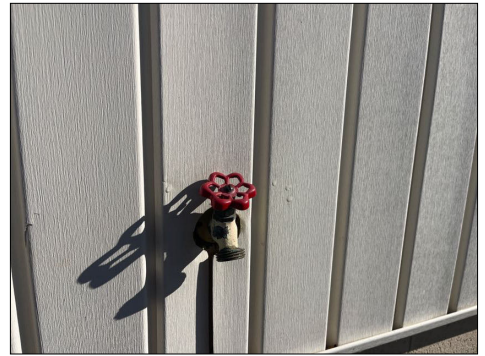

Recommend sealing all penetrations



Loose siding trim

2. Walkway and Driveway

2.1. You should consider repairing cracking at the driveway to prevent further damage and the development of trip hazards.



Seal cracks to prevent damage

3. Eaves, Soffits, and Trim

- 3.1. Loose soffit wrap should be properly installed or adjusted to prevent openings to the attic. Location:front right, rear
3.2. Secure and seal all loose trim to prevent moisture intrusion and possible damage. Location:middle left, shed
3.3. Missing soffit wrap should be properly installed or adjusted to prevent openings to the attic. Location:rear right

3.4. Multiple trim issues were observed, examples are listed in the report. A qualified contractor should make all necessary repairs.



Soffits need repair



Loose trim wrap



Soffits need repair



Loose trim wrap

4. Exterior Doors

- 4.1. Damage to an exterior door should be repaired or replaced as needed. Location:shed



Damaged



Damaged

5. Exterior Windows

Window flashing is concealed by the exterior wall covering, we specifically disclaim evaluation. Leaks may become evident only during heavy, prolonged or wind-driven rain. Window screens are not evaluated because many people choose to remove them for aesthetic reasons.

- 5.1. Sealant maintenance was needed at window(s) to prevent moisture intrusion. Location:multiple locations



Sealant needs repair

6. Porch and Patio Observations

6.1. Cracked concrete should be repaired as needed. Location: rear

6.2. There was settling or cracking at the patio which has created trip hazards. You should repair as needed.



All cracks should be sealed



Settling

7. Grade of Property

7.1. The **property grade** was neutral in areas which may require drainage if ponding develops.

8. Slab-on-Grade Foundation

The **slab foundation** was evaluated at the exterior, by examining the stem walls that project above the footing at the base of the house walls. The interior portions of the slab, which is also known as the slab floor, have little structural significance and because they are covered and not visually accessible, it is beyond the scope of our inspection.

8.1. Cracked mortar or holes at the concrete block foundation should be filled with an appropriate material to prevent air intrusion and future damage from moisture intrusion and freezing.

9. Recommendations for Exterior Inspection

We recommend that all repairs or replacements be conducted by a qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

HVAC

1. Energy Source and Filters

Our inspection of the HVAC system is a visual examination of the systems major components. Utility companies and HVAC professionals recommend an annual inspection of HVAC equipment. You should request the service records of the systems, and if there was no service within the last twelve months by a qualified HVAC contractor, it is recommended that a complete system evaluation be made to ensure proper operation. We cannot determine if the HVAC system is properly sized for the house. This can only be determined by a qualified contractor.



The heat energy source was 240 volt electric, and the cooling energy source was 240 volts electric.

2. Heating System Information


Air handler with electric backup heat located in utility closet was approximately 5 years old.

2.1. Heated air was provided when the thermostat was set to heat. No further diagnostics are performed as part of a home inspection per standards of practice.

2.2. FYI: The emergency heat setting was turned on at the thermostat and heat was being delivered.

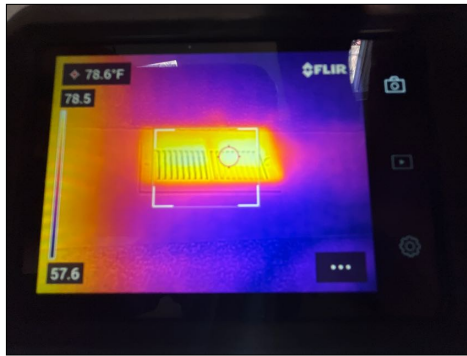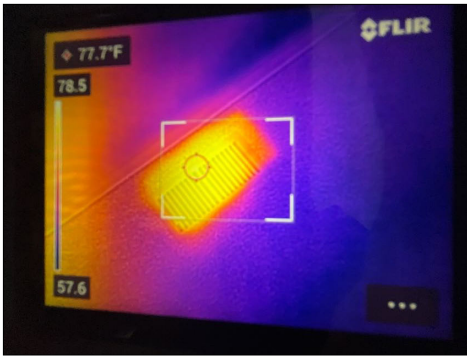

3. Heating System

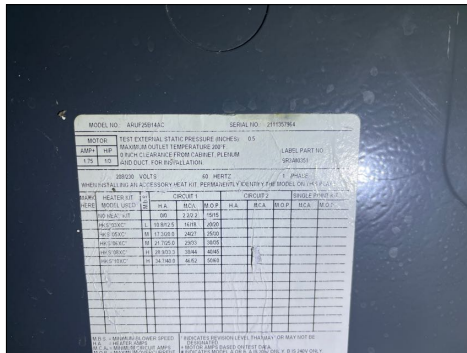

4. Cooling System Information


Heat pump condenser: approximately 5 years old.

4.1. Cooling system(s) was installed with a heat pump which have an average service life of 10 – 15 years.

4.2. Due to the cold temperature the heat pump was turned to cool to test that the reversing valve was functioning. We cannot determine how well the unit cools.



Reverse valve tested

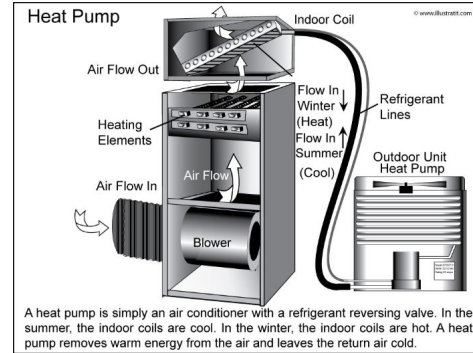

Heat Pump Information

5. Outside Cooling Equipment

5.1. FYI: It could not be determined if the appropriate breaker was installed in the panel due to the lack of proper labeling at the main electrical panel.



Manufacturer's Requirement 15

6. Condensate Drain(s)

The condensate drain inspection can be limited by insulation and finishing material. It is prudent to ensure that there are no holes or disconnections in the line which is difficult to determine in the heating season when the cooling system is not operating. We recommend splash blocks be placed under the condensation line to direct water away from the foundation. During the summer months the condensation line can put out a significant amount of water daily.

6.1. We recommend having a cap installed at the condensate line clean out to prevent conditioned air loss.

6.2. There was no **auxiliary condensate drain** line or float switch installed at the condensate pan, and should be corrected to prevent moisture damage if pan fills with water.



Cap needed at cleanout

7. Ductwork

7.1. The duct system was not visible and no inspection of condition was possible.

8. Recommendations for Heating and Air Conditioning Inspection

We recommend that all repairs or replacements be conducted by a qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

Plumbing

1. Plumbing Pics

Every effort to test all plumbing fixtures are made. All fixtures are not pictured here. Valves are not tested as part of a home inspection. Belongings are not moved and may conceal issues. Water flow is tested for adequacy by running water in the bath sink and shower while the toilet is flushed. Any issues will be noted in the appropriate section.



2. Shut Off and Pipes

The observed piping was predominantly copper.

Water was publicly supplied and the main shutoff was located at the meter box below ground.

Water was publicly supplied the main shutoff was not labeled but there were valves observed. Recommend inquiring with the sellers. Location: utility closet



Shutoff underground at meter box



Shutoff in utility closet

3. Plumbing Pipes

3.1. Visible pipes inspected.

4. Drain, Waste, Vent

DWV piping system was predominantly **PVC**. We test drain lines by draining all fixtures and watching for blockages or slow drains. This is not a conclusive test. ONLY A CAMERA-SCAN of the main line can confirm its actual condition.

4.1. There were drain pipes that showed signs of past leakage. No leaking was observed at time of inspection, however it is recommended that the areas be monitored or evaluated by a qualified plumber. Location: kitchen sink




Signs of past leak

5. Water Heater Information

50 gallon electric water heater located in utility closet was approximately 14 years old.

FYI: You should keep the water temperature set at a minimum of 110 degrees Fahrenheit to kill microbes and a maximum of 130 degrees to prevent scalding. Water heaters have a typical life expectancy of 8-12 years. Tank less water heaters have typical life expectancy of 15 to 20 years.

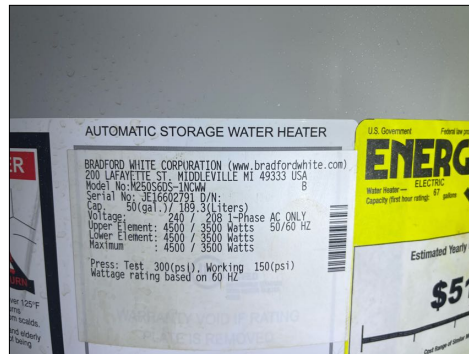

6. Water Heater

6.1. A drain pan and drain line is recommended to prevent damage if appliance leaks.

6.2. Mineral encrustation on fittings or valves should be cleaned to ensure that no leaking is present and be repaired if needed.

6.3. Issues were observed with the water heater, examples are in the report. Due to the age of the water heater we recommend a qualified plumbing contractor determine if repair or replacement is best option.



No drain pan installed




Mineral buildup

7. Hose Bib(s)

We do not turn on hose bib water shutoff valves. Plantings or belongings may conceal some locations.

There were standard hose spigots at the house with no **anti-siphon** devices which should be installed.

7.1. A hose spigot that was leaking while turned off should be repaired. Location:front

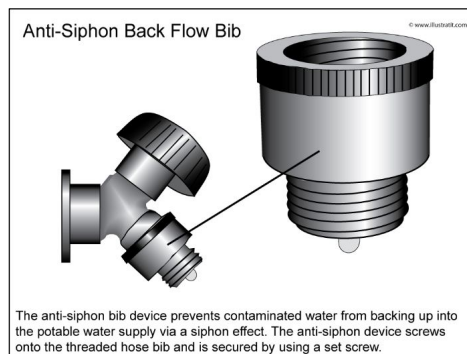

8. Faucets

8.1. Leaking faucet controls should be repaired as needed. Location:kitchen sink



Leaking controls

9. Sinks

9.1. We recommended all missing or inoperable **sink stoppers** be corrected.

9.2. Leaking sinks should be repaired as needed. Location: kitchen sink, master bath sink



Leaking sink



Leaking sink

10. Bathtub(s)

10.1. Excessive sealant was observed in the bathtub area. We are unable to determine if there was or is a moisture intrusion issue. Recommend inquiring with sellers or monitoring the area or further evaluation by a qualified plumber as needed. Location: Upstairs hall bath

10.2. Open tub controls can allow moisture intrusion into the wall and should be secured or sealed to prevent moisture intrusion. Location: Master bathroom

10.3. Leaking bathtub faucet controls should be repaired as needed. Location: master bathroom

10.4. There was damage to a bathroom tub that should be repaired as needed. Location: Master Bathroom and hall bathroom



Excessive sealant



Leaking control(s)



Open controls



Bathtub damage



Damaged



Damaged



Damaged



Damaged

11. Shower(s)

11.1. Leaking shower heads should be tightened or sealed to prevent moisture damage. Location: Upstairs hall bath

11.2. Loose shower head(s) should be secured to prevent damage to the pipe. Location: upstairs hall bath, master bath




Leaking shower head

12. Toilet(s)

12.1. Loose toilet(s) should be secured to prevent damage and moisture issues. Location: upstairs hall bath

12.2. A toilet ran continuously indicating the need for repair. Location: Upstairs hall bath

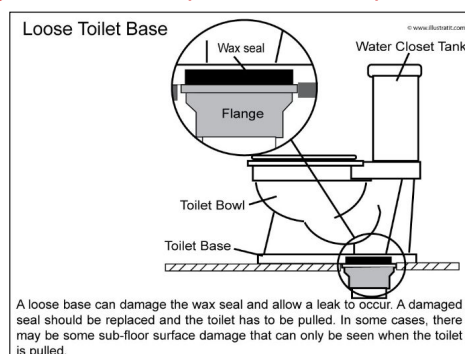

Loose Toilet Information

13. Recommendations for Plumbing Inspection

We recommend that all repairs or replacements be conducted by a qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

Electrical

1. Main Disconnect(s) and Sub Panels

Service equipment rating was 150 amps.

1.1. FYI: A total of (6) circuit breakers must be turned off (at the panel) to completely disconnect electrical power to the home.



Main disconnect - shed

2. Service and Grounding

The method for grounding was not visible, a ground wire was noted exiting the panel. This is not uncommon, but the grounding method could not be verified.

3. Service Panel

3.1. Although the installed breakers not listed by the **panel manufacturer** fit the panel we recommend they be verified they are classified for this panel.

3.2. Neutral conductors should be terminated individually at the terminal bars as required by manufacturer's.

3.3. Improve: Missing panel screws should be installed.

3.4. Breaker(s) were off in the main electrical service panel indicating there may be an issue. You should consult with the seller regarding this condition, and have repaired if needed. Location: **GIC**

3.5. A clear and complete circuit directory should be installed, and circuit size verified for correct installation, so that in an emergency individual circuits can be quickly shut off.

3.6. Rust or corrosion was present in the panel and a qualified electrical contractor should determine source of moisture and repair as needed.




Breaker off



Rust in panel



Neutrals should be terminated individually

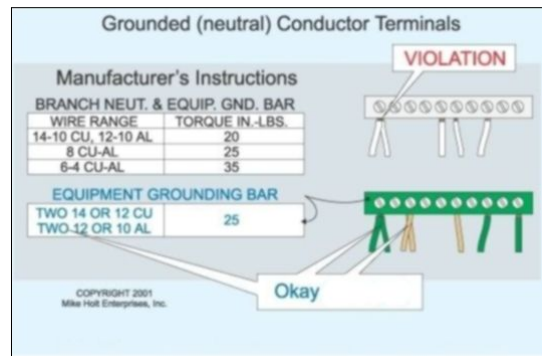

Isolated Neutrals Information

4. Wiring Methods

Residential branch circuits consist of wiring, switches, outlets, connections for permanently-wired appliances. Most wires are hidden behind floor, wall and ceiling coverings and cannot be evaluated. We do not remove cover plates and inspection of branch circuits and wiring is limited to proper response to testing of switches and electrical outlets.

The visible wiring observed was predominately copper non-metallic sheathed cable for branch circuits.

4.1. Inspected where accessible and visible

5. AFCI's

5.1. The home was built before the requirements for **AFCI** protection. You may wish to consult with an electrical contractor regarding the installation of AFCI protection at recommended locations.

5.2. AFCI Information: <http://bit.ly/3d9cCIE>


6. GFCI Observations

GFCI protection installed at: Bathrooms and exterior

It is recommended that you locate all reset buttons for any GFCI's that are present.

GFCI Information: <http://bit.ly/2MZGUN2>

6.1. GFCI protection was not present at all areas now deemed necessary for safety. It may not have been required at original construction. We recommend installation as a safety upgrade at all recommended locations.

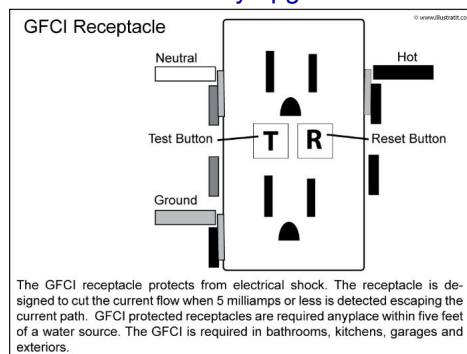

7. Receptacles

7.1. Loose exterior receptacles should be secured. Location: rear

7.2. Receptacle(s) that did not function should have circuit checked and replaced as needed. Location: rear exterior, all bathrooms, upstairs front right bedroom closet, upstairs front right bedroom multiple locations

7.3. Scorched receptacles should be replaced. Location: upstairs front right bedroom multiple locations

7.4. Multiple receptacles issues were observed, examples are listed in the report. We recommend all receptacles be repaired as needed.



Scorched receptacle



Scorched receptacle

8. Switches

8.1. There was a switch that did not function as intended and should be replaced. Location: upstairs left bedroom
upstairs right bedroom



Inoperable switch

9. Lights and Fixtures

Exterior lighting is outside the scope of a home inspection, we do try to operate exterior fixtures. Fixtures may appear to be inoperable due to bulbs that need to be replaced, connection to a timer or light-sensitive switch, or a problem may exist with the light fixture, wiring or the switch. Consult with seller regarding the operation of exterior fixtures.

- 9.1. Bulbs should be installed or replaced at inoperable light fixtures to ensure operation. If changing bulb does not cure issue, you should have repaired or replaced as needed. Location: primary bedroom
- 9.2. There was a loose ceiling fan which should be repaired or replaced. Location: primary
- 9.3. Improper installation of a light fixture in the living room should be repaired by a qualified contractor.
- 9.4. Bulbs should be installed or replaced at inoperable light fixtures to ensure operation. If changing bulb does not cure issue, you should have repaired or replaced as needed. Location: master bathroom



Improper installation

10. Smoke Alarms

Smoke alarms test buttons are engaged when accessible. We do not test carbon monoxide (CO) detectors. We recommend installation in all areas now required. Life expectancy of smoke alarms is 10 years and CO detectors is 6-8 years. If there are no fire extinguishers in the house it is recommended that they are placed in accessible areas.


Smoke Alarm Information: <https://bit.ly/3ajPclF>

CO Detector Information: <http://bit.ly/3ajPclF>

10.1. Smoke alarms were at recommended locations, and should be checked regularly to ensure they are functioning.

10.2. There were smoke alarms that appeared to be older and replacement is advised.

10.3. There was a central security panel present. We did not engage the smoke alarm test buttons in order to prevent causing a false alarm with a security company.

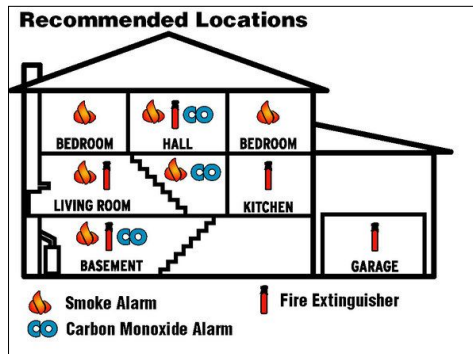

11. Recommendations for Electrical Inspection

We recommend that all repairs or replacements be conducted by a qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

Interior and Property Information

1. Exterior Doors

1.1. A door needed an adjustment in order to function as intended. Location:front and rear door

2. Cabinetry and Counters

2.1. Damaged cabinetry and counter tops should be repaired as needed. Location:upstairs hall bathroom and kitchen

2.2. Sealant at the bottom of a back splash was damaged or missing and should be corrected. Location:upstairs hall bath, master bathroom

2.3. Drawer glides that did not function as intended should be repaired where needed. Location:kitchen island



Broken drawer glides



Recommend sealing



Damaged



Damaged

3. Walls and Ceilings

Walls consisted of wood framing and drywall. Wall paper, paneling, mirrors, wall hangings can conceal damage which are not within the scope of a home inspection. Areas with typically high humidity, such as bathrooms, laundry rooms, damage to wall paper or paneling can allow moisture behind the wall, promoting moisture damage and possibly mold.

3.1. **Moisture stains** at wall were dry when tested with a moisture meter. We recommend asking the seller if action regarding any previous issues has taken place, and if issue is resolved. The interior condition of the wall is unknown. Location:shed

3.2. FYI: Moisture stains on the ceiling(s) were dry when tested with a moisture meter. We recommend asking the seller if action regarding any previous issues has taken place, and if issue is resolved. The interior condition of the ceiling is unknown. Location:left living area closet

3.3. Patches at wall were dry when tested with a moisture meter. We recommend asking the seller if action regarding any previous issues has taken place, and if issue is resolved. The interior condition of the wall is unknown. Location:downstairs bath



Moisture stains - dry



Moisture stains - dry




Moisture stains - dry



Moisture stains - dry

4. Interior Windows

4.1. Windows with degradation of the Low-E coating can affect the window's efficiency. You should inquire about any window warranty the seller may have for the windows or repair as needed. Location: living room right window

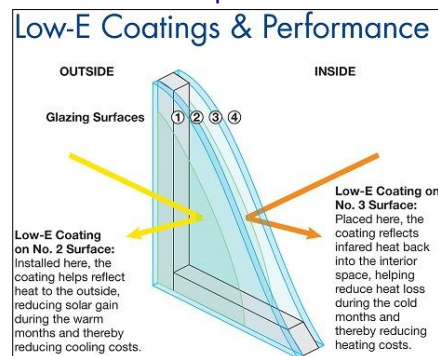

Low-E Windows Information

5. Floor Finishes


Floor coverings near water sources (kitchens, laundry, bathrooms, etc.) should be monitored regularly for moisture. Monitoring for damage to floor coverings is recommended to prevent moisture from getting under the flooring creating conducive conditions for mold. Moisture may have penetrated beneath floor coverings in an existing structure, and any mold or sub floor damage would not be detected during a visual home inspection.

5.1. FYI: The cause of **squeaking floors** is beyond the scope of visual inspection. Location: second floor

5.2. Improve: Uneven carpeting can create trip hazards and correction is recommended. Location: second floor multiple

5.3. Damaged floors should be repaired or replaced as needed. Location: multiple locations

5.4. Damaged floor coverings should be repaired or replaced as needed. Location: multiple locations

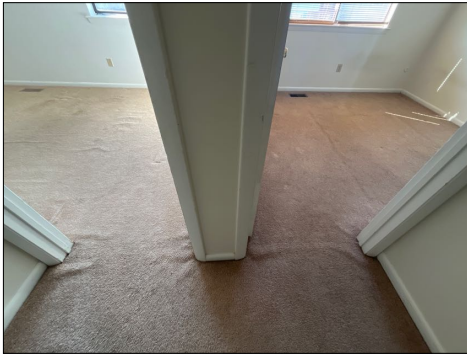


Uneven carpeting



Damaged flooring



Damaged flooring

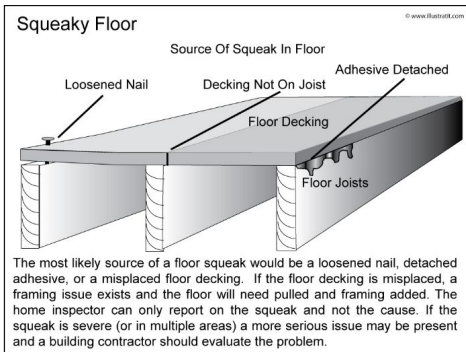

Squeaky Floor Information



Damaged flooring



Damaged flooring

6. Doors and Closets

6.1. Improve: We recommend installing any missing door stops to prevent damage.

6.2. Doors that did not properly latch should be repaired. Location: water heater closet, left living area closet

7. Stairways and Railings

The stairs may have met the standards which were generally-accepted during original construction but may not comply with current standards for safety. Safety concerns will be noted and correction is recommended.

Stairway Safety Information: <http://bit.ly/37aU2Wr>

7.1. Handrails for interior steps should be graspable, continuous and smooth as now required for the purpose of safety.


7.2. Improve: There was a non-continuous handrail installed. You should consider correction.

7.3. Openings that are too wide between balusters should be covered if small children are present.

7.4. Open risers had spacing that should be covered for safety if small children will be present.

7.5. Improve: Hand rail returns are recommended at stairways for safety.

7.6. Loose railing(s) at the stairs should be secured to provide safe conditions. Location: bottom and top of staircase

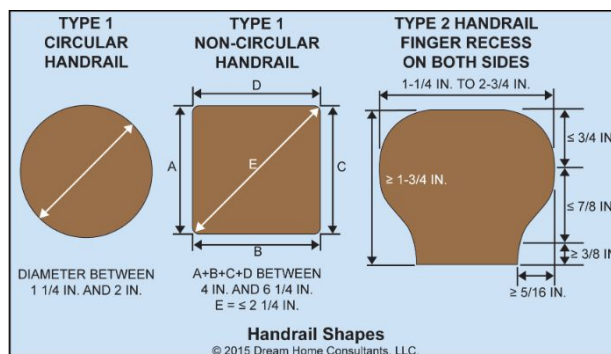

Graspable Handrail Example

8. Bathroom Fans

Bathroom ventilation improves air quality and helps to maintain proper moisture levels in the home. Ventilation may not have been required when the house was built, but the installation of mechanical ventilation is recommended.

8.1. The bathroom exhaust fan(s) functioned.

9. Recommendations for Interior Inspection

We recommend that all repairs or replacements be conducted by a qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

Attic, Insulation, and Ventilation

1. Attic Views and Structure

Roof framing consisted of engineered trusses. Every effort was made to visually inspect all accessible areas. We do not enter attics that have limited headroom, or are restricted by ducts, or in which the insulation obscures the joists. We do not disturb or move insulation which may obscure water pipes, electrical conduits, **unction boxes**, exhaust fans, and other components.



2. Entrance to Attic

2.1. Improve: The attic light fixture did not turn on during the inspection. You should have bulb installed or replaced to ensure the fixture is functional.

3. Attic

3.1. FYI: Visible moisture stains appeared to be from previous issues. There did not appear to be any active issues present, but could not be confirmed. Only a water test could determine if there was an active leak.

3.2. Bathroom fans terminated in the attic fan can allow moisture into the attic and cause damage to the fan and should be corrected.



Moisture staining - evaluated dry



Moisture staining - evaluated dry



Moisture staining - evaluated dry



Venting at ventilator

4. Insulation

Loose fill fiberglass **attic insulation** was installed. Current standards for this area is 10"- 15" for approximately R-30 to R-38 insulating value. Adding additional insulation as an upgrade may improve the overall efficiency and comfort of the home, but it may take several years to pay back in terms of energy savings. You may wish to consult with a qualified contractor if the installed levels are a concern.

4.1. FYI: The insulation levels may have been acceptable at the time of original construction, but do not adhere to today's standards.

4.2. Improve: The insulation had settled or been compressed and most likely does not perform to the proper R-value.



Approximately 6 - 8 inches

5. Ventilation

Attic ventilation was provided by the use of static vents, a powered ventilator, soffit vents.

5.1. FYI: The attic temperature was too cold to test the powered ventilator.

6. Attic Framing

6.1. FYI: There were previous repairs to the attic framing. You should consult with the seller regarding the need for the repairs and if the underlying cause of the issue was addressed. It could not be determined how effective the repaired area will perform. Location: rear left

6.2. There were indications of moisture intrusion evidenced by stained roof deck, but the location was not accessible to test. All necessary repairs should be made if not previously corrected. Location: rear left, front right, rear right


6.3. Damaged roof sheathing should be repaired as needed. Location: near power ventilator, front left plumbing vent, right of ventilator, front right



Inaccessible stains



Previous repairs observed

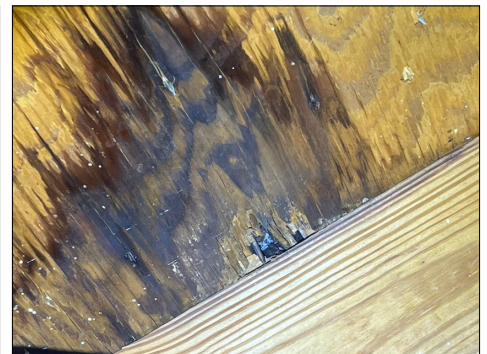

Sheathing damage



Sheathing damage



Sheathing damage



Inaccessible stains



Inaccessible stains



Sheathing damage

7. Recommendations for Attic Inspection

We recommend that all repairs or replacements be conducted by a qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

Outside Scope

Inspection of stand alone freezers, portable microwaves, portable dishwashers and after market water filtration systems and under cabinet lights are outside the scope of the inspection. No opinion is offered as to the adequacy of appliance operation. Appliances are tested for basic operation in one mode only. We do not test all aspects, controls, cycles and speeds and operational temperature of each appliance in the scope of this inspection. Appliances are not moved during the inspection. There may be floor damage under dishwashers and refrigerators that may not be discovered until the units are moved for service or replacement.

1. Scope

Outside the Scope

Our home inspections follow the InterNACHI Standards of Practice. The following information is outside the SOP of a standard home inspection, but your team at Safe House feels the information will be useful to you as a home buyer and owner.

Appliances

Inspection of appliances is outside the scope of a standard home inspection. No opinion is offered as to the adequacy of appliance operation. Appliances are tested for basic operation in one mode only. We do not test all aspects, controls, cycles and speeds and operational temperature of each appliance in the scope of this inspection. Appliances are not moved during the inspection. There may be floor damage under dishwashers and refrigerators that may not be discovered until the units are moved for service or replacement.

Appliance Data Plates

When accessible we took photos of the major appliance data plates. This information is useful when the need arises for repair or replacement. Also, you can go to <https://www.cpsc.gov/Recalls> to see if any of your equipment has been recalled.

2. Range and Cooktop

2.1. The heating elements/burners and oven operated when tested, but does not confirm the efficiency of the system. Not all settings were tested.

2.2. Anti Tip Information: <http://bit.ly/2Ox7tts>



Functional



Functional



3. Dishwasher


3.1. A full inspection of the dishwasher was limited by storage and/or personal belongings.

3.2. The dishwasher **high loop** was not properly secured to the underside of the cabinet.

3.3. The dishwasher was leaking after being turned on, and should be repaired by a qualified technician.



Leaking

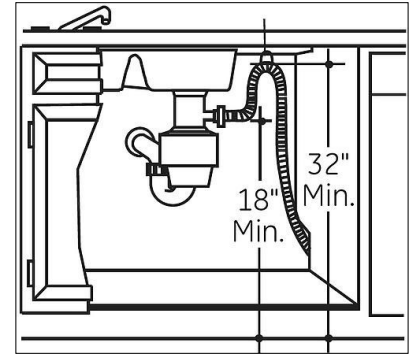

Dishwasher Highloop Example

4. Garbage Disposal

4.1. The disposal was inoperable and should be repaired or replaced as needed.

5. Hood or Exhaust System

5.1. The range hood exhaust fan and lights operated with no deficiencies observed.



Functional



Functional



6. Built In Microwave Oven

6.1. No built-in microwave was present.

7. Refrigerator

7.1. The refrigerator was operating during the inspection. We cannot determine the efficiency of the appliance.

7.2. FYI: When present, determining if the ice maker was functioning as intended is not possible during a home inspection.

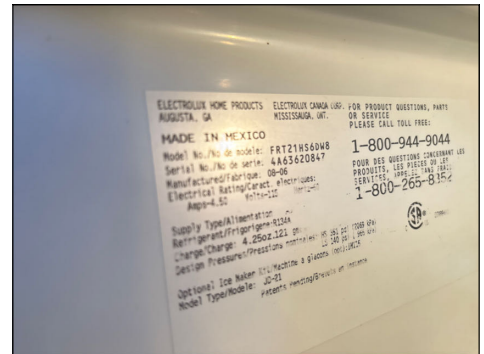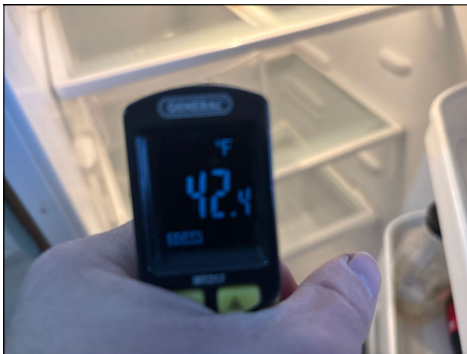

8. Washing Machine

8.1. There was no washing machine present at the time of the inspection. The washer supply valves and drain were not tested.

9. Dryer

9.1. There was no dryer present at the time of the inspection.

10. Clothes Dryer Vent

10.1. Dryer Safety: <http://bit.ly/3pglIVJ>

10.2. Inspected visible portions

11. Pest Information

We are not pest controls specialists and do not perform an invasive inspection for pests or **rodent activity**. As a courtesy we will report any observed presence of any activity indicative of a possible pest presence. These observations are not all-inclusive and it is recommended that you inquire with the seller regarding any present pest control service, pest control issues or have a pest control service evaluate for removal, and repair any concealed damage

12. Environmental Observations

Houses built before 1980 may contain asbestos and before 1978 may contain lead paint. Determining if they are present is outside the scope of a home inspection.

You can find information at the following links:Asbestos Information: <http://bit.ly/3pk0Eb7>

Lead Paint Information: <https://bit.ly/3tSJSUd>

Sampling of mold like substances is not included in a home inspection. As a courtesy we will report any suspected visual areas of mold like substances.

12.1. Visible **microbial growth**, type and extent unknown, had no elevated moisture levels. This may indicate a previous moisture issue has been remediated or is not presenting itself at this time. You should discuss with sellers regarding any prior moisture issues in this area. You should have remediated as needed. Location:shed

12.2. There were visible observations of environmental conditions which are outside the scope of a home inspection listed in the interior section under Environmental Observations. We recommend you review to understand observed conditions.



Microbial growth observed dry



Microbial growth observed dry

13. Auxiliary Systems

Observations:

13.1. Due to the specialized nature of alarm systems, we suggest that you review this system with the seller. These systems are outside the scope of the inspection and was not inspected.

14. Recommendations for Appliances

We recommend that all repairs or replacements be conducted by a qualified, licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

Report Summary

The following items are a brief summary of the significant deficiencies or critical concerns which are important to highlight as they relate to function or safety. Some of these items may warrant further investigation by a specialist. This is **only a summary** and is provided as a courtesy— it should not be considered to be the complete report. The complete list of issues, concerns, deficiencies and important details pertaining to this property is found throughout the body of the inspection report. The complete report may include additional information of concern to the customer. Your entire report must be carefully read to fully assess all of the findings and benefit from the recommendations, maintenance advice, tips and other important resource information.

Roof		
Page 3 Item: 4	Flashings and Penetrations	4.1. Loose flashing (s) should be secured and sealed to prevent moisture intrusion. Location:power ventilator
Exterior		
Page 5 Item: 1	Vinyl Siding	1.4. Damage to the vinyl siding which can allow moisture intrusion and should be repaired. Location:front middle
Page 6 Item: 3	Eaves, Soffits, and Trim	3.4. Multiple trim issues were observed, examples are listed in the report. A qualified contractor should make all necessary repairs.
Page 6 Item: 4	Exterior Doors	4.1. Damage to an exterior door should be repaired or replaced as needed. Location:shed
HVAC		
Page 9 Item: 6	Condensate Drain(s)	6.2. There was no auxiliary condensate drain line or float switch installed at the condensate pan, and should be corrected to prevent moisture damage if pan fills with water.
Plumbing		
Page 11 Item: 6	Water Heater	6.3. Issues were observed with the water heater, examples are in the report. Due to the age of the water heater we recommend a qualified plumbing contractor determine if repair or replacement is best option.
Page 11 Item: 7	Hose Bib(s)	7.1. A hose spigot that was leaking while turned off should be repaired. Location:front
Page 11 Item: 8	Faucets	8.1. Leaking faucet controls should be repaired as needed. Location:kitchen sink
Page 12 Item: 9	Sinks	9.2. Leaking sinks should be repaired as needed. Location: kitchen sink, master bath sink
Page 12 Item: 10	Bathtub(s)	10.3. Leaking bathtub faucet controls should be repaired as needed. Location: master bathroom 10.4. There was damage to a bathroom tub that should be repaired as needed. Location:Master Bathroom and hall bathroom
Page 13 Item: 12	Toilet(s)	12.2. A toilet ran continuously indicating the need for repair. Location:Upstairs hall bath
Electrical		
Page 15 Item: 3	Service Panel	3.5. A clear and complete circuit directory should be installed, and circuit size verified for correct installation, so that in an emergency individual circuits can be quickly shut off. 3.6. Rust or corrosion was present in the panel and a qualified electrical contractor should determine source of moisture and repair as needed.
Page 16 Item: 7	Receptacles	7.4. Multiple receptacles issues were observed, examples are listed in the report. We recommend all receptacles be repaired as needed.
Page 17 Item: 8	Switches	8.1. There was a switch that did not function as intended and should be replaced. Location: upstairs left bedroom upstairs right bedroom

Page 18 Item: 10	Smoke Alarms	10.3. There was a central security panel present. We did not engage the smoke alarm test buttons in order to prevent causing a false alarm with a security company.
Interior and Property Information		
Page 19 Item: 2	Cabinetry and Counters	2.3. Drawer glides that did not function as intended should be repaired where needed. Location:kitchen island
Page 20 Item: 5	Floor Finishes	5.4. Damaged floor coverings should be repaired or replaced as needed. Location:multiple locations
Page 21 Item: 7	Stairways and Railings	7.6. Loose railing(s) at the stairs should be secured to provide safe conditions. Location:bottom and top of staircase
Attic, Insulation, and Ventilation		
Page 23 Item: 3	Attic	3.2. Bathroom fans terminated in the attic fan can allow moisture into the attic and cause damage to the fan and should be corrected.
Page 24 Item: 6	Attic Framing	6.2. There were indications of moisture intrusion evidenced by stained roof deck, but the location was not accessible to test. All necessary repairs should be made if not previously corrected. Location:rear left, front right, rear right 6.3. Damaged roof sheathing should be repaired as needed. Location:near power ventilator, front left plumbing vent, right of ventilator, front right
Outside Scope		
Page 26 Item: 3	Dishwasher	3.3. The dishwasher was leaking after being turned on, and should be repaired by a qualified technician.
Page 27 Item: 4	Garbage Disposal	4.1. The disposal was inoperable and should be repaired or replaced as needed.
Page 28 Item: 12	Environmental Observations	12.2. There were visible observations of environmental conditions which are outside the scope of a home inspection listed in the interior section under Environmental Observations. We recommend you review to understand observed conditions.