



Inspection Report

Jasmin Malanzo

Property Address:
4232 Maplehurst Road
Virginia Beach VA 23462



Keff/Spec LLC

**John Keffer 3380000688
4901 Bradpointe Ln
Va Beach VA 2345757-650-7579**

Table of Contents

[Cover Page.....1](#)

[Table of Contents.....3](#)

[Intro Page.....4](#)

[1 Roofing.....5](#)

[2 Exterior.....6](#)

[3 Interiors.....8](#)

[4 Structural Components.....10](#)

[5 Plumbing System.....11](#)

[6 Electrical System.....14](#)

[7 Heating / Central Air Conditioning.....16](#)

[8 Insulation and Ventilation.....18](#)

[9 Built-In Kitchen Appliances.....19](#)

[General Summary.....20](#)

[Invoice.....56](#)

[Agreement.....57](#)

Date: 2/22/2026	Time: 10:00 AM	Report ID: 6628
Property: 4232 Maplehurst Road Virginia Beach VA 23462	Customer: Jasmin Malanzo	Real Estate Professional: Karen Archbell Rose & Womble

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

In Attendance:

Customer and their agent

Type of building:

Townhome

Approximate age of building:

1977

Temperature:

40 f

Weather:

Clear

Ground/Soil surface condition:

Staured

Rain in last 3 days:

Yes

1. Roofing

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

Styles & Materials

Roof Covering:	Viewed roof covering from:	Sky Light(s):
Architectural	Ground	None
	Binoculars	
	From inside attic	

		IN	NI	NP	IP	RR
1.0	ROOF COVERINGS					•
1.1	FLASHINGS	•				
1.2	SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS	•				
1.3	ROOF DRAINAGE SYSTEMS			•		
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

Comments:

1.0 (1) The roof covering/sheathing shows signs of a previous or possible current leak(s) at the rear of home. Further inspection is needed . A qualified roofing contractor should inspect further and repair or replace as needed.

1.0 (2) The roof covering was only fully inspected from inside the attic space due to ice and snow . at the front of home and rear of home. . A qualified roofing contractor should inspect further and repair or replace as needed.

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

2. Exterior

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

Styles & Materials

Siding Style:

Lap

Siding Material:

Vinyl

Exterior Entry Doors:

Steel

Glass sliding door(s)

Appurtenance:

Sidewalk

Driveway:

Parking lot

		IN	NI	NP	IP	RR
2.0	WALL CLADDING FLASHING AND TRIM	•				
2.1	DOORS (Exterior)					•
2.2	WINDOWS				•	
2.3	DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/ COVER AND APPLICABLE RAILINGS					•
2.4	EAVES, SOFFITS AND FASCIAS					•
2.5	VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)				•	
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

Comments:

2.1 (1) The main entry door and trim/brick mold/frame are only factory primed, paint is needed . This/ these are/is considered a maintenance issue. A qualified person should repair or replace as needed.

2.1 (2) The entry door at storage closet and/or trim/brick mold/frame is/are deteriorated from water infiltration. . A qualified contractor should inspect and repair as needed.

2.1 (3) Sliding screen for glass door unit at rear of home is torn or damaged. This/these are/is considered a maintenance issue. A qualified person should repair or replace as needed.

2.2 The screen(s) is, are damaged at front of home. This is a maintenance issue and is for your information. A qualified person should repair or replace as needed.

2.3 The Concrete/Brick porch on the porch at the rear of home is cracked and slightly settled.. Further

deterioration can occur if not repaired. A qualified contractor should repair or replace as needed.

2.4 (1) The soffit panels at the front of home and rear of home are loose and/or missing. Further deterioration may occur if not repaired. A qualified contractor should inspect and repair as needed.

2.4 (2) The rake board metal wrap at the left side is loose. Further deterioration may occur if not repaired. A qualified person should repair or replace as needed.

2.5 The bush, shrub or tree limbs that are in contact with roof/siding or hanging near roof/siding should be trimmed. Smaller tree limbs that rub against the roof/siding can cause damage to the building over time.

.....
The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

3. Interiors

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

Styles & Materials

Ceiling Materials:

Drywall
Plaster

Wall Material:

Drywall
Plaster

Floor Covering(s):

Carpet
Vinyl

Interior Doors:

Hollow core

Window Types:

Sliders

Window Manufacturer:

UNKNOWN

Cabinetry:

Wood

Countertop:

Laminate

		IN	NI	NP	IP	RR
3.0	CEILINGS	•				
3.1	WALLS					•
3.2	FLOORS					•
3.3	STEPS, STAIRWAYS, BALCONIES AND RAILINGS					•
3.4	COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS					•
3.5	DOORS (REPRESENTATIVE NUMBER)					•
3.6	WINDOWS (REPRESENTATIVE NUMBER)	•				
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

Comments:

3.1 (1) The Surround kit at bathtub on the wall is extremely dirty and shows signs of DIY "fix" at the hall bath. While this damage is cosmetic, it needs to be repaired. A qualified person should repair or replace as needed.

3.1 (2) The sheetrock plaster on the walls show signs of previous DIY re[pairs and/or mis-matched paint throughout the home. This is a cosmetic issue for your information. .

3.2 The Floor covering(s), Carpet and/or Vinyl is loose or baggy and not stretched for a tight installation and/or is/are in less than fair condition at the throughout the home. This is a cosmetic issue for your information. A qualified contractor should inspect and repair as needed.

3.3 The pull down stairs to attic dose not shut tightly to the ceiling and were not cut to fit the location at time of installation . This causes undue strain on the pull down stair system and can lead to stair failure have/has loose hardware or fasteners. . A qualified contractor should inspect and repair as needed.

3.4 (1) Base cabinetry, Cabinet door(s) and/or Drawer(s) are in less than fair condition and could use repair in the kitchen and all three baths . This is a maintenance issue . Recommend repair or replace as necessary.

3.4 (2) Laminated countertop is chipped, is damaged, is loose, not fastened securely and/or is swollen at diagonal seam(s) in the kitchen . This is a cosmetic issue for your information. Recommend repair or replace as necessary.

3.5 (1) Several closet and entry doors knob(s) is/are loose and/or have/has locking or keyed locking knob(s) installed where not permitted throughout the home. . A qualified contractor should inspect and repair as needed.

3.5 (2) Bi-fold door is/are damaged at the utility room. . A qualified contractor should inspect and repair as needed.

3.5 (3) Bi-fold door falls out of track when opened at the front left bedroom. This/these are/is considered a maintenance issue. A qualified person should repair or replace as needed.

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

4. Structural Components

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

Styles & Materials

Foundation: Poured concrete	Method used to observe Crawlspace: No crawlspace	Floor Structure: Slab
Roof Structure: Engineered wood trusses Plywood Sheathing	Roof-Type: Gable	Method used to observe attic: Walked
Attic info: Pull Down stairs		

		IN	NI	NP	IP	RR
4.0	FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)	•				
4.1	WALLS (Structural)	•				
4.2	COLUMNS OR PIERS			•		
4.3	FLOORS (Structural)	•				
4.4	CEILINGS (structural)	•				
4.5	ROOF STRUCTURE AND ATTIC	•				
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

5. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

Styles & Materials

Water Source: Public	Plumbing Water Distribution (inside home): Copper	Washer Drain Size: 2" Diameter
Plumbing Waste: PVC	Water Heater Power Source: Electric	Water Heater Capacity: 50 Gallon (2-3 people)
Manufacturer: BRADFORD-WHITE Extra Info : 2012	Water Heater Location: Upper level	

		IN	NI	NP	IP	RR
5.0	PLUMBING DRAIN, WASTE AND VENT SYSTEMS					•
5.1	PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES					•
5.2	HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS					•
5.3	MAIN WATER SHUT-OFF DEVICE (Describe location)	•				
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

Comments:

5.0 (1) The toilet is loose at floor and tank is loose to the bowl at the hall bath and primary bath. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.

5.0 (2) The stop-valve is missing at the Primary Bath sink and Half Bath sink. Repair(s) are needed. A qualified person should repair as necessary.

5.1 (1) The hose bib drips when off at the front of home. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.

5.1 (2) The All three shower/tub water controls; Hot ,Cold , and Diverter leak(s) behind handle when the water is turned on and show signs of inadequate repairs at the hall bath and primary bath. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.

5.1 (3) The plumbing supply shut-off(s) "gate vales" handle sis damaged at the utility room. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.

5.1 (4) The shower head Leaks , spays water against the adjacent wall(s) at the hall bath. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.

5.1 (5) The fiberglass tub is damaged at the primary bath. Repairs are needed to prevent possible leak through crack or damaged area A qualified licensed plumber should repair or correct as needed.

5.1 (6) The shower head water supply arm is loose in the wall under the primary bath. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.

5.1 (7) The spray nozzle/hose is loose at mount and needs securing to sink/counter and is clogged at the kitchen sink. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.

5.2 (1) The water heater dose not sit in an over flow pan that drains to the outside of the home .. This could cause damage to the inside the home should the unit leak .. suggest having a water alarm installed , if not able to plumb to the outside A qualified licensed plumber should repair or correct as needed.

5.2 (2) The wiring for the water heater power cut-off box is missing or not installed. This is a safety issue that needs to be corrected. I recommend a licensed electrical contractor correct as necessary.

5.3 The main shut off is the knob located in the utility closet. This is for your information.

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

6. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

Styles & Materials

Electrical Service Conductors:	Panel capacity:	Panel Type:
Below ground	150 AMP	Circuit breakers
Electric Panel Manufacturer:	Branch wire 15 and 20 AMP:	Wiring Methods:
MURRAY	Copper	Romex

		IN	NI	NP	IP	RR
6.0	SERVICE ENTRANCE CONDUCTORS	•				
6.1	SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS					•
6.2	BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATIBILITY OF THEIR AMPERAGE AND VOLTAGE	•				
6.3	CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)					•
6.4	POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, AND ALL RECEPTACLES IN GARAGE, CARPORT, EXTERIOR WALLS OF INSPECTED STRUCTURE					•
6.5	OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)					•
6.6	LOCATION OF MAIN AND DISTRIBUTION PANELS	•				
6.7	SMOKE DETECTORS					•
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

Comments:

6.1 The problem(s) discovered in the panel such as breaker(s) are different brands, and/or do not match the manufacture of panel, circuits not fully, properly or clearly labeled or identified, cover missing screws, and any other problems that an electrical contractor may discover while performing repairs need correcting. I recommend a licensed electrical contractor inspect further and correct as needed.

6.3 (1) Several switches and 3 prong outlets are loose in wall and need to be tightened, old and contacts are loose and no longer holds plug securely, clogged or obstructed with paint, and/or damaged/burnt throughout the home. Electrical issues are considered a hazard until repaired. A

qualified licensed electrical contractor should perform repairs that involve wiring.

6.3 (2) Dryer outlet is painted over . Electrical issues are considered a hazard until repaired. A qualified licensed electrical contractor should perform repairs that involve wiring.

6.3 (3) The ceiling fan does work, but "wobbles" and lights do not function in the primary bedroom. It is usually more cost effective to replace faulty ceiling fans . A qualified licensed electrical contractor should perform repairs that involve wiring.

6.3 (4) The light fixture does/do work, but is damaged at the Dining Room. Electrical issues are considered a hazard until repaired. A qualified licensed electrical contractor should perform repairs that involve wiring.

6.4 Outlet(s) within six feet of the kitchen sink(s) is/are not a GFCI protected outlet(s) . This is not considered to be up to today's standard.GFCI outlet(s) should be installed by a qualified electrician.

6.5 One GFCI (Ground Fault Circuit Interrupter) protected outlet at the Hall Bath has a short. This is a safety issue that needs to be corrected. A qualified licensed electrical contractor should perform repairs that involve wiring.

6.6 The main panel box is located at the storage closet.

6.7 The smoke detector are old and are due to be replaced at the common hallway(s) and/or bedroom(s). . A qualified person should repair or replace as needed.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

7. Heating / Central Air Conditioning

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

Styles & Materials

Heat Type: Heat Pump Forced Air (also provides cool air)	Heat System Brand: GOODMAN Serial # : 2021	Energy Source: Electric
Number of Heat Systems (excluding wood): One	Ductwork: Insulated	Cooling Equipment Type: Heat Pump Forced Air (also provides warm air)
Cooling Equipment Energy Source: Electricity	Central Air Manufacturer: GOODMAN Serial # : 2021	

		IN	NI	NP	IP	RR
7.0	HEATING EQUIPMENT					•
7.1	AUTOMATIC SAFETY CONTROLS	•				
7.2	NORMAL OPERATING CONTROLS	•				
7.3	DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)	•				
7.4	PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM	•				
7.5	COOLING AND AIR HANDLER EQUIPMENT					•
7.6	NORMAL OPERATING CONTROLS	•				
7.7	PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM	•				
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

Comments:

- 7.0** The Heat Pump Aux. heat mode was engaged (at a 2 degree difference) at the time of the inspection.. This means that the heat in the home is being solely or partially provided by the emergency heat strip in the air handler . This is not efficient and can cause an extremely high power bill. Suggest a full maintenance service, inspection, and clean of interior and exterior unit(s) by a qualified HVAC contractor and to repair if needed..
- 7.5** The A/C component(s) of HVAC system(s) was/were not tested for proper operation due to the outside air temperature is 50 degrees or less. Units will not run/turn on in lower temperature. Suggest a qualified HVAC contractor inspect further to insure proper functionality

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

8. Insulation and Ventilation

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

Styles & Materials

Ventilation:

Soffit Vents
Thermostatically controlled fan
Passive roof vents

Attic Insulation:

Fiberglass

Exhaust Fans:

Fan

Dryer Power Source:

220 Electric

Dryer Vent:

Metal

Floor System Insulation:

Slab

		IN	NI	NP	IP	RR
8.0	INSULATION UNDER FLOOR SYSTEM			•		
8.1	INSULATION IN ATTIC	•				
8.2	VAPOR RETARDERS (ON GROUND IN CRAWLSPACE OR BASEMENT)			•		
8.3	VENTILATION OF ATTIC AND FOUNDATION AREAS	•				
8.4	VENTING SYSTEMS (Kitchens, baths and laundry)					•
8.5	VENTILATION FANS AND THERMOSTATIC CONTROLS (ATTIC)	•				
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

Comments:

8.4 The Exhaust fan has a distinct hum that is not normal and is missing light cover at the primary bath. This is usually a sign that the unit is starting g to fail. A qualified contractor should inspect and repair as needed.

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9. Built-In Kitchen Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

Styles & Materials

Dishwasher Brand: WHIRLPOOL	Disposer Brand: DISPOSALL	Built in Microwave: NONE
Exhaust/Range hood: VENTED KENMORE	Range/Oven: WHIRLPOOL	

		IN	NI	NP	IP	RR
9.0	DISHWASHER	•				
9.1	RANGES/OVENS/COOKTOPS					•
9.2	RANGE HOOD	•				
9.3	FOOD WASTE DISPOSER					•
		IN	NI	NP	IP	RR

IN= Inspected, NI= Not Inspected, NP= Not Present, IP= Infomational Purposes, RR= Repair or Replace

Comments:

9.1 (1) There is no anti-tip device installed on the stove . This is considered a safety issue and needs to be corrected . A qualified contractor should perform the installation .

9.1 (2) The range/oven sits lower than the adjacent laminate counter top . This is considered a safety/ fire hazard .. I recommend repair as needed.

9.3 The food disposer rubber strainer/guard no longer works as intended unit is/has seized and is inoperable and is missing hose clamp from dishwasher. I recommend repair as needed.

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

General Summary



**4901 Bradpointe Ln
Va Beach VA 2345757-650-7579**

Customer
Jasmin Malanzo

Address
4232 Maplehurst Road
Virginia Beach VA 23462

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling;** or **warrants further investigation by a specialist,** or **requires subsequent observation.** This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

1. Roofing

1.0 ROOF COVERINGS

Repair or Replace

(1) The roof covering/sheathing shows signs of a previous or possible current leak(s) at the rear of home. Further inspection is needed . A qualified roofing contractor should inspect further and repair or replace as needed.



1.0 Item 1(Picture)



1.0 Item 2(Picture)



1.0 Item 3(Picture)



1.0 Item 4(Picture)



1.0 Item 5(Picture)



1.0 Item 6(Picture)

(2) The roof covering was only fully inspected from inside the attic space due to ice and snow . at the front of home and rear of home. . A qualified roofing contractor should inspect further and repair or replace as needed.



1.0 Item 7(Picture)

2. Exterior

2.1 DOORS (Exterior)

Repair or Replace


(1) The main entry door and trim/brick mold/frame are only factory primed, paint is needed . This/ these are/is considered a maintenance issue. A qualified person should repair or replace as needed.



2.1 Item 1(Picture)




2.1 Item 2(Picture)

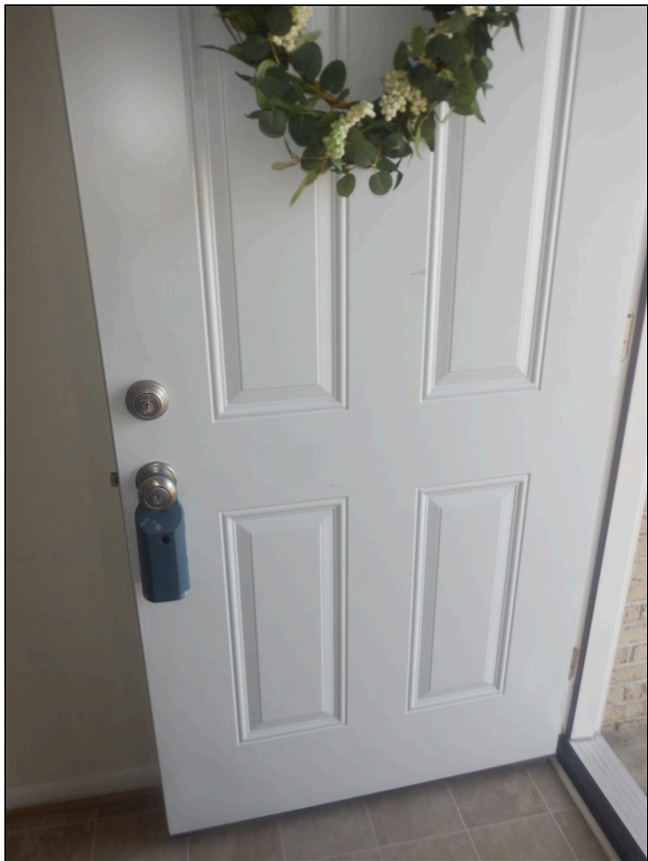

2.1 Item 3(Picture)

(2) The entry door at storage closet and/or trim/brick mold/frame is/are deteriorated from water infiltration. . A qualified contractor should inspect and repair as needed.

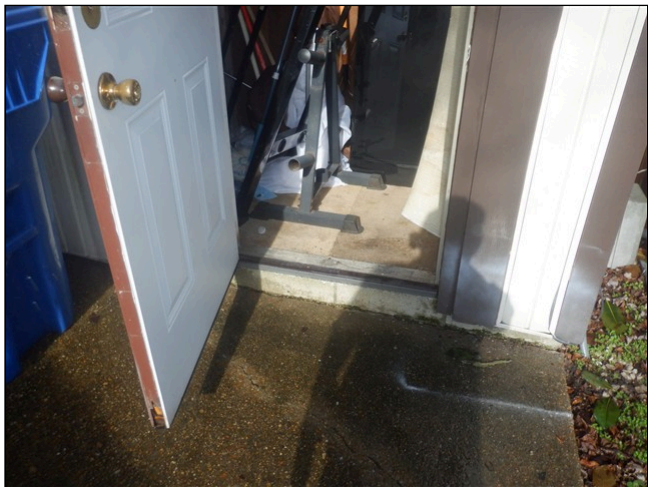

2.1 Item 4(Picture)



2.1 Item 5(Picture)



2.1 Item 6(Picture)

(3) Sliding screen for glass door unit at rear of home is torn or damaged. This/these are/is considered a maintenance issue. A qualified person should repair or replace as needed.



2.1 Item 7(Picture)

2.2 WINDOWS

Infomational Purposes

The screen(s) is, are damaged at front of home. This is a maintenance issue and is for your information. A qualified person should repair or replace as needed.



2.2 Item 1(Picture)

2.3 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/ COVER AND APPLICABLE RAILINGS

Repair or Replace

The Concrete/Brick porch on the porch at the rear of home is cracked and slightly settled.. Further deterioration can occur if not repaired. A qualified contractor should repair or replace as needed.



2.3 Item 1(Picture)



2.3 Item 2(Picture)



2.3 Item 3(Picture)

2.4 EAVES, SOFFITS AND FASCIAS

Repair or Replace

(1) The soffit panels at the front of home and rear of home are loose and/or missing. Further deterioration may occur if not repaired. A qualified contractor should inspect and repair as needed.



2.4 Item 1(Picture)



2.4 Item 2(Picture)



2.4 Item 3(Picture)



2.4 Item 4(Picture)

(2) The rake board metal wrap at the left side is loose. Further deterioration may occur if not repaired. A qualified person should repair or replace as needed.



2.4 Item 5(Picture)

2.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)

Infomational Purposes

The bush, shrub or tree limbs that are in contact with roof/siding or hanging near roof/siding should be trimmed. Smaller tree limbs that rub against the roof/siding can cause damage to the building over time.



2.5 Item 1(Picture)

3. Interiors

3.1 WALLS

Repair or Replace

(1) The Surround kit at bathtub on the wall is extremely dirty and shows signs of DIY "fix" at the hall bath. While this damage is cosmetic, it needs to be repaired. A qualified person should repair or replace as needed.




3.1 Item 1(Picture)



3.1 Item 2(Picture)

(2) The sheetrock plaster on the walls show signs of previous DIY re[pairs and/or mis-matched paint throughout the home. This is a cosmetic issue for your information. .

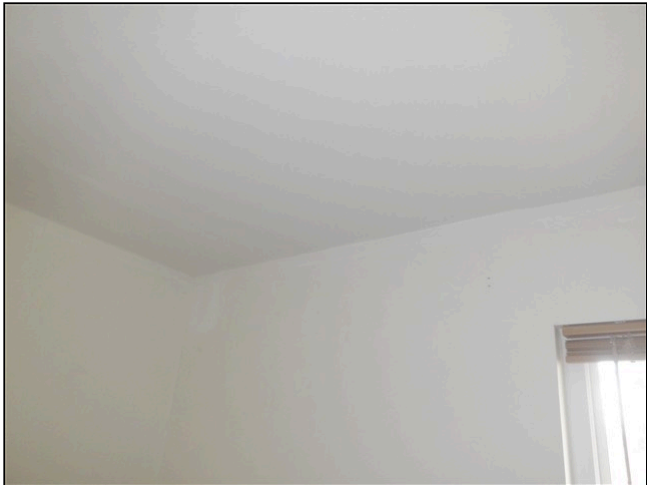

3.1 Item 3(Picture)



3.1 Item 4(Picture)




3.1 Item 5(Picture)




3.1 Item 6(Picture)



3.1 Item 7(Picture)

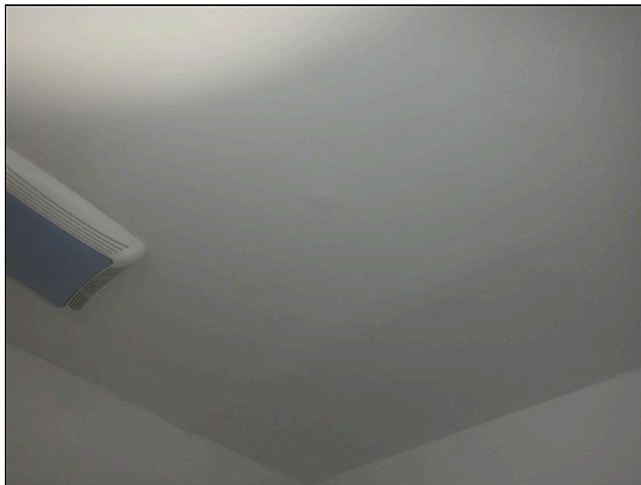

3.1 Item 8(Picture)

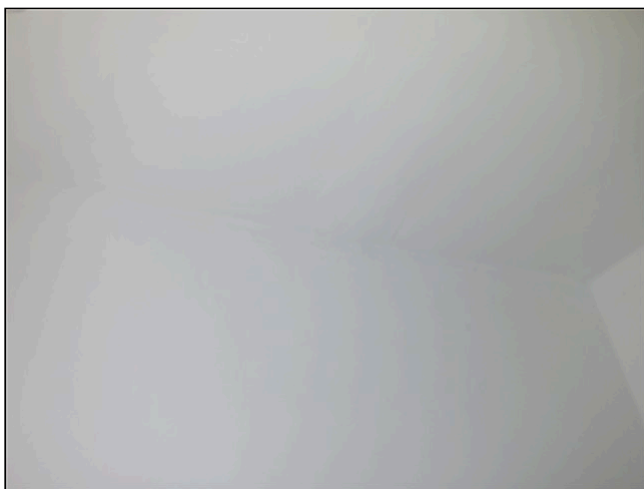

3.1 Item 9(Picture)

3.2 FLOORS

Repair or Replace

The Floor covering(s), Carpet and/or Vinyl is loose or baggy and not stretched for a tight installation and/or is/are in less than fair condition at the throughout the home. This is a cosmetic issue for your information. A qualified contractor should inspect and repair as needed.



3.2 Item 1(Picture)




3.2 Item 2(Picture)



3.2 Item 3(Picture)



3.2 Item 4(Picture)

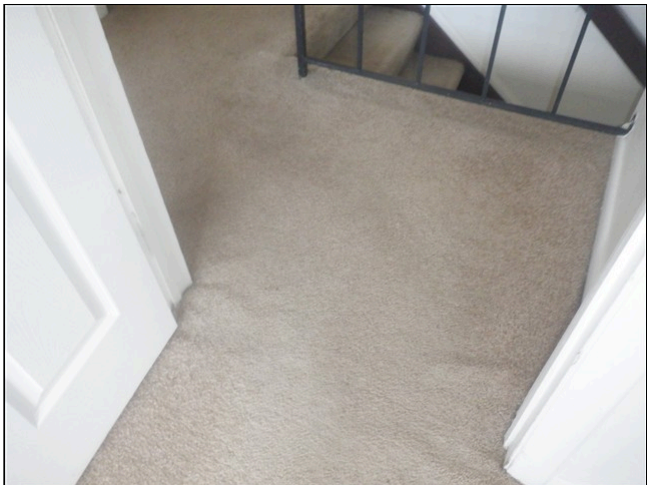

3.2 Item 5(Picture)



3.2 Item 6(Picture)



3.2 Item 7(Picture)




3.2 Item 8(Picture)




3.2 Item 9(Picture)



3.2 Item 10(Picture)

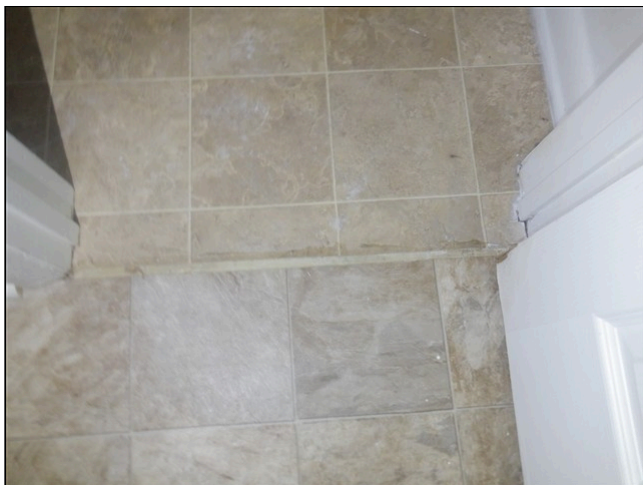

3.2 Item 11(Picture)

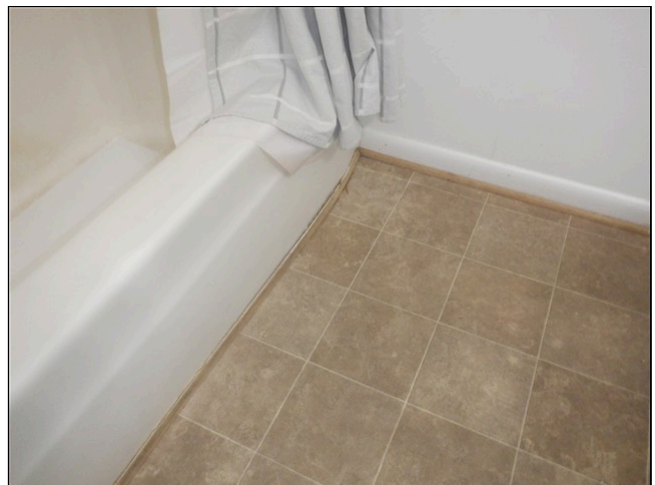

3.2 Item 12(Picture)

3.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

Repair or Replace

The pull down stairs to attic dose not shut tightly to the ceiling and were not cut to fit the location at time of installation . This causes undue strain on the pull down stair system and can lead to stair failure have/has loose hardware or fasteners. . A qualified contractor should inspect and repair as needed.



3.3 Item 1(Picture)



3.3 Item 2(Picture)



3.3 Item 3(Picture)



3.3 Item 4(Picture)



3.3 Item 5(Picture)



3.3 Item 6(Picture)



3.3 Item 7(Picture)


3.4 COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS

Repair or Replace

(1) Base cabinetry, Cabinet door(s) and/or Drawer(s) are in less than fair condition and could use repair in the kitchen and all three baths . This is a maintenance issue . Recommend repair or replace as necessary.



3.4 Item 1(Picture)

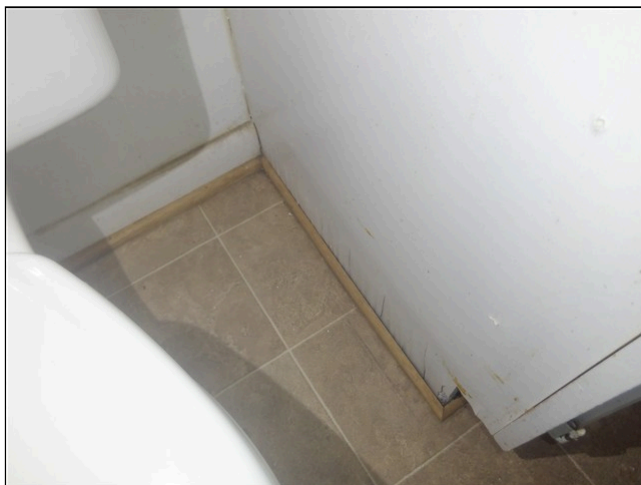


3.4 Item 2(Picture)



3.4 Item 3(Picture)



3.4 Item 4(Picture)

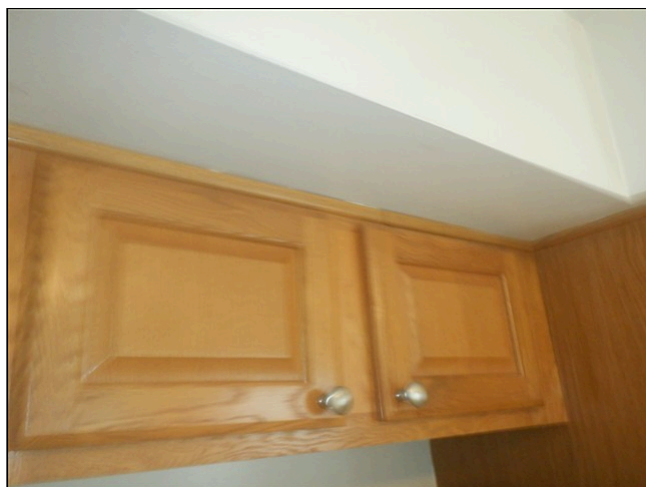

3.4 Item 5(Picture)



3.4 Item 6(Picture)

(2) Laminated countertop is chipped, is damaged, is loose, not fastened securely and/or is swollen at diagonal seam(s) in the kitchen . This is a cosmetic issue for your information. Recommend repair or replace as necessary.



3.4 Item 7(Picture)



3.4 Item 8(Picture)



3.4 Item 9(Picture)




3.4 Item 10(Picture)


3.5 DOORS (REPRESENTATIVE NUMBER)

Repair or Replace


(1) Several closet and entry doors knob(s) is/are loose and/or have/has locking or keyed locking knob(s) installed where not permitted throughout the home. . A qualified contractor should inspect and repair as needed.

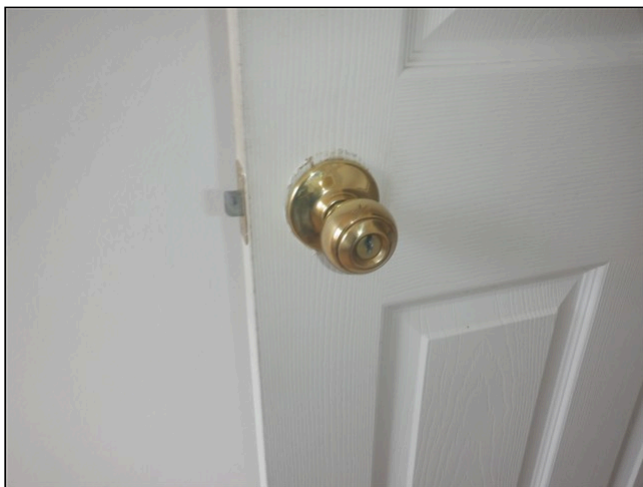


3.5 Item 1(Picture)

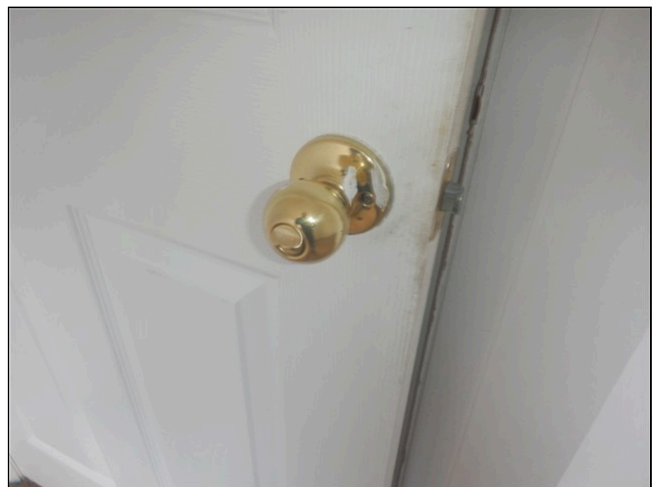


3.5 Item 2(Picture)

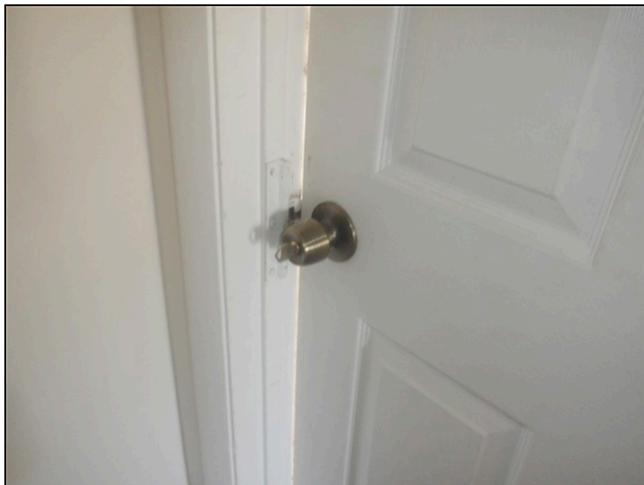


3.5 Item 3(Picture)

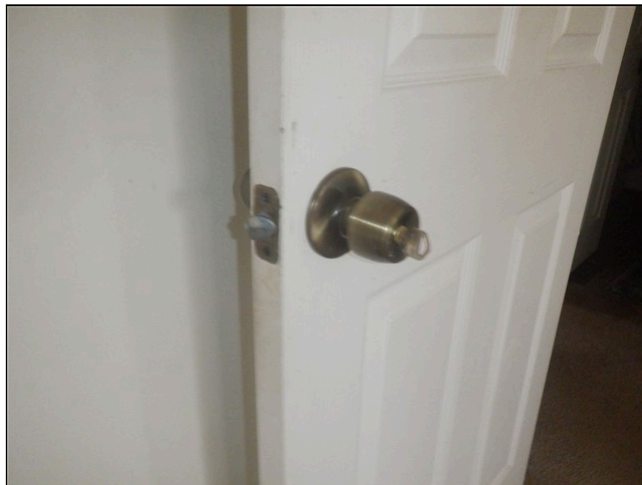

3.5 Item 4(Picture)

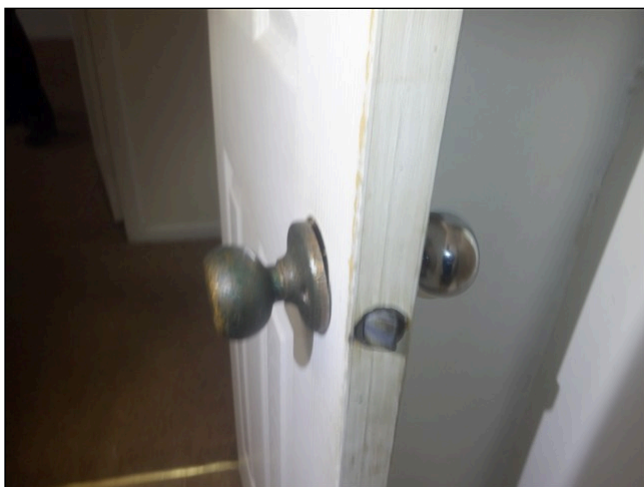

3.5 Item 5(Picture)

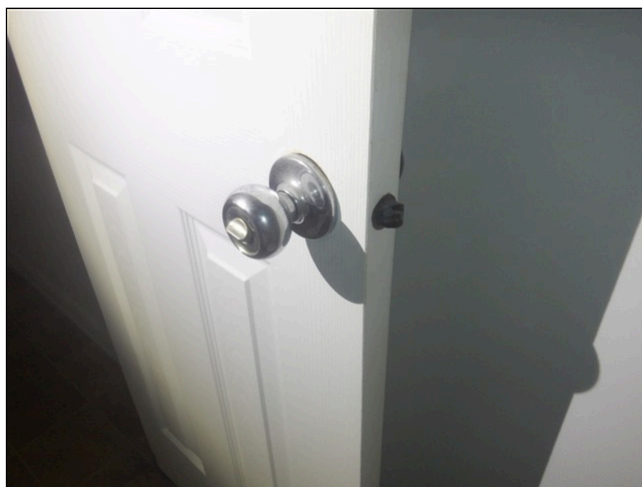

3.5 Item 6(Picture)

(2) Bi-fold door is/are damaged at the utility room. . A qualified contractor should inspect and repair as needed.



3.5 Item 7(Picture)


(3) Bi-fold door falls out of track when opened at the front left bedroom. This/these are/is considered a maintenance issue. A qualified person should repair or replace as needed.




3.5 Item 8(Picture)



3.5 Item 9(Picture)

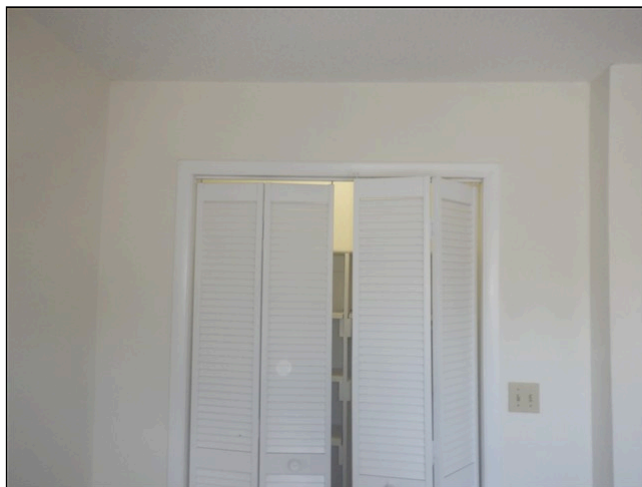

3.5 Item 10(Picture)

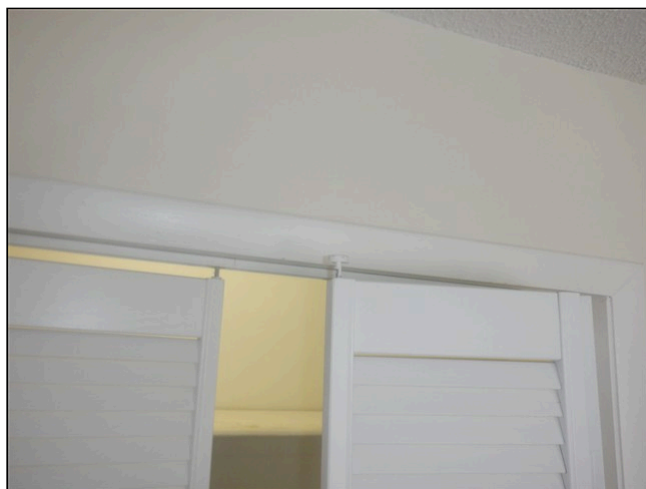

3.5 Item 11(Picture)

5. Plumbing System

5.0 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

Repair or Replace

(1) The toilet is loose at floor and tank is loose to the bowl at the hall bath and primary bath. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.



5.0 Item 1(Picture)



5.0 Item 2(Picture)



5.0 Item 3(Picture)



5.0 Item 4(Picture)

(2) The stop-valve is missing at the Primary Bath sink and Half Bath sink. Repair(s) are needed. A

qualified person should repair as necessary.



5.0 Item 5(Picture)



5.0 Item 6(Picture)

5.1 PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

Repair or Replace

(1) The hose bib drips when off at the front of home. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.



5.1 Item 1(Picture)



5.1 Item 2(Picture)

(2) The All three shower/tub water controls; Hot ,Cold , and Diverter leak(s) behind handle when the water is turned on and show signs of inadequate repairs at the hall bath and primary bath. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.




5.1 Item 3(Picture)



5.1 Item 4(Picture)




5.1 Item 5(Picture)

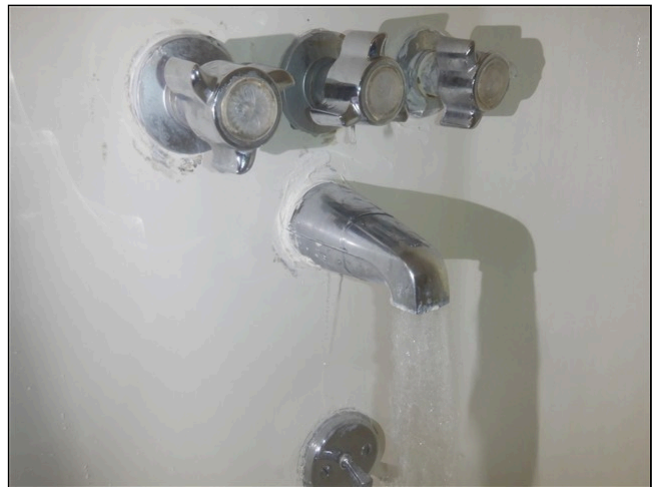

5.1 Item 6(Picture)



5.1 Item 7(Picture)

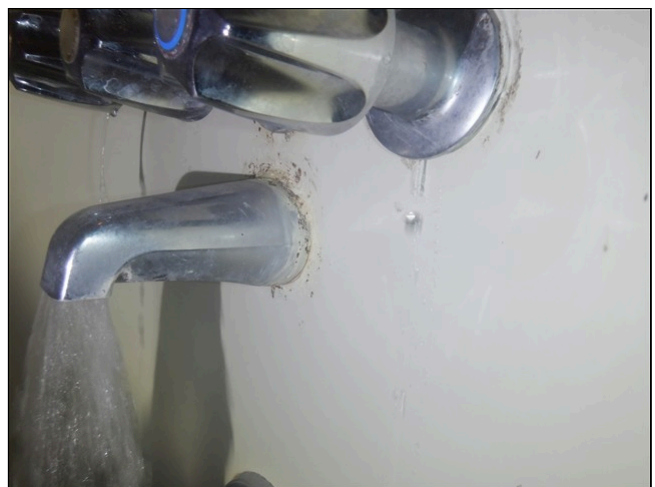

5.1 Item 8(Picture)



5.1 Item 9(Picture)



5.1 Item 10(Picture)

(3) The plumbing supply shut-off(s) "gate vales" handle sis damaged at the utility room. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.



5.1 Item 11(Picture)



5.1 Item 12(Picture)

(4) The shower head Leaks , spays water against the adjacent wall(s) at the hall bath. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.



5.1 Item 13(Picture)

(5) The fiberglass tub is damaged at the primary bath. Repairs are needed to prevent possible leak through crack or damaged area A qualified licensed plumber should repair or correct as needed.



5.1 Item 14(Picture)



5.1 Item 15(Picture)



5.1 Item 16(Picture)

(6) The shower head water supply arm is loose in the wall under the primary bath. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.



5.1 Item 17(Picture)

(7) The spray nozzle/hose is loose at mount and needs securing to sink/counter and is clogged at the kitchen sink. Repair(s) are needed. A qualified licensed plumber should repair or correct as needed.



5.1 Item 18(Picture)

5.2 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

Repair or Replace

(1) The water heater dose not sit in an over flow pan that drains to the outside of the home .. This could cause damage to the inside the home should the unit leak .. suggest having a water alarm installed , if not able to plumb to the outside A qualified licensed plumber should repair or correct as needed.



5.2 Item 1(Picture)



5.2 Item 2(Picture)

(2) The wiring for the water heater power cut-off box is missing or not installed. This is a safety issue that needs to be corrected. I recommend a licensed electrical contractor correct as necessary.



5.2 Item 3(Picture)

6. Electrical System

6.1 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

Repair or Replace

The problem(s) discovered in the panel such as breaker(s) are different brands, and/or do not match the manufacture of panel, circuits not fully, properly or clearly labeled or identified, cover missing screws, and any other problems that an electrical contractor may discover while performing repairs need correcting. I recommend a licensed electrical contractor inspect further and correct as needed.




6.1 Item 1(Picture)



6.1 Item 2(Picture)



6.1 Item 3(Picture)

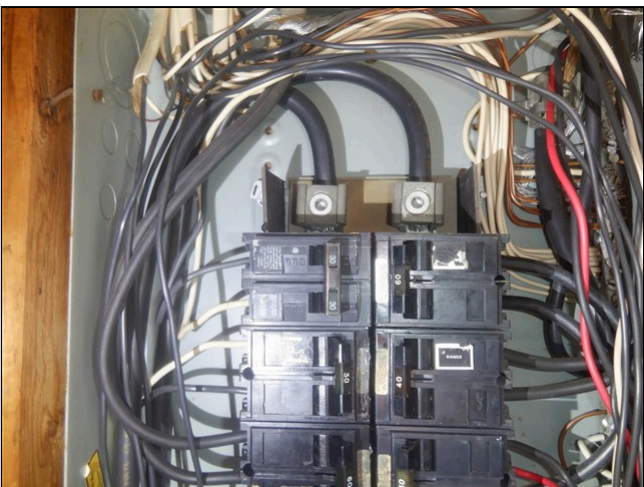

6.1 Item 4(Picture)




6.1 Item 5(Picture)

6.3 CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)

Repair or Replace

(1) Several switches and 3 prong outlets are loose in wall and need to be tightened, old and contacts are loose and no longer holds plug securely, clogged or obstructed with paint, and/or damaged/burnt throughout the home. Electrical issues are considered a hazard until repaired. A qualified licensed electrical contractor should perform repairs that involve wiring.

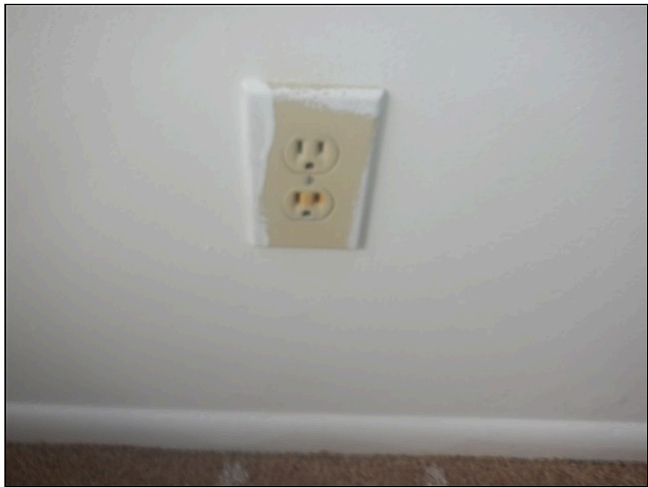


6.3 Item 1(Picture)




6.3 Item 2(Picture)



6.3 Item 3(Picture)

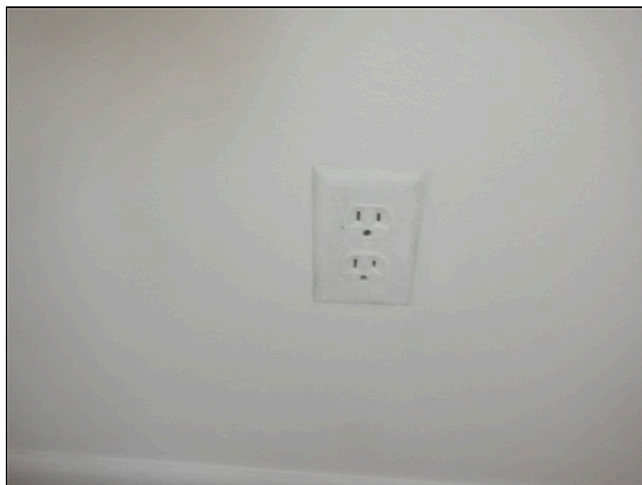

6.3 Item 4(Picture)

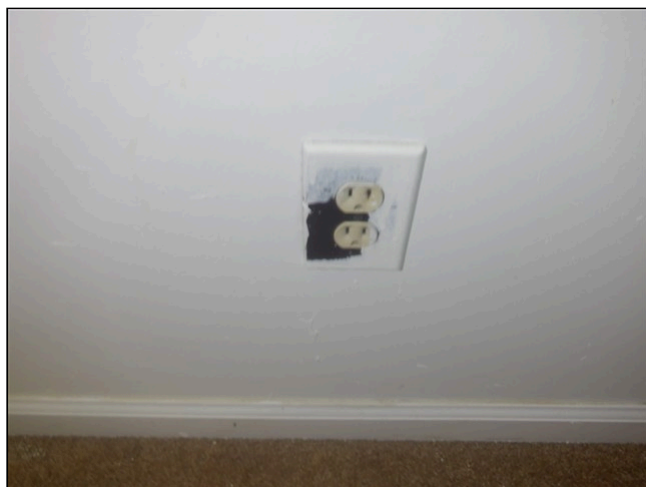

6.3 Item 5(Picture)

(2) Dryer outlet is painted over . Electrical issues are considered a hazard until repaired. A qualified licensed electrical contractor should perform repairs that involve wiring.



6.3 Item 6(Picture)

(3) The ceiling fan does work, but "wobbles" and lights do not function in the primary bedroom. It is usually more cost effective to replace faulty ceiling fans . A qualified licensed electrical contractor should perform repairs that involve wiring.



6.3 Item 7(Picture)



6.3 Item 8(Picture)



6.3 Item 9(Picture)



6.3 Item 10(Picture)

(4) The light fixture does/do work, but is damaged at the Dining Room. Electrical issues are considered a hazard until repaired. A qualified licensed electrical contractor should perform repairs that involve wiring.



6.3 Item 11(Picture)



6.3 Item 12(Picture)

6.4 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, AND ALL RECEPTACLES IN GARAGE, CARPORT, EXTERIOR WALLS OF INSPECTED STRUCTURE

Repair or Replace

Outlet(s) within six feet of the kitchen sink(s) is/are not a GFCI protected outlet(s) . This is not considered to be up to today's standard.GFCI outlet(s) should be installed by a qualified electrician.



6.4 Item 1(Picture)



6.4 Item 2(Picture)

6.5 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)**Repair or Replace**

One GFCI (Ground Fault Circuit Interrupter) protected outlet at the Hall Bath has a short. This is a safety issue that needs to be corrected. A qualified licensed electrical contractor should perform repairs that involve wiring.



6.5 Item 1(Picture)



6.5 Item 2(Picture)

6.7 SMOKE DETECTORS**Repair or Replace**

The smoke detector are old and are due to be replaced at the common hallway(s) and/or bedroom(s).
. A qualified person should repair or replace as needed.



6.7 Item 1(Picture)



6.7 Item 2(Picture)

7. Heating / Central Air Conditioning

7.0 HEATING EQUIPMENT

Repair or Replace

The Heat Pump Aux. heat mode was engaged (at a 2 degree difference) at the time of the inspection.. This means that the heat in the home is being solely or partially provided by the emergency heat strip in the air handler . This is not efficient and can cause an extremely high power bill. Suggest a full maintenance service, inspection, and clean of interior and exterior unit(s) by a qualified HVAC contractor and to repair if needed..



7.0 Item 1(Picture)

7.5 COOLING AND AIR HANDLER EQUIPMENT

Repair or Replace

The A/C component(s) of HVAC system(s) was/were not tested for proper operation due to the outside air temperature is 50 degrees or less. Units will not run/turn on in lower temperature. Suggest a qualified HVAC contractor inspect further to insure proper functionality



7.5 Item 1(Picture)

8. Insulation and Ventilation

8.4 VENTING SYSTEMS (Kitchens, baths and laundry)

Repair or Replace

The Exhaust fan has a distinct hum that is not normal and is missing light cover at the primary bath. This is usually a sign that the unit is starting g to fail. A qualified contractor should inspect and repair as needed.



8.4 Item 1(Picture)

9. Built-In Kitchen Appliances

9.1 RANGES/OVENS/COOKTOPS

Repair or Replace

(1) There is no anti-tip device installed on the stove . This is considered a safety issue and needs to be corrected . A qualified contractor should perform the installation .



9.1 Item 1(Picture)

(2) The range/oven sits lower than the adjacent laminate counter top . This is considered a safety/fire hazard .. I recommend repair as needed.



9.1 Item 2(Picture)



9.1 Item 3(Picture)

9.3 FOOD WASTE DISPOSER

Repair or Replace

The food disposer rubber strainer/guard no longer works as intended unit is/has seized and is inoperable and is missing hose clamp from dishwasher. I recommend repair as needed.



9.3 Item 1(Picture)



9.3 Item 2(Picture)



9.3 Item 3(Picture)



9.3 Item 4(Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To John Keffer



INVOICE

Keff/Spec LLC

4901 Bradpointe Ln

Va Beach VA 2345757-650-7579

Inspected By: John Keffer

Inspection Date: 2/22/2026

Report ID: 6628

Customer Info:	Inspection Property:
Jasmin Malanzo 4232 Maplehurst Road Virginia Beach VA 23462 Customer's Real Estate Professional: Karen Archbell Rose & Womble	4232 Maplehurst Road Virginia Beach VA 23462

Inspection Fee:			
Service	Price	Amount	Sub-Total
Heated Sq Ft 1,701 - 2,100	400.00	1	400.00
			Tax \$0.00
			Total Price \$400.00

Payment Method:

Payment Status: Paid

Note:



INSPECTION AGREEMENT

THIS IS A LEGALLY BINDING CONTRACT PLEASE READ IT CAREFULLY

Address of Structure to be Inspected: 4232 Maplehurst Road Virginia Beach VA
23462

Inspection Fee: \$ 400.00

Client requests a visual inspection of the structure identified at the above address by Keff/Spec LLC hereinafter collectively referred

1. as the "Company" and Client hereby represents and warrants that all approvals necessary have been secured for the Company's entrance on to the property.

Client warrants that (a) Client has read this Agreement carefully, (b) Client understands the Client is bound by all the terms of this Agreement, and (c) Client will read the entire Inspection Report and follow every recommendation for repairs, maintenance, safety

2. or further evaluation by a specialist. Furthermore, Client agrees that if such action is not undertaken and documented that the Company shall be held harmless for any subsequently alleged defects or deficiencies regarding that specific component/system or condition.

CONFIDENTIAL REPORT: Client understands that the inspection and the Inspection Report are performed and prepared for Client's sole, confidential use. Client agrees that Client will not transfer, disseminate or otherwise disclose any part of the Inspection Report to any other persons. The ONLY exceptions to this non-disclosure are as follows: (a) one copy may be provided to the current Seller (b) one copy may be provided to the Real Estate Agent directly representing Client and/or Client's lending institution for the use in

3. the Client's transaction only. (c) one copy may be provided to the Attorney directly representing Client. IN THE EVENT THAT ANYONE OR ANY ENTITY CLAIMS DAMEGES AS ARESULT OF THE RELIANCE UPON THE INSPECTION REPORT, AND SEEKS RECOMPENSE FOR SAID DAMAGES FROM THE COMPANY, Client agrees to indemnify, defend, and hold Company and/or Inspector harmless from any third party claims arising out of Client's unauthorized distribution of the Inspection Report, including, but not limited to, any claims caused by the alleged negligence, breach of contract, fraud, misrepresentation, or any other theory of liability of the company.

4. Company agrees to perform a limited visual inspection of the structure at the above address and to provide Client with a written opinion as to the apparent general condition of the structure's components and systems, including identification of significant

observable deficiencies, as they exist at the time of the inspection. The inspection will be performed in a manner consistent with the Standards of Practice of the American Society of Home Inspectors (ASHI). A copy of these standards is attached to the Inspection Agreement

SCOPE OF INSPECTION: The inspection only includes those systems and components expressly and specifically identified in the inspection report. Any area, which is not exposed to view, is concealed, is inaccessible because of soil, walls, floors, Carpets, ceilings, furnishings or any other thing, or those areas/items, which have been excluded is not included in this inspection. The inspection does not include any destructive testing or dismantling. In addition to the other LIMITATIONS provisions in this Agreement, Client agrees to assume all the risk for all conditions which are concealed from view at the time of the inspection or exist in any area excluded from Inspection by the terms of this agreement. Maintenance and other items may be discussed but will NOT form a part of the inspection report. The following areas/items, systems and components are among those NOT INCLUDED in the scope of inspection:

- Code or Zoning Violations/ Permit Research/ Building value appraisal/ADA compliance/ Repair cost estimates/ System or component installation/ Adequacy of efficiency of any system component/ prediction of life expectancy of any item/ Latent or concealed defects/ Structural, geological, soil, wave action or hydrological stability, survey, engineering, analysis or testing/ Soil condition/ Termites or other Wood Destroying Organisms, rodents or other pests/ Dry rot or fungus or the damage from or relating to the preceding/ Asbestos, radon gas, lead paint, mold, urea formaldehyde, toxic or flammable chemicals, water or air quality, PCB's or other toxins, electromagnetic fields, underground storage tanks,
- 5. proximity to toxic waste sites, Sick Building Syndrome or other environmental or health hazards/ Spas/ hot tubs/ Swimming pools/ Saunas/ Steam baths/ Fountains or other types of or related systems or components/ Water softener or purifiers/ Private water or sewage systems/ Seawalls, docks, davits, boat lifts or other marine equipment/ Radio controlled devices/ Telephone and cable television wiring and service/ Automatic gates/ Elevators/ Lifts/ Dumbwaiters/ Thermostatic or time clock controls/ Radiant heat systems/ Furnace heat exchanger/ Solar heating systems/ Heat pump recovery units/ Gas appliances such as fire pits, barbecues, heaters, lamps, and pool heaters/ Main gas shut off valve/ Gas leaks/ Seismic or hurricane safety/ Flood zone determination/ Previous flood history/ Boundaries/ Easements or right of way/ Freestanding appliances and buildings and sheds/ Security system/ Fire safety/ Sprinkler Systems/ Low voltage and landscape lighting systems/ Personal property/ Items specifically noted as excluded in the inspection report/ Odors & noise or any adverse condition that may affect the desirability of the property/ Proximity of railroad tracks or airplane routes/ Unique or technically complex systems or components.

If inspection is desired in any of the areas/items, systems or components listed above, then Client shall contact the appropriate professionals. (Some of the above items may be included in this inspection for additional fees-check with your inspector)

If your inspector recommends consulting other specialized experts, client must do so at client's expense.

- CLIENT UNDERSTANDS THAT THE INSPECTION AND THE INSPECTION REPORT DO NOT, IN ANY WAY, CONSTITUTE A/AN:**
- 6. **(1) GUARANTEE, (2) WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, (3) EXPRESS OR IMPLIED WARRANTY, OR (4) INSURANCE POLICY. ADDITIONALLY, NEITHER THE INSPECTION NOR THE INSPECTION REPORT IS SUITABLE FOR ANY REAL ESTATE TRANSFER DISCLOSURES THAT MAY BE REQUIRED BY LAW.**

- 7. The written report to be prepared by Company shall be considered the final and exclusive findings of Company of the structure. Client understands and agrees that Client will not rely on any oral statements made by the inspector prior or subsequent to the issuance of the written Inspection Report. Client further understands and agrees Company reserves the right to modify the inspection report for a period of time that shall not exceed two business days after the inspection report has first been delivered to

the Client.

- LIMITATION ON LIABILITY:** It is agreed that the Company, its employees, officers, owners, and heirs, are not in anyway insurers of the property inspected and that payments for the inspection services provided herein are based solely upon the value of those services, and it is not the intention of the parties that the Company assume responsibility: (1) for any loss occasioned by malfeasance or misfeasance in the performance of the services under this Agreement, (2) for any loss or damage sustained through burglary, theft, robbery, fire or other cause, or (3) for any liability on the part of the Company by virtue of this Agreement or because of the relationship hereby established. If there shall, notwithstanding the above provision, at any time be, or arise, any liability on the part of the Company by virtue of this Agreement, or because of the relationship hereby established, whether due to the negligence, omission, breach of contract, misrepresentation of the Company or otherwise, such liability is, and shall be limited to, a sum equal to the price charged for the inspection service, which sum shall be paid and received as liquidated damages. Such liability is herein set forth as liquidated damages and not as a penalty, and this liability shall be complete and exclusive. **THE COMPANY MAKES NO WARRANTIES, EXPRESS OR IMPLIED, AND ANY SUCH WARRANTY IS SPECIFICALLY EXCLUDED AND DISCLAIMED.**

- DISPUTES:** Client understands and agrees that any claim for failure to accurately report the visually discernible conditions at the subject property, shall be made in writing and reported to the inspector within ten business days of discovery. Client further agrees that, with exception of emergency conditions, Client or Client's agents, employees or independent contractors will make NO alterations, modifications or repairs to the claimed discrepancy prior to a re-inspection by the Inspector. Client understands and agrees that any failure to notify the Inspector as stated above shall constitute a waiver of any and all claims for said failure to accurately report the condition in question.

- ARBITRATION:** It is agreed that any dispute, controversy, interpretation or claim, including claims for, but not limited to, breach of contract, any form of negligence, fraud or misrepresentation arising out of, from or related to, this contract or arising out of, from or related to, the inspection or inspection report, shall be submitted to final and binding arbitration under the Rules and Procedures of the Expedited Arbitration of Home Inspection Disputes of Construction Arbitration Services, Inc. The decision of the arbitrator appointed hereunder shall be final and binding and judgment on the award may be entered in any court of competent jurisdiction. **CLIENT UNDERSTANDS AND AGREES THAT IN ANY SUCH ARBITRATION, ALL OF THE LIMITATIONS OF LIABILITY PROVISIONS OF THIS AGREEMENT SHALL APPLY.**

- Any legal action, including the arbitration proceeding more specifically described above, including, but not limited to, those proceedings involving claims sounding in tort or contract, against the Company, or its officers, agents or employees, must be brought within one (1) year from the date of the inspection, or same will be deemed waived and forever barred. Time is expressly of the essence herein. This time period may be shorter than otherwise provided for by law. It is agreed and understood that the arbitrator, in rendering any decision above, is to apply the laws of the State of Florida.

- ATTORNEY'S FEES:** The prevailing party in any dispute arising out of this agreement, the inspection, or Report(s) shall be awarded all reasonable attorney's fees, arbitrator fees and other costs.

- Client understands and agrees that if he or she is not present at the time of the inspection or do not sign this Inspection Agreement that this Agreement will become part of the Inspection Report, and therefore delivery of the**

Inspection Report to the Client (by mail, in person or via internet) will constitute acceptance of ALL the terms and conditions of this Agreement.

14. **SEVERABILITY:** If any portion of this Agreement is found to be invalid or unenforceable by any court or arbitrator the remaining terms shall remain in full force and effect between the parties.

PAYMENT:Payment is expected when the report is delivered. A 10% late fee (per month) will be charged for all late payments. All costs, including but not limited to, collections, liens & legal fees to recover past due payments will be added to the customer final bill. A \$50.00 fee will be added to all returned checks.

ENTIRE CONTRACT: This Agreement represents the entire agreement between the parties. No oral agreements, understandings or representations shall change, modify or amend any part of this agreement No change or modification shall be enforceable against any party unless such changes or modifications are in writing and signed by the parties. This Agreement shall be binding upon and inure to the parties hereto and their spouses, heirs, executors, administrators, successors, assigns and representatives of any kind whatsoever.

I have read, understand and agree to all the terms and conditions of this contract and to pay the fee listed above.

Dated_____

Signature of Client_____

(One signature binds all)

Printed Name of Client:_____

Dated_____

For the Company John Keffer