Easy Carve – quick guide


For the Genmitsu PROVerXL 4030. Keep this next to the machine.

Once only: getting set up


1. Save **easy-carve.html** in Documents. Right-click it → **Send to → Desktop (create shortcut)**. Double-click the shortcut to open it in Edge or Chrome; both work.
2. Switch the machine on, plug in the USB cable, press **Connect to machine** and pick the port (usually "USB-SERIAL CH340").
3. Press **First time? Check my machine** and follow the steps. It checks the machine moves the right way and the right distance, using a scrap of wood.
4. Touch plate (if you have one): measure its thickness and type it in under **"Or find the surface with the touch plate"**. It's remembered.

Every job

1. **Clamp the wood down firmly** and fit the right bit (see table on page 2).
2. Open Easy Carve → **Connect** → **Home**.
3. **Pick your design**: **Open design...** for a photo or file, or **Type some text**.
   For a photo of a drawing, choose what you want: *carve its lines*, *cut out its shape*, or *3D raised carving*.
4. Set **how wide** it should be and the **gaps** from the left and front edges of the wood.
5. **How to cut it**: Engrave, Carve out, Cut out or 3D raised. Then pick the material and bit. Settings you choose are remembered for next time.
6. Check the picture on the right looks right. Tick **Zoom in on the design** to look closely.

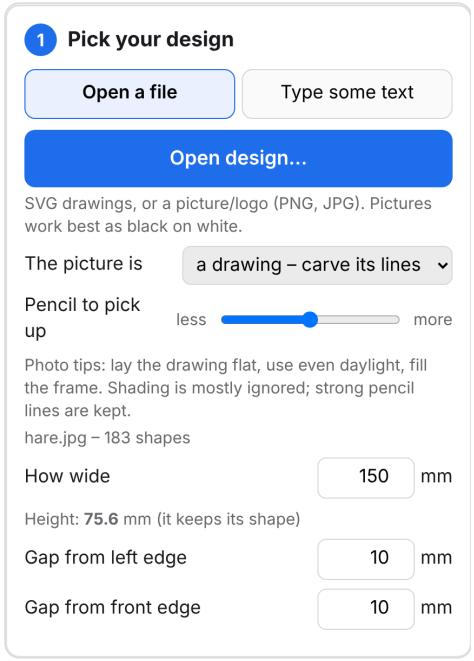


1 · Pick your design

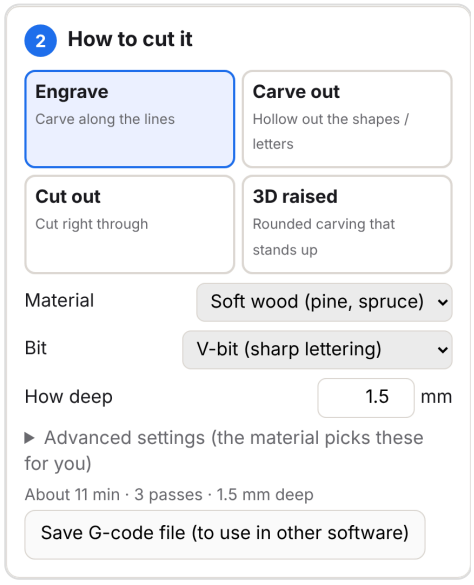

2 · How to cut it

7. **Set the start corner.** Use the arrow buttons to put the bit over the **front-left corner** of the wood, then press **Bit is over the front-left corner → set as start**.
8. **Set the surface.** Either lower the bit with **Z↓** (use 1 then 0.1 mm steps) until it just touches the wood and press **set as surface**, or use the **touch plate** button. Take the clip off afterwards!
9. Tick **Test run in the air** → **Start**. Watch the bit trace the job above the wood.
10. Untick the test box → safety glasses on, extraction on → **Start**.
11. Keep the window open while it cuts. **Pause** holds it; **STOP** stops everything.
12. When it says **Finished**, wait for the bit to stop spinning before touching anything.

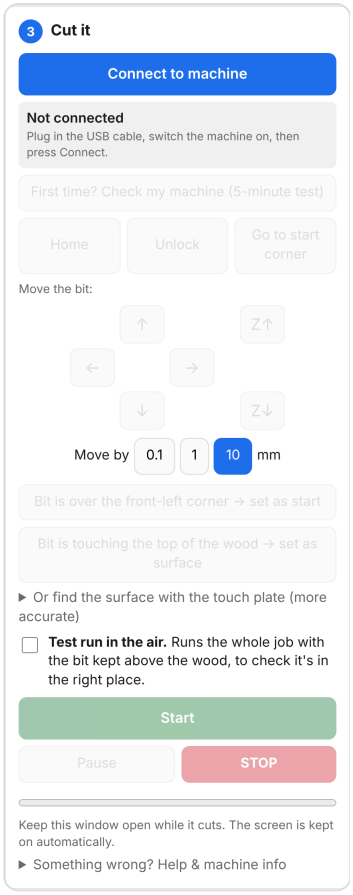

3 · Cut it

Safety. Stay with the machine while it runs. Hands away from the bit. Wear safety glasses. If anything looks wrong, press **STOP** on screen, or switch the machine off at its power switch.

Which bit?

Job	Bit	Notes
Engrave lines, drawings, writing	V-bit	Sharp, crisp lines. 1–1.5 mm deep.
Carve out (hollow) letters / shapes	Flat 3.175 mm (came with machine)	Use the 1 mm bit for small lettering.
Cut out a shape	Flat 3.175 mm	Leaves a thin skin; snap the piece out and sand.
3D raised carving	Ball-nose 3.175 mm or 6 mm	Slow: 1–3 hours. Wood at least 3 mm thicker than the carving height.

If something goes wrong

- **"Locked"**: press **Unlock**, then **Home**.
- **A red box with an error or alarm number**: it says what happened and what to do.
- **The job stopped part-way**: press Unlock → Home, **don't** reset the start corner or surface, then press **Carry on from where it stopped**.
- **Still stuck?** Open **"Something wrong? Help & machine info"** → **Copy report** and paste it in a message for help.

Photos of drawings: lay the drawing flat in daylight and use the phone's document scanner (iPhone: Notes → Scan Documents; Android: Google Drive → Scan). Going over the lines in black fineliner gives the crispest carving.