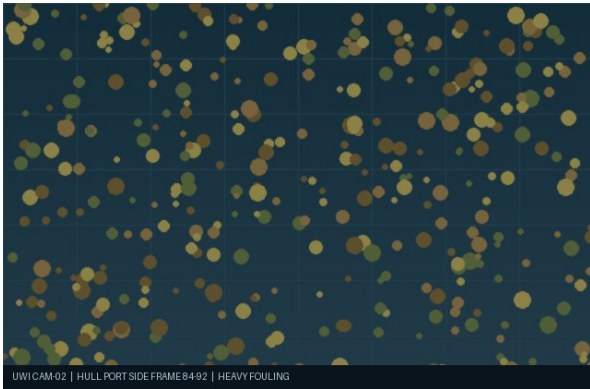


BV MARINE SURVEY SERVICES

UNDERWATER INSPECTION REPORT (UWI) — 水下檢查報告

Vessel:	YM WELLNESS	IMO No:	9786654
Inspection Date:	15-OCT-2024	Port:	SINGAPORE (PSA Terminal 3)
Method:	ROV Survey (Diver-assisted)	Surveyor:	BV Marine / J. Tan
Last Inspection:	08-MAR-2024 (Kaohsiung)	Last Drydock:	10-APR-2023

1. HULL CONDITION ASSESSMENT 船體狀況評估



*Photo: Port side hull, frame 84-92 — heavy barnacle clustering, ~7 months since last cleaning.

Zone	Biofouling	Paint
Bow/Bulbous	Moderate	~15%
Port (Fr.40-90)	Heavy*	~28%
Stbd (Fr.40-90)	Mod-Heavy	~22%
Flat Bottom	Heavy	~31%
Stern/Skeg	Light-Mod	~12%

Overall Hull Biofouling Score (1-100):	42 (HEAVY)
Estimated Avg. Paint Breakdown:	21.6%
Hull Cleaning Recommended:	YES — PRIORITY

2. PROPELLER & RUDDER SURVEY 螺旋槳與舵檢查



Photo: Propeller blade survey, 4 blades visible, surface condition rated FAIR.

Component	Cond.	Notes
Blade Surface	Fair	Light roughness
Leading Edge	Fair	Minor erosion, OK
Rudder Surface	Good	Clean
Rudder Bearing	Good	No play detected

3. SURVEYOR'S CONCLUSION 驗船師結論與建議

Overall hull condition is assessed as heavily fouled, consistent with extended interval since last hull cleaning (approx. 7 months, last performed 08-MAR-2024 Kaohsiung). Predominant fouling type is barnacle (*Balanus* spp.) clusters concentrated on port side and flat bottom, with moderate slime coverage elsewhere. Antifouling paint breakdown is moderate (avg. 21.6%) and approaching the threshold where re-coating should be considered at next scheduled drydock. Propeller and rudder are in fair-to-good condition with no urgent concerns; light blade roughness noted but does not warrant immediate polishing.

Recommendation: Schedule in-water hull cleaning within next 30 days to mitigate further speed loss and fuel penalty. Propeller polishing can be deferred to next drydock (currently scheduled 2025-10-01) unless further performance degradation is observed in interim Noon Report data. Estimated speed recovery post-cleaning: 0.6-0.9 kt based on similar fouling profiles on sister vessels.

This report is issued based on visual inspection only. Quantitative biofouling scoring follows internal BV Marine rating scale (1=clean, 100=severe).

Photographic appendix available on request.

Report No: BV-UWI-SG-2024-1015-YMWN | Page 1 of 1