

2021-05-27

Purpose for Service Bulletin

Motorcycles Affected


Markets Affected

Required Dealer Action

On Tire Pressure Monitoring System (TPMS) equipped models, the instrument module may read "-" after update. To restore the values:

- NOTE*

- *Have a battery tender connected to the battery while performing software update.*

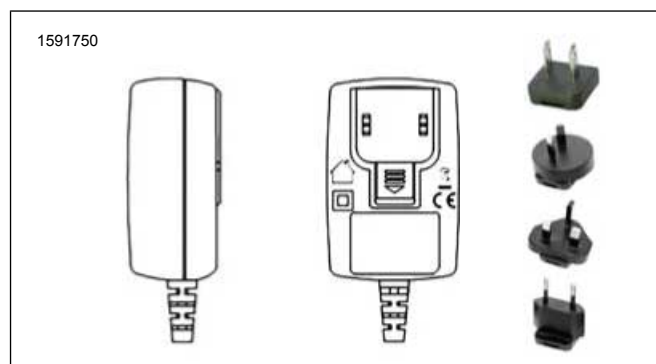

Special Tool: TECHLINK 3 (PART NUMBER: HD-48650-TL3)

BCM Software	Version
Calibration	13.22.0.2 or later
Application	13.14.0.2 or later

During Predelivery Inspection (PDI), verify that the most up-to-date software is installed. Check software version using DT II. Refer to Table 1.

Special Tool: DIGITAL TECHNICIAN II (PART NUMBER: HD-48650)

Body Control Module (BCM) Reflash Sequence

1. Connect battery tender directly to vehicle battery (not through battery tender lead).
 - a. Verify battery is fully charged before proceeding.
2. Connect TL-3 to vehicle.
3. Connect external power to TL-3 using appropriate power supply providing at least:
 - a. 12 V
 - b. 1.2 A
4. Place vehicle in Accessory mode.
 - a. Press and hold trip button 5 s.

NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

[illegible]

- 5. Open DT II program and establish communication with vehicle.
- 6. Proceed to reflash BCM and follow on-screen directions.

Supplemental Procedure Video

⚠ WARNING

Always review the appropriate service procedure prior to performing it. This video is intended to supplement, not replace, documented service procedures. Attempting service procedures without the proper training, tools, equipment, and manuals could result in death or injury to you or others. This could also damage the motorcycle or cause the motorcycle to operate improperly. (10406a)

This video is a supplement of the procedure covered in the document. This video can only be viewed through Service Information Portal (SIP).



Video 1.

Credit Procedure

NOTE

Enter bulletin number into comment section of claim.

Submit a warranty claim per Table 2 for each vehicle that receives this update.

Table 2.

ITEM	DATA
Claim Type	PRD
Problem Part Number	41000678
Quantity	Leave Blank
Primary Labor Code ⁽¹⁾	6186
Time	0.2 h
Customer Concern Code	9210
Condition Code	6186
(1) Download may be required	