



KONTROLLERA

ARBETSINNEHÅLL

Pos	Operationsmoment	Antal	Info
	Tejpa rödmarkerade områden på sekundärsidan	20	



VERIFIERA

3.

Φ

000000

00000000

D302

- R321 -

C211

L211

+

C195

"⊕

C369

OCONOCIO,

51

0251

nannanan, 0361

V221

FB FB X 3BSE007131R1

0386 4

-- R123 -V211

тФ

V212

Carr

Ψ

00000000

D304

0.61 dg

- R212 - R215 - C285

0385

ממממממק.

L194

0328

B

Typbet:

WI.Rev

R412

V465

XIE

K182

K183

Φ.

C124

H

"Φ

R314 -

C301

Φ.

PFVK 131

MMA

Operation/Bord

Sida / Tot. Antal sidor

2 av 6

MAS

Nästa Operation/Bord



KONTROLLERA

3.

ARBETSINNEHÅLL

Pos	Operationsmoment	Antal	Info
20, 125	Montera X2	1, 2	RK924043-AG, 21242025-175
21, 125	Montera X1	1, 2	5217615-3, 21242025- 175
37, 125	Montera X10	1, 2	RK924043-AD, 21242025-175
24, 47, 124, 126	Montera V221 och V221E med skruv och mutter	1, 1, 1, 1	4855372-3, 21210647- 220, 21262149-111, 4857173-2
45, 48	Montera C226 med sjävhäftande bricka	1, 1	3BSC510006R26, 3BSC990001R1
39	Montera T201	1	3BSC730111R1
40	Montera T202	1	3BSC730108R1


VERIFIERA

2.

×2

3.

"⊕

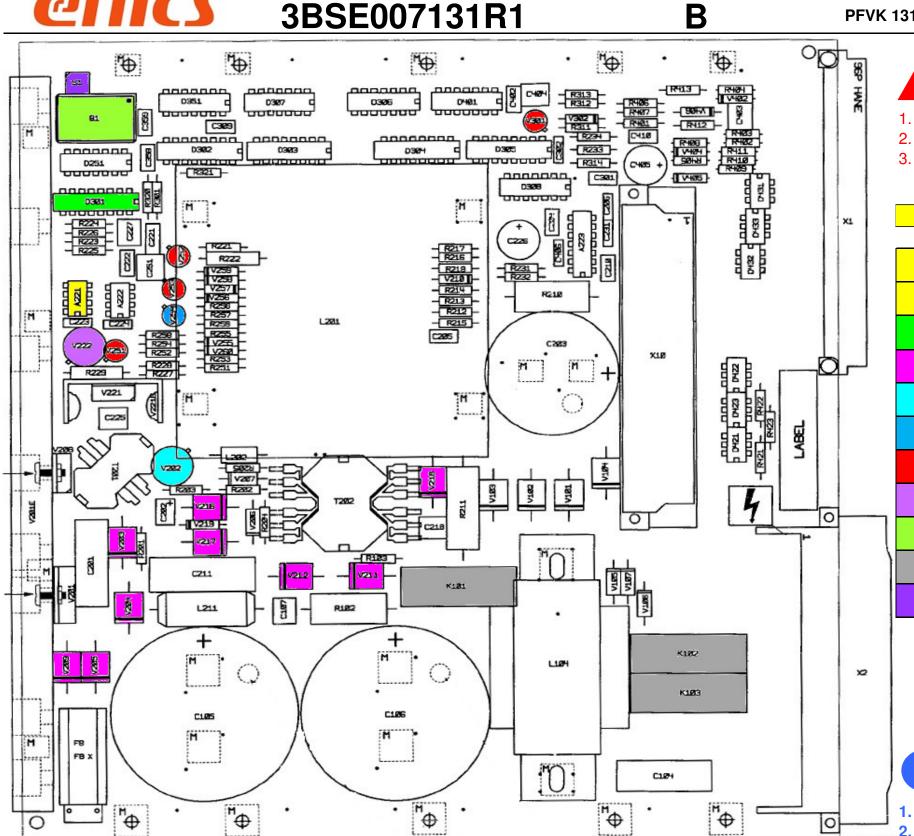



KONTROLLERA

ARBETSINNEHÅLL

Pos	Operationsmoment	Antal	Info
10	Montera A221	1	3BSC150097R1
18	Montera D301	1	4911004-615
22	Montera V203, V204, V205, V209, V211, V212, V216, V217, V218	9	4854208-6
26	Montera V202	1	4855031-1
27	Montera V254	1	4855052-2
28	Montera V251, V252, V253, V301	4	4855053-1
29	Montera V222	1	4855053-4
32	Montera B1	1	4969016-1
33	Montera K101,K102,K103	3	3BSC810005R4
36	Montera S1	1	5217526-2

VERIFIERA

2.

0

C195


"⊕

FB FBX

МФ

4 av 6



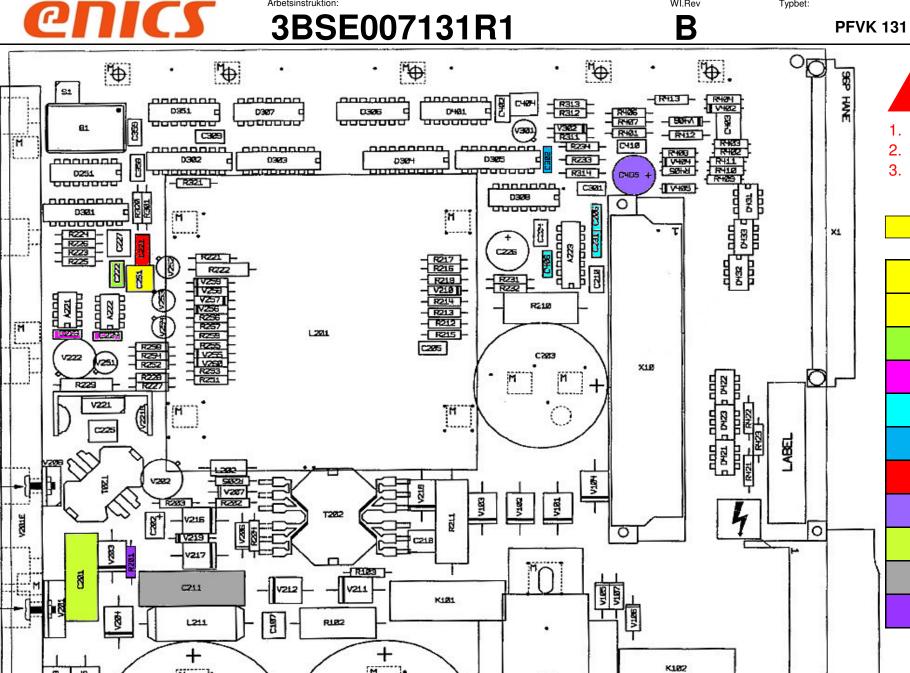

₩Ф

LIDH

K123

₩Ф

C124

Ή_Φ ,



KONTROLLERA

2.

3.

ARBETSINNEHÅLL

Pos	Operationsmoment	Antal	Info
50	Montera C251	1	4984215-322
54	Montera C222	1	3BSC520001R4
56	Montera C223,C224	2	4984161-13
57	Montera C206,C231,C406	3	4984161-21
58	Montera C302	1	4984161-23
59	Montera C221	1	4984161-37
61	Montera C405	1	4987088-121
62	Montera C104,C201	2	3BSC520009R1
63	Montera C211	1	4984246-247
67	Montera R201	1	3BSC550031R11




2. 3.

X

0

VERIFIERA



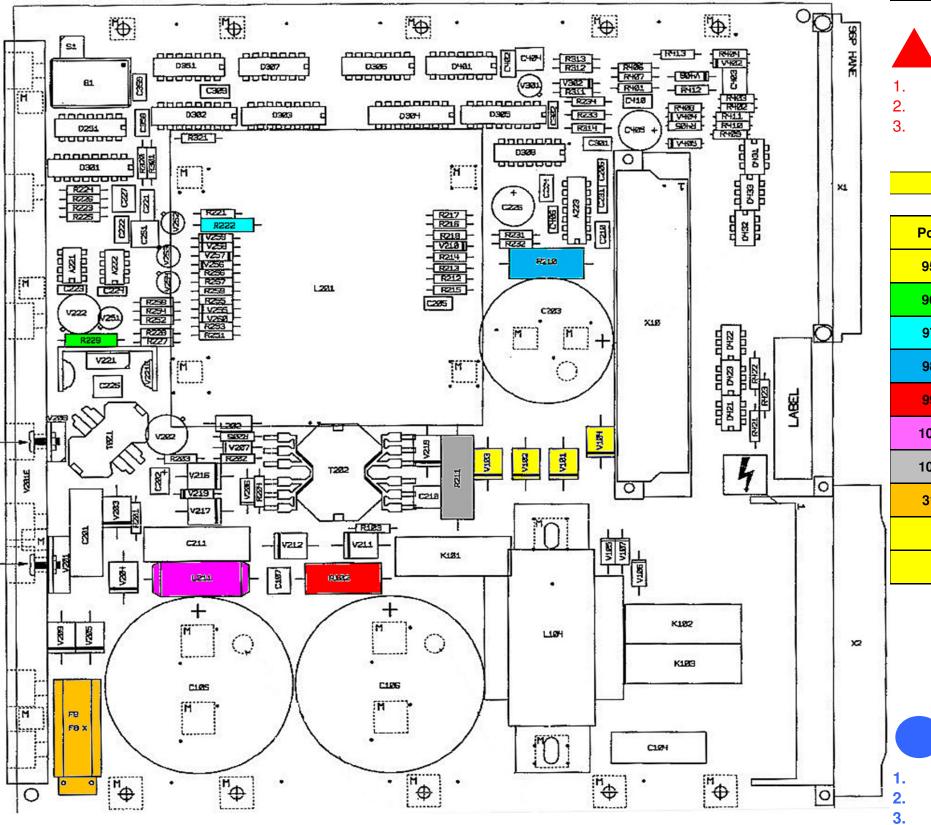


KONTROLLERA

ARBETSINNEHÅLL

VERIFIERA

Pos	Operationsmoment	Antal	Info
95	Montera V101,V102,V103,V104	4	4854104-8
96	Montera R229	1	3BSC550032R14
97	Montera R222	1	3BSC550032R75
98	Montera R210	1	52482114-515
99	Montera R102	1	52482114-610
100	Montera L211	1	4782021-1
101	Montera R211	1	52452022-10
31	Montera F8X	1	5677734-1

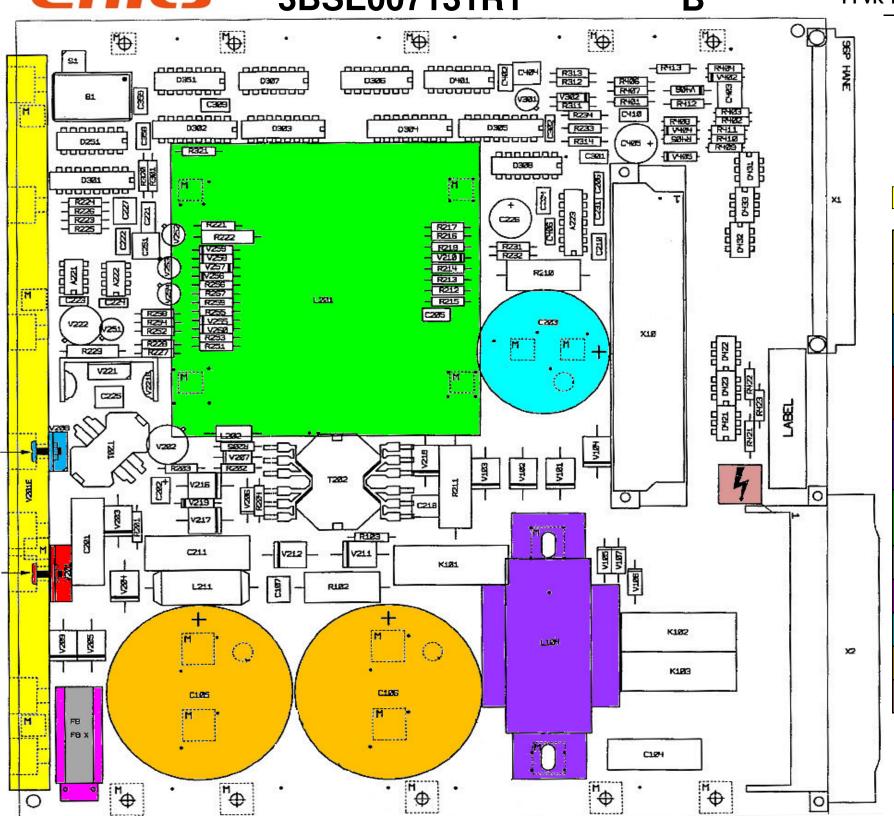



KONTROLLERA

١.

2.

3.

ARBETSINNEHÅLL

Pos	Operationsmoment	Antal	Info
123, 120, 121	Montera V201E med skruvar och brickor.	1, 1, 1	21721143-1, 21212416-287, 21542033-5
23, 115, 116	Montera V208 mot V201E med skruv och mutter.	1, 1, 1	4854173-6, 21210647- 224, 21262149-111
25, 115, 116	Montera V201 mot V201E med skruv och mutter.	1, 1, 1	3BSC320027R1, 21210647-224, 21262149-111
38, 116, 117, 122	Montera L104 med skruv, bricka och mutter. OBS!! Brickan placeras mellan PCB och L104. Koppla in trådarna enligt ARD.	1, 2, 2 ,2	3BSC730107R1, 21262149-111, 21512062-124, 21210647-222
46, 117, 118	Montera L201 med skruvar och brickor.	1, 4, 4	3BSC730113R1, 21512062-124, 21242025-225
102	Montera F8	1	3BSC770001R49
114	Monteras med F8 och F8X enligt ARD	0,1	15431022-140
34, 42, 43	Montera C203 med skruvar och brickor. Märk upp polaritet enligt ARD.	1,2, 2	4987074-601
35, 42, 43	Montera C105,C106 med skruvar och brickor. Märk upp polaritet enligt ARD.	2, 4, 4	4987074-604
108, 109	Placera blixt-etiketter, en på primär och en på sekundärsidan, enligt ARD.	2	29491541-140



VERIFIERA

-1

2.

3.