




If the ski with noise

Video link for how to remove the fan cover and fan: <https://www.dropbox.com/scl/fi/8kupqw5z7j2m9xl55uwup/How-to-remove-the-fan-case-and-fan-set.mp4?rlkey=htxa6bm3q89z5zhzahvqn6olh&dl=0>

1- The noise can be caused when the part A45 Round Magnet rubs against E14 Generator (marked in color). Please help to check these 2 areas, if the noise is from there, then can find the scratches on A45 round magnet.

Solution: 1- Check if the A44 and A45 are glued firmly: <https://www.dropbox.com/s/ti7jmyf877vnz0v/How%20to%20glue%20A2-8%20and%20A2-9.mp4?dl=0>




Solution: 2- Check if the E14 Generator (marked in color) are located and firmly assembled with 2x bolts firmly in the correct position?

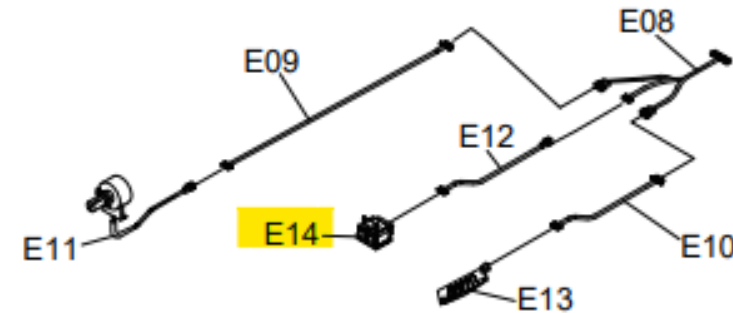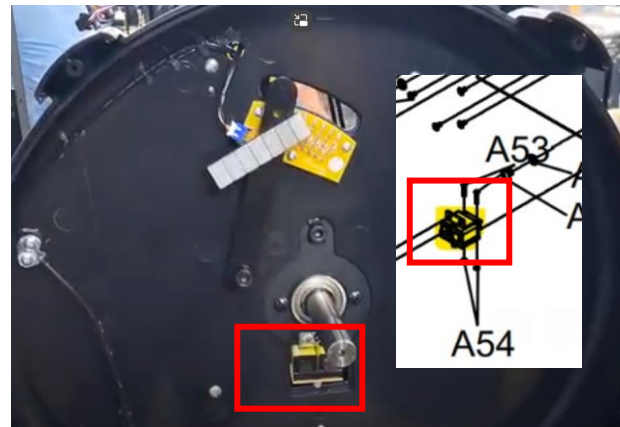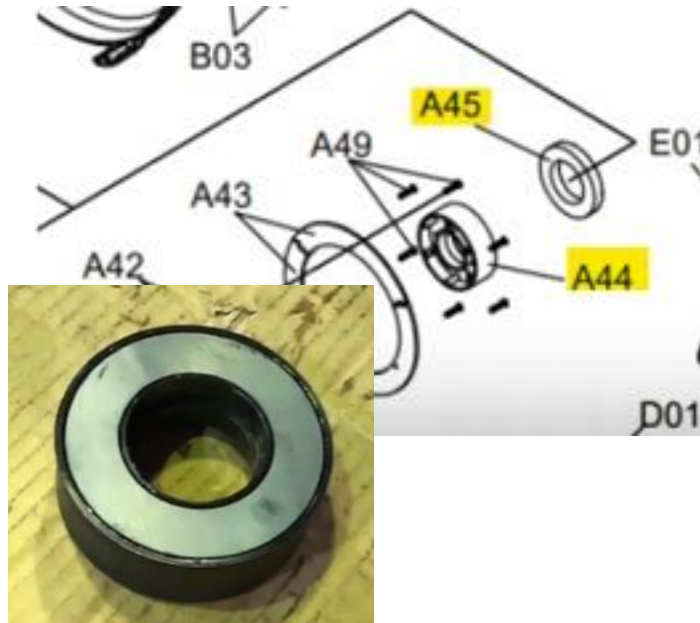

If the ski with noise

2- The noise can be caused when the part#A43 Aluminum Sheet rubs against #A33 Magnet Bracket circled in red as below

Solution 1: Check if the 6x #A49 bolts colored in blue are firmly assembled and can hold fan set tightly.

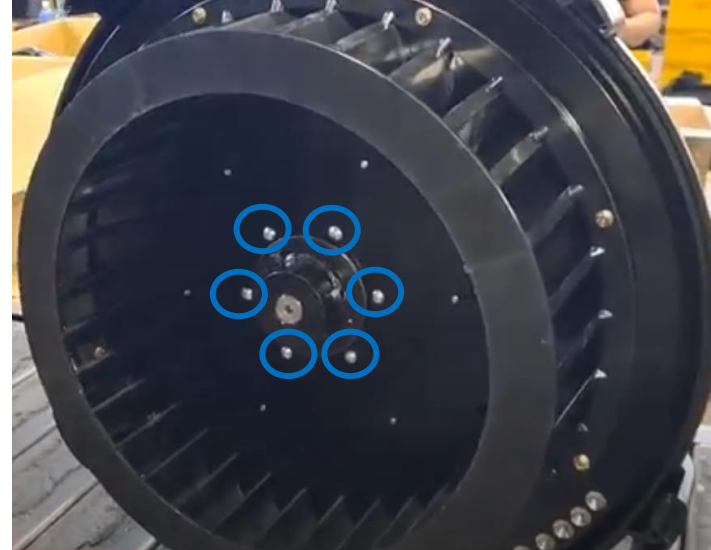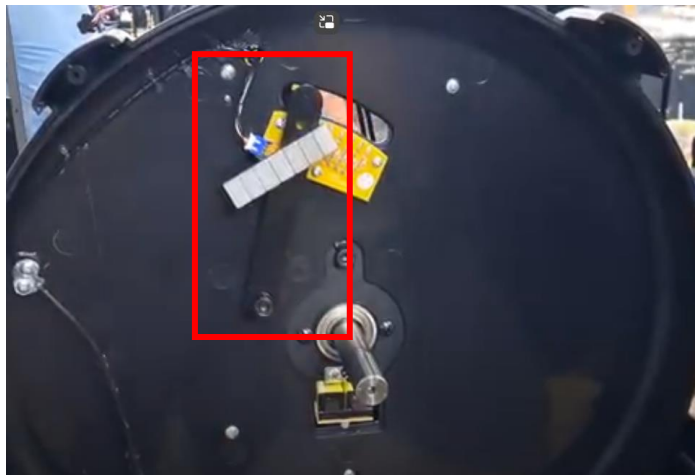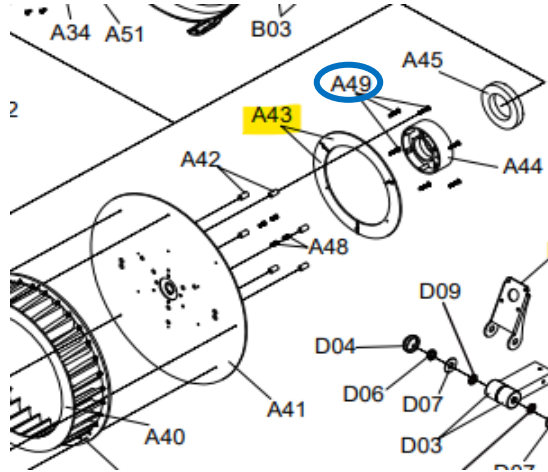


If the ski with noise

3. please rotate the axle to see if it works properly without noise. If there is noise, then the issue is from the bearing.

Solution : then you will need to replace the 2x A14bearing + 1x A11 Axle.

Video Link for how to replace Part#**A14** bearing and Part#**A11** fan axle:

<https://www.dropbox.com/scl/fi/aekfnkp2txhyz7pdpvsgs/2nd-ski-replace-the-bearing-A14-and-fan-axle-A11.mp4?rlkey=zwa98idtyk0puac717jtfxohc&dl=0>

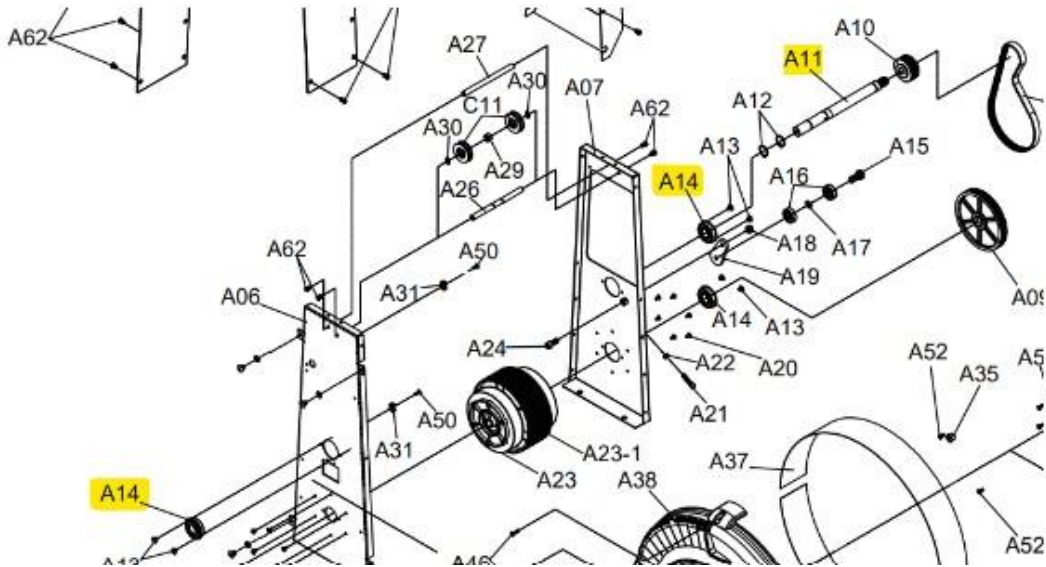

If the ski with noise

4. Please ask your customer to loosen the following 4 screws circled in red a bit, and try to pull the handle bars to see if the noise exists.

If the noise is gone, you can just tighten the screws back.

