

### FUNDAMENTALS OF WELDING

- 1. Overview of Welding Technology
- The Weld Joint
- 3. Physics of Welding
- 4. Features of a Fusion Welded Joint



# Joining and Assembly Distinguished

Joining - welding, brazing, soldering, and adhesive bonding

 These processes form a permanent joint between parts

Assembly - mechanical methods (usually) of fastening parts together

 Some of these methods allow for easy disassembly, while others do not



# Welding

Joining process in which two (or more) parts are coalesced at their contacting surfaces by application of heat and/or pressure

- Many welding processes are accomplished by heat alone, with no pressure applied
- Others by a combination of heat and pressure
- Still others by pressure alone with no external heat
- In some welding processes a filler material is added to facilitate coalescence



# Why Welding is Important

- Provides a permanent joint
  - Welded components become a single entity
- Usually the most economical way to join parts in terms of material usage and fabrication costs
  - Mechanical fastening usually requires additional hardware components (e.g., screws and nuts) and geometric alterations of the parts being assembled (e.g., holes)
- Not restricted to a factory environment
  - Welding can be accomplished "in the field"



# Limitations and Drawbacks of Welding

- Most welding operations are performed manually and are expensive in terms of labor cost
- Most welding processes utilize high energy and are inherently dangerous
- Welded joints do not allow for convenient disassembly
- Welded joints can have quality defects that are difficult to detect



# Faying Surfaces in Welding

The part surfaces in contact or close proximity that are being joined

- Welding involves localized coalescence of the two metallic parts at their faying surfaces
- Welding is usually performed on parts made of the same metal
  - However, some welding operations can be used to join dissimilar metals



# Types of Welding Processes

- Some 50 different types of welding processes have been catalogued by the American Welding Society (AWS)
- Welding processes can be divided into two major categories:
  - Fusion welding
  - Solid state welding



# **Fusion Welding**

Joining processes that melt the base metals

- In many fusion welding operations, a filler metal is added to the molten pool to facilitate the process and provide bulk and added strength to the welded joint
- A fusion welding operation in which no filler metal is added is called an autogenous weld




# Some Fusion Welding Processes

- Arc welding (AW) melting of the metals is accomplished by electric arc
- Resistance welding (RW) melting is accomplished by heat from resistance to an electrical current between faying surfaces held together under pressure
- Oxyfuel gas welding (OFW) melting is accomplished by an oxyfuel gas such as acetylene



# **Arc Welding**

A manual arc welding operation

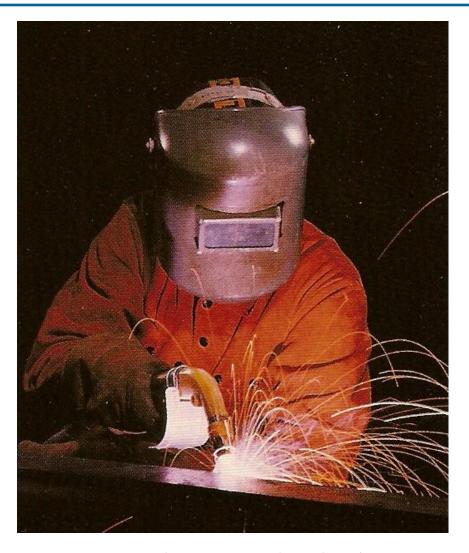



# Solid State Welding

Joining processes in which coalescence results from application of pressure alone or a combination of heat and pressure

- If heat is used, temperature is below melting point of metals being welded
- No filler metal is added in solid state welding



# Some Solid State Welding Processes

- Diffusion welding (DFW) –coalescence is by solid state fusion between two surfaces held together under pressure at elevated temperature
- Friction welding (FRW) coalescence by heat of friction between two surfaces
- Ultrasonic welding (USW) coalescence by ultrasonic oscillating motion in a direction parallel to contacting surfaces of two parts held together under pressure



# Principal Applications of Welding

- Construction buildings and bridges
- Piping, pressure vessels, boilers, and storage tanks
- Shipbuilding
- Aircraft and aerospace
- Automotive
- Railroad



#### Welder and Fitter

- Welder manually controls path or placement of welding gun
- Often assisted by second worker, called a fitter, who arranges the parts prior to welding
  - Welding fixtures and positioners are used to assist in this function



# The Safety Issue

- Welding is inherently dangerous to human workers
  - High temperatures of molten metals
  - In gas welding, fuels (e.g., acetylene) are a fire hazard
  - Many welding processes use electrical power, so electrical shock is a hazard



# Special Hazards in Arc Welding

- Ultraviolet radiation emitted in arc welding is injurious to human vision
  - Welder must wear a special helmet with a dark viewing window
    - Filters out dangerous radiation but welder is blind except when arc is struck
- Sparks, spatters of molten metal, smoke, and fumes add to the risks
  - Ventilation needed to exhaust dangerous fumes from fluxes and molten metals



# **Automation in Welding**

- Because of the hazards of manual welding, and to increase productivity and improve quality, various forms of mechanization and automation are used
  - Machine welding mechanized welding under supervision and control of human operator
  - Automatic welding equipment performs welding without operator control
  - Robotic welding automatic welding implemented by industrial robot



### The Weld Joint

The junction of the edges or surfaces of parts that have been joined by welding

- Two issues about weld joints:
  - Types of joints
  - Types of welds used to join the pieces that form the joints



# Five Types of Joints

- 1. Butt joint
- 2. Corner joint
- 3. Lap joint
- 4. Tee joint
- 5. Edge joint



### **Butt Joint**

Parts lie in same plane and are joined at their edges

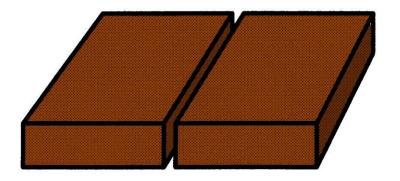


Figure 30.2 Five basic types of joints: (a) butt

(a)



### **Corner Joint**

Parts in a corner joint form a right angle and are joined at the corner of the angle

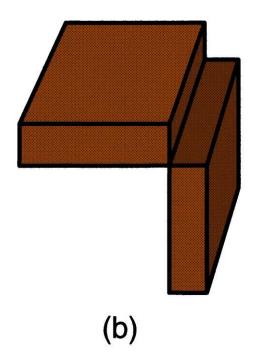


Figure 30.2 (b) corner



# Lap Joint

# Consists of two overlapping parts

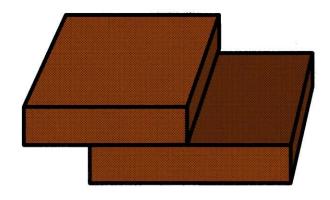


Figure 30.2 (c) lap

(c)



### Tee Joint

One part is perpendicular to the other in the approximate shape of the letter "T"

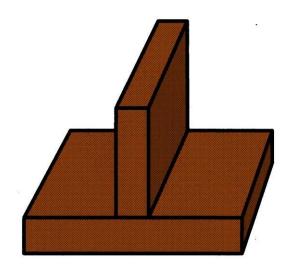


Figure 30.2 (d) tee

(d)



# Edge Joint

Parts in an edge joint are parallel with at least one of their edges in common, and the joint is made at the common edge(s)

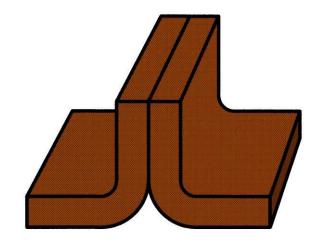


Figure 30.2 (e) edge

(e)



# Types of Welds

- Each of the preceding joints can be made by welding
- Other joining processes can also be used for some of the joint types
- There is a difference between joint type and the way it is welded - the weld type




### Fillet Weld

- Used to fill in the edges of plates created by corner, lap, and tee joints
- Filler metal used to provide cross section in approximate shape of a right triangle
- Most common weld type in arc and oxyfuel welding
- Requires minimum edge preparation



#### Fillet Welds

Figure 30.3 Various forms of fillet welds: (a) inside single fillet corner joint; (b) outside single fillet corner joint; (c) double fillet lap joint; and (d) double fillet tee joint. Dashed lines show the original part edges.

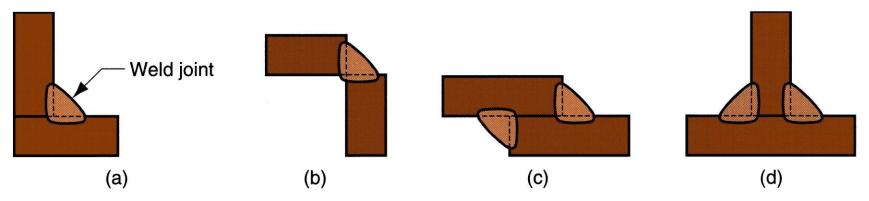




### **Groove Welds**

- Usually requires part edges to be shaped into a groove to facilitate weld penetration
- Edge preparation increases cost of parts fabrication
- Grooved shapes include square, bevel, V, U, and J, in single or double sides
- Most closely associated with butt joints



Figure 30.4 Some groove welds: (a) square groove weld, one side; (b) single bevel groove weld; (c) single V-groove weld; (d) single U-groove weld; (e) single J-groove weld; (f) double V-groove weld for thicker sections. Dashed lines show original part edges.

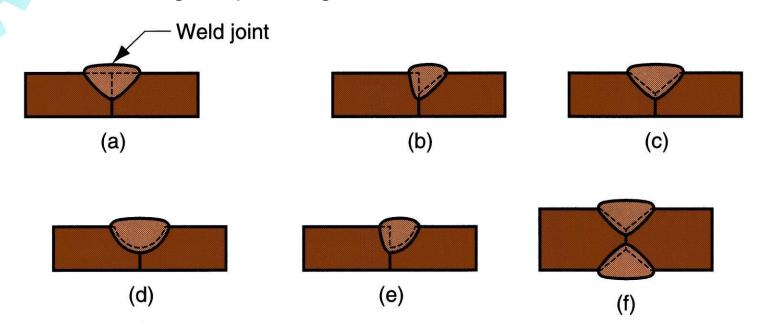



# Spot Weld

Fused section between surfaces of two plates

- Used for lap joints
- Closely associated with resistance welding

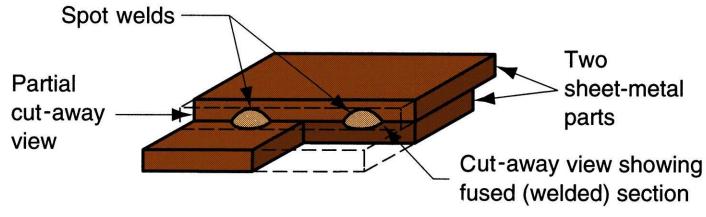


Figure 30.6 (a) Spot weld

(a)



# **Physics of Welding**

- Fusion is most common means of achieving coalescence in welding
- To accomplish fusion, a source of high density heat energy must be supplied to the faying surfaces, so the resulting temperatures cause localized melting of base metals (and filler metal, if used)
- For metallurgical reasons, it is desirable to melt the metal with minimum energy but high heat densities



### **Power Density**

Power transferred to work per unit surface area, W/mm<sup>2</sup> (Btu/sec-in<sup>2</sup>)

- If power density is too low, heat is conducted into work, so melting never occurs
- If power density too high, localized temperatures vaporize metal in affected region
- There is a practical range of values for heat density within which welding can be performed



# Comparisons Among Welding Processes

- Oxyfuel gas welding (OFW) develops large amounts of heat, but heat density is relatively low because heat is spread over a large area
  - Oxyacetylene gas, the hottest of the OFW fuels, burns at a top temperature of around 3500°C (6300°F)
- Arc welding produces high energy over a smaller area, resulting in local temperatures of 5500° to 6600°C (10,000° to 12,000°F)



# Power Densities for Welding Processes

Welding process	W/mm <sup>2</sup>	(Btu/sec-in <sup>2</sup> )
Oxyfuel	10	(6)
Arc	50	(30)
Resistance	1,000	(600)
Laser beam	9,000	(5,000)
Electron beam	10,000	(6,000)



# **Power Density**

Power entering surface divided by corresponding surface area:

$$PD = \frac{P}{A}$$

where *PD* = power density, W/mm<sup>2</sup> (Btu/sec-in<sup>2</sup>); *P* = power entering surface, W (Btu/sec); and *A*= surface area over which energy is entering,

mm<sup>2</sup> (in<sup>2</sup>)



# Unit Energy for Melting

Quantity of heat required to melt a unit volume of metal

- Symbolized U<sub>m</sub>
- It is the sum of:
  - Heat to raise temperature of solid metal to melting point
    - Depends on volumetric specific heat
  - Heat to transform metal from solid to liquid phase at melting point
    - Depends on heat of fusion



# Heat Transfer Mechanisms in Welding

- Not all of the input energy is used to melt the weld metal
  - 1. Heat transfer efficiency  $f_1$  actual heat received by workpiece divided by total heat generated at source
  - 2. Melting efficiency  $f_2$  proportion of heat received at work surface used for melting; the rest is conducted into work metal



# Heat Available for Welding

$$H_w = f_1 f_2 H$$

where  $H_w$  = net heat available for welding;  $f_1$  = heat transfer efficiency;  $f_2$  = melting efficiency; and H = total heat generated by welding process



# Heat Transfer Efficiency f<sub>1</sub>

Proportion of heat received at work surface relative to total heat generated at source

- Depends on welding process and capacity to convert power source (e.g., electrical energy) into usable heat at work surface
  - Oxyfuel gas welding processes are relatively inefficient
  - Arc welding processes are relatively efficient



# Melting Efficiency f<sub>2</sub>

Proportion of heat received at work surface used for melting; the rest is conducted into the work

- Depends on welding process but also influenced by thermal properties of metal, joint configuration, and work thickness
  - Metals with high thermal conductivity, such as aluminum and copper, present a problem in welding because of the rapid dissipation of heat away from the heat contact area



# **Energy Balance Equation**

 Net heat energy into welding operation equals heat energy required to melt the volume of metal welded


$$H_w = U_m V$$

where  $H_w$  = net heat energy delivered to operation, J (Btu);  $U_m$  = unit energy required to melt the metal, J/mm<sup>3</sup> (Btu/in<sup>3</sup>); and V = volume of metal melted, mm<sup>3</sup> (in<sup>3</sup>)



# Typical Fusion Welded Joint

Figure 30.8 Cross section of a typical fusion welded joint: (a) principal zones in the joint, and (b) typical grain structure.

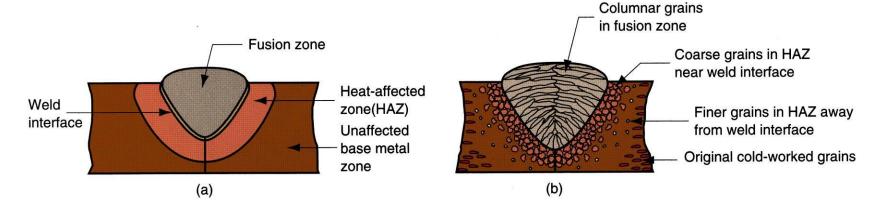



### Features of Fusion Welded Joint

Typical fusion weld joint in which filler metal has been added consists of:

- Fusion zone
- Weld interface
- Heat affected zone (HAZ)
- Unaffected base metal zone



### **Heat Affected Zone**

- Metal has experienced temperatures below melting point, but high enough to cause microstructural changes in the solid metal
- Chemical composition same as base metal, but this region has been heat treated so that its properties and structure have been altered
  - Effect on mechanical properties in HAZ is usually negative, and it is here that welding failures often occur