

- 1.
- 2.
- 3.
- 4.
- 5.

1. This product has a unique anti-interference design and filtering algorithm. Please ensure reliable grounding and separate it from the AC grounding wire.
2. Ensure use in an environment that meets the technical specifications of this product.
3. Avoid direct sunlight.
4. Personnel with corresponding professional knowledge and the ability to operate safely should be responsible for the installation, wiring, and maintenance of this product.
5. It is strictly prohibited to open the chassis with electricity.

5
 DC10-28V,AC85-265V 100-240V,50/60HZ ,
 8 350
 :0.5~3.0mV/V
 5V
 10 40 640 1280HZ
 24 - ADC 1/1000000
 1/100000
 0.005%F.S
 5W
 -25~+45
 85%RH
 300g
 96 48 110mm 92 46mm

Display: Double 5-digit segment code tube display

Working power supply: DC10-28V, AC85-265V (rated 100-240V, 50/60Hz), wide voltage power supply, choose one of them

Carrying capacity: 8 350 sensors

Signal range: 0.5~3.0mV/V

Excitation voltage: 5V

Sampling frequency: 10, 40, 64, 1280Hz, adjustable

Internal resolution: 24 bits - ADC, internal resolution 1/1000000

Display resolution: 1/100000

Non linearity: 0.005% F.S

Maximum power consumption: 5W

Working temperature: -25~+45

Relative humidity: 85% RH

Weight: approximately 300g

External dimensions: 96 x 48 x 110mm (control cabinet opening size 92 x 46mm)

	3
	+ 0-5V,0-10V,0-5-10V,0-20mA,4-20mA,4-12-20mA
RS485	+RS485
	+ +RS485



- Double five digit display window, with the main screen displaying net weight and the secondary screen displaying set parameters, total weight, peak value, and unit



/

- Enter the menu/return to the previous level, long press to enter the decimal point selection interface



- Enter the calibration interface, move the cursor, move the main menu interface and parameter selection interface downwards, long press to enter the zero setting option



- Change the menu, add values, long press to enter the peeling option



The menu interface is a confirmation menu, and the display interface is to switch to the second window display, which includes units, total weight, and peak value. Long press to enter the clear peak value interface


- PEAK PEAK

The PEAK light is constantly on, and the second window is the peak display. The PEAK light flashes to wait for the peak state to be triggered

- OUT1/OUT2/OUT3 1,2,3

Out1/Out2/Out3 lights on indicate the triggering status of relays 1, 2, and 3 respectively, while lights off indicate the non

triggering status

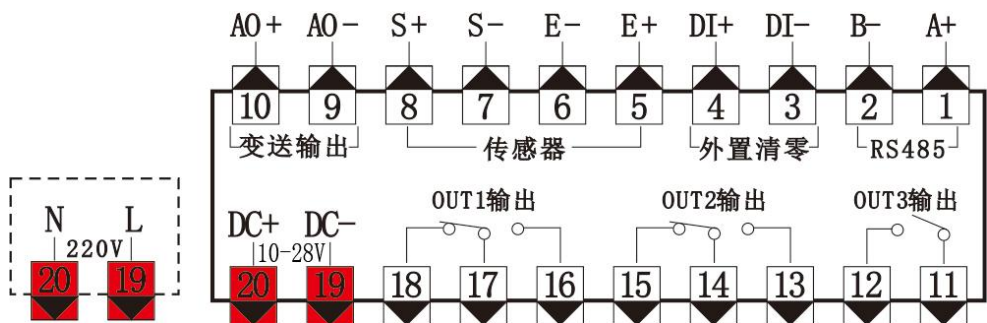

Terminal Description

- 19,20 DC+,DC- 10-28V N,L 85-265V 100-240V
Terminals 19 and 20 are the power supply interface for the instrument. DC+, DC - is a 10-28V DC power supply, and N, L is an 85-265V (rated 100-240V) AC power supply.
- OUT1 OUT2 OUT3

C3.rEL

[OUT1] [OUT2] [OUT3] are relay alarm output terminals, all of which are passive dry contacts and can be set as upper limit output, lower limit output, and interval output
Internal output, interval external output, see menu C3.rEL relay settings for details.

- 0-20mA,4-20mA,4-12-20mA,0-3.3V,0-5V,0-10V,0-5-10V

C6 ANA

Transmission Output (optional), can output analog signals such as 0-20mA, 4-20mA, 4-12-20mA, 0-3.3V, 0-5V, 0-10V, 0-5-10V, etc. Please refer to the menu for details
C6.ANA analog output.

- S+: + S-: - E-: - E+

[Sensor] S+: Sensor signal+, S -: Sensor signal -, E -: Sensor excitation -, E+: Sensor excitation+, this instrument can flicker in ballast calibration mode
The sensor signal is slightly positive or negative, and can be directly calibrated to a positive value.


- 3,4 tPEEL SPEEL
CPEEL SZero CZero
REMAX C1.SyS

External reset Short circuiting terminals 3 and 4 can achieve the following functions: tPEEL peeling (not saved when power is off) SPEEL peeling (saved when power is off)
CPEEL cancels peeling (save after power failure) SZero zeros (do not save after power failure) CZero zero point calibration (save after power failure) REMAX clears peak value. This function is disabled by default. Please refer to menu

C1.SyS system settings for details.

●

C5 CON 485

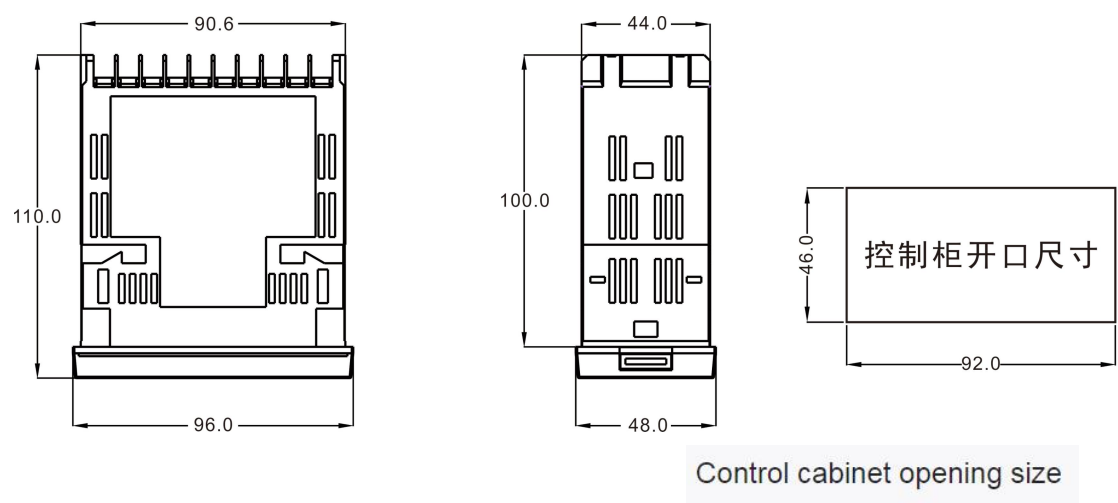

C1.SyS		100.SP				
		101.GA				
		102.ME				
		103.rV				

		104.ds		uNit	Gross 1: pEak 2: uNit	
		105.uN		kG		NoNE G kG t N pa kpa mpa N.M kN
		106.bi		0		88888,8888 8,888 88, 88 888,8 8888
		107.dV		1		
		108.ro		99999		AL.oL
		109.di		NoNE	0-5	0: NoNE (invalid) 1: TPEEL (skin removed but not saved) 2: SPEEL (Peeled Storage) 3: CPEEL (Cancel Peeling Save) 4: SZero (set to zero without saving) 5: CZero (zero calibration save) 6: REMAX (clear peak) Ma in int erf ace vali d
		110.MZ		50	0-50000	0 If the peak value exceeds the set value, it will be re detected. When set to 0, it will only be refreshed when the new peak

						value is larger than the current original peak value.
		111.MN		0.5	0-5.000	Detect again after exceeding the set value and exceeding the judgment threshold peak value (seconds)
		112.br		L5	L1-L8	Brightness adjustment of segment code tube display
		113.uP		0.02	0.02-1.000	Refresh display based on set value (seconds)
		114.bp		NO	YES/NO	Backup the current configuration parameters, including calibration parameters, and load the current backup when needed to avoid parameter clearing caused by factory recovery. The instrument will restart, please disconnect the power supply of the external controlled equipment
		115.Lp		NO	YES/NO	
		116.FA		NO	YES/NO	
C2.CAL		200.ZE			AD AD internal code value	AD After entering, display the AD value, press the up key to reset and save at the same time
		201.Mo		Load	Load/data	Load data Load ballast calibration, data digital calibration

			202.WE				Actual weight value input during ballast calibration	
			203.rA			10-99999	X Single sensor range X number of sensors	data
			204.SE		2.000	0.010-10.000	mv/v	13/10000
			205.rE		5	0.010-10.000	V	
			206.rV		1.000	0.010-2.000	Further correct the linearity of the sensor by modifying the coefficient	Display only during data digital calibration
			207.mE		0		0:CLosE 1:opEN	
			208.mC				Please refer to the operation example for details	
			209.Mr					
C3.rEL		1 Rel ay 1	300.m1		0	0-4	0 NoNE 1 hiGh 2 Low 3 iNrAn 4 outrN 0: NoNE (no output) 1: HiGh (upper limit output) 2: Low (lower limit output) 3: INraN (interval output) 4: OutrN (out of range output)	
			301.V1		0	0-2	0 GroSS 1 NEt 2 pEak 0: GroSS (total weight) 1: NEt (net weight) 2: PEak (peak)	

			302.r1		0	0.001-1	0.500 50% By setting the return difference to avoid frequent relay actions at the alarm point, 0.500 is 50% of the alarm value
			303.t1		0	0-9.999	Relay delay action (seconds)
			304.h1		9000	0-99999	Relay output upper limit value
			305.L1		1000	0-99999	Lower limit value of relay output
		2 Rel ay 2	306.m2		0	0-4	1 Same as relay 1
			307.V2		0	0-2	
			308.r2		0	0.001-1	
			309.t2		0	0-9.999	
			310.h2			0-99999	
			311.L2			0-99999	
		3 Rel ay 3	312.m3		0	0-4	
			313.V3		0	0-2	
			314.R3		0	0.001-1	
			315.t3		0	0-9.999	
			316.h3			0-99999	
			317.L3			0-99999	

C4.AdV		400.CV		0	0-10	10 0 10 levels, adjusted based on actual creep, 0: invalid
		401.dZ		0	0-50000	4 5 0 20 24 When the absolute weight value is within this range, it will be displayed as zero (this parameter only shows zero, the actual weight value still exists and

						participates in the calculation). For example, if the sensor's actual zero point is 4 and the current parameter is set to 5, the display will be 0. When the weight is 20, the instrument will display 24
		402.tV		0	0-50000	0:
		403.tC		0.2	0-2.000	0: Do not enable dynamic tracking, see [noun explanation] for details
		404.SV		0	0-1	0 close 1 Open 200 0 200 0-200 0: close 1: When Open is turned on, the weight display will directly display the final value. For example, if the actual weight is 200, the display will start from 0 and directly display 200, without displaying the change process from 0 to 200.
		405.Zr		500	0-50000	The absolute value of zero point can only be manually or automatically reset within this parameter range
		406.PZ		0	0-1	0 close 1 Open
		407.Pt		10	0-1800	Re powering on will count down to this time
		408.Pr		50	0-50000	When the power is turned on and reset to zero, when the power is turned on again and the absolute value of the zero point is detected

						within this parameter range, the zero point will be automatically reset to zero
		409.AZ		0	0-1	0 close 1 Open
		410.At		0.10	0.01-9.999	
		411.Ar		1.0	0.1-50.0	X 401 0 * 412 413 During the automatic zeroing time, when the absolute value of the zero point is within the automatic zeroing range, it is automatically zeroed (this parameter's X division value is the final range, which is different from [401 Display Zero Range], where the zero point is 0 after automatic zeroing) *Effective when determining "weight stability"
		412.Wr		0	0-5	=0 0 413 412 X Determine whether "weight stability" is effective, =0: represents instability, weight is always stable 0: When the weight change is within the stable range of 412 within the stable time of 413, it indicates "weight stability"

						This parameter affects manual peeling and automatic zeroing. The X division value of this parameter is the final range
		413.Wt		1.000	0.01-9.999	412 413 412 413 Two parameters jointly determine whether it is in a stable state
C5.CoM		500.Ar		1	1-253	
		501.br		3	1-15	2400 4800 9600 19200 22800 38400 57600 115200 128000 230400 256000 :460800 500000 512000 600000 2400 24 15200 1152 The modification of the baud rate takes effect immediately and requires power outage and reconnection. Due to limited display digits, the last two digits are removed during display, such as 2400 displaying 2415200 displaying 1152
		502.Vb		0	0-2	0 none 1 even 2 odd 0: none (no verification) 1: Even (odd check) 2: Odd (Even Check)
		503.so		1	1/2	1 2 Stop bit 1 or 2
		504.AS		0	0-1	0 close 1 Open modbus-rtu When the active sending mode is turned off, it indicates modbus rtu communication mode

		505.AF		2	0-9	1Hz 2Hz 5Hz 10Hz 20Hz 25Hz 60Hz 100Hz 500Hz 1000Hz	
C6.aNa		600.At		1	0-3	NONE GroSS NEt pEak 0: NONE 1: GroSS 2: NEt 3: pEak	
		601.As		0	0-1	Curr VoLt 0: Curr 1: VoLt	
		602.ax		5000	0-99999	Full range corresponding to analog output	604 AO
		603.ai		0	0-9999	Zero point corresponding to analog output	Capable of bipolar output, when 604 selects negative polarity, the minimum weight of AO output is full scale in the negative direction
		604.aP		0	0-1	plus miNus 1 4-12-20mA 0-5-10V 0: plus (positive) 1: miNus (negative) When this parameter is selected as 1, it can achieve outputs of 4-12-20mA and 0-5-10V	
		605.CL		4	0-10.00	0-20mA 0 4-20mA,4-12-20mA 4 0-20mA input 0 4-20mA, 4-12-20mA input 4 0-20mA input 0 4-20mA, 4-12-20mA input 4 0-20mA input 0	

						4-20mA, 4-12-20mA input 4
		606.Ch		20	10.00-21.00	
		607.VL		0	0-5.00	
		608.Vh		10.00	5.00-10.00	0-5V 5.00 0-10V 0-5-10V 10.00 0-5V input 5.00 0-10V, 0-5-10V input 10.00
C7.LOC		700.oP	<i>Login password switch</i>	0	0-1	0 close 1 Open
		701.PW		0000	0-9999	0000 The default password is 0000. To change it, you need to enter the default password in order to change the new password
C8.FAC		800.Lo				Internal use by the manufacturer
		801.EX				
		802.01	AO AO 0.1mA calibration			
		803.4m	AO AO 4mA calibration			
		804.10	AO AO 10mA calibration			
		805.12	AO AO 12mA calibration			
		806.20	AO AO 20mA calibration			
		807.UU	AO AO 10V calibration			

		808.Ad				
C9.iNF		900.VE				
		901.id				

PoiNt	Power on initialization status, displayed on startup, automatically exits after obtaining the first valid data. If the power on reset function is enabled, exits at the end of the countdown
-----	No effective peak was captured
Err.ro	EEPROM Fault EEPROM read/write failed, user presses OK key to resolve
Err.Ad	ADC ADC malfunction
AL.Ad	ADC ADC ADC malfunction, sampling signal too large, ADC reading maximum or minimum value (automatic release)
AL.oL	Sensor overload or exceeding maximum range
AL.AZR	Sensor power on reset failed, exceeding the set power on reset value
AL.PEL	Manual peeling failed, not meeting the peeling conditions
AL.MZr	Manual zeroing failed, not meeting the zeroing conditions
-----	Appears when modifying sampling rate, automatically exits
Er.doM	The value set by the user is too small and will be automatically set to the minimum value that can be set
Er.up	The value set by the user is too large and will be automatically set to the maximum value that can be set
Er.iNV	User input is invalid
Er.pwE	User entered password incorrectly

FA.roM	The configuration parameters failed to be written, but the parameters have already taken effect	
FA.AdC	ADC	ADC setting failed
Er.buy	The system is busy and unable to perform operations, usually due to data not being collected stably before performing zeroing or calibration operations	

						NoNE G kG t N pa kp mpa N.M kN

